

TRANSPORTATION PROJECT REPORT

DRAFT DESIGN REPORT / DRAFT ENVIRONMENTAL IMPACT STATEMENT / DRAFT 4(f) EVALUATION

VOLUME 8 Appendix B12:

B12 – Hazardous Waste / Contaminated Materials Screening – Volume I

November 2016

PIN 5470.22
NYS Route 198 (Scajaquada Expressway) Corridor
Grant Street Interchange to Parkside Avenue Intersection
City of Buffalo
Erie County



ANDREW M. CUOMO
Governor

**Department of
Transportation**

MATTHEW J. DRISCOLL
Commissioner



**U.S. Department of Transportation
Federal Highway Administration**

TRANSPORTATION PROJECT REPORT


DRAFT DESIGN REPORT / DRAFT ENVIRONMENTAL IMPACT STATEMENT / DRAFT 4(f) EVALUATION

APPENDIX B12

Hazardous Waste / Contaminated Materials Screening – Volume I

November 2016

PIN 5470.22
NYS Route 198 (Scajaquada Expressway Corridor)
Grant Street Interchange to Parkside Avenue Intersection
City of Buffalo
Erie County

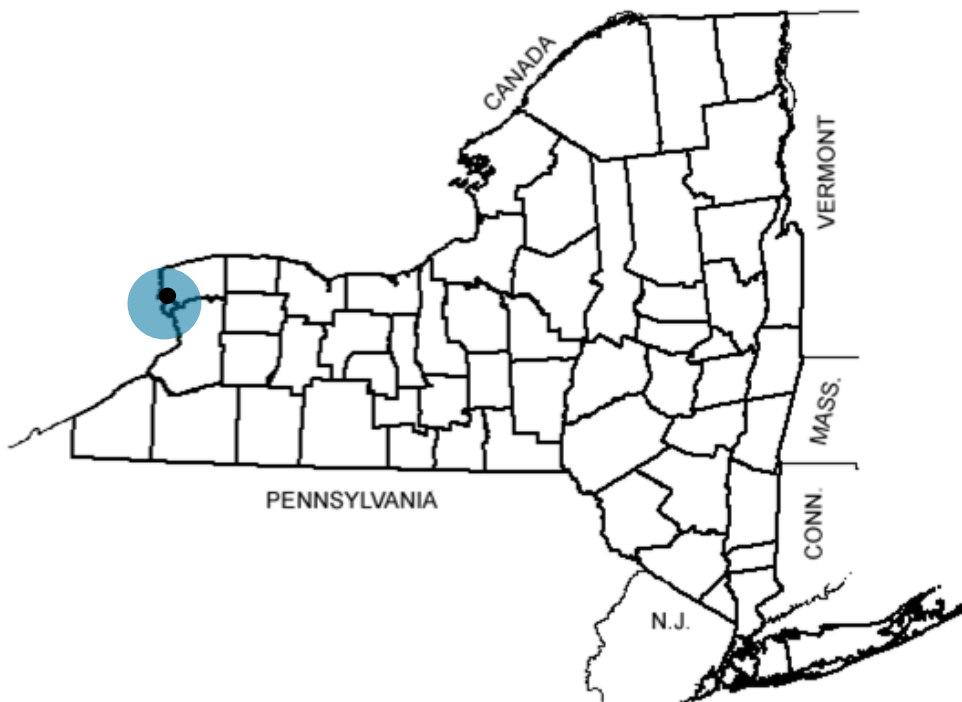

ANDREW M. CUOMO
Governor

Department of
Transportation

MATTHEW J. DRISCOLL
Commissioner



U.S. Department of Transportation
Federal Highway Administration

PRELIMINARY SCREENING INVESTIGATION REPORT
FOR THE
HAZARDOUS WASTE/CONTAMINATED MATERIALS ASSESSMENT
OF
RECONSTRUCTION OF NY ROUTE 198, SCAJAQUADA EXPRESSWAY
FROM I-190 TO ROUTE 33 (KENSINGTON EXPRESSWAY)
CITY OF BUFFALO, ERIE COUNTY
PIN 5470.22

VOLUME I of II

SEPTEMBER 2008
(UPDATED NY SPILLS SEARCH - MAY 2016)

PREPARED FOR:
BERGMANN ASSOCIATES, P.C.
200 FIRST FEDERAL PLAZA
28 EAST MAIN STREET
ROCHESTER, NY 14614

FOR SUBMISSION TO:
NEW YORK STATE DEPARTMENT OF TRANSPORTATION
REGION FIVE
125 MAIN STREET
BUFFALO, NEW YORK 14203

95 Perry Street, Suite 300
Buffalo, New York 14203
p: 716.206.5100
f: 716.206.5199



PRELIMINARY SCREENING INVESTIGATION REPORT
FOR THE
HAZARDOUS WASTE/CONTAMINATED MATERIALS ASSESSMENT
OF
RECONSTRUCTION OF NY ROUTE 198, SCAJAQUADA EXPRESSWAY
FROM I-190 TO ROUTE 33 (KENSINGTON EXPRESSWAY)
CITY OF BUFFALO, ERIE COUNTY
PIN 5470.22

VOLUME I of II

SEPTEMBER 2008
(UPDATED NY SPILLS SEARCH - MAY 2016)

PREPARED FOR:
BERGMANN ASSOCIATES, P.C.
200 FIRST FEDERAL PLAZA
28 EAST MAIN STREET
ROCHESTER, NY 14614

FOR SUBMISSION TO:
NEW YORK STATE DEPARTMENT OF TRANSPORTATION
REGION FIVE
125 MAIN STREET
BUFFALO, NEW YORK 14203

PREPARED BY:
WATTS ARCHITECTURE & ENGINEERING
95 PERRY STREET
BUFFALO, NEW YORK 14203

VOLUME I of II

TABLE OF CONTENTS

Section	Page
1.0 INTRODUCTION	1
1.1 Project Description	1
1.2 Purpose.....	1
2.0 SCOPE AND METHODOLOGY	2
2.1 Investigation of Previous Activities and Site Use	2
2.1.1 USGS Topographic Map	2
2.1.2 Historic Land Use Maps.....	2
2.1.3 Sanborn Fire Insurance Maps.....	2
2.1.4 City Directories	2
2.1.5 Aerial Photographs.....	3
2.1.6 Soil Survey of Erie County.....	3
2.2 Review of Government Records and Databases.....	3
2.3 Field Inspection.....	5
2.4 Interviews	5
3.0 FINDINGS.....	6
3.1 Specific Properties Considered to be Potential Environmental Concerns.....	6
3.1.1 Site A: Scajaquada Creek/Hoyt Lake.....	6
3.1.2 Site B: B&B Collision – 1660 Niagara St.	9
3.1.3 Site C: Zeller Electric – 1675 Niagara St.	10
3.1.4 Site D: Railroad ROW – Niagara St.	11
3.1.5 Site E: Niagara Mohawk – 1626 Niagara St.....	11
3.1.6 Site F: I-190 – Niagara Section	12
3.1.7 Site G: City of Buffalo Park – Niagara St.	13
3.1.8 Site H: City of Buffalo Park Bike Path Area beneath Route 198 – Niagara St.	13
3.1.9 Site I: Hohl Machine & Conveyor Company – 1540-1590 Niagara St.	14
3.1.10 Site J: Vincent's Self-Storage – 1573 Niagara St.....	15
3.1.11 Site K: Infinity Architectural Windows – 1555 Niagara St.....	16
3.1.12 Site L: G&G Sunoco Gas Station – 1531-1543 Niagara St.....	17
3.1.13 Site M: Rascal's Restaurant – 1516 Niagara St.	19
3.1.14 Site N: Contract Pharmaceuticals Parking Lot – 80 Forest Ave.	20
3.1.15 Site O: Vacant Lot – Former Pratt & Lambert Lacquer Plant – 1451 West Ave.	21
3.1.16 Site P: Contract Pharmaceuticals Limited Niagara – 100 Forest Ave.....	22
3.1.17 Site Q: Pagan Auto Sales – 18 Tonawanda St.....	26
3.1.18 Site R: Fort Knox Business Center – 31 Tonawanda St.....	27
3.1.19 Site S: Vacant Lot – Former Pratt & Lambert Paint and Varnish Plant – 75 Tonawanda St.	30
3.1.20 Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, & Kellex Polymers – 125-137 Tonawanda St.....	33
3.1.21 Site U: Former Pratt & Letchworth - 189-205 Tonawanda St.....	34
3.1.22 Site V: City of Buffalo Impound Lot – 166 Dart St.	36
3.1.23 Site W: Buffalo State College Parking Lot – Grant St.....	37

3.1.24 Site X: Buffalo State College Stadium & Parking Lots – 1300 Elmwood Ave.....	38
3.1.25 Site Y: On/Off Ramp – Grant St.	41
3.1.26 Site Z: Tops Grocery Store/Burger King – 333-365 Amherst St.	42
3.1.27 Site AA: Former Buffalo Fire Station – 395 Amherst St.	43
3.1.28 Site AB: Wegman’s – 601 Amherst St.....	44
3.1.29 Site AC: Marcon Erectors – 1 Howell St.....	46
3.1.30 Site AD: Contractor Storage Area – 18 Howell St.	48
3.1.31 Site AE: Residential Property – 227 Middlesex Rd.	48
3.1.32 Site AF: Buffalo Police Radio Tower – Route 198 Eastbound.....	48
3.1.33 Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Pl.....	49
3.1.34 Site AH: Delaware Park – Parkside Ave.....	51
3.1.35 Site AI: Metro-Rail Subway Station – 2085 Main St.....	52
3.1.36 Site AJ: Buffalo Lining & Fabricating – 93 Gillette Ave.	53
3.1.37 Site AK: Wm. Maunz Co. – 387 East Delavan Ave.	54
3.1.38 Site AL: Route 33	55
3.1.39 Site AM: Railroad ROW – East End.....	56
3.1.40 Site AN: Residential Property – 413 East Delevan Ave.....	56
3.1.41 Site AO: Sears, Roebuck & Co. & North Extension – 370-440 E. Delevan Ave.	57
3.1.42 Site AP: Brookline Machine & North Extension – 1870-1896 Fillmore Ave.....	59
3.2 Properties Considered to be Potential Environmental Concerns Identified Outside the Project Limits.....	59
3.2.1 DiVal Safety – 1701 Niagara St.....	59
3.2.2 Hudson Ramsey Co. – 1679 Niagara St.....	60
3.2.3 Volland Electric Equipment Co. & Mead Supply Co. – 1511-1527 Niagara St...60	
3.2.4 Buffalo Metal Finishing – 135 Dart St.....	61
3.2.5 Willard Machine Corporation – 73 Forest Ave.	61
3.2.6 Luigi’s Family Bakery – 77-83 Forest Ave.	62
3.2.7 Vacant Lot – 1354-1360 West Ave.....	63
3.2.8 Liberty Auto Plus Inc. – 980 Grant St.....	63
3.2.9 Vacant Building - Former Gas Station – 479-481 Amherst St.	64
3.2.10 Quality Binding Company & Habitat for Humanity ReStore – 501 Amherst St...65	
3.2.11 Medaille College – 18 Agassiz Cir.....	66
3.2.12 Forest Lawn Cemetery Garage – 1994 Main St.....	67
3.2.13 Sisters of Charity Hospital – 2127-2157 Main St.....	68
3.2.14 J.W. Danforth – 1940 Fillmore Ave.....	70
3.2.15 Trinidad Neighborhood Association & Garden – 113 Gillette Ave./237 Kensington Ave.....	70
3.2.16 Contractor Storage Area - 239 Kensington Ave.....	71
3.2.17 Kentucky Fried Chicken & Niagara Mohawk Power Station – 448-470 E. Delevan Ave.....	71
4.0 CONCLUSIONS AND RECOMMENDATIONS	73

LIST OF TABLES

Table 1 - Summary of Recommendations	76
--------------------------------------------	----

LIST OF FIGURES

	<u>Follows Page</u>
Figure 1 - Project Location Map	1
Figure 2 - Sites of Potential Environmental Concern	6

LIST OF ATTACHMENTS

Attachment A	Sources of Information
Attachment B	Site Photographs
Attachment C	FirstSearch Technologies Environmental Report
Attachment D	Third Party Correspondences and Information (VOLUME II of II)

1.0 INTRODUCTION

Watts Architecture & Engineering (Watts) was retained by Bergmann Associates, P.C. to perform a preliminary screening for the Hazardous Waste/Contaminated Materials (HW/CM) Assessment of New York (NY) Route 198, Scajaquada Expressway, for the Reconstruction of NY Route 198, from Grant Street to Parkside Avenue, City of Buffalo, Erie County, New York (PIN 5470.22). This report was prepared for the New York State Department of Transportation (NYSDOT) under contract D015557 in technical support of the proposed roadway reconstruction project.



1.1 Project Description

This project is located along a 2.0 mile segment of NYS Route 198, Scajaquada Expressway, in the City of Buffalo, Erie County, New York. The purpose of the project is to provide geometric and operational improvements to NYS Route 198 in its current location from the intersection of Grant Street to the intersection of Parkside Avenue, including the segment through Delaware Park. These improvements will be made while maintaining local connectivity and a critical transportation link between Interstate 190 and NYS Route 33, and providing enhanced compatibility with adjacent land uses. The feasible alternative being progressed at this time is Alternative 2. For more information on Alternative 2, refer to the Design Report for this project. The project location is shown on **Figure 1**.

The study area includes the project corridor and those areas immediately adjacent to the corridor. The study area for analyses was developed based on appropriate protocols under NEPA and related laws, regulations and NYSDOT procedures.

1.2 Purpose

The purpose of the preliminary screening phase of the HW/CM Assessment is to identify potential areas of contamination that may be excavated during construction or acquired by the NYSDOT as temporary or permanent easements or right-of-way (ROW) acquisitions. The second phase of the HW/CM Assessment, if warranted, is used for soil (or other material) characterization to determine disposal requirements for excavated soil and to identify environmental concerns that could affect the public or worker safety. It is NYSDOT's policy to identify potential areas of contamination to avoid unexpected costs and significant delays late in the development of a project.

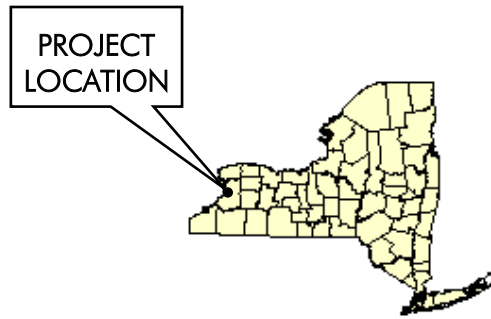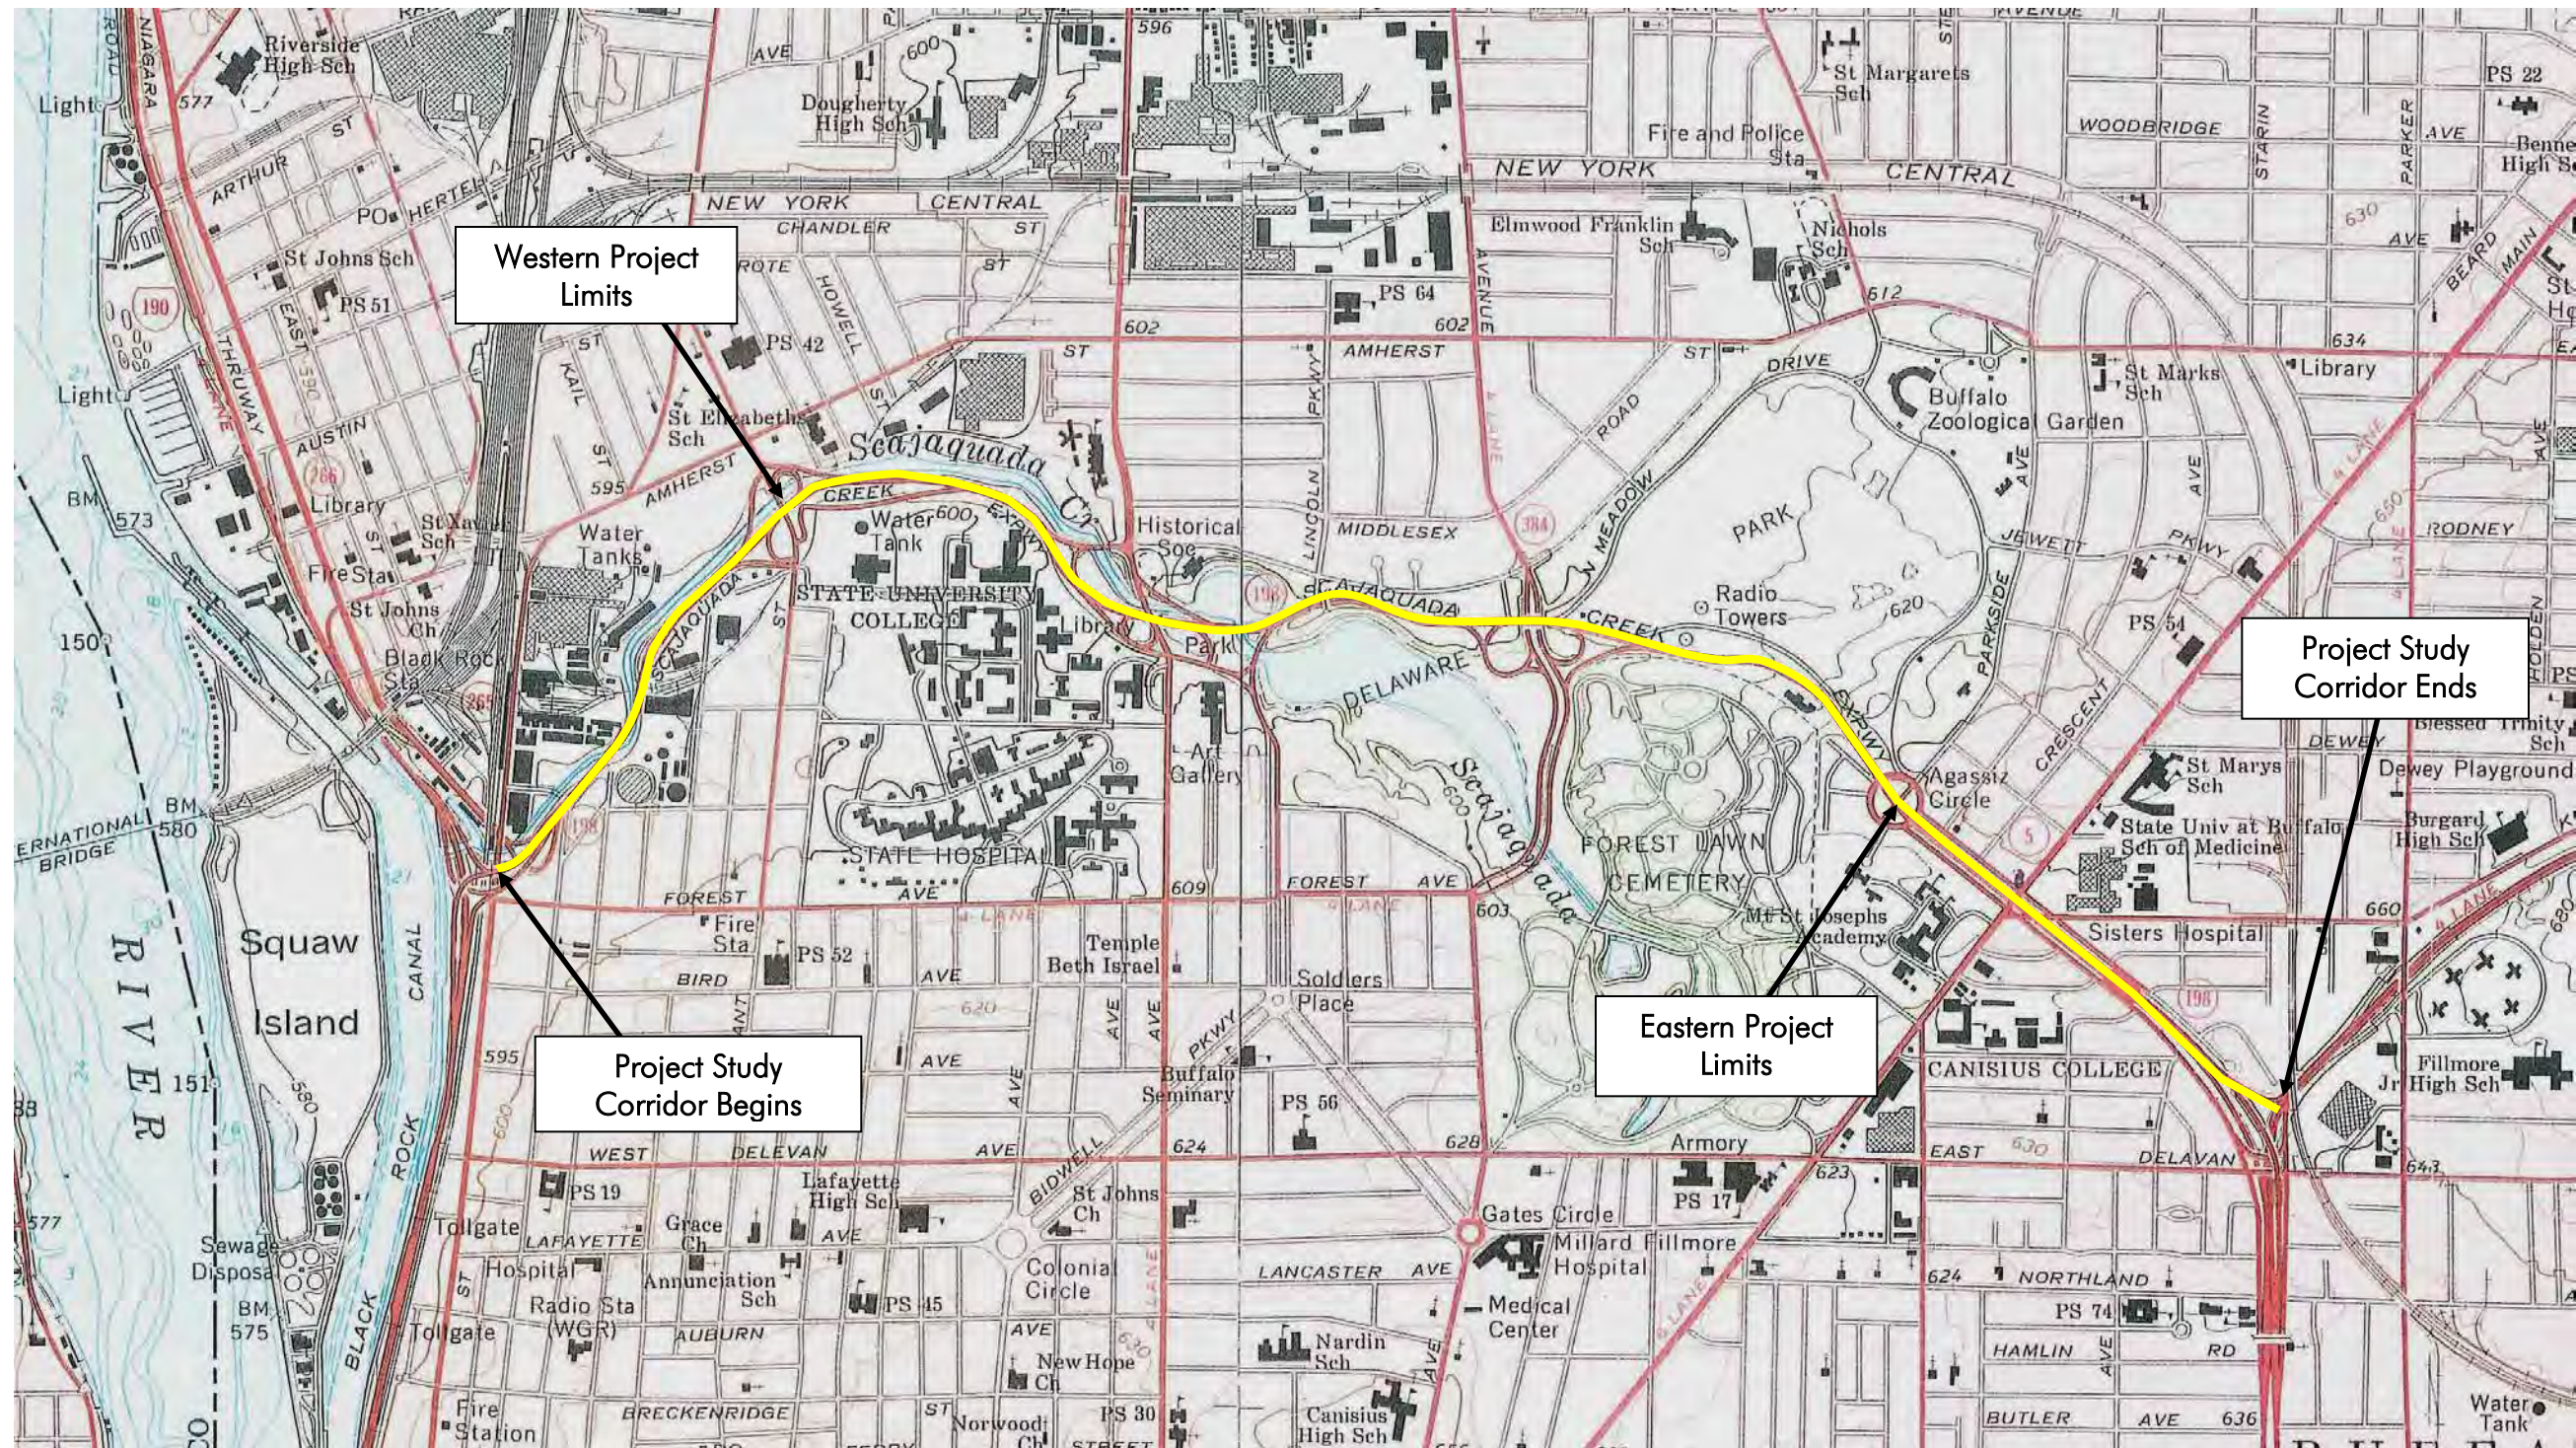

Watts Architecture &
Engineering, P.C.
3826 Main Street
Buffalo, New York

Source:
USGS 7.5 x 15' QUADRANGLES
"Buffalo, NE" and "Buffalo, NW"
1965

Figure 1 - Project Location Map

NYS Route 198 – Scajaquada Expressway
PIN 5470.22
Buffalo, Erie County, New York

Not to Scale

May 2016

2.0 SCOPE AND METHODOLOGY

This preliminary screening conforms to the procedures recommended in NYSDOT's The Environmental Manual (TEM) 2010, Section 4.4.20 Contaminated Materials and Hazardous Substances. The screening consists of collecting information through a record search to investigate previous activities and site uses in the corridor, a review of government databases and records, a field inspection, and interviews with local residents, employees, government personnel, and other knowledgeable individuals. This study was performed in 2008; however, the NYSDEC Spills database review was updated in December 2012 and again in May 2016. A complete list of sources referenced in this report is found in **Attachment A**.

2.1 Investigation of Previous Activities and Site Use

A records search is conducted to determine past or current land uses on and in the immediate vicinity of the project study corridor that may be of environmental concern. The following sources were used to evaluate potential environmental concerns on the project study corridor:

2.1.1 USGS Topographic Map

The 1965 Buffalo, NE and Buffalo, NW Quadrangle maps provides a historical reference to land use in addition to showing prominent structures, roadways, bodies of water, and topography.

2.1.2 Historic Land Use Maps

The 1884 Atlas of the City of Buffalo, NY; 1894 Atlas of the City of Buffalo, NY; and 1915 New Century Atlas of Greater Buffalo; were reviewed at the Buffalo and Erie County Public Library Main Branch in Buffalo, New York.

The 1901 and 1948 Buffalo Quadrangle Topographic Maps provide a historical reference to land use in addition to showing prominent structures, roadways, bodies of water, and topography.

2.1.3 Sanborn Fire Insurance Maps

The 1889, 1893, 1900, 1916, 1935, 1950, 1981, and 1986 Sanborn Fire Insurance Maps were obtained from FirstSearch Technology Corporation (FirstSearch), an independent research firm.

2.1.4 City Directories

Watts reviewed the following City of Buffalo, Erie County, New York, Polk Directories: 1930, 1935, 1940, 1946, 1950, 1955, 1960, 1965, 1971, 1975, 1980, 1985, 1990, 1996, 2000, and 2005. The city directories were

reviewed at the Buffalo and Erie County Public Library Main Branch in Buffalo, New York.

2.1.5 Aerial Photographs

An aerial photograph dated 1927 was obtained from the Erie County Department of Public Works. Aerial photographs dated 1966 and 1978 were obtained from the State University of New York at Buffalo Map Collection. Additional aerial photographs dated 1995 and 2008 were obtained from TerraserverUSA and Microsoft Virtual Earth websites, respectively.

2.1.6 Soil Survey of Erie County

The Erie County Soil Survey was reviewed online to determine the different soil types and their distinct characteristics present in the project study corridor.

2.2 Review of Government Records and Databases

The government records search included a review of federal, state, and local government databases of known or suspected inactive hazardous waste sites; petroleum and chemical bulk storage tank sites; reported spills, including leaking underground storage tanks; and hazardous waste generation sites.

FirstSearch Technology Corporation (FirstSearch), an independent research firm, was employed to perform a United States Environmental Protection Agency (USEPA) and New York State Department of Environmental Conservation (NYSDEC) database search for the proposed project study corridor in 2008. The FirstSearch report is found in **Attachment C**.

The following federal and state databases were searched within a 1/8 mile radius from the roadway corridor:

- National Priorities List (NPL)
- National Priorities List Delisted (NPL Delisted)
- Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS)
- No Further Remedial Action Planned Sites (CERC-NFRAP)
- Resource Conservation and Recovery Act (RCRA) Treatment, Storage, and Disposal Sites (RCRA TSD)
- Corrective Action Sites (RCRA COR)
- Large and Small Quantity Generators (RCRAGN)
- No Longer Regulated (RCRANLR)
- Federal Institutional Controls/Engineering Controls (Fed IC/EC)
- Emergency Response Notification System (ERNS)

- Tribal Lands
- NYSDEC Registry of Inactive Hazardous Waste Disposal Sites (STATE)
- NYSDEC Spills (SPILLS & SPILLS80)
- Solid Waste Landfills (SWL)
- Leaking Underground Storage Tanks (LUST)
- Storage Tanks (Reg UST/AST)
- State/Tribal EC
- State/Tribal IC
- State/Tribal Voluntary Cleanup Program (VCP)
- State/Tribal Brownfield
- Federal Land Use
- National Pollution Discharge Elimination System (NPDES)
- Facility Index System (FINDS)
- Toxic Chemical Inventory Release System (TRIS)
- Hazardous Materials Information Reporting System (HMIRS)
- National Compliance Database (NCDB)
- PCB Activity Database System (PADS)
- Airs
- Docket
- Nuclear Permits
- Air and Surface Water Releases (Releases)
- Federal Other (includes various federal databases)
- Superfund Enforcement Tracking System Potentially Responsible Parties (SETS PRP)
- State Permitted Facilities (Permits)
- State Other

Watts also reviewed in-house data including NYSDEC, Division of Environmental Remediation, Freedom of Information Law (FOIL) CD-ROM dated April 1, 2000 and the NYSDEC Environmental Remediation Databases on their website. Online databases were searched in 2008; however, the NYSDEC Spills Database search was updated in December 2012 and again in April 2016.

Additional site information was also obtained through data searches of local agency files. These files were reviewed to determine past environmental problems, engineering studies, utility locations, and property ownership/boundaries. Watts made the following contacts:

- Erie County Public Works Division of Highways for aerial photographs;
- University of Buffalo Map Collection for aerial photographs;
- New York State Department of Environmental Conservation Region 9 for hazardous materials information;
- City of Buffalo Building Department for land use and ownership;

- City of Buffalo Fire Department for hazardous materials information;
- Erie County Department of Health for hazardous materials information;
- Erie County Department of Environment and Planning for hazardous materials information; and
- Erie County Public Library (local history department) for historical information.

2.3 Field Inspection

The field inspection is a walkover of the project study corridor to observe potential locations of contamination that may be environmental concerns and affect the design or construction of a project. Potential environmental concerns may be identified by: stained or discolored soil or building foundations; distressed, dead, or absence of vegetation; air emissions or odors; discolored or sheened surface water or ground water discharges; evidence of previous fill placement or waste disposal; and evidence of previous fires. Additional concerns may be identified by: evidence of former or existing underground storage tanks; aboveground storage tanks; monitoring wells; pipes or pipelines; 55-gallon (208 L) drums or other evidence of bulk chemical storage and disposal; old pump islands; possible PCB storage, including transformers and former transformer pads; railroad tracks; sumps or septic systems; and pits, lagoons, or other surface impoundments.

A field walkover of the project study corridor was conducted on June 12th and July 14th, 2008. Properties of potential environmental concern were noted, and photographs are found in **Attachment B**.

2.4 Interviews

Local residents, historians, employees, and government authorities were interviewed as valuable sources of information regarding past and present land uses, potential contamination problems, and other relevant information regarding environmental concerns that may affect the project study corridor. A list of contacts and sources reviewed is found in **Attachment A**.

3.0 FINDINGS

A property is included in this section if it showed the potential to be an environmental concern during one of the methods of investigation listed in Section 2.0. Available information from researched sources, that was found to be of potential environmental concern, is listed for each property followed by an evaluation of impacts or potential impacts on the project study corridor.

3.1 Specific Properties Considered to be Potential Environmental Concerns

The following properties are considered to be potential environmental concerns with respect to the project study area. The project study area and the location of each property of potential environmental concern to the proposed project is shown in **Figure 2** by designated site letter. Photographs of the sites of potential environmental concern are included in **Attachment B**.

3.1.1 Site A: Scajaquada Creek/Hoyt Lake

This creek is located north of Route 198 between the Black Rock Canal and Lincoln Parkway and south of Route 198 from Lincoln Parkway to Forest Lawn Cemetery where it is channeled underground. The portion of the creek between Black Rock Canal and inclusive of Hoyt Lake is located within the Project Study Area. Refer to Photos #1-3 in Attachment B.

Site Inspection


This creek is located north of Route 198 between the Black Rock Canal and Hoyt Lake. The creek is then channeled underground adjacent to Hoyt Lake. Scajaquada Creek returns to the surface at Delaware Avenue.

Aerial Photos

Scajaquada Creek and Hoyt Lake are shown as much larger on the 1927 aerial photo than their current size. In addition, Scajaquada Creek appears to be wider between Grant Street and Elmwood Avenue and near the mouth of the creek on the 1927 aerial photo than its current size. Scajaquada Creek and Hoyt Lake are shown at their smaller current size and configuration on the 1966, 1978, 1995, and 2008 aerial photos.

Historic Atlases

Scajaquada Creek and Hoyt Lake are depicted in the 1884 and 1915 Atlases as well as the 1901 topographical map as a creek extending across the project study area west of Delaware Avenue. The portion of the creek between Grant Street and Niagara Street is shown as much wider than its current configuration. In addition, Hoyt Lake, through which the creek flows, is shown as much larger than its current size. Scajaquada Creek is depicted in the 1948 topographic map as a creek extending across the western project study area until it goes underground near Main Street. The

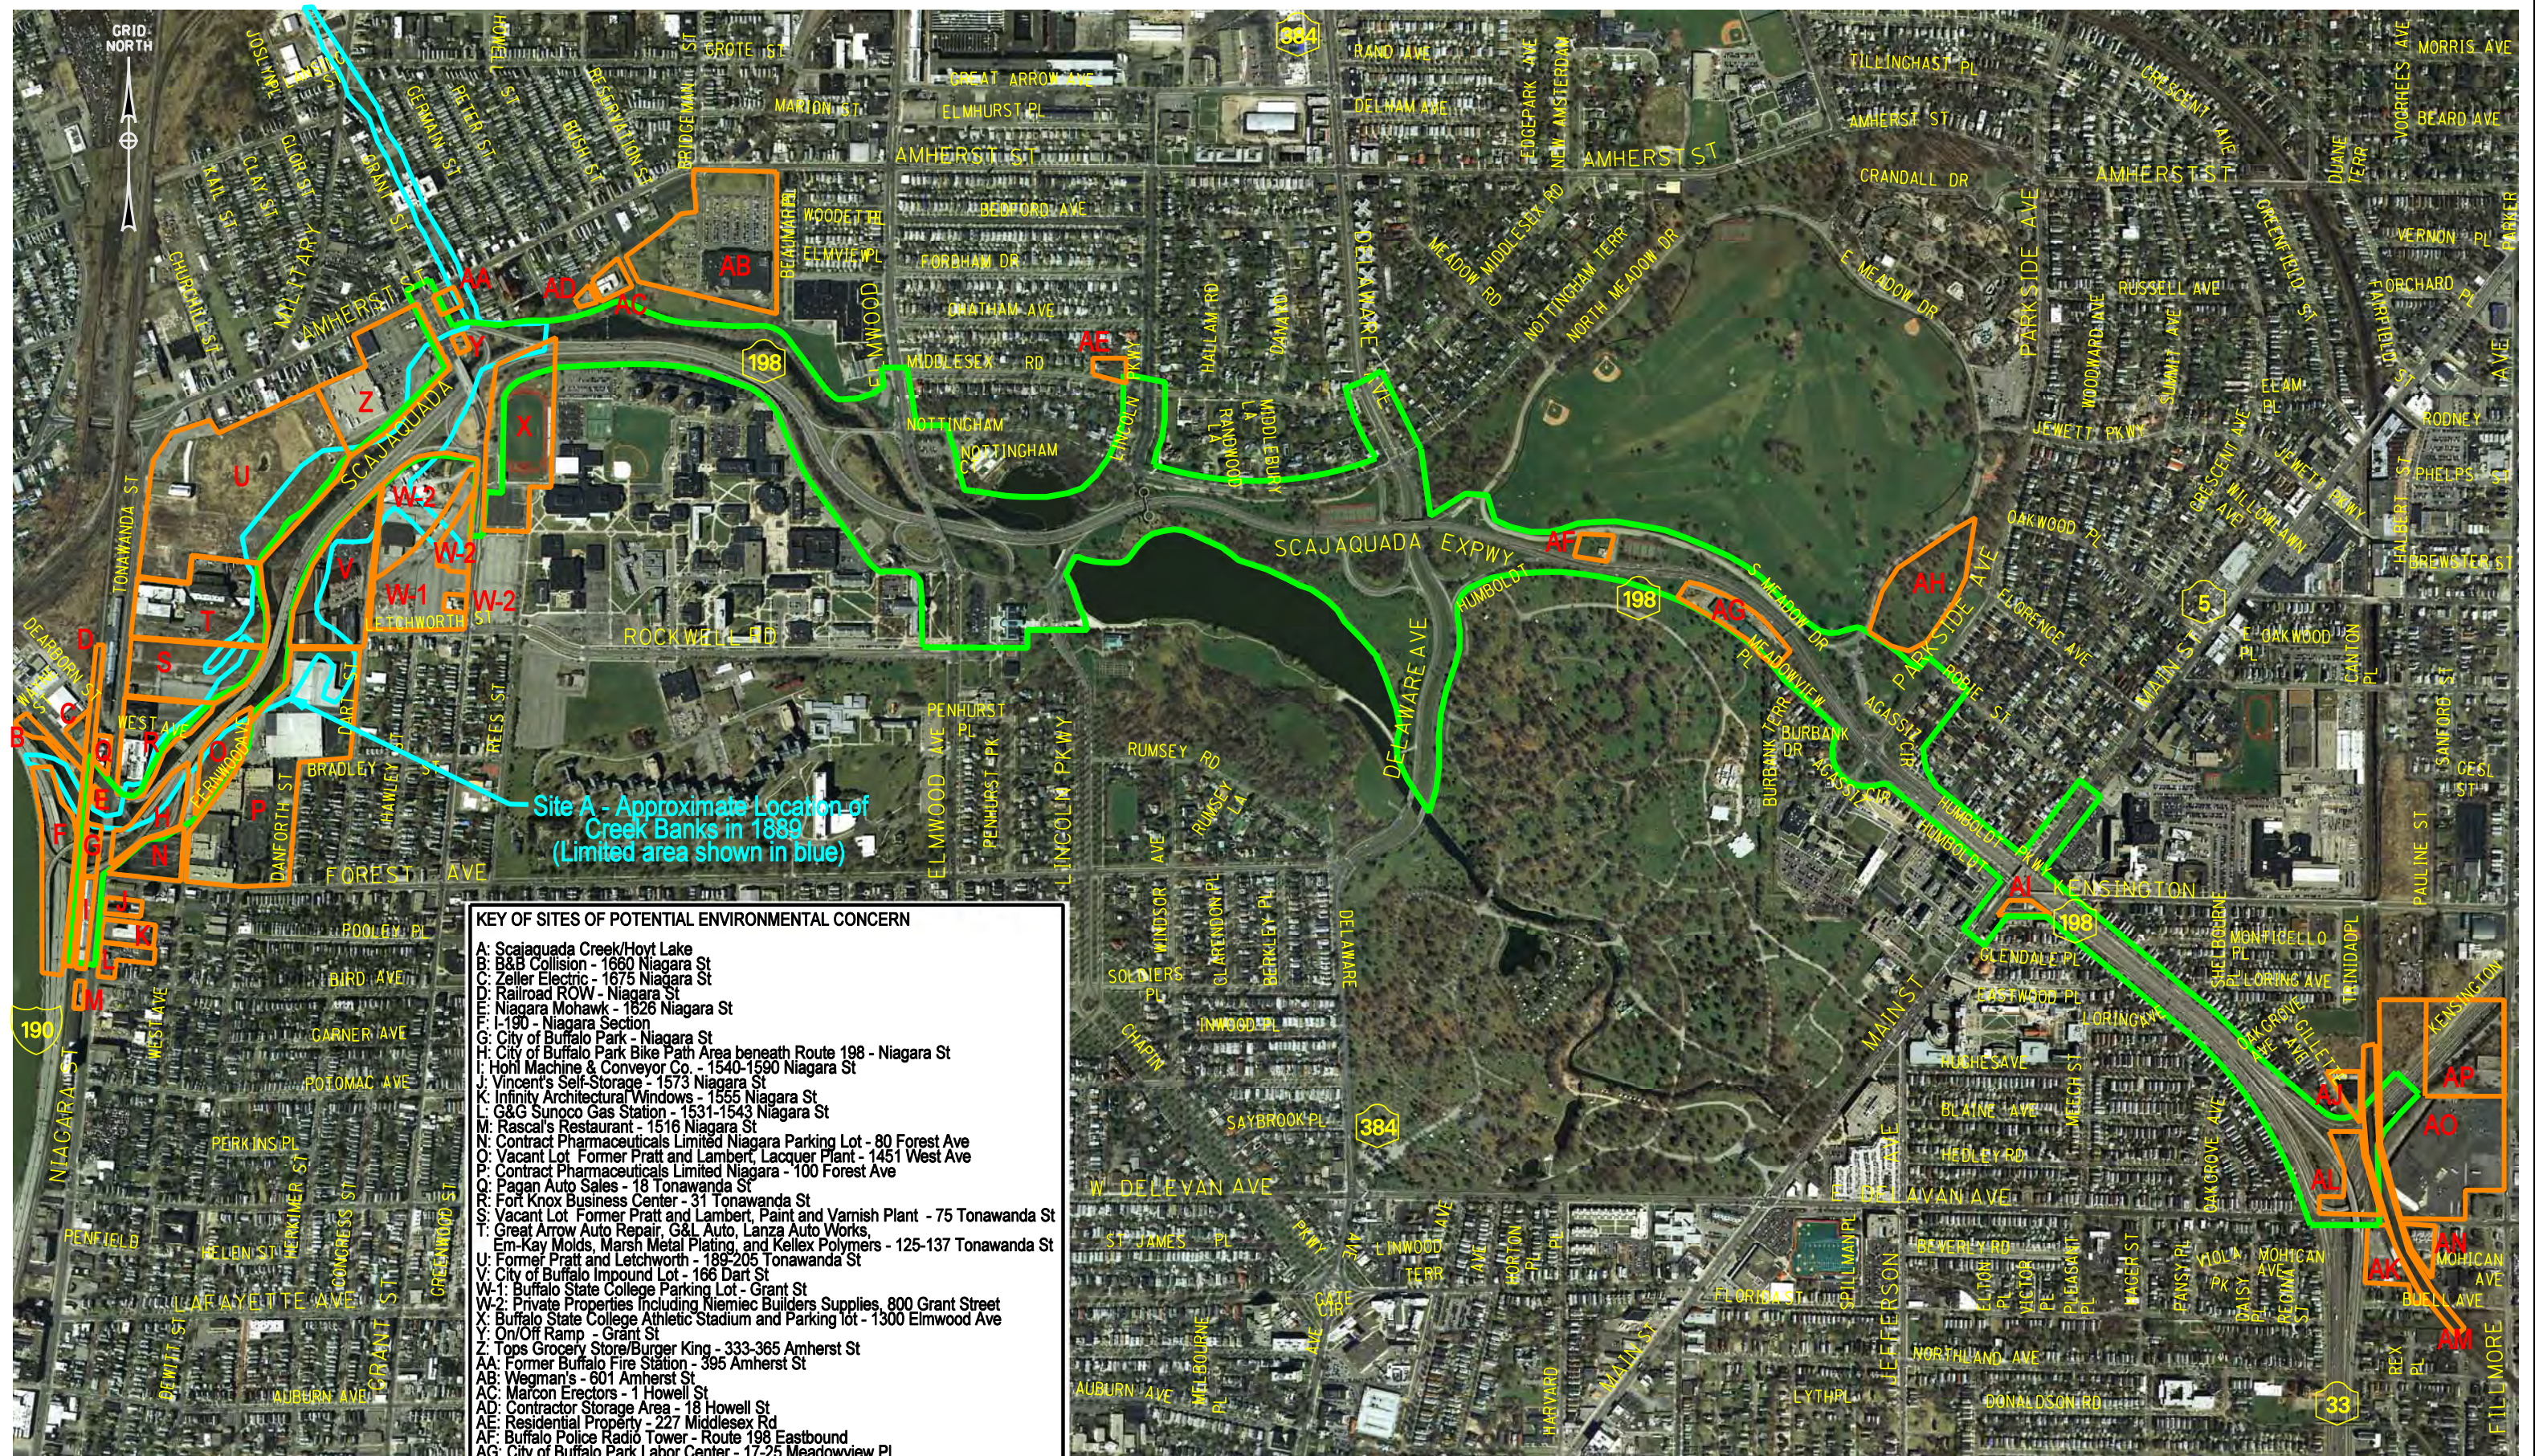

- KEY OF SITES OF POTENTIAL ENVIRONMENTAL CONCERN**
- A: Scajaquada Creek/Hoyt Lake
 - B: B&B Collision - 1660 Niagara St
 - C: Zeller Electric - 1675 Niagara St
 - D: Railroad ROW - Niagara St
 - E: Niagara Mohawk - 1626 Niagara St
 - F: I-190 - Niagara Section
 - G: City of Buffalo Park - Niagara St
 - H: City of Buffalo Park Bike Path Area beneath Route 198 - Niagara St
 - I: Hohl Machine & Conveyor Co. - 1540-1590 Niagara St
 - J: Vincent's Self-Storage - 1573 Niagara St
 - K: Infinity Architectural Windows - 1555 Niagara St
 - L: G&G Sunoco Gas Station - 1531-1543 Niagara St
 - M: Rascal's Restaurant - 1516 Niagara St
 - N: Contract Pharmaceuticals Limited Niagara Parking Lot - 80 Forest Ave
 - O: Vacant Lot - Former Pratt and Lambert, Lacquer Plant - 1451 West Ave
 - P: Contract Pharmaceuticals Limited Niagara - 100 Forest Ave
 - Q: Pagan Auto Sales - 18 Tonawanda St
 - R: Fort Knox Business Center - 31 Tonawanda St
 - S: Vacant Lot - Former Pratt and Lambert, Paint and Varnish Plant - 75 Tonawanda St
 - T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers - 125-137 Tonawanda St
 - U: Former Pratt and Letchworth - 189-205 Tonawanda St
 - V: City of Buffalo Impound Lot - 166 Dart St
 - W-1: Buffalo State College Parking Lot - Grant St
 - W-2: Private Properties Including Niemic Builders Supplies, 800 Grant Street
 - X: Buffalo State College Athletic Stadium and Parking lot - 1300 Elmwood Ave
 - Y: On/Off Ramp - Grant St
 - Z: Tops Grocery Store/Burger King - 333-365 Amherst St
 - AA: Former Buffalo Fire Station - 395 Amherst St
 - AB: Wegman's - 601 Amherst St
 - AC: Marcon Erectors - 1 Howell St
 - AD: Contractor Storage Area - 18 Howell St
 - AE: Residential Property - 227 Middlesex Rd
 - AF: Buffalo Police Radio Tower - Route 198 Eastbound
 - AG: City of Buffalo Park Labor Center - 17-25 Meadowview Pl
 - AH: Delaware Park - Parkside Ave
 - AI: Metro-Rail Subway Station - 2085 Main St
 - AJ: Buffalo Lining & Fabricating - 93 Gillette Ave
 - AK: VM Maunz Co. - 387 East Delavan Ave
 - AL: Route 33
 - AM: Railroad ROW - East End
 - AN: Residential Property - 413 East Delavan Ave
 - AO: Sears, Roebuck & Co. and North Extension - 370-440 East Delavan Ave
 - AP: Brookline Machine Inc. and North Extension - 1870-1896 Fillmore Ave

LEGEND

- HW/CM ASSESSMENT PROJECT STUDY AREA
- SITES OF POTENTIAL ENVIRONMENTAL CONCERN
- APPROXIMATE LOCATION OF CREEK BANKS IN 1889

FIGURE 2
SITES OF POTENTIAL ENVIRONMENTAL CONCERN
NY 198 (SCAJAQUADA) CORRIDOR (PIN 5470.22)
CITY OF BUFFALO, ERIE COUNTY, NEW YORK
 1:12,000 (11X17 PRINT) DATE: OCTOBER 2009

portion of the creek between Grant Street and Niagara Street is shown as similar to its current configuration. However, Hoyt Lake, through which the creek flows, is shown as much larger than its current size.

Sanborn Maps

Scajaquada Creek is depicted on the 1889, 1893, and 1900 Sanborn Fire Insurance maps. The creek is shown as wider between Elmwood Avenue and the mouth of the creek. In addition, there is a tributary that flows east of Grant Street and connects to the Niagara River near Ontario Street. The historic boundaries of the creek are approximated on **Figure 2**.

Scajaquada Creek is depicted on the 1916, 1935, 1950, 1981, and 1986 maps but is shown as narrower than the earlier maps and the tributary has been filled in. In addition, Hoyt Lake is smaller on the 1986 map.

NYSDEC Division of Environmental Permits Correspondence

The New York State Department of Transportation Region 5 received a letter from the NYSDEC Region 9 Division of Environmental Permits, dated May 20, 2008. The letter detailed the following information and issues regarding the Scajaquada Corridor Project. Note that not all of the information and issues addressed in the letter are relevant to the Hazardous Waste/Contaminated Materials Assessment.

- Contact Mr. Greg Sutton, NYSDEC Division of Hazardous Waste Remediation, if any of the design alternatives have the potential to impact any of the sites where remediation has occurred or in portions of the creek where contamination is known to exist.
- City of Buffalo Floodplain Coordinator, Mr. Donald Poletto, should be included in the stakeholders group if there are any impacts to the floodplain.
- Federal funding was used to improve the water quality of Hoyt Lake; any activities that may negatively affect the water quality may be in conflict with the purpose of that funding. The project may have the opportunity to improve the water quality of the lake. If the lake is returned to its original size, disposal options for the excavated materials would have to be considered.
- NYSDEC Division of Water will be reviewing the SWPPP and can be contacted regarding its development.
- Sediments may require special handling by construction workers since pathogens have been found in the sediments.
- Division of Air Resources can review the model created to describe the changes in vehicular air emissions that would result from both road design and changes in motorist's behavior.
- Disturbances to the creek may be regulated by the US Army Corps of Engineers.

- The riparian vegetation along the creek should not be compromised by the project; it should be maintained or enhanced. A complete fish and wildlife survey for the corridor will be required as the design stage progresses.
- Cleanup of the creek bed should be part of the renovation plan, including removal of all debris and litter.

NYSDEC Spill Report Database

Ten spill records were identified for this site:

- Foam in Creek – Germain Street – Spill# 9315020 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Scajaquada Creek – West Avenue – Spill# 8603086 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Scajaquada Creek – Route 198 and Elmwood Avenue – Spill# 9314227 – On March 5, 1994 oil was found in Scajaquada Creek. An investigation identified the source as a discharge pipe from McKinley High School. The spill was cleaned up, closed and met NYSDEC cleanup standards.
- Scajaquada Creek – Delaware Avenue – Spill# 8907285 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Scajaquada Creek – Niagara and Tonawanda Streets – Spill# 8902835 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Car in Scajaquada Creek – Niagara Street – Spill# 9201726 – On May 1, 1992 a car was found in Scajaquada Creek. After the car was removed, the Spill was closed, and met NYSDEC cleanup standards.
- Scajaquada Creek – Niagara and Tonawanda Streets – Spill# 8907953 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Sheen on Scajaquada – Howell Street – Spill# 0075565 – On January 17, 2001 a sheen was identified on Scajaquada Creek. The source of the sheen could not be identified. The US Coast Guard cleaned up the spill and it was closed.
- Hoyt Lake – Nottingham Terrace & Delaware – Spill# 1008362 – On November 9, 2010 a 30 foot by 60 foot film was identified on the surface of Hoyt Lake. The material was identified as “not oil or chemical in nature”. A City of Buffalo contractor removed the material that was assumed to be mulch. The spill file was closed on 11/10/2010.
- Mirror Lake – Japanese Garden Historical Society – Elmwood Avenue / Middlesex – Spill# 1307239 – On October 12, 2013 NYSDEC received a report of a gas can floating on the lake. The site was inspected and no can or sheen was found. The spill was closed but did not meet NYSDEC cleanup standards.

Conclusion

Portions of Scajaquada Creek and Hoyt Lake were historically wider than their current dimensions. This indicates that a large amount of fill has been placed along the banks of the creek. Most of the fill was placed at a time when environmental laws were not in place; therefore, there is a potential to encounter historic contaminated fill from unknown sources throughout creek banks. Although no documentation was found for the source of the fill used, there is the potential that these fill materials included wastes from the industrial sites located around the creek. In addition, Scajaquada Creek runs through an urban industrial area which likely has had numerous undocumented waste outfalls and spills in its over 150 years of industrial land use.

3.1.2 Site B: B&B Collision – 1660 Niagara St.

This property is located on the west side of Niagara Street, north of Tonawanda Street. This site is located north of the Project Study Area. Refer to Photo #4 in Attachment B.

Site Inspection

This site is currently an auto repair shop consisting of several connected buildings.

Historic Maps

A large structure is depicted on this site on the 1901 topographic map.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as an auto service station with two tanks; on the 1950 map as an auto repair shop, a marine sales shop, and a filling station; and on the 1981 and 1986 maps as marine sales and service.

City Directories

This site is listed in the 1975-2005 directories as an auto sales and service facility, 1660 Niagara Street; in the 1971-1990 directories as an auto sales and service facility, 1670 Niagara Street; and in the 1946-1990 directories as an auto repair shop and gas station, a boat sales facility, and an adhesives company, 1700 Niagara Street.

City of Buffalo Building Department Records

City records indicate that this site had two (2) 1,000-gallon and four (4) 1,500-gallon gasoline underground storage tanks installed in 1/1941; one (1) 1,000-gallon underground storage tank installed in 5/1961; and one (1) 2,000-gallon gasoline underground storage tank installed in 5/1963.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 2,000-gallon and one (1) 1,000-gallon gas tanks installed in 5/1963. In addition, the site had two (2) 1,000-gallon and one (1) 1,500-gallon gas tanks installed in 11/1944.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Former Gas Station – 1660 Niagara Street – Spill# 1508546 – On November 18, 2015 two USTs were found when digging a test pit. The contents of the tanks were removed. A Phase I Environmental Site Assessment was completed in May 2011 and a Phase II Environmental Site Assessment was completed in February 2016. The Phase II indicated the presence of two USTs, two in-ground hydraulic lifts, a grease cylinder and potentially contaminated soil and groundwater. In addition, fill material was found overlying the site. The owner is applying for inclusion into the NYSDEC Brownfield Cleanup Program. This spill is still active.
- Oil Sheen in Creek – Behind 1654 Niagara Street – Spill# 1406307 – On September 9, 2014 sediment sampling being performed in Scajaquada Creek found petroleum contamination within the sediments. The adjacent property (1654-1700 Niagara Street) has historically been utilized as gas stations and auto repair shops. Tank records indicate that several tanks were on site but no removal records were found. The buildings were demolished in August 2015. The tanks were removed under Spill# 1508546 (see above). This spill is still active.

Conclusion

The past and present use of this property as gas station, auto repair shop, boat sales and service and the presence of underground storage tanks indicates the potential for encountering soil contamination in the ROW from petroleum products and also the potential for abandoned USTs in the existing ROW.

3.1.3 Site C: Zeller Electric – 1675 Niagara St.

This property is located on the east side of Niagara Street, north of Tonawanda Street. This site is located adjacent to the north side of the Project Study Area. Refer to Photo #5 in Attachment B.

Site Inspection

This site is currently an electronic equipment supplier. The site consists of two connected buildings and an associated parking lot.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Maps as a contractor's warehouse and on the 1981 and 1986 map as wholesale rubber warehouse.

City Directories

This site is listed in the 1955-1985 directories as Prince Rubber & Plastic Company, 1675 Niagara Street and in the 1996-2005 directories as Zeller Electric, 1675 Niagara Street.

Conclusion

The past use of this property as a contractor's storage area, a rubber company and the present use as an electronic equipment supplier indicates the potential for encountering soil contamination in the ROW from chemicals and solvents associated with these manufacturing processes.

3.1.4 Site D: Railroad ROW – Niagara St.

This property is located at the west end of the Project Study Area. This site is located within the Project Study Area. Refer to Photo #6 in Attachment B.

Site Inspection

This site is an active railroad line.

Sanborn Maps

The railroad is depicted on the 1889, 1900, 1916, 1950, and 1986 Sanborn Fire Insurance Maps.

Conclusion

The project study area crosses an active railroad line located in an urban industrial zone. Although no documented incidents were found for this assessment, contamination is often associated with railroad corridors as a result of normal rail line operations. Such activities include: hauling and service, cleaning and maintenance, fueling, and loading and unloading of packaged goods. Contamination typically found along rail lines includes partially combusted fossil fuels consisting of polynuclear aromatic hydrocarbons; leachate from creosote-preserved railroad ties; pesticides used in maintenance of the corridor; strong acid or alkaline materials; spent cleaning and degreasing solvents; ignitable paint wastes; used oil; and lead contamination from older freight cars with plane bearings, as well as other heavy metals including chromium and arsenic.

3.1.5 Site E: Niagara Mohawk – 1626 Niagara St.

This property is located on the west side of Niagara Street, south of Tonawanda Street. This site is located within the Project Study Area. Refer to Photo #7 in Attachment B.

Site Inspection

This site is currently a vacant lot owned by Niagara Mohawk.

Historic Maps

This site is depicted in the 1915 Atlas as a power station.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as the Buffalo General Electric Company Station No. 6 Transformer House and on the 1950, 1981, and 1986 maps as The Niagara Mohawk Power Corporation – Substation No. 6.

City Directories

This site is listed in the 1930-1955 directories as the Buffalo Niagara power house, 1626 Niagara Street.

City of Buffalo Building Department Records

City records indicate that a brick power station was constructed at this site in 8/1912.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Niagara Mohawk – 1626 Niagara Street – Spill# 9604790 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Niagara Mohawk – 1626 Niagara Street – Spill# 9608474 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.

Conclusion

The use of this property as power substation indicates the potential for encountering soil contamination including PCBs from transformers.

3.1.6 Site F: I-190 – Niagara Section

This property is located on the west side of Niagara Street, south of Scajaquada Creek. This site is located adjacent to the west end of the Project Study Area. Refer to Photo #8 in Attachment B.

Site Inspection

This site is currently a portion of I-190, Niagara Section.

Historic Maps

This site is depicted in the 1884 Atlas as part of the B. I. & N. Company and in the 1894 Atlas as the Spring and Carriage Works. On the 1915 Atlas, the northern portion of this site (north of Forest Avenue) contained a large gasometer.

Sanborn Maps

The northern portion of this site (north of Forest Avenue) is depicted on the 1889 Sanborn Fire Insurance Map as a foundry for the Sheppard Hardware Company and

the southern portion of the site (south of Forest Avenue) is depicted as a foundry for the NY Car Wheel Works. On the 1900 map, the northern portion of this site is depicted as the Buffalo Gas Light Company with a large gasometer and the southern portion of the site is still a foundry for the NY Car Wheel Works. On the 1916 map, the northern portion of this site still contains the Buffalo Gas Light Company with a large gasometer and the southern part of the site is used by the NY Car Wheel Works as factory space. The southern portion of the site continues to be depicted as a foundry for the NY Car Wheel Works. On the 1950 map, the northern portion of this site is depicted as vacant land and the southern portion of the site continues to be depicted as a foundry for the NY Car Wheel Works. On the 1981 and 1986 maps, the entire site is depicted as part of the NYS Thruway – Niagara Section.

Conclusion

Despite redevelopment, the use of this property as a foundry and a gas company with a large gas tank indicates the potential for encountering soil contamination from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.7 Site G: City of Buffalo Park – Niagara St.

This property is located on the west side of Niagara Street, south of Scajaquada Creek. This site is within the Project Study Area. Refer to Photo #9 in Attachment B.

Site Inspection

This site is currently a rest area for the City of Buffalo Bike Path. It consists of a shelter, bench, and historical information signage.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as an electric company and on the 1916 map as a coal yard.

City of Buffalo Building Department Records

City records indicate that a coal trestle was demolished on this site (1592-1600 Niagara Street) in 9/1943.

Conclusion

Despite redevelopment, the past use of this property as a coal yard and electrical transformer lot indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes.

3.1.8 Site H: City of Buffalo Park Bike Path Area beneath Route 198 – Niagara St.

This property is located on the east side of Niagara Street, south of Scajaquada Creek. This site is within the Project Study Area. Refer to Photo #10 in Attachment B.

Site Inspection

This site currently includes a portion of a City of Buffalo Bike Path that runs below the elevated section of Route 198.

Sanborn Maps

This site is depicted on the 1900 Sanborn Fire Insurance Map as a plaster company.

City of Buffalo Building Department Records

City records indicate that this site (1607 Niagara Street) was a plaster company in 6/1894.

Conclusion

Despite redevelopment, the past use of this property as a plaster company indicates the potential to encounter chemicals and solvents associated with this historical manufacturing process.

3.1.9 Site I: Hohl Machine & Conveyor Company – 1540-1590 Niagara St.

This site is located on the west side of Niagara Street between Bird Avenue and Forest Avenue. This site is located within the Project Study Area. Refer to Photos #11-12 in Attachment B.

Site Inspection

The property is currently Hohl Machine & Conveyor Company. The site consists of a large building and an associated parking lot.

Aerial Photos

Several large structures are present on this site on the 1927 aerial photograph. The 1966, 1978, 1995, and 2008 aerial photographs show that the site now consists of one large manufacturing facility. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

This site is depicted in the 1894 Atlas as the Griffin Machine Works, in the 1884 Atlas as part of the Niagara Bridge Works, and in the 1915 Atlas as New York Car Wheel Works. A large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889, 1900, 1916, and 1950 Sanborn Fire Insurance Map as a wheel manufacturer/foundry and on the 1981 and 1986 map as Hohl Machine & Conveyor Company.

City Directories

This site is listed in the 1930-1946 directories as the NY Car Wheel Company, 15 Forest Avenue and in the 1960-2005 directories as Hohl Machine and Conveyor Inc., 1540-1580 Niagara Street.

City of Buffalo Building Department Records

City records indicate that this site (15 Forest Avenue) had one (1) 280-gallon gas underground storage tank installed in 9/1929.

RCRA No Longer Regulated

A RCRA record for this site is listed as Hohl Machine & Conveyor Company – 1580 Niagara Street. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Hohl Machine & Conveyor Company – 1580 Niagara Street – Spill# 8709761 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Vacant Lot – 1590 Niagara Street – Spill# 0175459 – On December 1, 2001 three 55-gallon drums were abandoned on this site. The drums were removed; the spill was closed and met NYSDEC cleanup standards.

Conclusion

The past use of this property as a conveyor manufacturer and train wheel manufacturing facility with an identified underground storage tank indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes.

3.1.10 Site J: Vincent's Self-Storage – 1573 Niagara St.

This site is located on the east side of Niagara Street, south of Forest Avenue. This site is adjacent to the Project Study Area. Refer to Photo #13 in Attachment B.

Site Inspection

This site is currently a self-storage facility consisting of one large building and an associated parking lot.

Historic Maps

This site is depicted in the 1915 Atlas as Bergman Tool Manufacturing Company. In addition, a large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as Bergman Tool Manufacturing Company.

City Directories

This site is listed in the 1930-1996 directories as Bergman Tool Manufacturing Company, 1573 Niagara Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 8,000-gallon #2 fuel oil underground storage tank installed in 1/1967; one (1) 1,000-gallon gas underground storage tank installed in 8/1932; and one (1) 1,000-gallon gas underground storage tank installed in 8/1942.

RCRA No Longer Regulated

A RCRA record for this site is listed as Bergman Tool Manufacturing Company Inc. – 1573 Niagara Street. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Bergman Manufacturing – 1573 Niagara Street – Spill# 0275210 – On July 19, 2002 contamination was found in the area of a former tank. The contamination was removed; however excavation along the south wall could not be extended due to the building foundation. Therefore, the spill was made inactive and closed.

Conclusion

The past use of this property as a tool manufacturing facility, for more than 70 years with several underground storage tanks and known soil contamination indicates the potential for encountering soil contamination from petroleum products or unmarked, abandoned USTs in the ROW.

3.1.11 Site K: Infinity Architectural Windows – 1555 Niagara St.

This site is located on the east side of Niagara Street, south of Forest Avenue. This site is adjacent to the Project Study Area. Refer to Photo #14 in Attachment B.

Site Inspection

This site is currently a window manufacturing facility. It consists of a factory building and an associated parking lot.

Historic Maps

A large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as a factory building with two tanks shown on the 1950 map.

City Directories

This site is listed in the 1930-1965 directories as a manufacturing company and gas station, 1559 Niagara Street; in the 1965-1975 directories as Dynamo & Motor Exchange Company, 1555 Niagara Street; in the 1971-1975 directories as Richter Electric Motor Repair, 1559 Niagara Street; in the 1996 directory as Cooling Products International, 1555 Niagara Street; and in the 2005 directory as Infinity Architectural Windows, 1555 Niagara Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon gas underground storage tank installed in 7/1928; (1) 280-gallon gas underground storage tank installed in 6/1932; one (1) 550-gallon gas underground storage tank installed in 8/1932; one (1) 1,000-gallon gas underground storage tank installed in 7/1935; one (1) 1,000-gallon gas underground storage tank installed in 9/1935; one (1) 550-gallon gas underground storage tank installed in 5/1955; and four (4) 1,000-gallon, three (3) 550-gallon and one (1) 280-gallon underground storage tanks removed in 12/1955. In addition, City records indicate that this site was used as a gas station in 7/1923.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 550-gallon gas tank installed in 5/1955; one (1) 1,000-gallon gas tank installed in 9/1935; one (1) 280-gallon gas tank installed in 6/1932; three (3) 550-gallon gas tanks installed in 8/1932; one (1) 1,500-gallon gas tank installed in 1/1941; and two (2) 1,000-gallon gas tanks installed in 1/1941.

Conclusion

The past use of this property as a machine shop, manufacturing facility and gas station with several underground storage tanks indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes as well as the potential for encountering soil contamination from petroleum products or unmarked, abandoned USTs in the ROW.

3.1.12 Site L: G&G Sunoco Gas Station – 1531-1543 Niagara St.

This property is located on the east side of Niagara Street, south of Forest Avenue. This site is adjacent to the Project Study Area. Refer to Photo #15 in Attachment B.

Site Inspection

This site is currently a Sunoco Gas Station with three pump islands and three service bays.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as a hammer manufacturer; on the 1916 map as an ink factory with an oil house; and on the 1950, 1981, and 1986 maps as a filling station building with two tanks shown on the 1950 map.

City Directories

This site is listed in the 1940-2005 directories as a gas and service station, 1543 Niagara Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 5,000-gallon gas underground storage tank installed 10/1951; one (1) 550-gallon waste oil underground storage tank installed 7/1954; one (1) 2,000-gallon gas underground storage tank installed 4/1957; one (1) 5,000-gallon gas underground storage tank installed 6/1965; and one (1) 8,000-gallon and one (1) 6,000-gallon gas underground storage tank installed 3/1968. In addition, City records indicated that the site was used as used car lot in 8/1932 and for auto sales and service in 12/1979.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 2,000-gallon gas tank installed in 3/1957; one (1) 550-gallon waste oil tank installed in 7/1954; two (2) 3,000-gallon gas tanks installed in 1/1945; one (1) 1,000-gallon kerosene tank installed in 1/1945; one (1) 1,000-gallon propane tank installed in 6/1994; two (2) 12,000-gallon gas tanks in 4/1994; and one (1) 2,000-gallon gas tank installed in 4/1957. In addition, one (1) 5,000-gallon, one (1) 6,000-gallon, and one (1) 8,000-gallon gas tanks were installed in 3/1968 and removed in 5/1993.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as G&G Petroleum – 1531-1543 Niagara Street. One (1) 8,000-gallon gasoline underground storage tank (installed 1/1967, closed-removed 4/1994); one (1) 7,000-gallon gasoline underground storage tank (installed 5/1994, in service); one (1) 5,000-gallon diesel underground storage tank (installed 5/1994, in service); one (1) 6,000-gallon gasoline underground storage tank (installed 01/1967, closed-removed 4/1994); one (1) 9,000-gallon gasoline underground storage tank (installed 5/1994, in service); one (1) 3,000-gallon kerosene underground storage tank (installed 5/1994, in service); one (1) 5,000-gallon gasoline underground storage tank (installed 01/1968, closed-removed 4/1994); and one (1) 550-gallon underground storage tank (installed 1/1968, closed-removed date unknown) were listed for this site.

NYSDEC Spill Report Database

Six spill records were identified for this site:

- G & G Sunoco – 1543 Niagara Street – Spill# 9415155 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- G & G Petroleum – 1543 Niagara Street – Spill# 0110881 – This spill was minor in nature, was cleaned-up and has been closed.
- Vinnie’s Gulf Service – 1543 Niagara Street – Spill# 8810060 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- G & G Petroleum – 1543 Niagara Street – Spill# 9400660 – On April 11, 1994 contamination was found during the removal of an underground storage tank. Some contaminated soil was removed from the site and an investigation to the extent of the contamination is still underway. This spill is still active.
- Sunoco G & G Petroleum – Niagara Street – Spill# 9700094 – On April 3, 1997 NYSDEC received a complaint of gasoline contaminated soil running onto property behind the gas station. An investigation revealed a large pile of soil behind the gas station. The gas station has an active Spill record regarding this contaminated soil. See Spill# 9400660 for more information.
- Manhole #42 – Bird Avenue @ Niagara Street – Spill# 1505905 – On September 2, 2015 gas odors and film on the water were found when National Grid opened a manhole for service. The oily film was vacuumed out and the vault was power washed. No signs of dumping were observed. The spill was closed but did not meet NYSDEC cleanup standards.

Conclusion

The past and present use of this property as gas station and an auto sales lot for more than 50 years and the identification of an active spill file indicates the potential for encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.13 Site M: Rascal’s Restaurant – 1516 Niagara St.

The property is located on the west side of Niagara Street, south of Bird Avenue. This site is located south of the Project Study Area. Refer to Photo #16 in Attachment B.

Site Inspection

This site is currently a restaurant with a single-story building, an outside eating area and a parking lot.

Sanborn Maps

This site is depicted on the 1950, 1981, and 1986 Sanborn Fire Insurance Map as a filling station building with two tanks shown on the 1950 map.

City Directories

This site is listed in the 1930-1965, and 2000 directories as a gas station, 1526 Niagara Street.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Rascal's Restaurant – 1516 Niagara Street – Spill# 0175253 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.

Conclusion

The past use of this property as gas station with underground storage tanks for more than 20 years indicates the potential for encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.14 Site N: Contract Pharmaceuticals Parking Lot – 80 Forest Ave.

This property is located on the north side of Forest Avenue between Niagara Street and West Avenue. This property is adjacent to the Project Study Area. Refer to Photos #17-18 in Attachment B.

Site Inspection

The property is currently Contract Pharmaceuticals Limited Niagara Parking Lot. Access to the entire site was not possible due to fencing.

Aerial Photos

Several large structures and associated parking lots are present on this site on the 1966, 1978, 1995, and 2008 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

The Buffalo Barrel Works is depicted on the west side of West Avenue north of Forest (currently 80 Forest Avenue) in the 1894 Atlas and the Kelly Electric Machine Company is depicted on the west side of West Avenue in the 1915 Atlas. In addition, a large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as a barrel manufacturer; on the 1950 map as a dry cleaner and a packing machine company; and on the 1981 map as a dry cleaner.

City Directories

This site encompasses numerous addresses. It is listed in the 1930-1940 directories as Birk Manufacturing (awning manufacturer), 76 Forest Avenue; in the 1930-1975 directories as Consolidated Packaging Machinery, 1400 West Avenue; in the 1935-

1946 directories as an auto repair shop, 62-64 Forest Avenue; in the 1940 directory as Martin Furniture Spray Company, 68-74 Forest Avenue; in the 1950-1971 directories as a dry cleaners, 76 Forest Avenue; in the 1960-1990 directories as Consolidated Packing Machine Corporation (parking lot), 56 Forest Avenue; and in the 1975-1980 directories as an engraver, 76 Forest Avenue.

City of Buffalo Building Department Records

City records indicate that this site (1400 West Avenue) had one (1) 6,000-gallon fuel oil underground storage tank installed in 9/1959. In addition, City records indicate that this site was used as a service station (56 Forest Avenue) in 2/1927 and a dry cleaner (76 Forest Avenue) in 11/1949.

CERCLIS No Further Remedial Action Planned Sites

A CERCLIS NFRAP record for this site is listed as Consolidated Packing Machinery Corporation – 1400 West Avenue. A preliminary assessment was performed in 1986. No further remedial action is planned.

Conclusion

The past use of this property as a dry cleaner, an auto repair shop, a machine shop with an underground storage tank, an engraver and a manufacturing facility indicates the potential to encounter chemicals, solvents, and petroleum products associated with these historical processes. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.15 Site O: Vacant Lot – Former Pratt & Lambert Lacquer Plant – 1451 West Ave.

This property is located on the east side of West Avenue, south of Route 198. This site is located within the Project Study Area. Refer to Photo #19 in Attachment B.

Site Inspection

This site is currently a vacant lot. Access to the site was not possible due to fencing.

Aerial Photos

One small building is present on this site on the 1927 aerial photograph. A second building has been added to the site on the 1966, 1978, and 1995 aerial photographs. The site is vacant on the 2008 aerial photograph. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

A large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1950, 1981, and 1986 Sanborn Fire Insurance Maps as Pratt & Lambert Lacquer Plant with eight solvent tanks.

City of Buffalo Building Department Records

City records indicate that this site had six (6) 10,000-gallon tanks installed in 9/1927.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Pratt & Lambert – 1451 West Avenue – Spill# 8906606 – On October 01, 1989 ten chemical tanks were removed. The spill was closed and met NYSDEC cleanup standards.

Conclusion

The past use of the property for a lacquer manufacturer, as well as the past presence of tanks on the property indicate the potential for soil contamination from petroleum, chemicals, solvents and paint products to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.16 Site P: Contract Pharmaceuticals Limited Niagara – 100 Forest Ave.

This property is located on the north side of Forest Avenue between West Avenue and Danforth Street and extends to the northeast. This site is located adjacent to and partially within the Project Study Area. Refer to Photos #20-21 in Attachment B.

Site Inspection

The site is currently Contract Pharmaceuticals Limited Niagara. The building consists of several connected large buildings, parking lots, and aboveground storage tanks. Access to the entire site was not possible due to fencing.

Aerial Photos

Several large buildings and associated parking lots are shown along Forest Avenue and several very large tanks are shown north of Bradley Street on the 1927 and 1966 aerial photographs. The large buildings and associated parking lots are still present on the 1978 aerial photograph but the large tanks have been replaced with several large one-story buildings. Another large building has been added to the site, north of Bradley Street on the 1995 and 2008 aerial photographs.

Historic Atlases

This site is depicted on the 1894 Atlas as containing the Niagara Carriage Top Works at the northeast corner of Dewitt Street and Bradley Streets and a Sawmill at the end of Dewitt Street. This site is depicted in the 1915 Atlas as the Peoples Gas, Light and Coke Company north of Dart Street. Several large tanks are depicted at this facility. In addition there is Kelly Electric Machine Company located on the west side of West Avenue. The 1948 topographic map depicts several large structures including a large circular structure labeled “gas” on this site.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as a carriage and wagon manufacturer; on the 1900 map as the Peoples Gas Light and Coke Company; on the 1916 map as a book binding company, a machine company, a medicine manufacturer, an incubator manufacturer, and the Buffalo Gas Light Company with several gasometers and tar tanks; on the 1950 map as a radiator manufacturer, a medicine manufacturer, a freight company, and the Iroquois Gas Corporation with several gasometers, tar tanks; and on the 1981 and 1986 maps as Westwood Pharmaceuticals.

City Directories

This site is listed in the 1930 directory as Foster Milburn Co. (medicine manufacturer), 41-55 Fernwood Avenue; in the 1930-1955 directories as Iroquois Gas Corporation, 40 Bradley Street; in the 1930 directory as Jiffy Battery Terminal Corporation, 1399 West Avenue; in the 1930-1940 directories as Buffalo Incubator, 15 Bradley Street; in the 1930-1955 directories as a heating manufacturer, 1407-11 West Avenue; in the 1935-1940 directories as Mushroom Transportation, 15 Bradley Street; in the 1946-1955 directories as Kramer Brothers Freight Lines, 15 Bradley Street; in the 1965 directory as Am Standard (machine manufacturer), 1407 West Avenue; in the 1971-1980 directories as National Fuel Gas, 40 Bradley Street; in the 1971-1975 directories as Westwood Pharmaceuticals, 1407 West Avenue; and in the 1990 directory as Westwood Pharmaceuticals, 100 Dart Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,000-gallon tank installed in 12/1943 (1-21 Bradley Street); one (1) 1,000-gallon tank installed in 5/1936 (15 Bradley Street); one (1) fuel oil tank installed in 8/1939 (15 Bradley Street); one (1) 1,000,000-gallon tank constructed in 9/1948 (36 Bradley Street); and one (1) 550-gallon gas tank installed in 10/1948 (40 Bradley Street). In addition, City records indicate that the gas holders were demolished at 40 Bradley Street in 5/1968.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 25,000-gallon fuel oil tank removed in 6/2005.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Contract Pharmaceuticals Limited Niagara – 100 Forest Avenue. One (1) 15,000-gallon #6 fuel oil underground storage tank (installed 4/1964, closed prior to 3/1991); one (1) 25,000-gallon #6 fuel oil aboveground storage tank (installed 6/2005, closed-removed date unknown); and one (1) 20,000-gallon #6 fuel oil aboveground storage tank (installed 9/2005, in service) were listed for this site.

NYSDEC Chemical Bulk Storage Database

A CBS record for this site is listed as Westwood-Squibb Pharmaceuticals – 100 Forest Avenue. One (1) 2,000-gallon hydrochloric acid aboveground storage tank (installed 12/1992, converted to non-regulated use 9/1994) was listed for this site.

RCRA Generator

Three RCRA Generator records were identified for this site. National Fuel Gas – Scajaquada Creek – 100-A Forest Avenue is listed as a small quantity hazardous waste generator; Contract Pharmaceuticals LTD – 100 Forest Avenue is listed as a large quantity hazardous waste generator; and Westwood Squibb – 468 Dewitt Street is listed as a large quantity hazardous waste generator. Westwood Squibb – 468 Dewitt Street had generator oversight violations associated with this property. No other violations were identified.

RCRA No Longer Regulated

A RCRA record for this site is listed as National Fuel Gas – Scajaquada Creek – 100-A Forest Avenue. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

Toxic Release Inventory System Database

A TRIS record for this site is listed as Contract Pharmaceuticals Ltd Niagara – 100 Forest Avenue. The record indicates that this site reported releases from 1987 to 2005. No further information was available.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Truck at Westwood Squibb – 100 Forest Avenue – Spill# 9800516 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Bristol-Meyer-Squibb – 100 Forest Avenue – Spill# 0550407 – On June 8, 2005 contaminated soil was encountered during a tank removal. The soil was removed, the excavation was sampled, and the spill was closed.

NYSDEC Registry of Inactive Hazardous Waste Disposal Sites

Three Inactive Hazardous Waste Disposal Site records were identified for this site:

- Iroquois Gas/Westwood Pharmaceutical – Dart Street. The site was used by the Iroquois Gas Company for the manufacture and storage of gas from 1900 to 1972. Westwood Squibb purchased the site in 1972. During subsequent building construction, the soil and groundwater were found to be contaminated with polynuclear hydrocarbons (PAHs), benzene, toluene, ethylbenzene and xylene (BTEX). The Consent Decree has divided the site into two components: terrestrial and riparian. These are described below.

- Iroquois Gas/Westwood Pharmaceutical Terrestrial – Dart Street. The site was used by the Iroquois Gas Company for the manufacture and storage of gas from 1900 to 1972. An investigation of the site was started in 1985 and found that the soil was contaminated with polynuclear hydrocarbons (PAHs), BTEX (benzene, toluene, ethylbenzene, xylene), lead and cyanide and that the groundwater was contaminated with PAHs and BTEX. A clay cap was placed on the site and the soils and groundwater were bio-treated in-place. In addition, vertical sheet piling barrier walls and extraction wells were installed. This site is a Class 4, which indicates that it has been properly closed but requires continued management. The site is currently pumping contaminated groundwater from six extraction wells, which is then treated and discharged to the sanitary sewer. The remedial action was completed on the plant site in 1997.
- Iroquois Gas/Westwood Pharmaceutical Riparian – Dart Street. This site is a 1,600-foot long section of the Scajaquada Creek, extending upstream from the West Avenue Bridge. Wastes entered the creek via discharges from piped outlets, spills and movement of surface and groundwater. This site is also a Class 4, which indicates that it has been properly closed and requires continued management. The contaminated sediments were removed from the creek and the remedial action was completed in 2000.

Erie County Department of Environmental and Planning Solid Waste Disposal Sites

One Erie County Solid Waste Disposal Site record was identified for this site, Iroquois Gas/Westwood Pharmaceutical – Dart Street and Bradley Street. Information on these sites was summarized in a previous section that described NYSDEC Registry of Inactive Hazardous Waste Disposal Sites.

Registry of Institutional and Engineering Controls Database

An Institutional Controls record for this site is listed as Iroquois Gas/Westwood Pharmaceutical Terrestrial – Dart Street. Information on this site was summarized in a previous section that described NYSDEC Registry of Inactive Hazardous Waste Disposal Sites.

Conclusion

The past use of the property as a manufactured gas plant and a medicine manufacturer, as well as the past presence of large gas tanks on the property indicate the potential for soil contamination from petroleum, chemicals, and solvents to exist on or adjacent to the site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.17 Site Q: Pagan Auto Sales – 18 Tonawanda St.

This property is located on the west side of Tonawanda Street, north of Niagara Street. This site is located adjacent to the north side of the Project Study Area. Refer to Photo #22 in Attachment B.

Site Inspection

This site is currently a used auto sales lot. It consists of a parking area for used cars and a small office.

Historic Maps

This site is depicted in the 1894 Atlas as US Electric Light Powerhouse.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as a gas station with three tanks and on the 1981 and 1986 maps as an auto repair shop.

City Directories

This site is listed in the 1930-2005 directories as an auto repair shop, 16-20 Tonawanda Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon gas underground storage tank installed in 7/1927 and one (1) 550-gallon gas UST installed in 9/1930.

City of Buffalo Fire Department Records

City records indicate that this site had three (3) 550-gallon gas tanks installed in 11/1944.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Lockport Truck Repair – Niagara and Tonawanda Streets – Spill# 9009320 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.

Conclusion

The past use of this property as a gas station and/or an auto repair shop with underground storage tanks for more than 50 years indicates the potential for encountering soil contamination from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.18 Site R: Fort Knox Business Center – 31 Tonawanda St.

This property is located on the east side of Tonawanda Street, north of the Route 198 Niagara Street off-ramp, on both sides of West Avenue. This site is adjacent to and partially within the Project Study Area. Refer to Photos #23-25 in Attachment B.

Site Inspection

The property is currently Fort Knox Business Center. The building consists of several connected large buildings, parking lots, and storage area.

Aerial Photos

Several large structures are present on this site on the 1927, 1966, 1978, 1995, and 2008 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

This site is depicted in the 1884 and 1894 Atlases as a steam saw mill and the Steam Fire & Brick Works. This site is depicted in the 1915 Atlas as Fedders Automotive, Hall & Sons Fire Brick Works and the US Electric Light Powerhouse. In addition, several small structures are depicted on the 1901 topographic map and two large structures are depicted on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as an electric company, a shingle mill, a cooper shop, and a fire brick manufacturer; on the 1900 map as an electric company and a fire brick manufacturer; on the 1916 map as Fedders Manufacturing Company, a carting company, and a fire brick manufacturer; and on the 1950, 1981, and 1986 maps as Fedders Manufacturing Company with a gas tank and two aboveground propane tanks shown on the 1950 map.

City Directories

This site is listed in the 1930-1935 directories as Hall Brothers Fire Bricks, 69 Tonawanda Street; in the 1930-1935 directories as Buffalo General Electric, 3 Tonawanda Street; in the 1930-1996 directories as Fedders/Fedco Automotive Components Company, 3-57 Tonawanda Street; and in the 1990 directory as Black Rock Trade Center, 69 Tonawanda Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 15,000-gallon #6 fuel oil underground storage tank installed in 9/1961; one (1) 3,000-gallon gas underground storage tank installed in 9/1947; and two (2) 550-gallon gas underground storage tanks installed in 8/1946.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Fedco Automotive Components Company – 57 Tonawanda Street. One (1) 15,000-gallon #6 fuel oil underground storage tank (installed 12/1961, closed-removed 9/1992) was listed for this site.

NYSDEC Chemical Bulk Storage Database

A CBS record for this site is listed as Fedco Automotive Components Company – 57 Tonawanda Street. Four (4) 250-gallon zinc aboveground storage tanks (installed 7/1987 and closed 3/1991); one (1) 1,000-gallon mixed xylene aboveground storage tank (install date unknown, closed 3/1991); and two (2) 250-gallon zinc aboveground storage tanks (installed 3/1991, closed 12/1992) were listed for this site.

RCRA Generator

A RCRA record for this site is listed as Fedco Automobile Components Company – 57 Tonawanda Street. This site was identified as a small quantity hazardous waste generator. Generator and Land Ban Requirement violations were identified for this property.

RCRA No Longer Regulated

A RCRA record for this site is listed as Go/Dan Industries Inc. – Tonawanda Street. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. Generator oversight violations were identified for this property.

No Further Remedial Action Planned Sites

A CERCLIS NFRAP record for this site is listed as Fedders Auto Company – 57 Tonawanda Street. This site manufactured automotive components. In 1974, waste oil was spread over the dirt parking lot to control dust. No transformer oil was used. This process was discontinued in 1976. A site inspection in 1986 discovered 66 drums of paint material and waste oil. No further remedial action is planned.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Fedco Automotive Components – 57 Tonawanda Street – Spill# 9975208 – On June 15, 1999 an underground storage tank was taking on water. The tank had not been used for 25 years. The tank was removed and contamination was found in the excavation. The contaminated soil was removed; the spill was made inactive and closed.
- Fedder Corporation – 57 Tonawanda Street – Spill# 8809528 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.

NYSDEC Registry of Inactive Hazardous Waste Disposal Sites

An Inactive Hazardous Waste Disposal Site record for this site is listed as Fedders Auto Components – 57 Tonawanda Street – The site identifies the parking lot for the Fedco Automotive Components Company. Historically, waste oils were spread over the dirt parking area as a dust suppressant. Volatile organics, PCBs and lead contaminants were detected in site soils and sediments of the adjacent Scajaquada Creek. In addition, VOCs were detected in the groundwater. The parking area was covered with gravel in 1981. This site is a Class 4, which indicates that it has been properly closed but requires continued management. The Scajaquada Creek sediments were remediated in 1998-1999. The remaining contamination is reportedly not currently posing a significant threat to the environment.

Erie County Department of Environmental and Planning Solid Waste Disposal Sites

One Erie County Solid Waste Disposal Site record was identified for this site, Fedders Auto Components – 57 Tonawanda Street. Information on these sites was summarized in a previous section that described NYSDEC Registry of Inactive Hazardous Waste Disposal Sites.

Toxic Release Inventory System Database

A TRIS record for this site is listed as Fedco Automotive Components – 57 Tonawanda Street. The record indicates that this site reported releases from 1987 to 2002. No further information was available.

Docket

A Docket record for this site is listed as Fedders Automotive Components – 57 Tonawanda Street. This site had a violation of the Toxic Release Inventory System and Emergency Planning and Community Right-to-Know Act. No further information was available.

Emergency Response Notification System Database

An ERNS record for this site is listed as 57 Tonawanda Street. On November 2, 1990 a traffic accident caused the release of diesel fuel. The fire department was on the scene and no further information was available.

Conclusion

The past use of the property for an auto parts manufacturer, a brick manufacturer and electric company as well as the past presence of tanks and spills on the property indicates the potential for soil contamination from petroleum, chemicals, and solvents to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.19 Site S: Vacant Lot – Former Pratt & Lambert Paint and Varnish Plant – 75 Tonawanda St.

This property is located on the east side of Tonawanda Street, north of the Route 198 Niagara Street off-ramp. This site is adjacent to the Project Study Area. Refer to Photos #26-27 in Attachment B.

Site Inspection

This site is currently a vacant lot surrounded by a fence. Access to the entire site was not possible due to fencing.

Aerial Photos

Several large structures and associated railroad spurs are present on this site on the 1927, 1966, and 1978 aerial photographs. On the 1995 aerial photograph a few of the buildings have been demolished. On the 2008 aerial photographs most of the buildings have been demolished. Only a few buildings remain on this site. The railroad spurs have also been removed. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

This site is depicted in the 1894 Atlas as Buffalo Sewer Pipe Works and in the 1915 Atlas as Pratt and Lambert Varnish Works. In addition, one small structure is depicted on the 1901 topographic map and several large structures are depicted on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889 and 1900 Sanborn Fire Insurance Map as Buffalo Sewer Pipe Company and on the 1916, 1950, 1981, and 1986 maps as Pratt and Lambert Varnish Makers.

City Directories

This site is listed in the 1930-1990 directories as Pratt and Lambert Inc., 73-79 Tonawanda Street and in the 2005 directory as Miracle Adhesives, 75 Tonawanda Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,000-gallon gas underground storage tank installed in 8/1945 and eighteen (18) 12,000-gallon oil and solvent aboveground storage tanks installed in 6/1994.

City of Buffalo Fire Department Records

City records indicate that this site had eighteen (18) 12,000-gallon fuel oil and solvent tanks installed in 9/1959.

NYSDEC Chemical Bulk Storage Database

A CBS record for this site is listed as Pratt and Lambert – 75 Tonawanda Street. One (1) 1,500-gallon mixed xylene aboveground storage tank (installed 12/1904, closed-removed 6/1996); nine (9) 12,000-gallon mixed xylene underground storage tanks (installed 12/1959, closed-removed date unknown); three (3) 2,500-gallon mixed xylene aboveground storage tanks (installed 12/1904, closed-in-place 6/1996); one (1) 2,500-gallon mixed xylene aboveground storage tank (install date unknown, closed-in-place 6/1996); sixteen (16) 2,500-gallon mixed xylene aboveground storage tanks (installed 12/1911, closed-in-place 6/1996); five (5) 2,300-gallon mixed xylene aboveground storage tanks (installed 12/1905, closed-in-place 6/1996); three (3) 2,300-gallon mixed xylene aboveground storage tanks (installed 12/1907, closed-in-place 6/1996); eleven (11) 2,300-gallon mixed xylene aboveground storage tanks (installed 12/1909, closed-in-place 6/1996); two (2) 2,300-gallon triethylamine aboveground storage tanks (installed 12/1909, closed-in-place 6/1996); two (2) 1,600-gallon mixed xylene aboveground storage tanks (installed 12/1929, closed-in-place 6/1996); six (6) 1,500-gallon mixed xylene aboveground storage tanks (installed 12/1904, closed-in-place 6/1996); four (4) 1,500-gallon mixed xylene aboveground storage tanks (installed 12/1910, closed-in-place 6/1996); three (3) 1,500-gallon mixed xylene aboveground storage tanks (installed 12/1909, closed-in-place 6/1996); five (5) 4,000-gallon mixed xylene aboveground storage tanks (installed 12/1922, closed-in-place 6/1996); one (1) 1,550-gallon mixed xylene aboveground storage tank (installed 12/1904, closed-in-place 6/1996); one (1) 500-gallon mixed xylene aboveground storage tank (installed 12/1904, closed-in-place 6/1996); two (2) 1,400-gallon mixed xylene aboveground storage tanks (installed 12/1927, closed-in-place 6/1996); one (1) 1,050-gallon mixed xylene aboveground storage tank (installed 12/1957, closed-in-place 06/1996); one (1) 1,500-gallon mixed xylene aboveground storage tank (installed 12/1914, closed-in-place 6/1996); one (1) 1,500-gallon mixed xylene aboveground storage tank (installed 12/1957, closed-in-place 6/1996); one (1) 1,550-gallon mixed xylene aboveground storage tank (installed 12/1957, closed-in-place 6/1996); three (3) 2,600-gallon mixed xylene aboveground storage tanks (installed 12/1904, converted to non-regulated use date unknown); one (1) 1,500-gallon mixed xylene aboveground storage tank (installed 12/1907, converted to non-regulated use date unknown); two (2) 1,500-gallon mixed xylene aboveground storage tanks (installed 12/1914, converted to non-regulated use date unknown); one (1) 1,300-gallon mixed xylene aboveground storage tank (installed 12/1914, converted to non-regulated use date unknown); four (4) 4,000-gallon mixed xylene aboveground storage tanks (installed 12/1922, converted to non-regulated use date unknown); one (1) 1,300-gallon mixed xylene aboveground storage tank (installed 12/1929, converted to non-regulated use date unknown); one (1) 1,100-gallon mixed xylene aboveground storage tank (installed 12/1914, converted to non-regulated use date unknown); one (1) 1,500-gallon mixed xylene aboveground storage tank (installed 12/1904, converted to non-regulated use date unknown); one (1) 1,100-gallon mixed xylene aboveground storage tank (installed 12/1927, converted to non-regulated use date unknown); and two (2) 1,100-gallon mixed xylene aboveground

storage tanks (installed 12/1957, converted to non-regulated use date unknown); were listed for this site.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Pratt and Lambert – 75 Tonawanda Street. One (1) 1,500-gallon #2 fuel oil aboveground storage tank (installed 12/1924, closed-removed 12/1990); one (1) 1,500-gallon #2 fuel oil aboveground storage tank (installed 12/1924, closed prior to 3/1991); two (2) 12,000-gallon #2 fuel oil underground storage tanks (installed 12/1959, closed-removed 12/1990); one (1) 325-gallon #2 fuel oil aboveground storage tank (installed 12/1924, closed prior to 3/1991); one (1) 1,500-gallon #2 fuel oil aboveground storage tank (installed 12/1924, closed 12/1990); three (3) 3,400-gallon #6 fuel oil aboveground storage tanks (installed 12/1914, closed-removed 12/1990) and thirteen (13) 3,400-gallon #6 fuel oil aboveground storage tanks (installed 12/1914, closed-in-place 12/1990) were listed for this site.

RCRA Generator

A RCRA record for this site is listed as Pratt and Lambert – 75 Tonawanda Street. This site was identified as a large quantity hazardous waste generator. Generator oversight violations were identified for this property.

NYSDEC Spill Report Database

Five spill records were identified for this site:

- Pratt and Lambert – 75 Tonawanda Street – Spill# 9406685 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Pratt and Lambert – 75 Tonawanda Street – Spill# 8603542 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Pratt and Lambert – 75 Tonawanda Street – Spill# 8603159 – On August 11, 1986 an equipment failure caused xylene to spill into the SPDES discharge. The spill was cleaned up, closed, and met NYSDEC cleanup standards.
- Pratt & Lambert – 75 Tonawanda Street – Spill# 8707798 – On December 10, 1987 a tank failed its tank test. The tank was re-tested and passed. The spill was closed and met NYSDEC cleanup standards.
- Pratt & Lambert – 75 Tonawanda Street – Spill# 8908237 – On November 17, 1989 a tank failed its tank test. The tank was removed along with contaminated groundwater. The spill was closed and met NYSDEC clean-up standards.

Emergency Response Notification System Database

An ERNS record for this site is listed as Lehigh Construction – 75 Tonawanda Street. On August 17, 1994, 5-gallons of petroleum solvent (Aromatic 100) was released during the removal of a pipe. Booms were deployed and the material was cleaned up. No further action was required.

RCRA – Treatment, Storage & Disposal

A RCRA TSD record for this site is listed as Pratt and Lambert – 75 Tonawanda Street. The records indicate generator oversight violations for this site.

Toxic Release Inventory System Database

A TRIS record for this site is listed as Pratt and Lambert – 75 Tonawanda Street. The record indicates that this site reported releases from 1987 to 1996. No further information was available.

Conclusion

The past use of the property as a paint and solvent manufacturer, as well as the past presence of over 100 petroleum and chemical storage tanks on the property indicate the potential for soil contamination from petroleum, chemicals, solvents and paint products to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.20 Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, & Kellex Polymers – 125-137 Tonawanda St.

This property is located on the east side of Tonawanda Street, north of the Route 198 Niagara Street off-ramp. This site is adjacent to and partially within the Project Study Area. Refer to Photos #28-31 in Attachment B.

Site Inspection

This site consists of vacant land, manufacturing facilities and vacant factory buildings. A sign on the building identifies that a portion of the site is used as auto repair shops and light industrial facilities. Portions of the site are currently vacant with broken cement, scrap metal, rusted drums, rusted trucks, used tires, and other garbage spread across the lot.

Aerial Photos

Several large structures and associated railroads are present on this site on the 1927, 1966, 1978, 1995, and 2008 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Atlases

This site is depicted in the 1884 Atlas as FP Wood Tub and Pail Company and as the US Hame Company in the 1915 Atlas. In addition, one small structure is depicted on the 1901 topographic map and several large structures are depicted on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889 Sanborn Fire Insurance Map as part of Pratt & Letchworth; on the 1900, 1916, and 1950 maps as US Hame Company with a

gasoline storage house and fuel oil tanks; and on the 1981 and 1986 maps as Watts Properties Inc. & Fedders Inc. warehouse.

City Directories

This site is listed in the 1930-1950 directories as USHCO Manufacturing Company, 135 Tonawanda Street; in the 1930-1965 directories as Hard Manufacturing Company (hospital furniture manufacturer), 117-23 Tonawanda Street; in the 1965 directory Concor Inc., Stetter Machine Company, Electric Apparatus Company, 135 Tonawanda Street; in the 1971 directory as Castle Company (washing machine manufacturer), 117 Tonawanda Street; in the 1975 directory as Castle Company (hospital and lab supplies), 111 Tonawanda Street; in the 1980 directory as G&R Machinery, 135 Tonawanda Street; in the 1980-1996 directories as Plywood Plastics, 111 Tonawanda Street; in the 1990-2005 directories as Em-Kay Molds, Marsh Metal Plating, Kellex Polymers, Dan's Auto Body, Lanza Auto Works, 135 Tonawanda Street; and in the 2005 directory as Buffalo Business Interiors, 111 Tonawanda Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon gas underground storage tank installed in 10/1935.

Conclusion

The past use of the property as a manufacturing facility for numerous companies, as well as the past presence of tanks on the property indicate the potential for soil contamination from petroleum, chemicals, and solvents to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.21 Site U: Former Pratt & Letchworth - 189-205 Tonawanda St.

This property is located on the east side of Tonawanda Street, north of the Route 198 Niagara Street off-ramp. This site is adjacent to and partially within the Project Study Area. Refer to Photos #32-33 in Attachment B.

Site Inspection

This site is currently a vacant lot. Most recently it was used as a golfing facility and the remains of the miniature golf course are still present along the eastern end of the property. The rest of the property is currently a field.

Aerial Photos

Several large structures and associated railroad spurs are present on this site on the 1927, 1966, and 1978 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses. Some of the structures have been demolished on the 1995 and 2008 aerial photographs.

Historic Maps

This site is depicted in the 1894 Atlas as Buffalo Malleable Iron Works and in the 1884 and 1915 Atlases as Pratt & Letchworth Buffalo Malleable Iron Works. In addition, one very large structure is depicted on the 1901 topographic map and several very large structures are depicted on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1889, 1900, 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as Pratt & Letchworth.

City Directories

This site is listed in the 1930-1980 directories as Pratt & Letchworth, 189 Tonawanda Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 500,000-gallon tank installed in 10/1939; one (1) 500,000-gallon fuel oil tank installed in 8/1941; one (1) 2,000-gallon gas underground storage tank installed in 2/1955; and one (1) 30,000-gallon propane aboveground storage tank installed in 10/1977. In addition, City records indicate that a concrete oil tank house was constructed at this site in 7/1916.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as 189 Tonawanda Street Corporation – 189 Tonawanda Street. Four (4) 20,000-gallon #6 fuel oil aboveground storage tanks (install date unknown, removed 8/1995) were listed for this site.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Along Street – Spill# 1403149 – Tonawanda Street & Watts – On June 20, 2014 two (2) 55-gallon drums and a pile of drums were found abandoned along the grassy shoulder of the street. Some leakage has occurred. The drums, tires and contaminated soil were removed from the site. The spill was closed but did not meet NYSDEC cleanup standards.

NYSDEC Registry of Inactive Hazardous Waste Disposal Sites

An Inactive Hazardous Waste Disposal record for this site is listed as Pratt & Letchworth – 189 Tonawanda Street. A preliminary investigation documented subsurface soil, surface soil, and surface water contamination on this site. Contaminants included polycyclic aromatic hydrocarbons, PCBs, phenolics, volatile organic compounds, and heavy metals. A petition to delist a portion of the site for the construction of a store and parking lot was submitted and approved. The PCB contaminated soils have been removed from the site. No known hazardous wastes reportedly remain on the site.

Erie County Department of Environmental and Planning Solid Waste Disposal Sites

One Erie County Solid Waste Disposal Site record was identified for this site, Pratt and Letchworth – 189 Tonawanda Street. Information on these sites was summarized in a previous section that described NYSDEC Registry of Inactive Hazardous Waste Disposal Sites.

Conclusion

The past use of the property for an iron works site, as well as the past presence of tanks on the property indicate the potential for soil contamination from petroleum, chemicals, and solvents to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.22 Site V: City of Buffalo Impound Lot – 166 Dart St.

The property is located on the west side of Dart Street. This site is adjacent to the Project Study Area. Refer to Photos #34-35 in Attachment B.

Site Inspection

This site is currently being used by the City of Buffalo as an automobile impound lot.

Aerial Photos

One structure and associated railroad spur is present on this site on the 1927 aerial photograph. Several additional structures have been added to the site on the 1966 aerial photograph, the railroads are still shown. The 1978 and 1995 aerial photographs depict an additional building on the site. The railroad track appears to have been removed from the central portion of the site on the 1995 aerial photograph. The buildings remain the same on the 2008 aerial photograph but the open land around the buildings is now used as a parking lot. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Atlases

This site is depicted in the 1915 Atlas as Buffalo Structural Steel. In addition, one large structure is depicted on the 1948 topographic map. Scajaquada Creek was much wider through this section and a portion of the creek crossed this site.

Sanborn Maps

This site is depicted on the 1900, 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as Buffalo Structural Steel.

City Directories

This site is listed in the 1930-1990 directories as Buffalo Structural Steel, 166-200 Dart Street, in the 2005 directory as Buffalo Parking Enforcement, 166 Dart Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 4,000-gallon underground storage tank installed in 11/1966.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Buffalo Structural Steel – 166 Dart Street. Three (3) 1,800-gallon #2 fuel oil aboveground storage tanks (install date unknown, in service) and one (1) 4,000-gallon diesel underground storage tank (install date unknown, closed-removed 2/1992) were listed for this site.

Conclusion

The past use of this property as a steel company and an automobile storage area indicates the potential for soil contamination from petroleum, chemicals, and solvents to exist on site. In addition, a portion of Scajaquada Creek was filled in on this site. Therefore, there is the potential for a large amount of fill material to be present on this site.

3.1.23 Site W: Buffalo State College Parking Lot – Grant St.

This site is mainly a parking lot owned by Buffalo State College (Site W-1). This site also includes some private properties including Niemiec Builders Supplies at 800 Grant Street (Site W-2). This site is shown on **Figure 2** as Sites W-1 and W-2 respectively. The site is located on the west side of Grant Street, south of Route 198. This site is adjacent to the Project Study Area. Refer to Photos #36-37 in Attachment B.

Site Inspection

This site is currently a parking lot for Buffalo State College.

Aerial Photos

Several large structures and associated railroad spurs are present on this site on the 1927, 1966, and 1978 aerial photographs. On the 1995 and 2008 aerial photographs many of the buildings have been removed and replaced with parking lots. Only a few buildings remain on this site. The railroad tracks have also been removed. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Atlases

This site is depicted in the 1915 Atlas as residential property along Grant Street and Frontier Iron Works and US Headlight Company along Dart Street and in the 1884 Atlas as part of the Pratt and Letchworth Company. In addition, several large structures are depicted on this site on the 1948 topographic map. Scajaquada Creek was much wider through this section and a portion of the creek crossed this site.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as several large factories with tanks; on the 1981 map as several large factories with tanks; and on the 1986 map as several large factories with tanks and a lumber yard.

City Directories

This site is listed in the 1930-1940 directories as Combined Supply and Equipment Company (foundry supplies), 766-72 Grant Street; in the 1930-1960 directories as Air Reduction Sales Company, 730 Grant Street; in the 1935-2005 directories as a gasket company, 684 Grant Street; in the 1940-1950 directories as Air Reduction Sales Company, 720 Grant Street; in the 1940-1955 directories as Niemiec Brother's coal, 802 Grant Street; in the 1960 directory as Fireside Fuel, 800 Grant Street; in the 1965 directory as Ohio Chemical and Surgical Equipment Co., 730 Grant Street; in the 1971-1975 directories as Buffalo State College, 730 Grant Street; in the 1990-2005 directories as Niemiec Brother Bldg. Supply, 800 Grant Street; and in the 2000 directory as Jewett Refrigeration, 750 Grant Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon gas underground storage tank installed in 12/1926 (2 Letchworth Street); one (1) 1,000-gallon gas underground storage tank installed in 1/1950 (2 Letchworth Street); one (1) 8,000-gallon #5 fuel oil underground storage tank installed in 12/1955 (21 Letchworth Street); one (1) 8,000-gallon gas underground storage tank installed in 6/1957 (730 Grant Street); and one (1) 1,000-gallon gas underground storage tank installed in 7/1954 (800 Grant Street).

RCRA Generator

A RCRA record for this site is listed as Ruslander and Sons – 18 Letchworth Street. This site was identified as a small quantity hazardous waste generator. Generator oversight violations were identified for this property.

Conclusion

The past use of the property for manufacturing facilities for numerous companies, as well as the past presence of tanks on the property indicate the potential for soil contamination from petroleum, chemicals, and solvents associated with these historical manufacturing processes exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.24 Site X: Buffalo State College Stadium & Parking Lots – 1300 Elmwood Ave.

This property is located south of Route 198 between Elmwood Avenue and Grant Street. Portions of this site are located within the Project Study Area. Refer to Photo #38 in Attachment B.

Site Inspection

The property is currently Buffalo State College. The site consists of several large buildings, parking lots, and an athletic field.

Aerial Photos

A college campus is present on this site on the 1966, 1978, 1995, and 2008 aerial photographs. The site consists of large buildings, parking lots and an athletic field.

Historic Maps

This site is depicted in the 1884 Atlas as part of Buffalo State Insane Asylum and the portion of the site currently occupied by the athletic stadium was part of Pratt and Letchworth. The 1915 Atlas depicts the site as part of Buffalo State Hospital and the portion of the site currently occupied by the athletic stadium was part of Connell Anthracite Coal Company.

Sanborn Maps

Portions of this site are depicted on the 1916 Sanborn Fire Insurance Map as a brass foundry, a coal company, and the Buffalo State Hospital for the Insane; on the 1950 map as a factory, two gas stations, and the NYS College for Teachers; and on the 1981 and 1986 maps as Buffalo State College.

City Directories

This site is listed in the 1930-1955 directories as a gas station, 817 Grant Street; in the 1940-1950 directories as a gas station, 767 Grant Street; and in the 1940-1960 directories as Buffalo Machinery Corporation, 833-841 Grant Street.

City of Buffalo Building Department Records

City records indicate that portions of this site had one (1) 3,000-gallon gas underground storage tank installed in 7/1958 (817 Grant Street); one (1) 29,500-gallon gas underground storage tank installed in 10/1926 (817 Grant Street); one (1) 2,000-gallon gas tank installed in 5/1952 (767 Grant Street); and one (1) 1,000-gallon gas tank installed in 9/1941 (767 Grant Street).

RCRA Generator

This site is located on Buffalo State College Property. A RCRA record was identified for the college which was listed as State University College at Buffalo – Elmwood Avenue. The College was identified as a large quantity hazardous waste generator. Generator oversight violations were identified for this property. This record is for the College Campus and is not located directly on our Site.

NYSDEC Petroleum Bulk Storage Database

This site is located on Buffalo State College Property. A PBS record was identified for the college which was listed as Buffalo State College (SUNY) – 1300 Elmwood Avenue. Six (6) 42,000-gallon #6 fuel oil underground storage tanks (installed 1/1949, in service); one (1) 100-gallon diesel aboveground storage tank (installed

3/1991, in service); one (1) 275-gallon diesel aboveground storage tank (installed 6/1991, in service); one (1) 200-gallon diesel aboveground storage tank (installed 10/1999, in service); one (1) 500-gallon diesel underground storage tank (installed 7/1963, closed-removed 8/1994); one (1) 8,000-gallon gasoline underground storage tank (install date unknown, closed prior to 3/1991); two (2) 8,000-gallon gasoline underground storage tanks (installed 9/1979, in service); one (1) 12,000-gallon diesel underground storage tank (installed 09/1979, closed-removed 10/1998); and one (1) 275-gallon diesel aboveground storage tank (installed 6/1967, closed-removed 8/1994) were listed for this site. This record is for the College Campus and is not located directly on our Site.

NYSDEC Spill Report Database

This site is located on Buffalo State College Property. Eleven (11) spill records were identified for the college. These records are for the College Campus and are not located directly on our Site.

- SUNY College – 1300 Elmwood Avenue – Spill# 8911892 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- New Building Construction Area – Spill# 0751064 – On November 1, 2007 soil borings were installed for soil loading purposes, petroleum odor was identified in the soil borings at 6-12 feet in depth. The NYSDEC contacted Buffalo State College regarding clean-up. Buffalo State College indicated that they would be building in that area in the next year and they would do the clean-up during construction. The Spill is still active.
- Buffalo State College – 1300 Elmwood Avenue – Spill# 0750778 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Buffalo State College – 1300 Elmwood Avenue – Spill# 9906828 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Buffalo State College-Upton Hall – 1300 Elmwood Avenue – Spill# 0175417 – oil contamination found during construction – closed – did not meet standards.
- Buffalo State College – 1300 Elmwood Avenue – Spill# 8605107 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- SUNY College – 1300 Elmwood Avenue – Spill# 9902022 On May 21, 1999 the top of a tank was cracked during a tank upgrade. No product was lost. The tank was repaired and re-tested. The tank passed the re-test. The spill was closed and met NYSDEC clean-up standards.
- Buffalo State College – 1300 Elmwood Avenue – Spill# 9975398 – On September 7, 1999 contamination was found during the demolition of a sheet metal processing facility. A 6,000-gallon #6 fuel oil tank was removed along with the contaminated soil. The spill was closed and met NYSDEC clean-up standards.

- Buffalo State College – Elmwood Avenue – Spill# 8911283 – On February 28, 1990 a contractor removed and replaced a leaking line. The spill was closed and met NYSDEC clean-up standards.
- Buffalo State College/NYS – Elmwood Avenue – Spill# 9310026 – On November 9, 1993 a leaking 300-gallon tank was removed. The contaminated soil was removed. The spill was closed and met NYSDEC clean-up standards.
- Buffalo State College – Elmwood Avenue – Spill# 0911317 – On January 21, 2010 PCB contaminated soil was identified in a limited area near some windows at Bacon Hall. The PCB contamination is reportedly from PCBs leaching from the window caulk. The site was to be cleaned up under the supervision of EPA. The spill was closed on 1/17/2012.

Emergency Response Notification System Database

An ERNS record for this site is listed as Buffalo State College – 1300 Elmwood Avenue. On September 7, 1999 a contractor damaged an underground storage tank during construction work and caused the release of #6 fuel oil. No further information was available.

Conclusion

The past use of the property as a brass foundry; a coal company, and gas stations as well as the past presence of tanks on the property indicate the potential for soil contamination from petroleum, chemicals, and solvents associated with these historical processes to exist on site. In addition, there is a potential for abandoned USTs to be present on the property.

3.1.25 Site Y: On/Off Ramp – Grant St.

This property is located on the east side of Grant Street, south of Amherst Street. This site is located within the Project Study Area. Refer to Photo #39 in Attachment B.

Site Inspection

This site is currently the Grant Street on/off ramp from Route 198.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as a filling station with two tanks.

City Directories

This site is listed in the 1935-1950 directories as a gas station, 917 Grant Street.

City of Buffalo Building Department Records

City records indicate that this site (917 Grant Street) had one (1) 550-gallon gas underground storage tank installed in 5/1930.

Conclusion

The past use of this property as gas station with underground storage tanks for more than 20 years indicates the potential for encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.26 Site Z: Tops Grocery Store/Burger King – 333-365 Amherst St.

This property is located on the west side of Grant Street, at Amherst Street. This site is adjacent to the project study area. Refer to Photos #40-41 in Attachment B.

Site Inspection

This site is currently a shopping plaza with a large grocery store, a Burger King Restaurant and several small retail stores. A large parking lot is also present on this site.

Aerial Photos

Several large structures are located on the southwest corner of Grant Street and Amherst Street on the 1927 aerial photograph. On the 1966 and 1978 photographs there are still several large structures at the intersection of Grant Street and Amherst Street, however, the large building near the creek has been removed and an on-ramp to Route 198 is present. On the 1995 aerial photograph, the large building on the southwest corner has been replaced with another large building and the on ramp to Route 198 has been removed. An additional building has been added to the site on the 2008 aerial photograph. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Sanborn Fire Insurance Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as a dye manufacturer and as an auto sales and service lot.

City Directories

This site is listed in the 1950 directory as Black Rock Motors, 367 Amherst Street; in the 1971-1975 directories as a gas station, 329 Amherst Street; and in the 1985-1990 directories as an auto repair shop, 329 Amherst Street.

City of Buffalo Building Department Records

City records indicate that this site (367 Amherst Street) was used for an auto service facility in 1946 and as an auto parts store in 1959.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Street – Grant & Amherst Street – Spill# 1511123 – On February 19, 2016 equipment failure caused hydraulic oil to spill. The spill was cleaned up and closed but did not meet NYSDEC cleanup standards.

- Parking Lot – 345 Amherst Street – Spill #1307337 – On October 16, 2013 contaminated fill was found during test pit sampling for the construction of a new gas station. The site has a history of fill material throughout which has historic contaminants. The material excavated for the construction activities were disposed of and no further action was required. The spill was made inactive and closed but did not meet NYSDEC cleanup standards

Conclusion

The past use of this property as a dye manufacturer and as an auto sales and service facility indicates the potential for encountering soil contamination in the ROW from petroleum products, chemicals, and solvents associated with historical processes. In addition, a portion of Scajaquada Creek was filled in on this site. Therefore, there is the potential for a large amount of fill material to be present on this site.

3.1.27 Site AA: Former Buffalo Fire Station – 395 Amherst St.

This property is located on the south side of Amherst Street, east of Grant Street. This site is adjacent to the project study area. Refer to Photo #42 in Attachment B.

Site Inspection

This site is a former fire station that is currently owned by the Polish Cadets. A diesel pump is present in front of the building.

Sanborn Fire Insurance Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as having two gas tanks in the road in front of 399-411 Amherst Street and on the 1950, 1981, and 1986 maps as the Buffalo Fire Department with one tank.

City Directories

This site is listed in the 1930-1990 directories as the City of Buffalo Fire Station #12, 395 Amherst Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 275-gallon underground storage tank installed in 3/1964.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Buffalo Fire Ladder #12 – Spill# 9911520 – Amherst Street & Grant Street – On January 3, 2000 contaminated soil was discovered during a tank removal. The majority of the contaminated soil was removed however; a small amount remained under the building. The spill was made inactive and closed.

- Buffalo Fire Dept. Ladder 12 – Spill# 0809549 – Amherst near Grant – On November 24, 2008, petroleum contaminated soil was discovered while removing a 550-gallon diesel fuel tank. The tank was removed along with 25.2 tons of contaminated soil and 380-gallons of contaminated groundwater. Some contaminated soil was left in place beneath the building and under the street. The spill cleanup and closed nut did not meet NYSDEC cleanup standards.

Conclusion

The past presence of USTs and the spill records for this site indicate that petroleum contamination remains under the building and under the street adjacent to the site. Therefore, there is a potential for encountering contaminated soils in the ROW if excavations are to take place adjacent to this site.

3.1.28 Site AB: Wegman's – 601 Amherst St.

This property is located on the south side of Amherst Street, east of Bridgeman Street. This site is adjacent to the Project Study Area. Refer to Photos #43-44 in Attachment B.

Site Inspection

This site is currently a Wegman's Grocery Store.

Aerial Photos

Several large facilities and associated railroad are present on this site on the 1927, 1966, 1978, and 1995 aerial photographs. In the 2008 aerial photograph, the large building has been demolished and replaced with a smaller building and a large parking lot. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

A large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1950 and 1981 Sanborn Fire Insurance Maps as Morrison Steel Products and the Kelker Blower Company with a gas well and on the 1986 map as the Amherst Industrial Park.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,000-gallon tank installed in 5/1946.

City Directories

This site is listed in the 1930 directory as Alco-Gravure Inc. (lithographs), 601 Amherst Street; in the 1930-1935 directories as American Lithographic Company, 595-635 Amherst Street; in the 1930-1965 directories as Kelker Blower Company, 19 Bush

Street; in the 1940-1971 directories as Morrison Steel, 601 Amherst Street; in the 1975-1980 directories as Markel Nu Tone (electric heating manufacturer), 601 Amherst Street; in the 1985 directory as Mohawk Industries, Morrison Industries, AABCO Packaging Inc., 601 Amherst Street; in the 1990 directory as Mohawk Industries, Morrison Industries, Conveyor & Caster Corporation – 601 Amherst Street; in the 1996 directory as Campus Industries (conveyor and caster manufacturer), Mohawk Industries, Moor Electronics, Niagara Aluminum Adhesive Products Corporation, 601 Amherst Street; and in the 2005 directory as Wegman's, 601 Amherst Street.

Voluntary Cleanup Program

A Voluntary Cleanup Program record for this site is listed as 601 Amherst Street. The property was formerly the location of an industrial park known as Campus Industries. The property is bound on the south side by a city bike path and Scajaquada Creek. Historically the site was used for the disposal of ash and cinders from various sources as fill material. The property has been used for industrial and commercial purposes since the 1920's. In 1997, Wegman's Food Markets purchased the property and entered the States Voluntary Cleanup Program to investigate and remediate the site. The remediation consisted of the removal of transformers containing PCB oil, three (3) underground storage tanks, one (1) aboveground storage tank, and 345 tons of contaminated soil. Deed restrictions and a final engineering report were filed in 1997. No further action is required at this site.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Morrison Industries – 601 Amherst Street – Spill# 8901265 – On May 9, 1989 National Fuel Gas found gasoline in the stone sub-base of the parking lot when they excavated to repair a gas line. The property owner investigated and identified a fuel oil tank as the possible source. The tank was removed and no contamination was identified. National fuel gas repaired the gas line and no further action was required. The spill was closed and the cleanup met NYSDEC standards.
- Spill# 9704335 – Wegman's Store – 601 Amherst Street – On December 07, 1997 the NYSDEC received the results from a post tank removal test that indicated elevated levels of 1,2,4 trimethylbenzene. No further action was required and the spill was made inactive and closed.

Conclusion

The past use of this property as a steel company, a lithographic company, and blower manufacturing facility, indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes. Much of the site has been remediated; however, deed restrictions indicate that contamination may still be present.

3.1.29 Site AC: Marcon Erectors – 1 Howell St.

This property is located on the east side of the foot of Howell Street. This site is adjacent to the project study area. Refer to Photos #45-46 in Attachment B.

Site Inspection

This site is currently a warehouse.

Aerial Photos

A large building and associated railroad are present on this site on the 1927, 1966, 1978, 1995, and 2008 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

A large structure is depicted on this site on the 1901 and 1948 topographic maps.

Sanborn Maps

This site is depicted on the 1900 and 1916 Sanborn Fire Insurance Maps as the American Buffalo Robe Company with a dye house; on the 1950 and 1981 maps as a petroleum company with several tanks; and on the 1986 map as large unidentified factory/warehouse.

City Directories

This site is listed in the 1930 directory as Allied Oil Corporation, 1 Howell Street; in the 1935-1955 directories as Terminal Petroleum Company, 1 Howell Street; in the 1940-1955 directories as Erie Oil Corporation, 1 Howell Street; in the 1960-1965 directories as Solvents & Chemical Company, 1 Howell Street; in the 1960-1965 directories as Frontier Oil, 1 Howell Street; in the 1971 directory as Ashland Oil Company (warehouse), 1 Howell Street; in the 1975 directory as Hoffman Roofers, Upstate Insulation Company, 1 Howell Street; in the 1980-2005 directories as Marcon Erectors, 1 Howell Street.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 1,000-gallon waste oil aboveground tank installed in 9/1968. In addition, City records indicate that in 10/1945, Cities Service Fuel Corporation had 30 aboveground storage tanks (installation date unknown) that contained gasoline, ethyl gas, fuel oil, motor oil and kerosene. These tanks ranged in size from 280-gallon to 90,000-gallon. Approximately 11,000-gallons of anti-freeze were stored in the basement in 50-gallon drums.

City of Buffalo Building Department Records

City records indicate that this site had four (4) 20,000-gallon fuel oil tanks installed in 9/1931; one (1) 5,000-gallon fuel oil tank installed in 2/1961; and one (1) 1,000-gallon fuel oil tank installed in 10/1968. In addition an asphalt tank was constructed

in 12/1936. This site (1-7 Howell Street) was identified as the American Buffalo Robe Company in 1916.

RCRA Generator

A RCRA record for this site is listed as Marcon Erectors – 1 Howell Street. This site was identified as a large quantity hazardous waste generator. Generator oversight and land ban violations were identified for this property.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Marcon Erectors – Spill# 9507939 – Howell Street – On September 1, 1995 a contractor hired to remove scrap tanks from the site found the tanks cut open and leaking all over the property. The contaminated soil and sludge from the tanks was removed from the site. Additional underground storage tanks were identified during the removal of contaminated soils. These tanks were also removed. This spill is still active. See the section on NYSDEC Registry of Inactive Hazardous Waste Disposal Sites below for more information on this site.

NYSDEC Registry of Inactive Hazardous Waste Disposal Sites

A State record for this site is listed as Marcon Erectors – 1 Howell Street. This site is listed as a delisted hazardous waste site. From 1915 to 1971, the site was used by a company affiliated with Ashland Petroleum Company for fuel blending operations. In addition, the site was used by a roofing company from 1971 to 1980. Most recently, the site was used to re-manufacture windows. The site was abandoned when Marcon purchased the site. The site comprises approximately 1.3-acres in a mixed residential, commercial and industrial area. This site contained a multi-story brick and block building and a concrete containment area that had two horizontal, 10,000-gallon ASTs in saddles and one 25,000-gallon aboveground storage tank which had been modified. The concrete containment area had been compromised, with cracks evident in the sides and bottom. The modified tank contained sludge that was contaminated with VOCs and PCBs and had the potential to fill with precipitation and overflow into a compromised containment area. Soil samples taken in and outside of the containment area in 1997 contained PCB levels at varying amounts from 7 parts per million (ppm) to 230 ppm. All PCB contaminated sludge and soils has reportedly been removed and disposed of off-site.

Conclusion

The past use of this property as a window manufacturer, a petroleum company and a robe manufacturer with numerous tanks and an open spill file indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes.

3.1.30 Site AD: Contractor Storage Area – 18 Howell St.

This property is located on the west side of the foot of Howell Street. This site is adjacent to the project study area. Refer to Photo #47 in Attachment B.

Site Inspection

This site is currently a fenced in storage yard being used to store miscellaneous construction equipment. No tanks or drums were identified on the site,

Sanborn Maps

This site is depicted on the 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as having a railroad crossing the northern side of a vacant lot.

Conclusion

The past and present use of this property as a contractor storage area indicates a potential for encountering contaminated soils in the ROW from chemicals, solvents and petroleum products stored on the site.

3.1.31 Site AE: Residential Property – 227 Middlesex Rd.

This property is located on the north side of Middlesex Road, west of Lincoln Parkway. This site is located north of the project study area. Refer to Photo #48 in Attachment B.

Site Inspection

This site consists of a residential home on Middlesex Road and the backyard of a residential home on Lincoln Parkway.

Sanborn Maps

A gas tank is depicted in the backyard of 227 Middlesex Road on the 1935, 1950, and 1986 Sanborn Fire Insurance Maps and a gas tank is depicted in the backyard of 201 Middlesex Road on the 1916 Sanborn Fire Insurance Map.

Conclusion

The past presence of an underground storage tank behind the houses indicates a potential for encountering contaminated soils in the ROW.

3.1.32 Site AF: Buffalo Police Radio Tower – Route 198 Eastbound

This property is located on the north side of Route 198 in Delaware Park. This site is located within the Project Study Area. Refer to Photo #49 in Attachment B.

Site Inspection

The property is currently the Buffalo Police Radio Tower. A fill port and vent was observed on the east side of the building.

Aerial Photos

A small structure is visible at the current location of the Buffalo Police Radio Tower on the 1927, 1966, 1978, 1995, and 2008 aerial photographs.

Sanborn Maps

This site is depicted on the 1950 and 1986 Sanborn Fire Insurance Maps as the Buffalo Police Radio Tower.

City Directories

This site is listed in the 1971-1990 directories as the Buffalo Police Radio Tower, Humboldt Parkway.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Buffalo Police Radio Tower – Route 198 Eastbound – Spill# 9910558 – On December 4, 1999 petroleum contamination was found during the removal of a tank. The contaminated soil was removed along with the tank. The spill was closed, and met NYSDEC cleanup standards.
- Buffalo Police Radio Tower – Route 198 Eastbound – Spill# 9910557 – This is a duplicate of Spill# 9910558.

Conclusion

The presence of an underground storage tank with a spill record at this site indicates a potential for encountering contaminated soils in the ROW.

3.1.33 Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Pl.

This property is located on the north side of Meadowview Place. This site is located within the Project Study Area. Refer to Photos #50-51 in Attachment B.

Site Inspection

The property is currently the Delaware Park Labor Center. The building consists of a twelve-bay garage and office space. Two gas pumps and used tires were observed west of the building.

Aerial Photos

A single horseshoe shaped building is present on this site on the 1927 aerial photograph. On the 1966 aerial photograph a second building has been added to the site, west of the original building. On the 1978, 1995, and 2008 aerial photographs, the horseshoe shaped building is gone and the current building is present. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Sanborn Map

This site is depicted on the 1935, 1950, and 1986 Sanborn Fire Insurance Maps as the Park Maintenance Garage. A tank was depicted in front of the building on the 1950 and 1935 maps.

City Directories

This site is listed in the 1971-1990 directories as the City of Buffalo Parks Department, Humboldt Parkway and in the 1996-2005 directories as the City of Buffalo Parks Department, 17 Meadowview Place.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 2,000-gallon gas underground storage tank installed in 3/1968.

RCRA Generator

A RCRA record for this site is listed as City of Buffalo Parks Department – 17 Meadowview Place. This site was identified as a large quantity hazardous waste generator; however, no violations were identified for this property.

RCRA No Longer Regulated

A RCRA record for this site is listed as City of Buffalo Parks Department – 17 Meadowview Place. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Delaware Labor Center – 17 Meadowview Place. One (1) 200-gallon waste oil aboveground storage tank (installed 7/2001, currently in-service); two (2) 3,000-gallon gasoline underground storage tanks (installed 10/1971, closed prior to 3/1991); one (1) 3,000-gallon diesel underground storage tank (installed 10/1971, closed prior to 3/1991); one (1) 4,000-gallon gasoline underground storage tanks (installed 5/1989, currently in-service); and one (1) 3,000-gallon diesel underground storage tank (installed 10/1971, currently in-service) were listed for this site.

NYSDEC Spill Report Database

Three spill records were identified for this site:

- City of Buffalo Park – 17 Meadowview Place – Spill# 9875365 – On January 28, 1999 petroleum contamination was found during the removal of a tank. The contaminated soil was removed along with the tank. The spill was made inactive due to low levels of benzene that remain in the excavation. The spill was closed on December 10, 1999.

- Delaware Park Labor Center – 25 Meadowview Place – Spill# 8809536 – On March 10, 1989 an underground storage tank failed its tank test. The tank was emptied and removed. No contamination was observed in the excavation and the spill was closed, and met NYSDEC cleanup standards.
- Delaware Park Labor Center –17 Meadowview Place – Spill# 0906483 – On September 3, 2009 10-gallons of hydraulic oil was spilled onto the floor inside the garage. The spill ran outside to the concrete entrance pad and then onto the soil. The concrete surfaces and soil were cleaned up and the spill was closed on 10/02/2009. The spill file indicates that the cleanup met standards.

Conclusion

The past and present use of this property as a garage/repair shop and the presence of multiple USTs indicates the potential for encountering soil contamination from petroleum products or unmarked, abandoned USTs in the ROW during excavation and construction activities.

3.1.34 Site AH: Delaware Park – Parkside Ave.

This property is located on the west side of Parkside Avenue, north of Robie Street. This site is adjacent to the Project Study Area. Refer to Photo #52 in Attachment B.

Site Inspection

This site is currently a portion of Delaware Park.

Historic Maps

A pond is depicted on this site on the 1901 topographic map.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as an abandoned quarry and on the 1935 and 1950 maps as a rock garden.

Conclusion

The past use of the property as a quarry that has since been filled indicates the potential for encountering soil contamination from the filling of the quarry. Most of the quarry fill was placed at a time when environmental laws were not in place; therefore, if excavation is expected in this area, there is a potential to encounter historic contaminated fill from unknown sources. In addition, Route 198 is located in an industrial area that was producing industrial wastes that were commonly used as fill at the time this quarry was being filled.

3.1.35 Site AI: Metro-Rail Subway Station – 2085 Main St.

This property is located on the southeast corner of Main Street and Kensington Avenue. This site is located within the Project Study Area. Refer to Photos #53-54 in Attachment B.

Site Inspection

This site is currently a single-story Metro Rail subway station surrounded by sidewalks and a small maintenance building.

Aerial Photos

The subway station building is present on the 1995-2008 aerial photos.

Sanborn Map

This site is depicted on the 1916 Sanborn Fire Insurance Map as a paint shop and on the 1935 and 1950 maps as a gas station with six (6) tanks.

City Directories

This site is listed in the 1930-1946 directories as an auto repair shop and gas station, 5-11 Kensington Avenue.

City of Buffalo Building Department Records

City records indicate that this site (1-11 Kensington Avenue) had one (1) 550-gallon gas tank installed in 10/1927 and one (1) 2,500-gallon gas underground storage tank installed in 9/1930. In addition, City records indicate that the gas station was demolished in 10/1953 and a building was demolished in 8/1981 for the subway station.

Emergency Response Notification System Database

An ERNS record for this site is listed as Humboldt Parkway and Main Street. On June 7, 1999 a traffic accident caused the release of a container of a hazardous material. The container was removed and two people were isolated due to contact with the container. No further action was required.

NYSDEC Spill Report Database

Three spill records were identified for this site:

- NYSDOT Project/Tank – Main Street and Humboldt Parkway – Spill# 0007497 – On September 26, 2000 a tank was found during excavation at the corner of Main Street and Humboldt Parkway. The tank and water within the tank were removed and the spill was closed, and met NYSDEC cleanup standards.

- Radioactive Containers – Humboldt Parkway and Main Street – Spill# 9902593 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Radioactive Containers – Humboldt Parkway and Main Street – Spill# 9975173 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards. This spill refers to the same spill as Spill# 9902593.

Conclusion

The past use of this property as gas station and auto repair shop with underground storage tanks indicates the potential for encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.36 Site AJ: Buffalo Lining & Fabricating – 93 Gillette Ave.

This property is located on the north side of Gillette Avenue. This site is adjacent to and partially within the Project Study Area. Refer to Photo #55 in Attachment B.

Site Inspection

This site is currently Buffalo Lining and Fabricating Company and consists of a single-story manufacturing building. The northern portion of the lot is vacant land that is used for parking.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as an ice plant; on the 1935 and 1950 maps as an ice and a fuel company and a chemical company; and on the 1986 map as a factory building/warehouse.

City Directories

This site is listed in the 1945 directory as Vulcan Flooring Company, 73 Gillette Avenue; in the 1950-1955 directories as Getzol Products Corporation (chemical manufacturer), 73 Gillette Avenue; and in the 1960-2005 directories as Buffalo Lining & Fabricating, 73 Gillette Avenue.

City of Buffalo Building Department Records

City records indicate that this site (93-95 Gillette Avenue) had one (1) 550-gallon gas underground storage tank installed in 4/1928.

Conclusion

The past use of the property as a fuel company for more than 20 years with underground storage tanks and as a metal fabricating company for more than 40 years indicates the potential for encountering soil contamination from solvents, metals and petroleum products and the discovery of unmarked, abandoned USTs in the ROW.

3.1.37 Site AK: Wm. Maunz Co. – 387 East Delavan Ave.

This property is located on the southeast corner of East Delavan Avenue and Humboldt Parkway. This site is adjacent to the Project Study Area. Refer to Photo #56 in Attachment B.

Site Inspection

This site is currently a window manufacturer and installer. It consists of office space, a manufacturing facility and associated parking lot.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as a pressed steel company; on the 1935 map as a sheet metal company; and on the 1950 and 1986 maps as Wm. Maunz Company with tanks.

City Directories

This site is listed in the 1930-1940 directories as Delevan Metal & Roofing Company, 379 East Delavan Avenue; in the 1946-2005 directories as Wm. Maunz Company, 383-387 East Delavan Avenue; in the 1955 directory as Timken Oil Heating Corporation, 383-387 East Delavan Avenue; and in the 1971-1990 directories as Delevan Heating Supply, 383 East Delavan Avenue.

City of Buffalo Building Department Records

City records indicate that this site had two (2) 3,000-gallon gas tanks installed in 7/1959; one (1) 20,000-gallon fuel oil tank installed in 10/1946; one (1) 6,000-gallon fuel oil tank installed in 1/1938; and one (1) 1,000-gallon tank installed in 6/1946.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Wm. Maunz Company Inc. – 387 East Delavan Avenue. One (1) 20,000-gallon fuel oil aboveground storage tank (installed 1/1949, closed-removed 6/1996); one (1) 20,000-gallon fuel oil aboveground storage tank (installed 01/1950, closed-removed 6/1996); two (2) 3,000-gallon gasoline underground storage tanks (installed 8/1959, closed prior to 3/1991); one (1) 1,000-gallon fuel oil underground storage tank (installed 1/1946, closed prior to 3/1991); two (2) 275-gallon fuel oil aboveground storage tanks (installed 1/1981, in service); and two (2) 220-gallon fuel oil aboveground storage tanks (installed 11/1987, in service) were listed for this site.

Conclusion

The past and present use of the property for metal working facilities for more than 30 years, as well as the presence of USTs indicate the potential for soil contamination from petroleum, chemicals, and solvents to exist on site, as well as abandoned, unmarked underground storage tanks in the ROW.

3.1.38 Site AL: Route 33

This property is located on Route 33 at Route 198. This site is located within the Project Study Area. Refer to Photo #57 in Attachment B.

Site Inspection

This site is currently a 4-lane expressway that connects to the eastern end of Route 198.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as a contractor's storage yard and a garage with an underground storage tank; on the 1935 map as a furniture manufacturer, auto repair shop with two gas tanks and contractor's storage yard; and on the 1950 map as a furniture manufacturer; auto repair shop; dry cleaner; paint shed; and contractor's storage yard.

City Directories

This site is listed in the 1930-1940 directories as a used car sales, repair, and gas station, 378 East Delevan Avenue; in the 1960 directory as Designer Folding Box Company and Cadet Cleaners, 378 East Delevan Avenue.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,800-gallon gas tank installed in 10/1934; one (1) 1,000-gallon gas tank installed in 3/1927; and one (1) 1,100-gallon gas tank installed in 10/1930.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Highway – Route 33 E/B at Route 198 W/B – Spill# 1508678 – On November 22, 2015 a traffic accident caused five-gallons of gas to spill onto the roadway. The spill was cleaned up and closed but did not meet NYSDEC cleanup standards.
- State Highway – 198 and 33 – Spill# 1406280 – On September 11, 2014 a traffic accident caused 15-gallons of oil to spill onto the pavement. The spill was cleaned up and closed but did not meet NYSDEC cleanup standards.

Conclusion

Despite redevelopment, the past use of this property as a used car lot, a gas station, a contractor's storage yard, an auto repair shop with underground storage tanks, a furniture manufacturer, and a dry cleaner indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes as well as encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.39 Site AM: Railroad ROW – East End

This property is located at the east end of the Project Study Area. This site is located within the Project Study Area. Refer to Photo #58 in Attachment B.

Site Inspection

This site is an active railroad.

Sanborn Maps

The railroad is depicted on the 1893, 1900, 1935, 1950, and 1986 Sanborn Fire Insurance Maps.

Conclusion

The project study corridor crosses an active railroad line. Although no documented incidents were found for this assessment, contamination is often associated with railroad corridors as a result of normal rail line operations. Such activities include: hauling and service, cleaning and maintenance, fueling, and loading and unloading of packaged goods. Contamination typically found along rail lines includes partially combusted fossil fuels consisting of polynuclear aromatic hydrocarbons; leachate from creosote-preserved railroad ties; pesticides used in maintenance of the corridor; strong acid or alkaline materials; spent cleaning and degreasing solvents; ignitable paint wastes; used oil; and lead contamination from older freight cars with plane bearings, as well as other heavy metals including chromium and arsenic.

3.1.40 Site AN: Residential Property – 413 East Delevan Ave.

This property is located on the south side of East Delavan Avenue, west of Fillmore Avenue. This site is located southeast of the Project Study Area. Refer to Photo #59 in Attachment B.

Site Inspection

This site is a residential complex consisting of six two-story structures, a central parking lot and surrounded by grass.

Historic Maps

A large structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1935 Sanborn Fire Insurance Maps as an auto body manufacturer; on the 1900, 1916, and 1950 maps as a furniture manufacturer; and on the 1986 map as a vacant factory.

City Directories

This site is listed in the 1930-1935 directories as Stewart Motor Corporation Plant #2, 413 East Delevan Avenue and in the 1940 directory as a used car lot and Marlette Plating Company, 437 East Delevan Avenue.

Conclusion

Despite redevelopment, the past use of this property as a furniture manufacturing facility with underground storage tanks, an auto body manufacturing facility, a plating company, and used auto lot, indicates the potential to encounter chemicals and solvents associated with these historical manufacturing processes as well as encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.1.41 Site AO: Sears, Roebuck & Co. & North Extension – 370-440 E. Delevan Ave.

This site is located on the north side of East Delevan Avenue between Humboldt Parkway and Fillmore Avenue. The site extends north past Route 33 and is partially within the Project Study Area. Refer to Photo #60 in Attachment B.

Site Inspection

This site is currently the Sears Roebuck & Company warehouse and consists of a large warehouse building surrounded by parking lots. One aboveground tank and several small propane tanks were identified in the parking lot. The tanks were fenced in and no spills were identified near the tanks. A portion of this site includes the Route 33 Expressway and some vacant land to the north of Route 33.

Aerial Photographs

A large building and associated parking lot is depicted on the 1978, 1995, and 2008 aerial photographs. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Historic Maps

This site is depicted in the 1915 Atlas as Barber Asphalt Paving Company.

Sanborn Maps

This site is depicted on the 1893 and 1900 Sanborn Fire Insurance Map as an asphalt paving company; on the 1935 map as a quarry; and on the 1986 map as Sears, Roebuck & Company. A transformer house is depicted on the 1950 map in the current location of the Route 33 Expressway.

City Directories

This site is listed in the 1930-1935 directories as Bituminous Paving Corporation, 450 East Delevan Avenue; in the 1940 directory as a used auto parts facility, 1894 Fillmore Avenue; in the 1975 directory as National Casket Company, 1800 Fillmore Avenue; and in the 1985-2005 directories as Sears, Roebuck & Company, 420 East

Delevan Avenue; and in the 1995-2005 directories as General Transportation Service, 420 East Delevan Avenue.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 11,980-gallon fuel oil tank installed 12/1953; one (1) 3,000-gallon gas tank installed in 12/1953; one (1) 6,000-gallon gas tank installed in 1/1966; two (2) 4,000-gallon gas tanks installed in 5/1958; one (1) 6,000-gallon gas tank installed in 11/1979; one (1) 10,000-gallon fuel oil tank installed in 7/1984; and one (1) 1,000-gallon waste oil tank installed in 8/1987.

RCRA Generator

A RCRA record for this site is listed as Sears, Roebuck & Company – 420 East Delevan Avenue. This site was identified as a small quantity hazardous waste generator; however, no violations were identified for this property.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Sears, Roebuck & Company – 420 East Delevan Avenue. One (1) 5,000-gallon gasoline underground storage tank (installed 1/1966, closed-removed 11/1992) and one (1) 6,000-gallon gasoline underground storage tank (installed 11/1979, closed-removed 11/1992) were listed for this site.

NYSDEC Spill Report Database

Two spill records were identified for this site:

- Sears, Roebuck & Company – 420 East Delevan Avenue – Spill# 9106064 – This spill was minor in nature, has been closed, and met NYSDEC cleanup standards.
- Sears Warehouse – 420 East Delevan Avenue – Spill# 8704178 – On August 19, 1987 contamination was found during a tank removal. The contamination was removed; the spill was closed, and met NYSDEC cleanup standards.

Conclusion

The present and past use of the property as a distribution warehouse, gas station and dry cleaners with underground storage tanks indicates the potential for encountering soil contamination from solvents, petroleum products and the discovery of unmarked, abandoned USTs in the ROW. The past use of the property as a quarry that has since been filled indicates the potential for encountering soil contamination from the filling of the quarry. Most of the quarry fill was placed at a time when environmental laws were not in place; therefore, if excavation is to occur in this area, there is a potential to encounter historic contaminated fill from unknown sources.

3.1.42 Site AP: Brookline Machine & North Extension – 1870-1896 Fillmore Ave.

This property is located on the west side of Fillmore Avenue, south of Kensington Avenue. This site extends north past Route 33 and is adjacent to the Project Study Area. Refer to Photo #61 in Attachment B.

Site Inspection

This site is currently a machine shop. The site consists of a large building and associated parking lot. A portion of this site includes the Route 33 Expressway and some vacant land to the north of Route 33.

Sanborn Maps

This site is depicted on the 1950 and 1986 Sanborn Fire Insurance Maps as an auto wrecking yard and on the 1935 map as an auto repair shop / spray painting facility.

City Directories

This site is listed in the 1940 directory as an auto repair shop, 1896 Fillmore Avenue; in the 1940-1985 directories as G&J Used Auto Parts, 1894-1896 Fillmore Avenue; and in the 1975-2000 directories as Automotive Parts Warehouse Corporation, 1870 Fillmore Avenue.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 4,000-gallon gas underground storage tank and two (2) 4,000-gallon fuel oil underground storage tanks installed in 8/1963. In addition, City records indicate that the site was altered to be used for auto sales and service in 7/1973.

Conclusion

The past use of this property as a junk yard, an auto repair shop, and a used auto parts store with underground storage tanks indicates the potential for encountering soil contamination in the ROW from petroleum products and the potential for abandoned USTs in the existing ROW.

3.2 Properties Considered to be Potential Environmental Concerns Identified Outside the Project Limits

The following properties were located outside of the project study limits. Should the limits of the reconstruction change to require construction along these addresses, the subsequent properties would be considered properties of potential environmental concern.

3.2.1 DiVal Safety – 1701 Niagara St.

This property is located on the east side of Niagara Street, north of Tonawanda Street. This site is located north of the Project Study Area.

Site Inspection

This site is currently a safety equipment store. It consists of a storefront, warehouse and three shipping bays.

Sanborn Maps

This site is depicted on the 1981 and 1986 Sanborn Fire Insurance Maps as an auto junk yard.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as an auto junk yard. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.2 Hudson Ramsey Co. – 1679 Niagara St.

This property is located on the east side of Niagara Street, north of Tonawanda Street. This site is located north of the Project Study Area.

Site Inspection

This site is currently a concrete company. It consists of a single-story building.

Sanborn Maps

This site is depicted on the 1889 and 1900 Sanborn Fire Insurance Maps as grain elevator and on the 1981 and 1986 map as a contractor's storage facility.

City Directories

This site is listed in the 1955-2005 directories as Hudson-Rumsey Company (concrete contractor), 1679 Niagara Street.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a grain elevator and a contractor's storage area. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.3 Volland Electric Equipment Co. & Mead Supply Co. – 1511-1527 Niagara St.

This property is located on the east side of Niagara Street at the southern corner of Bird Avenue. This site is located south of the Project Study Area.

Site Inspection

This site is currently an electronic motor control manufacturer and construction equipment rental/sales company. The site consists of two buildings with a large storage area between the buildings.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as a manufacturing facility with a machine shop and on the 1981 and 1986 maps as an electrical equipment warehouse.

City Directories

This site is listed in the 1930-1955 directories as MSW Manufacturer Company (electrical supplies), 1527 Niagara Street.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a manufacturing facility for more than 25 years. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.4 Buffalo Metal Finishing – 135 Dart St.

This property is located on the east side of Dart Street, between Letchworth Street and Bradley Street. This site is located south of the Project Study Area.

Site Inspection

This site is currently a metal shop.

Sanborn Maps

This site is depicted on the 1950, 1981, and 1986 Sanborn Fire Insurance Maps as metal finishing company.

City Directories

This site is listed in the 1930-1935 directories as Eaton Wax Company, 135 Dart Street; in the 1946-1965 directories as Vick Platting Company, 135 Dart Street; in the 1971-1996 directories as National Morelight Company, 135 Dart Street; and in the 1965-2005 directories as Buffalo Metal Finishing, 135 Dart Street.

Conclusion

This site is located beyond the limits of the defined study limits. However, the site has been identified as having been used as a metal finishing facility and a manufacturing facility. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.5 Willard Machine Corporation – 73 Forest Ave.

The property is located on the south side of Forest Avenue, between Niagara Street and West Avenue. This site is located southeast of the Project Study Area.

Site Inspection

This site is currently a machine shop.

Historic Maps

A small structure is depicted on this site on the 1948 topographic map.

Sanborn Maps

This site is depicted on the 1900, 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as a machine manufacturing facility.

City Directories

This site is listed in the 1930-2005 directories as Willard Machine Corporation, 67-73 Forest Avenue.

RCRA No Longer Regulated

A RCRA record for this site is listed as Willard Machine Corporation – 73 Forest Avenue. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a machine shop for more than 70 years. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.6 Luigi's Family Bakery – 77-83 Forest Ave.

This property is located on the south side of Forest Avenue, at West Avenue. This site is located south of the Project Study Area.

Site Inspection

This site is currently a wholesale bakery.

Sanborn Maps

This site is depicted on the 1916 Sanborn Fire Insurance Map as a metal shop; on the 1950 map as a factory building; and on the 1981 and 1986 maps as a bakery.

City Directories

This site is listed in the 1935-1960 directories as metal fabricators, 77-83 Forest Avenue.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a metal fabricator and metal shop. In

addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.7 Vacant Lot – 1354-1360 West Ave.

This site is located on the west side of West Avenue, south of Forest Avenue. This site is located southeast of the Project Study Area.

Site Inspection

This site is currently a vacant lot.

Sanborn Maps

This site is depicted on the 1916, 1950, 1981, and 1986 Sanborn Fire Insurance Maps as a machine company.

City Directories

This site is listed in the 1930-1955 directories as Buffalo Machinery Company, 1354-56 West Avenue; in the 1960-1971 directories as International Paper Company (assembly plant), 1360 West Avenue; and in the 1975 directory as Consolidated Packaging Machinery, 1360 West Avenue.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a machine shop for more than 70 years. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.8 Liberty Auto Plus Inc. – 980 Grant St.

This property is located on the west side of Grant Street, north of Amherst Street. This site is located northwest of the project study area.

Site Inspection

This site is currently an auto repair shop, used car lot and car wash.

Sanborn Maps

This site is depicted on the 1950, 1981, and 1986 Sanborn Fire Insurance Maps as a filling station and auto repair shop with two tanks.

City Directories

This site is listed in the 1935-1950 directories as an auto repair shop, 966-970 Grant Street; in the 1955-1985 directories as a gas and auto service station, 974 Grant Street; and in the 1990 directory as City Taxi, 980 Grant Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon gas underground storage tank installed in 10/1930; one (1) 2,000-gallon gas underground storage tank installed in 9/1948; one (1) 550-gallon gas underground storage tank installed in 7/1930; one (1) 10,000-gallon underground storage tank installed in 10/1985; and one (1) 1,000-gallon gas underground storage tank installed in 11/1930.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 550-gallon gas tank installed in 10/1930; two (2) 550-gallon tanks installed in 11/1938; one (1) 2,000-gallon gas tank installed in 9/1948; one (1) 550-gallon gas tank installed in 11/1963; one (1) 2,000-gallon gas tank installed in 11/1963; and one (1) 10,000-gallon gas tank installed in 10/1985.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as City Service Taxi – 980 Grant Street. One (1) 10,000-gallon gasoline underground storage tank (installed 1/1985, in service) and one (1) 500-gallon waste oil aboveground storage tank (installed 1/1999, in service) were listed for this site.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a gas station and an auto repair shop with underground storage tanks. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.9 Vacant Building - Former Gas Station – 479-481 Amherst St.

This property is located on the south side of Amherst Street, east of Howell Street. This site is located south of the Project Study Area.

Site Inspection

This site is currently a vacant building.

Sanborn Maps

This site is depicted on the 1950 and 1981 Sanborn Fire Insurance Maps as storefront with a gas tank in front of building.

City Directories

This site is listed in the 1930-1985 directories as a gas and service station, 481 Amherst Street.

City of Buffalo Building Department Records

City records indicate that this site had two (2) 1,000-gallon gas underground storage tanks installed in 11/1923; one (1) 1,000-gallon gas underground storage tank installed in 7/1962; one (1) 1,000-gallon gas underground storage tank installed in 1/1965; and two (2) 1,000-gallon gas underground storage tanks installed in 3/1972.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a gas station for more than 20 years with underground storage tanks. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.10 Quality Binding Company & Habitat for Humanity ReStore – 501 Amherst St.

This property is located on the south side of Amherst Street, east of Bush Street. This site is located north of the project study area.

Site Inspection

This site is currently a book binding company and a used building material distributor.

Sanborn Maps

This site is depicted on the 1950 Sanborn Fire Insurance Map as a fuel company and on the 1981 and 1986 maps as a rubber company.

City Directories

This site is listed in the 1930-1955 directories as Amherst Fuels Inc. (coal), 533-43 Amherst Street; in the 1946-1950 directories as Wilsolite Rubber Company, 501 Amherst Street; in the 1955-1985 directories as Keystone Rubber Products, 501 Amherst Street; in the 1960 directory as Malast Rubber, 511 Amherst Street; in the 1996 directory as Dates Weiser Furniture Company, 501 Amherst Street; and in the 2005 directory as Sel Drum Corporation (copier products), 501 Amherst Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 440-gallon tank installed in 4/1927; one (1) 550-gallon tank installed in 1/1932; one (1) 1,000-gallon tank installed in 1/1950; and four (4) coal silos demolished in 9/1959.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a rubber company, a furniture company, and coal yard. In addition, the site is located both topographically and hydraulically

upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.11 Medaille College – 18 Agassiz Cir.

This property is located on the south side of Agassiz Circle. This site is adjacent to the Project Study Area.

Site Inspection

This site is a small college campus consisting of several large buildings, parking lots and grassy areas.

Aerial Photos

A single large structure is present on this site on the 1927 aerial photograph. On the 1966 aerial photograph a second building has been added to the site, southeast of the original building. On the 1978, 1995, and 2008 aerial photographs, there are now several large buildings on the site. Due to the scale of the photographs it is not possible to determine the nature of the businesses.

Sanborn Map

This site is depicted on the 1935, 1950, and 1986 Sanborn Fire Insurance Maps as part of Mount St. Joseph Academy. A gas tank is depicted behind the boiler room.

City Directories

This site is listed in the 1965 – 2005 directories as Medaille College, 18 Agassiz Circle and in the 1950-1971 directories as the Mount St. Joseph Academy, 18 Agassiz Circle.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Medaille College – Agassiz Circle. One (1) 10,000-gallon #2 fuel oil underground storage tank (installed 1/1945, closed prior to 3/1991) was listed for this site.

RCRA Generator

A RCRA record for this site is listed as Medaille College – 18 Agassiz Circle. This site was identified as a small quantity hazardous waste generator; however, no violations were identified for this property.

NYSDEC Spill Report Database

One spill record was identified for this site:

- Medaille College – 18 Agassiz Circle – Spill# 8709122 – On January 25, 1988 a tank failed its tank test. The tank was removed and no contamination was reportedly observed in the excavation. The spill was closed, and met NYSDEC cleanup standards.

Conclusion

The underground storage tank identified for this site is located beyond the limits of the defined study area. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.12 Forest Lawn Cemetery Garage – 1994 Main St.

This property is located on the west side of Main Street, south of Eastwood Place. This site is located southwest of the project study area.

Site Inspection

This site consists of a two-story dwelling, a one-story garage, and a one-story maintenance garage surrounded by grass and paved parking areas. This site is part of Forest Lawn Cemetery. An aboveground gas tank and an underground storage tank both with pumps were identified at the site.

Sanborn Maps

This site is depicted on the 1950 and 1986 Sanborn Fire Insurance Maps as a repair shop with a tank and on the 1935 map as a dwelling with a tank behind the garage.

City Directories

This site is listed in the 1971-1980 directories as Forest Lawn Cemetery Garage, 1994 Main Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 4,000-gallon fuel oil underground storage tank installed in 11/1975 and one (1) 2,000-gallon gas underground storage tank installed in 11/1985.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 280-gallon gas tank installed in 11/1930; one (1) 4,000-gallon gas tank installed in 8/1979; one (1) 4,000-gallon fuel oil tank installed in 11/1975; one (1) 2,000-gallon gas tank installed in 1/1985; one (1) 1,000-gallon gas tank removed in 1/1985; and one (1) 4,000-gallon gas tank removed in 2/1988.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a garage/repair shop with multiple USTs. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.13 Sisters of Charity Hospital – 2127-2157 Main St.

This property is located at the corner of Main Street and West Humboldt Parkway. This site is adjacent to the Project Study Area.

Site Inspection

This property is a multi-building hospital surrounded by paved parking lots. A boiler house is located behind the main hospital building and has a large smokestack.

Aerial Photos

A large structure surrounded by lawns is present on the 1927 and 1966 aerial photos. A highway is present between the two sides of Humboldt Parkway on the 1966 aerial photo. Several large connected buildings were identified on this site on the 1978, 1995 and 2008 aerial photos. Due to the scale of the photographs it is not possible to determine the nature of the commercial businesses.

Historic Atlases

This site is depicted in the 1915 Atlas as two properties: US Marine Hospital and Providence Retreat (hospital, established 1860, run by the Sisters of Charity). In addition, this site is depicted on the 1948 topographic map as a hospital.

Sanborn Maps

This site is depicted on the 1900, 1916, 1935, 1950, and 1986 Sanborn Fire Insurance Maps as a hospital.

City Directories

This site is listed in the 1930-2005 directories as hospital, 2157 Main Street.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,000-gallon gas underground storage tank installed in 9/1969; two (2) 8,000-gallon gas underground storage tanks and two (2) 20,000-gallon fuel oil underground storage tanks installed in 9/1962; and one (1) 20,000-gallon fuel oil underground storage tank installed in 4/1976.

City of Buffalo Fire Department Records

City records indicate that this site had one (1) 20,000-gallon fuel oil tank installed in 4/1976; one (1) 1,000-gallon gas tank installed in 9/1969 and removed 2/1993; one (1) 8,000-gallon diesel tank installed in 10/1962 and removed in 1/1988; two (2) 20,000-gallon fuel oil tanks installed in 10/1962; and one (1) 1,000-gallon gas tank installed in 5/1993. In addition one (1) 20,000-gallon fuel oil tank was tested in 11/1996 and passed the test.

NYSDEC Petroleum Bulk Storage Database

A PBS record for this site is listed as Sisters of Charity Hospital – 2157 Main Street. Two (2) 20,000-gallon #6 fuel oil underground storage tanks (installed 8/1962,

closed-removed 10/1996); one (1) 8,000-gallon #2 fuel oil underground storage tank (installed 8/1962, closed prior to 3/1991); one (1) 20,000-gallon #2 fuel oil underground storage tank (installed 1/1974, closed-removed 10/1996); one (1) 20,000-gallon #2 fuel oil underground storage tank (installed 1/1974, in service); one (1) 1,000-gallon gasoline underground storage tank (installed 4/1993, in service); and one (1) 1,000-gallon gasoline underground storage tank (installed 10/1969, closed-removed 10/1992) were listed for this site.

RCRA Generator

A RCRA record for this site is listed as Sisters of Charity Hospital – 2157 Main Street. This site was identified as a small quantity hazardous waste generator; however, no violations were identified for this property.

RCRA No Longer Regulated

A RCRA record for this site is listed as Parkway Cytology Laboratory Inc. – 2121 Main Street. This site was identified as a site that no longer generates, transports, treats, stores or disposes of hazardous waste. No violations were identified for this property.

NYSDEC Spill Report Database

Four spill records were identified for this site:

- Sisters Hospital – 2157 Main Street – Spill# 9208731 – On October 28, 1992 a tank failed its tank test. The tank was re-tested and passed. The spill was closed and the clean-up met NYSDEC standards.
- Sisters Hospital – 2157 Main Street – Spill# 9205780 – On August 18, 1992 a tank failed its tank test. The tank was removed; the spill was made inactive and was closed.
- Sisters Hospital – 2157 Main Street – Spill# 9608662 – On October 1, 1995 contamination was found in soil borings. Three tanks were removed along with contaminated soil and two monitoring wells were installed. The spill was made inactive and was closed.
- Sisters Hospital – 2157 Main Street – Spill# 8705066 – On September 16, 1987 a tank failed its tank test. The tank was removed along with contaminated soil and groundwater. The spill was closed and the clean-up met NYSDEC standards.

Hazardous Materials Incident Response System

A HMIRS record for this site is listed as Consolidated Freightways Corporation – 2157 Main Street. Ethylene oxide cylinders arrived damaged. No further information was available.

Conclusion

The underground storage tanks identified for this site are located by the boiler house which is beyond the limits of the defined study area. If the limits of the project change

to include this area, then this site will be considered a site of potential environmental concern.

3.2.14 J.W. Danforth – 1940 Fillmore Ave.

This property is located on the southwest corner of Fillmore Avenue and Kensington Avenue. This site is located northeast of the Project Study Area.

Site Inspection

This site is currently a manufacturing facility consisting of several large buildings and loading docks.

Sanborn Maps

This site is depicted on the 1935 Sanborn Fire Insurance Maps as a general contractor yard; on the 1950 map as a used car lot; and on the 1986 map as a factory building and machine shop.

City Directories

This site is listed in the 1946-1950 directories as an auto sales and service station, 1940 Fillmore Avenue and in the 1965-2000 directories as J.W. Danforth Company (HVAC contractor), 1940 Fillmore Avenue.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 1,000-gallon propane aboveground storage tank installed in 11/1981.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a machine shop and an auto sales and service lot. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.15 Trinidad Neighborhood Association & Garden – 113 Gillette Ave./237 Kensington Ave.

This property is located on the north side of Gillette Avenue. This site is located north of the project study area.

Site Inspection

This site is currently a vacant lot and a City of Buffalo playground.

Sanborn Maps

This site is depicted on the 1893, 1900, 1916, 1935, 1950 Sanborn Fire Insurance Maps as an asphalt company. The site is also depicted on the 1950 map as a machine shop and a contractor storage yard; and on the 1986 map as a playground.

City of Buffalo Building Department Records

City records indicate that this site (113 Gillette Avenue) had two (2) 4,000-gallon diesel underground storage tanks installed in 12/1980.

City of Buffalo Fire Department Records

City records indicate that this site (113 Gillette Avenue) had two (2) 4,000-gallon diesel underground storage tanks installed in 12/1980.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as an asphalt company, machine shop and storage yard with underground storage tanks. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.16 Contractor Storage Area - 239 Kensington Ave.

This property is located on the south side of Kensington Avenue. This site is located north of the project study area.

Site Inspection

This site is currently a contractor storage area.

Sanborn Maps

This site is depicted on the 1935 Sanborn Fire Insurance Map as an asphalt and construction company. The site is also depicted on the 1950 map as a coal yard; and on the 1986 map as a contractor's storage yard.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a contractor's storage yard and coal yard. In addition, the site is located both topographically and hydraulically upgradient of the limits of the project. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

3.2.17 Kentucky Fried Chicken & Niagara Mohawk Power Station – 448-470 E. Delevan Ave.

This property is located on the northwest corner of East Delevan Avenue and Fillmore Avenue. This site is located southeast of the Project Study Area.

Site Inspection

This site is currently a Kentucky Fried Chicken restaurant, a parking lot, and an electric company power station.

Sanborn Maps

This site is depicted on the 1935 Sanborn Fire Insurance Maps as a printer, dry cleaner, filling station and as a power station. The site is also depicted on the 1950 map as a dry cleaner, filling station and as a power station.

City Directories

This site is listed in the 1930-1965 directories as a gas station, 470 East Delevan Avenue; in the 1930-1960 directories as Buffalo Community Laundry, 460 East Delevan Avenue; in the 1935 directory as Truck Equipment Company, 1782 Fillmore Avenue; in the 1940-1990 directories as Niagara Mohawk Power Corporation Station #31, 454 East Delevan Avenue; in the 1940-1950 directories as Community Laundry, 1782 Fillmore Avenue; in the 1955-1960 directories as an auto sales and service facility, 440 East Delevan Avenue; in the 1960 directory as a gas station, 1790 Fillmore Avenue; in the 1971-1975 directories as National Laminated Products, 460 East Delevan Avenue; and in the 1975-2005 directories as Welding by Riley, 1782 Fillmore Avenue.

City of Buffalo Building Department Records

City records indicate that this site had one (1) 550-gallon diesel tank and one (1) 1,500-gallon gas tank installed in 7/1968; one (1) 550-gallon gas tank installed in 9/1937; and one (1) 3,000-gallon gas tank installed in 5/1949. In addition, city records indicate that a substation was constructed in 4/1931 at 454 East Delevan Avenue.

Conclusion

This site is located beyond the limits of the defined study area. However, the site has been identified as having been used as a gas station, dry cleaner, print shop, and power station for more than 30 years with tanks. If the limits of the project change to include this area, then this site will be considered a site of potential environmental concern.

4.0 CONCLUSIONS AND RECOMMENDATIONS

Forty-two sites (A through AP) were identified in this Preliminary Screening Investigation Report prepared for the Hazardous Waste/Contaminated Materials (HW/CM) Assessment that may pose environmental risk to the Route 198 study area. These sites are recommended for further investigation if the chosen design alternative will require excavation or right-of-way acquisition in these areas. Each potentially contaminated site is listed with a recommendation for further work in **Table 4-1**; however, currently under the Preferred Build Alternative (Alternative 2), construction or ROW acquisition is anticipated along only six (A, X, Y, AB, AF, and AG) of these forty-two sites. Recommendations for further work may require alteration depending on the chosen design alternative. Once the design alternative has been chosen, a Field Sampling Plan (FSP) should be prepared for the performance of a subsequent Detailed Site Investigation (DSI) if suspect areas are to be impacted. The FSP and DSI should include the areas near the sites of potential environmental concern that would be affected by right-of-way (ROW) acquisition or construction for the proposed project. If the results of the DSI indicate that construction will involve the excavation of large areas of contamination, a Soil Management Plan may be necessary. For many of the identified sites, recommendations are based on multiple environmental concerns (e.g. petroleum, USTs, industrial use, fill) reflecting the changing land uses throughout the centuries of occupation in this area. Detailed findings, for each site, that support these recommendations are described in **Section 3.1**.

Due to the urban nature of the project study area, urban/industrial fill is likely present throughout the corridor. Historic research has confirmed that significant amounts of fill have been placed at sites A (filled creek/lake banks), Z (filled creek), AH (filled quarry), and AO (filled quarry). This fill was placed at a time when environmental laws were not in place; therefore, there is a potential to encounter historic contaminated fill from unknown sources at these sites. If construction or ROW acquisition is anticipated in the area of these sites, we recommend that soil boring inspections (and laboratory analysis for general industrial compounds, if warranted) be conducted in the area of each involved site, to determine whether contaminated soil or groundwater is present within the existing or proposed ROW.

In addition, there are numerous industrial sites that border Scajaquada Creek (Site A) which may have contaminated the Creek sediments. The NYSDEC has indicated that there are also numerous active remediation projects within the project study area and contamination is known to exist along portions of the creek. Sediment sampling should be performed within the creek, in coordination with NYSDEC input, if creek sediments are to be acquired or disturbed during construction. Laboratory analysis would include general industrial compounds.

Thirty-two of the forty-two sites (Sites A, B, I, J, K, L, M, N, O, P, Q, R, S, T, U, V, W, X, Y, Z, AA, AB, AC, AE, AF, AG, AI, AJ, AK, AL, AO, and AP) contain or have

contained petroleum USTs or have petroleum spills on record. Under the current design plans (Alternative 2), construction or ROW acquisition is anticipated at six of these sites (A, X, Y, AB, AF, and AG). We recommend that a soil gas survey and soil boring inspections (and laboratory analysis for petroleum compounds, if warranted) be conducted in the area of each involved site to determine whether petroleum contaminated soil or groundwater is present within the existing or proposed ROW.

There is also an elevated potential that these thirty-five sites, with the exception of Sites A, AD, and AE, may have abandoned and unmarked USTs within the existing or proposed ROW because of known or suspected former use as petroleum storage sites and their proximity to the highway. Under the current design plans (Alternative 2), construction or ROW acquisition is anticipated at five of these sites (X, Y, AB, AF, and AG). We recommend that a geophysical survey be conducted in the proposed or existing ROW of each involved area of concern to determine whether USTs and/or ancillary piping are located within the ROW of the project study corridor. Ground penetrating radar (GPR) is an especially practical type of geophysical survey used to locate and measure the dimensions of buried metal USTs to a depth of approximately 5 feet. Geophysical survey results will help ensure the safety of soil gas survey personnel by locating unmarked USTs, if present, to prevent accidental tank puncture. In addition, locating USTs will prepare the NYSDOT for their proper removal prior to or during construction.

Twenty-eight of the forty-two sites (B, C, F, H, I, J, K, N, O, P, Q, R, S, T, U, V, W, X, Z, AB, AC, AG, AI, AJ, AK, AL, AN, and AP) are or have been auto repair shops or manufacturing facilities including metal shops, furniture manufacturers, window manufacturers, foundries, steel companies, paint, varnish and lacquer manufacturers and auto part manufacturers. *(Please note: Some of these sites are in addition to or overlap with the land use on the thirty-five sites identified above as potentially petroleum contaminated.)* Under the current design plans (Alternative 2), construction or ROW acquisition is anticipated at three of these sites (X, AB, and AG). We recommend that a soil gas survey and soil boring inspections (and laboratory analysis for general industrial compounds, if warranted) be conducted in the area of each involved site to determine whether soil or groundwater contaminated with industrial type compounds is present within the existing or proposed ROW.

Of the remaining sites, two (2) are active railroad lines (Sites D and AM). Contamination typically found along railroad lines includes partially combusted fossil fuels consisting of polynuclear aromatic hydrocarbons; leachate from creosote-preserved railroad ties; pesticides used in maintenance of the corridor; strong acid or alkaline materials; spent cleaning and degreasing solvents; ignitable paint wastes; used oil; and lead contamination from older freight cars with plane bearings, as well as other heavy metals including chromium and arsenic. Under the proposed design plans construction or ROW acquisition is not anticipated in the area of these sites. However, if the design plans change to involve these areas, we recommend that a soil

gas survey and soil boring inspections (and laboratory analysis for general industrial compounds, if warranted) be conducted at each site to determine whether contaminated soil or groundwater is present within the existing or proposed ROW.

Two of the forty-two sites are former transformer lots (Sites E and G) and one is a contractor's storage area (Site AD) that are all of concern due to past potential usage of petroleum products and other hazardous materials such as solvents, metals, and PCB oils. Under the proposed design plans construction or ROW acquisition is not anticipated in the area of these sites. However, if the design plans change to involve these areas, we recommend that a soil gas survey and soil boring inspections (and laboratory analysis for general industrial compounds, if warranted) be conducted at each site to determine whether contaminated soil or groundwater is present within the existing or proposed ROW.

Please note, if soil sample collection is warranted at any of the sites through soil gas survey or soil boring inspection, a groundwater sample should also be collected if groundwater is encountered within the soil borings. Collection of the groundwater sample should be directly from the hole created by the soil borings which represents the worst case conditions. Laboratory analysis should include the parameters identified above for the soil sample proposed at each individual site.

These recommendations are based on the construction work proposed as of May 2016. If design plans or construction activities change during the project, the conclusions and recommendations of this assessment may require alteration.

Table 4-1
Summary of Recommendations

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
A	Scajaquada Creek/Hoyt Lake	Fill Placed on Creek Bed, Industrial Area with Former Outfalls and Spills	Contaminated Soils and Fill, Contaminated Sediments	Soil Gas Survey, Soil Boring Inspections, and Sediment Sampling in Creek
B	B&B Collision – 1660 Niagara St	Auto Repair Shop, Former Gas Station, Former Boat Sales And Service, Active Spill Records, USTs	Abandoned USTs, Petroleum and Auto Repair Shop Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
C	Zeller Electric – 1675 Niagara St.	Electronic Equipment Supplier, Former Contractor's Storage Area, Former Rubber Company	General Industrial Contamination	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
D	Railroad ROW – Niagara St	Railroad Line	Contaminated Soils and Fill Associated With Railroad Use	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
E	Niagara Mohawk – 1626 Niagara St.	Former Power Substation	Metals, Solvents, PCBs	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
F	I-190 – Niagara Section	Former Foundry, Former Gas Company	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
G	City of Buffalo Park – Niagara St.	Former Coal Yard, Former Transformer Lot	Metals, Solvents, SVOCs, PCBs	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
H	City of Buffalo Park Bike Path Area beneath Route 198 – Niagara St.	Former Plaster Company	General Industrial Contamination	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
I	Hohl Machine & Conveyor Co. – 1540-1590 Niagara St.	Conveyor Manufacturer, Former Train Wheel Manufacturer, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.

Table 4-1
Summary of Recommendations
(continued)

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
J	Vincent's Self-Storage – 1573 Niagara St.	Former Tool Manufacturer, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
K	Infinity Architectural Windows – 1555 Niagara St.	Window Manufacturer, Former Machine Shop, Former Gas Station, USTs, Soil Contamination	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
L	G&G Sunoco Gas Station – 1531-1543 Niagara St.	Gas Station, Former Auto Sales Lot, Active Spill Record, USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
M	Rascal's Restaurant – 1516 Niagara St.	Former Gas Station, USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
N	Contract Pharmaceuticals Limited Niagara Parking Lot – 80 Forest Ave.	Former Dry Cleaner, Former Auto Repair Shop, Former Machine Shop, Former Engraver, Former Manufacturing Facility, USTs	Abandoned USTs, Petroleum, Solvents, and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
O	Vacant Lot – Former Pratt and Lambert, Lacquer Plant – 1451 West Ave.	Former Lacquer Manufacturer, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
P	Contract Pharmaceuticals Limited Niagara – 100 Forest Ave.	Pharmaceutical Company, Former Manufactured Gas Plant, Manufacturing Facility, USTs	Abandoned USTs, Petroleum and General Industrial, and Manufactured Gas Plant Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.

Table 4-1
Summary of Recommendations
(continued)

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
Q	Pagan Auto Sales – 18 Tonawanda St.	Auto Repair Shop, Former Gas Station, USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
R	Fort Knox Business Center – 31 Tonawanda St.	Former Auto Parts Manufacturer, Former Brick Manufacturer, Former Electric Company, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
S	Vacant Lot – Former Pratt and Lambert, Paint and Varnish Plant – 75 Tonawanda St.	Former Paint & Solvent Manufacturer, USTs	Abandoned USTs, Petroleum, Solvents, and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
T	Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers – 125-137 Tonawanda St.	Current And Former Manufacturing Facilities, Auto Repair Shop, Metal Plating, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
U	Former Pratt and Letchworth – 189-205 Tonawanda St.	Former Iron Works Company, Spill Record, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
V	City of Buffalo Impound Lot – 166 Dart St.	Automobile Storage Area, Former Steel Company, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
W	Buffalo State College Parking Lot – Grant St.	Former Manufacturing Facilities, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
X	Buffalo State College Athletic Stadium and Parking Lots – 1300 Elmwood Ave.	Former Brass Foundry, Former Coal Company, Former Gas Station, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey Soil Boring Inspections Geophysical Survey

Table 4-1
Summary of Recommendations
(continued)

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
Y	On/Off Ramp – Grant St.	Former Gas Station, USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey Soil Boring Inspections Geophysical Survey
Z	Tops Grocery Store/Burger King – 333-365 Amherst St.	Former Dye Manufacturer, Former Auto Sales And Service, Spill Records	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AA	Former Buffalo Fire Station – 395 Amherst St.	USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AB	Wegman's – 601 Amherst St.	Former Steel Company, Former Lithographic Company, Former Blower Manufacturer, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey Soil Boring Inspections Geophysical Survey
AC	Marcon Erectors – 1 Howell St.	Former Window Manufacturer, Former Petroleum Company, Former Robe Manufacturer, USTs, Active Spill Records	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AD	Contractor Storage Area – 18 Howell St.	Contractor Storage Area	Petroleum and General Industrial Contamination	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
AE	Residential Property – 227 Middlesex Rd.	USTs	Petroleum Contamination	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
AF	Buffalo Police Radio Tower – Route 198 Eastbound	USTs	Abandoned USTs, Petroleum Contamination	Soil Gas Survey Soil Boring Inspections Geophysical Survey
AG	City of Buffalo Park Labor Center – 17-25 Meadowview Pl.	Garage/Repair Shop, USTs	Abandoned USTs, Petroleum and Auto Repair Shop Contamination	Soil Gas Survey Soil Boring Inspections Geophysical Survey

Table 4-1
Summary of Recommendations
(continued)

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
AH	Delaware Park – Parkside Ave.	Former Quarry – Filled In	Contaminated Soils and Fill	Soil Boring Inspections if work is proposed near site.
AI	Metro-Rail Subway Station – 2085 Main St.	Former Gas Station, Former Paint Shop Former Auto Repair Shop, USTs	Abandoned USTs, Petroleum, Solvent, and Auto Repair Shop Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AJ	Buffalo Lining & Fabricating – 93 Gillette Ave.	Metal Fabricating Company, Former Fuel Company, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AK	WM Maunz Co. – 387 East Delavan Ave.	Metal Working Facilities, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AL	Route 33	Former Used Car Lot, Former Gas Station, Former Contractor's Storage Yard, Former Auto Repair Shop, Former Furniture Manufacturer, Former Dry Cleaner, Spill Records, USTs	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AM	Railroad ROW – East End	Railroad Line	Contaminated Soils and Fill Associated With Railroad Use	Soil Gas Survey and Soil Boring Inspections if work is proposed near site.
AN	Residential Property – 413 East Delevan Ave.	Former Furniture Manufacturer, Former Auto Body Manufacturer, Former Plating Company, Former Used Car Lot	Abandoned USTs, Petroleum and General Industrial Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.

Table 4-1
Summary of Recommendations
(continued)

Site	Property Name and Address	Environmental Concerns		Recommendation
		Known	Potential	
AO	Sears, Roebuck & Co. and North Extension – 370-440 East Delevan Ave.	Distribution Warehouse, Former Gas Station, Former Dry Cleaners, Former Quarry, USTs, AST	Abandoned USTs, Petroleum and Solvent Contamination, Fill Contaminated with Industrial Wastes	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.
AP	Brookline Machine Inc. and North Extension – 1870-1896 Fillmore Ave.	Machine Shop, Former Junk Yard, Former Auto Repair Shop, Former Used Auto Parts Store, USTs	Abandoned USTs, Petroleum and Auto Repair Shop Contamination	Soil Gas Survey, Soil Boring Inspections, and Geophysical Survey if work is proposed near site.

- Recommendations assume full depth reconstruction on the site in question and sampling targeted to excavation areas. “Soil Gas Survey” and “Soil Boring Inspections” are field screening methods to determine if collection of soil or groundwater samples is warranted at a site. If sample collection is warranted at a site and groundwater is encountered within the soil borings, a groundwater sample should be collected directly from the hole created by the soil borings which represents the worst case conditions. *The Project’s design plans are subject to change; however; it should be noted that under the current proposed design (Build Alternative 2) it is anticipated that only sites A, X, Y, AB, AF and AG are expected to be involved in the project.*

ATTACHMENT A

Sources of Information

REPORT REFERENCES

Source: First Search
Corridor Study Report and Sanborn Fire Insurance Maps
Date: April 2008

Source: U.S. Department of Agriculture, Soil Conservation Service Web Soil Survey
Erie County Soil Survey
Date: 2007

Source: NYS Department of Environmental Conservation
Registry of Inactive Hazardous Waste Disposal Sites
Date: 2003

Source: NYS Department of Environmental Conservation
Petroleum Bulk Storage Facilities Registry
Date: Includes April 2000 update

Source: NYS Department of Environmental Conservation
Chemical Bulk Storage Facilities Registry
Date: Includes April 2000 update

Source: NYS Department of Environmental Conservation
Major Oil Storage Facilities Database
Date: Includes April 2000 update

Source: NYS Department of Environmental Conservation
Spill Reports Database Website
Date: 2008, 2012, and 2016

Source: Erie County Department of Environment and Planning
Solid Waste Site Map
Date: 1995

Source: City of Buffalo Public Library
Atlas of the City of Buffalo, NY;
Date: 1884

Source: City of Buffalo Public Library
Atlas of the City of Buffalo, NY;
Date: 1894

Source: City of Buffalo Public Library
New Century Atlas of Greater Buffalo;
Date: 1914

Source: City of Buffalo Public Library
City of Buffalo Polk Directories;
Date: 1930, 1935, 1940, 1946, 1950, 1955, 1960, 1965, 1971, 1975, 1980,
1985, 1990, 1996, 2000 and

Source: Erie County Department of Public Work
Aerial Photographs
Date: 1927

Source: State University of New York at Buffalo Map Collection
Aerial Photographs
Date: 1966 and 1978

Source: TerraserverUSA
Aerial Photographs
Date: 1995

Source: Microsoft Virtual Earth
Aerial Photographs
Date: 2008

ACRONYMS

AST	Aboveground Storage Tank
CERCLIS	Comprehensive Environmental Response, Compensation and Liability Information System
EDR	Environmental Data Resources
EM	Electromagnetic Conductivity
EPM	Environmental Procedures Manual
GPR	Ground Penetrating Radar
HW/CM	Hazardous Waste/Contaminated Materials Assessment
LQG	Large Quantity Generator
MOSF	Major Oil Storage Facility
NFRAP	No Further Remedial Action Planned
NPL	National Priority List
NYSDEC	New York State Department of Environmental Conservation
NYSDOT	New York State Department of Transportation
PBS	Petroleum Bulk Storage
PID	Photon Ionizing Detector
RCRA	Resource Conservation and Recovery Act
ROW	Right-of-way
SQG	Small Quantity Generator
TSDf	Treatment, Storage, and Disposal Facility
USEPA	United States Environmental Protection Agency
USGS	United States Geological Survey
UST	Underground Storage Tank

ATTACHMENT B

Site Photographs



Photo 1: Site A: Scajaquada Creek – Photo is taken from old railroad bridge near Buffalo Structural Steel, facing north.



Photo 2: Site A: Scajaquada Creek – Photo is taken from old railroad bridge near Buffalo Structural Steel, facing south.



Photo 3: Site A: Scajaquada Creek – Photo is taken from West Avenue Bridge, facing southwest.



Photo 4: Site B: B&B Collision – 1660 Niagara Street – Photograph is taken from across Niagara Street, facing southwest.



Photo 5: Site C: Zeller Electric – 1675 Niagara Street – Photograph is taken from across Niagara Street, facing southeast.



Photo 6: Site D: Railroad ROW – Niagara Street – Aerial view of railroad corridor.



Photo 7: Site E: Niagara Mohawk – 1626 Niagara Street – Photograph is taken from across Niagara Street, facing northwest.



Photo 8: Site F: I-190 – Niagara Section – Aerial photograph of highway corridor.



Photo 9: Site G: City of Buffalo Park – Niagara Street – Photograph is taken from across Niagara Street, facing west.



Photo 10: Site H: City of Buffalo Park Bike Path Area beneath Route 198 – Niagara Street – Photograph is taken from across Niagara Street, facing east.



Photo 11: Site I: Hohl Machine & Conveyor Co. – 1540-1590 Niagara Street – Photograph is taken from adjacent property, facing south.



Photo 12: Site I: Hohl Machine & Conveyor Co. – 1540-1590 Niagara Street – Photograph is taken from across Niagara Street, facing northwest.



Photo 13: Site J: Vincent's Self-Storage – 1573 Niagara Street – Photograph is taken from across Niagara Street, facing east.



Photo 14: Site K: Infinity Architectural Windows – 1555 Niagara Street – Photograph is taken from across Niagara Street, facing east.



Photo 15: Site L: G&G Sunoco Gas Station – 1531-1543 Niagara Street – Photograph is taken from across Niagara Street, facing northeast.



Photo 16: Site M: Rascal's Restaurant – 1516 Niagara Street – Photograph is taken from across Niagara Street, facing northwest.



Photo 17: Site N: Contract Pharmaceuticals Limited Niagara Parking Lot – 80 Forest Avenue –
Photograph is taken from across Forest Avenue, facing north.



Photo 18: Site N: Contract Pharmaceuticals Limited Niagara Parking Lot – 80 Forest Avenue –
Photograph is taken from adjacent Bike Path, facing east.



Photo 19: Site O: Vacant Lot – Former Pratt and Lambert, Lacquer Plant – 1451 West Avenue –
Photograph is taken from across West Avenue, facing east. Note the building in the background is part of Site P.



Photo 20: Site P: Contract Pharmaceuticals Limited Niagara – 100 Forest Avenue –
Photograph is taken from along Forest Avenue, facing west.



Photo 21: Rear Portion of Site P: Contract Pharmaceuticals Limited Niagara – Dart Street – Photograph is taken from entrance on Dart Street, facing southwest.



Photo 22: Site Q: Pagan Auto Sales – 18 Tonawanda Street – Photograph is taken from across Tonawanda Street, facing southwest.



Photo 23: Southern Portion of Site R: Fort Knox Business Center – 31 Tonawanda Street – Photograph is taken from across Tonawanda Street at West Avenue, facing southeast.



Photo 24: Northern Portion of Site R: Fort Knox Business Center – 31 Tonawanda Street – Photograph is taken from across Tonawanda Street, facing east.



Photo 25: Rear Portion of Site R: Fort Knox Business Center – 31 Tonawanda Street – Photograph is taken from adjacent Bike Path, facing southwest.



Photo 26: Site S: Vacant Lot – Former Pratt and Lambert, Paint and Varnish Plant – 75 Tonawanda Street – Photograph is taken from across Tonawanda Street, facing east.



Photo 27: Rear portion of Site S: Vacant Lot – Former Pratt and Lambert, Paint and Varnish Plant – 75 Tonawanda Street – Photograph is taken from adjacent Bike Path, facing southwest.



Photo 28: Rear of Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers – 125-137 Tonawanda Street – Photograph is taken from adjacent Bike Path, facing southwest.



Photo 29: Portion of Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers – 125-137 Tonawanda Street – Photograph is taken from along Tonawanda Street, facing east.



Photo 30: Portion of Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers – 125-137 Tonawanda Street– Rear of property. Photograph is taken from adjacent Bike Path, facing west.



Photo 31: Portion of Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers – 125-137 Tonawanda Street – Photograph is taken from across Tonawanda Street, facing southeast.



Photo 32: Site U: Former Pratt and Letchworth – 189-205 Tonawanda Street – Photograph is taken from across Tonawanda Street, facing east.



Photo 33: Rear Portion of Site U: Former Pratt and Letchworth – 189-205 Tonawanda Street – Photograph is taken from adjacent Bike Path, facing northwest.



Photo 34: Site V: City of Buffalo Impound Lot – 166 Dart Street – Photograph is taken from across Dart Street, facing northwest.



Photo 35: Portion of Site V: City of Buffalo Impound Lot – 166 Dart Street – Photograph is taken from northern end of property, facing south.



Photo 36: Portion of Site W: Buffalo State College Parking Lot – Grant Street – Photograph is taken from across Letchworth Street, facing north.



Photo 37: Portion of Site W: Buffalo State College Parking Lot – Grant Street – Photograph is taken from across Grant Street, facing west.



Photo 38: Portion of Site X: Buffalo State College – 1300 Elmwood Avenue – Photograph is taken from the adjacent parking lot, facing north.



Photo 39: Site Y: On/Off Ramp – Grant Street – Photograph is taken from across Grant Street, facing east.



Photo 40: Site Z: Tops Grocery Store/Burger King – 333-365 Amherst Street – Photograph is taken from along Amherst Street, facing southwest.



Photo 41: Site Z: Tops Grocery Store/Burger King – 333-365 Amherst Street – Photograph is taken from across Amherst Street, facing south.



Photo 42: Site AA: Former Buffalo Fire Station – 395 Amherst Street – Photograph is taken from across Amherst Street, facing south.



Photo 43: Site AB: Wegman's – 601 Amherst Street – Photograph is taken from store parking lot, facing south.



Photo 44: Rear of Site AB: Wegman's – 601 Amherst Street – Photograph is taken from adjacent bike path, facing northwest.



Photo 45: Site AC: Marcon Erectors – 1 Howell Street – Photograph is taken from adjacent bike path, facing northwest.



Photo 46: Site AC: Marcon Erectors – 1 Howell Street – Photograph is taken from across Howell Street, facing northeast.



Photo 47: Site AD: Contractor Storage Area – 18 Howell Street – Photograph is taken from Howell Street, facing southwest.



Photo 48: Site AE: Residential Property – 227 Middlesex Road – Photograph is taken from across Middlesex Road, facing north.



Photo 49: Site AF: Buffalo Police Radio Tower – Route 198 Eastbound – Photograph is taken from Delaware Park, facing west.



Photo 50: Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Place – Photograph is taken from across Route 198, facing southwest.



Photo 51: Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Place –
Photograph is taken from across Route 198, facing south.



Photo 52: Site AH: Delaware Park – Parkside Avenue – Photograph is taken from along
Meadow Drive in Delaware Park, facing east.



Photo 53: Site A1: Metro-Rail Subway Station – 2085 Main Street – Photograph is taken from along Kensington Avenue, facing south.
Source: Google Maps Street View

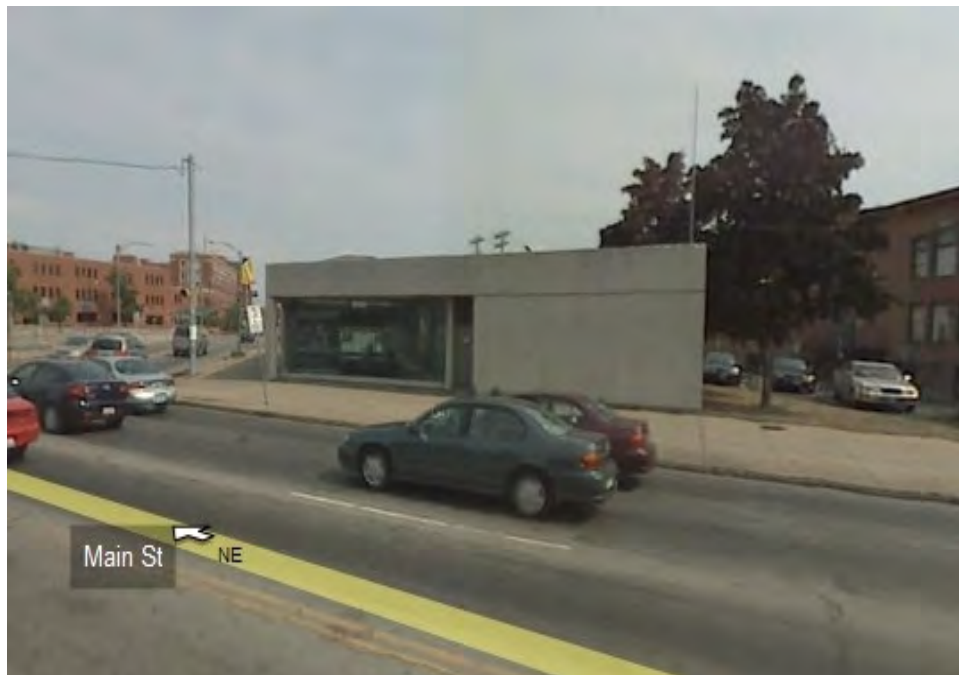


Photo 54: Site A1: Metro-Rail Subway Station – 2085 Main Street – Photograph is taken from across Main Street, facing southeast.
Source: Google Maps Street View



Photo 55: Site AJ: Buffalo Lining & Fabricating – 93 Gillette Avenue – Photograph is taken from across Gillette Avenue, facing northwest.



Photo 56: Site AK: WM Maunz Co. – 387 East Delavan Avenue – Photograph is taken from across Humboldt Parkway, facing southeast.



Photo 57: Site AL: Portion of Route 33 – Aerial view of highway corridor.



Photo 58: Site AM: Railroad ROW – East End – Aerial view of railroad corridor.

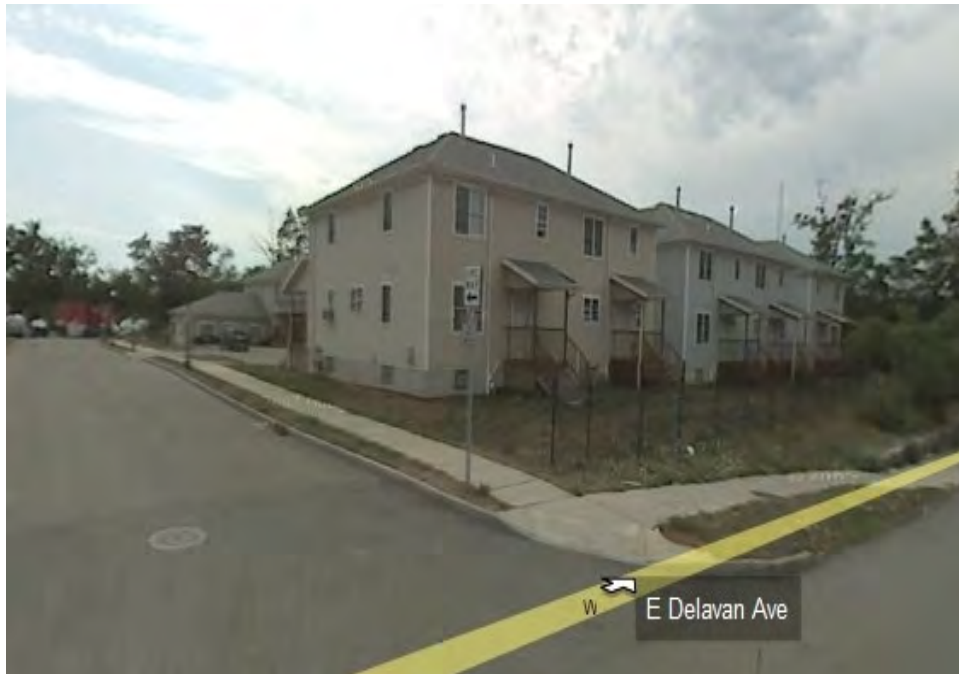


Photo 59: Site AN: Residential Property – 413 East Delevan Avenue – Photograph is taken from along East Delevan Avenue, facing southwest.
Source: Google Maps Street View

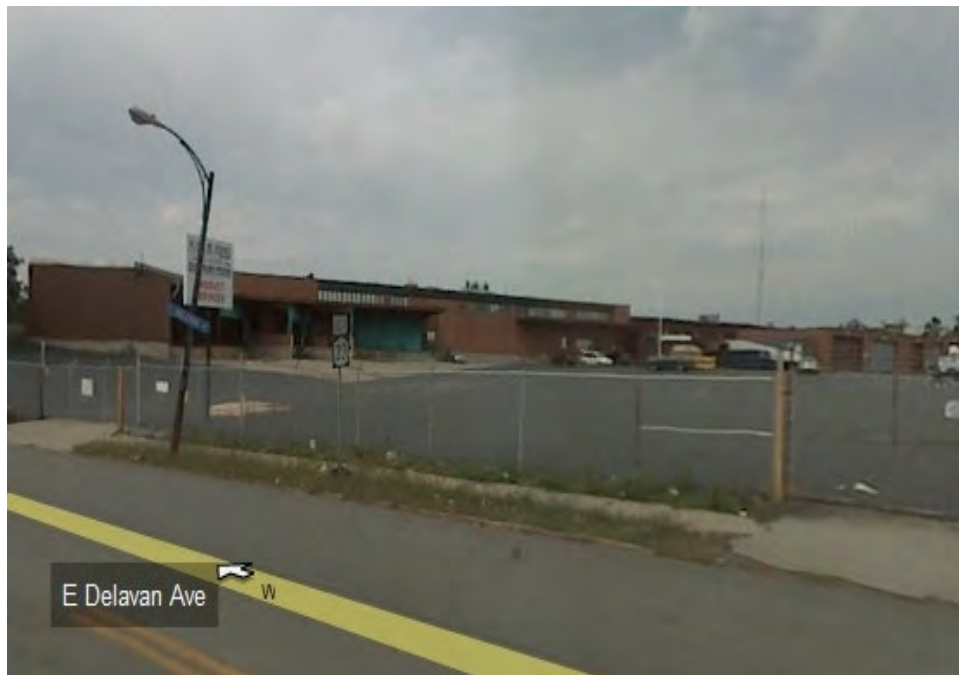


Photo 60: Site AO: Sears, Roebuck & Co. and North Extension – 370-440 East Delevan Avenue – Photograph is taken from along East Delevan Avenue, facing northwest.
Source: Google Maps Street View



Photo 61: Site AP: Brookline Machine Inc. and North Extension – 1870-1896 Fillmore Avenue – Photograph is taken from across Fillmore Avenue, facing southwest.

ATTACHMENT C

FirstSearch Report

FirstSearch Technology Corporation

Environmental FirstSearch™ Report

Target Property:

NY 198

BUFFALO NY 14216

Job Number: 5466

PREPARED FOR:

Watts Engineers

3826 Main Street

Buffalo, NY 14226

04-25-08



Tel: (781) 551-0470

Fax: (781) 551-0471

Environmental FirstSearch Search Summary Report

Target Site: NY 198

BUFFALO NY 14216

FirstSearch Summary

Database	Sel	Updated	Radius	Site	1/8	1/4	1/2	1/2>	ZIP	TOTALS
NPL	Y	02-08-08	0.12	0	0	-	-	-	0	0
NPL Delisted	Y	02-08-08	0.12	0	0	-	-	-	0	0
CERCLIS	Y	02-08-08	0.12	0	0	-	-	-	2	2
NFRAP	Y	02-08-08	0.12	0	2	-	-	-	0	2
RCRA COR ACT	Y	04-01-08	0.12	0	1	-	-	-	0	1
RCRA TSD	Y	04-01-08	0.12	0	1	-	-	-	0	1
RCRA GEN	Y	04-01-08	0.12	2	20	-	-	-	6	28
RCRA NLR	Y	04-01-08	0.12	4	15	-	-	-	8	27
Federal IC / EC	Y	02-08-08	0.12	0	0	-	-	-	3	3
ERNS	Y	12-31-07	0.12	0	5	-	-	-	46	51
Tribal Lands	Y	12-01-05	0.12	0	0	-	-	-	0	0
State/Tribal Sites	Y	12-06-08	0.12	0	5	-	-	-	0	5
State Spills 90	Y	02-05-08	0.12	4	62	-	-	-	153	219
State Spills 80	Y	10-18-00	0.12	0	20	-	-	-	44	64
State/Tribal SWL	Y	05-03-06	0.12	0	2	-	-	-	0	2
State/Tribal LUST	Y	02-05-08	0.12	1	17	-	-	-	6	24
State/Tribal UST/AST	Y	02-05-08	0.12	1	16	-	-	-	0	17
State/Tribal EC	Y	12-06-07	0.12	0	0	-	-	-	0	0
State/Tribal IC	Y	02-05-08	0.12	0	1	-	-	-	0	1
State/Tribal VCP	Y	02-05-08	0.12	0	0	-	-	-	0	0
State/Tribal Brownfields	Y	02-05-08	0.12	0	0	-	-	-	0	0
Receptors	Y	01-01-05	0.12	0	2	-	-	-	0	2
NPDES	Y	07-21-07	0.12	0	0	-	-	-	6	6
FINDS	Y	07-10-07	0.12	12	68	-	-	-	286	366
TRIS	Y	09-14-07	0.12	0	7	-	-	-	0	7
HMIRS	Y	02-01-08	0.12	0	2	-	-	-	21	23
NCDB	Y	09-22-06	0.12	0	4	-	-	-	0	4
PADS	Y	12-15-07	0.12	0	0	-	-	-	1	1
AIRS	Y	01-12-08	0.12	0	5	-	-	-	0	5

Notice of Disclaimer

Due to the limitations, constraints, inaccuracies and incompleteness of government information and computer mapping data currently available to FirstSearch Technology Corp., certain conventions have been utilized in preparing the locations of all federal, state and local agency sites residing in FirstSearch Technology Corp.'s databases. All EPA NPL and state landfill sites are depicted by a rectangle approximating their location and size. The boundaries of the rectangles represent the eastern and western most longitudes; the northern and southern most latitudes. As such, the mapped areas may exceed the actual areas and do not represent the actual boundaries of these properties. All other sites are depicted by a point representing their approximate address location and make no attempt to represent the actual areas of the associated property. Actual boundaries and locations of individual properties can be found in the files residing at the agency responsible for such information.

Waiver of Liability

Although FirstSearch Technology Corp. uses its best efforts to research the actual location of each site, FirstSearch Technology Corp. does not and can not warrant the accuracy of these sites with regard to exact location and size. All authorized users of FirstSearch Technology Corp.'s services proceeding are signifying an understanding of FirstSearch Technology Corp.'s searching and mapping conventions, and agree to waive any and all liability claims associated with search and map results showing incomplete and or inaccurate site locations.

- Continued on next page -

Environmental FirstSearch Search Summary Report

Target Site: NY 198

BUFFALO NY 14216

FirstSearch Summary

Database	Sel	Updated	Radius	Site	1/8	1/4	1/2	1/2>	ZIP	TOTALS
DOCKET	Y	01-09-06	0.12	0	2	-	-	-	0	2
Nuclear Permits	Y	04-30-99	0.12	0	0	-	-	-	0	0
Releases	Y	12-31-07	0.12	0	1	-	-	-	30	31
Federal Other	Y	01-12-08	0.12	0	0	-	-	-	0	0
SETS PRP	Y	11-19-02	0.12	0	0	-	-	-	0	0
State Permits	Y	04-01-06	0.12	0	0	-	-	-	1	1
State Other	Y	02-05-08	0.12	0	0	-	-	-	0	0
- TOTALS -				24	258	0	0	0	613	895

Notice of Disclaimer

Due to the limitations, constraints, inaccuracies and incompleteness of government information and computer mapping data currently available to FirstSearch Technology Corp., certain conventions have been utilized in preparing the locations of all federal, state and local agency sites residing in FirstSearch Technology Corp.'s databases. All EPA NPL and state landfill sites are depicted by a rectangle approximating their location and size. The boundaries of the rectangles represent the eastern and western most longitudes; the northern and southern most latitudes. As such, the mapped areas may exceed the actual areas and do not represent the actual boundaries of these properties. All other sites are depicted by a point representing their approximate address location and make no attempt to represent the actual areas of the associated property. Actual boundaries and locations of individual properties can be found in the files residing at the agency responsible for such information.

Waiver of Liability

Although FirstSearch Technology Corp. uses its best efforts to research the actual location of each site, FirstSearch Technology Corp. does not and can not warrant the accuracy of these sites with regard to exact location and size. All authorized users of FirstSearch Technology Corp.'s services proceeding are signifying an understanding of FirstSearch Technology Corp.'s searching and mapping conventions, and agree to waive any and all liability claims associated with search and map results showing incomplete and or inaccurate site locations.

***Environmental FirstSearch
Site Information Report***

Request Date: 04-25-08
Requestor Name: jkellogg/watts/bc
Standard: LINEAR

Search Type: LINEAR
5.35 mile(s)
Job Number: 5466

Target Site: NY 198
BUFFALO NY 14216

Demographics

Sites: 895	Non-Geocoded: 613	Population: NA
Radon: OF THE 101 HOMES TESTED, THE AVG. PCI/L LEVEL WAS .7		

Site Location

	<u>Degrees (Decimal)</u>	<u>Degrees (Min/Sec)</u>	<u>UTMs</u>
Longitude:	-78.870575	-78:52:14	Easting: 673770.378
Latitude:	42.930105	42:55:48	Northing: 4755038.144
			Zone: 17

Comment

Comment:

Additional Requests/Services

Adjacent ZIP Codes: 0.25 Mile(s)

Services:

ZIP Code	City Name	ST	Dist/Dir	Sel
14207	BUFFALO	NY	0.00 --	Y
14208	BUFFALO	NY	0.00 --	Y
14209	BUFFALO	NY	0.00 --	Y
14211	BUFFALO	NY	0.02 SE	Y
14213	BUFFALO	NY	0.00 --	Y
14214	BUFFALO	NY	0.00 --	Y
14222	BUFFALO	NY	0.00 --	Y

	Requested?	Date
Sanborns	Yes	04-25-08
Aerial Photographs	No	
Historical Topos	No	
City Directories	No	
Title Search/Env Liens	No	
Municipal Reports	No	
Online Topos	No	

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
8	FINDS	NYSDOT BIN 1039970 110007983744/FRS	NY RTE 198 BRG OVER SCAJQU BUFFALO NY 14222	0.00 --	1
2	FINDS	NYSDOT BIN 103989B - D123456 110018888747/FRS	SCAJQUADA CRK EXPWY I-190 BUFFALO NY 14213	0.00 --	2
3	FINDS	NYSDOT BIN 1001590 110008066172/FRS	MAIN ST OVER NY RT 198 BUFFALO NY 14214	0.00 --	4
3	FINDS	NYSDOT NYD986968659	RTE 5 MAIN ST OVER RTE 198 BUFFALO NY 14214	0.00 --	5
1	FINDS	BUFFALO CITY OF PARKS DEPT 110012242019/FRS	17 MEADOWVIEW PL BUFFALO NY 14214	0.00 --	6
1	FINDS	BUFFALO CITY OF DEPT OF PARKS NY0000057240	17 MEADOW VIEW DR BUFFALO NY 14214	0.00 --	8
8	FINDS	NYSDOT CONTRACT D254888 NY0000098400	RTE 198 OVER SCAJQUADA CRE BUFFALO NY 14222	0.00 --	9
8	FINDS	NYSDOT BIN 1039959 D256194 110007986386/FRS	RTE 198 RAMP C BRIDGE OVER BUFFALO NY 14222	0.00 --	10
8	FINDS	NYSDOT BIN 1039959 D256194 NY0000347013	RTE 198 RAMP C BRG OVER SCA BUFFALO NY 14222	0.00 --	11
2	FINDS	NYSDOT BIN 103989C - D123456 110018888710/FRS	SCAJQUADA CRK EXPWY INT I- BUFFALO NY 14213	0.00 --	12
2	FINDS	NYSDOT BIN 103989A - D123456 110018888756/FRS	SCAJQUADA CRK EXPWY INT W BUFFALO NY 14213	0.00 --	14
2	FINDS	NYSDOT BIN 103989D - D123456 110018888701/FRS	SCAJQUADA CRK EXPWY INT BUFFALO NY 14213	0.00 --	16
1	LUST	CITY OF BUFFALO PARKS 9875365/CLOSED	17 MEADOWVIEW PLACE BUFFALO NY 14214	0.00 --	18
6	RCRAGN	NYSDOT BIN 103989C - D123456 NYR000127712/LGN	SCAJQUADA CRK EXPWY INT I- BUFFALO NY 14213	0.00 --	20
1	RCRAGN	BUFFALO CITY OF PARKS DEPT NYR000100982/LGN	17 MEADOWVIEW PL BUFFALO NY 14214	0.00 --	21
3	RCRANLR	NYSDOT BIN 1001590 NYD986968659/NLR	MAIN ST OVER NY RT 198 BUFFALO NY 14214	0.00 --	22
1	RCRANLR	BUFFALO CITY OF DEPT OF PARKS NY0000057240/NLR	17 MEADOW VIEW DR BUFFALO NY 14214	0.00 --	24
8	RCRANLR	NYSDOT BIN 1039970 NY0000098400/NLR	NY RTE 198 BRG OVER SCAJQU BUFFALO NY 14222	0.00 --	26
8	RCRANLR	NYSDOT BIN 1039959 D256194 NY0000347013/NLR	RTE 198 RAMP C BRIDGE OVER BUFFALO NY 14222	0.00 --	27
5	SPILLS	FOAM IN CREEK 9315020/CLOSED	GERMAIN STREET BUFFALO NY 14207	0.00 --	28
7	SPILLS	CYLINDER UNDER ROUTE 198 9806367/CLOSED	NIAGARA, FOREST, RT 198 BUFFALO NY 14213	0.00 --	29

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
4	SPILLS	WASTE OIL CONTAINERS 9875028/CLOSED	DART STREET SO OF RT198 BUFFALO NY 14213	0.00 --	31
1	SPILLS	CITY OF BUFFALO PARKS 9875365/CLOSED	17 MEADOWVIEW PLACE BUFFALO NY 14214	0.00 --	33
1	UST	DELAWARE LABOR CENTER PBS9-427268/ACTIVE	17 MEADOWVIEW PL BUFFALO NY 14214	0.00 --	35
13	FINDS	PARKWAY CYTOLOGY LABORATORY INC NYD080328883	2121 MAIN ST BUFFALO NY 14214	0.01 NE	38
13	FINDS	PARKWAY CYTOLOGY LABORATORY INC 110004370975/FRS	2121 MAIN ST BUFFALO NY 14214	0.01 NE	39
13	RCRANLR	PARKWAY CYTOLOGY LABORATORY INC NYD080328883/NLR	2121 MAIN ST BUFFALO NY 14214	0.01 NE	40
20	SPILLS	POLE TOP 0608235/CLOSED	AMHERST ST GRANT BUFFALO NY 14207	0.01 NE	41
20	SPILLS	BUFFALO FIRE LADDER 12 9911520/CLOSED	AMHERST ST and GRANT ST BUFFALO NY 14207	0.01 NE	43
11	FINDS	NYSDOT BRIDGE BIN 103989E 110018888658/FRS	RTE 198 OFF RAMP TO NIAGARA BUFFALO NY 14213	0.01 NW	45
15	FINDS	NYSDOT BIN 1039990 110008105380/FRS	PEDRESTRIAN BRG OVER RTE 19 BUFFALO NY 14216	0.01 NW	47
11	RCRAGN	NYSDOT BRIDGE BIN 103989E NYR000127670/LGN	RTE 198 OFF RAMP TO NIAGARA BUFFALO NY 14213	0.01 NW	49
18	FINDS	NYSDOT BIN 1022680 NYD982797276	RTE 33EB RAMP TO RTE 198WB BUFFALO NY 14208	0.01 SE	50
9	FINDS	NYSDOT BRIDGE BIN 103989F 110018888676/FRS	RTE 198 ON RAMP FROM NIAGAR BUFFALO NY 14213	0.01 SE	51
18	FINDS	NYSDOT BIN 1022660 110008077204/FRS	DELEVAN AVE OVER RTE 33 BUFFALO NY 14208	0.01 SE	53
18	FINDS	NYSDOT BIN 1022680 110008033706/FRS	HUMBOLDT PKY OVER RT 33 BUFFALO NY 14208	0.01 SE	54
18	FINDS	NYSDOT BIN 1022660 NYD987008331	DELEVAN AVE OVER RTE 33 BUFFALO NY 14208	0.01 SE	55
9	RCRAGN	NYSDOT BRIDGE BIN 103989F NYR000127688/LGN	RTE 198 ON RAMP FROM NIAGAR BUFFALO NY 14213	0.01 SE	56
18	RCRANLR	NYSDOT BIN 1022660 NYD987008331/NLR	DELEVAN AVE OVER RTE 33 BUFFALO NY 14208	0.01 SE	57
18	RCRANLR	NYSDOT BIN 1022680 NYD982797276/NLR	HUMBOLDT PKY OVER RT 33 BUFFALO NY 14208	0.01 SE	58
22	SPILLS	WARD TRUCKING 0075255/CLOSED	ROUTE 198 EB BUFFALO NY 14213	0.01 SE	59

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
18	SPILLS	BUFFALO FUEL - HAZ WASTE 0001030/CLOSED	ROUTE 33 RAMP ROUTE 198 BUFFALO NY 14208	0.01 SE	61
18	SPILLS	AMHERST PAVING 9410366/CLOSED	ROUTE 33-WB AT ROUTE 198 BUFFALO NY 14208	0.01 SE	63
21	SPILLS	ABANDONED DRUMS VACANT LO 0175459/CLOSED	1590 NIAGARA ST BUFFALO NY 14213	0.01 SE	65
18	SPILLS	AUTO ACCIDENT 9006316/CLOSED	RT 198 and RT 33 BUFFALO NY 14208	0.01 SE	67
17	SPILLS80	SCAJAQUADA CREEK 8603086/CLOSED	WEST AVE BUFFALO NY 14213	0.01 SE	69
19	UST	WM C MAUNZ CO INC PBS9-224375/UNREGULATED BY PBS	387 E DELAVAN AVE BUFFALO NY 14208	0.01 SE	70
12	ERNS		HUMBOLDT PARKWAY AND MAIN S	0.01 SW	73
		625983/HIGHWAY RELATED	BUFFALO NY 14214		
14	FINDS	NYSDOT BIN 1040000 110008036188/FRS	KENSINGTON AVE OVER NY RT 1 BUFFALO NY 14214	0.01 SW	74
10	FINDS	NYSDOT BIN 1039969 110008083849/FRS	ELMWOOD AVE OVER RTE 198 BUFFALO NY 14216	0.01 SW	75
10	FINDS	NYSDOT BIN 1039969 NYD987025467	ELMWOOD AVE OVER RTE 198 BUFFALO NY 14216	0.01 SW	77
14	FINDS	NYSDOT BIN 1040000 NYD986885879	KENSINGTON AVE OVER RTE 198 BUFFALO NY 14214	0.01 SW	78
16	LUST	DELAWARE PARK LABOR CENT. 8809536/CLOSED	25 MEADOW VIEW PLACE BUFFALO NY 14214	0.01 SW	79
14	RCRANLR	NYSDOT BIN 1040000 NYD986885879/NLR	KENSINGTON AVE OVER NY RT 1 BUFFALO NY 14214	0.01 SW	80
10	RCRANLR	NYSDOT BIN 1039969 NYD987025467/NLR	ELMWOOD AVE OVER RTE 198 BUFFALO NY 14216	0.01 SW	81
10	SPILLS	TRASH FROM AUTO 9514722/CLOSED	ROUTE 198 AND ELMWOOD BUFFALO NY 14216	0.01 SW	82
12	SPILLS	NYSDOT PROJECT/TANK 0007497/CLOSED	MAIN ST and HUMBOLDT PKWY BUFFALO NY 14214	0.01 SW	84
12	SPILLS	RADIOACTIVE CONTAINERS 9902593/CLOSED	HUMBOLDT AND MAIN STREET BUFFALO NY 14214	0.01 SW	86
10	SPILLS	SCAJAQUADA CREEK 9314227/CLOSED	ROUTE 198 and ELMWOOD AVE. BUFFALO NY 14216	0.01 SW	88
12	SPILLS	RADIOACTIVE CONTAINERS 9975173/CLOSED	HUMBOLDT AND MAIN STREET BUFFALO NY 14214	0.01 SW	90
16	SPILLS80	DELAWARE PARK LABOR CENT. 8809536/CLOSED	25 MEADOW VIEW PLACE BUFFALO NY 14214	0.01 SW	92

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
28	FINDS	NYSDOT BIN 1033910 110008105399/FRS	GRANT ST BRG OVER RTE 198 BUFFALO NY 14213	0.02 NE	93
28	RCRAGN	NYSDOT BIN 1033910 NYR000062372/LGN	GRANT ST BRG OVER RTE 198 BUFFALO NY 14213	0.02 NE	95
24	SPILLS	FRANK HOUSE 0375312/CLOSED	1910 DELAWARE BUFFALO NY 14216	0.02 NE	96
23	FINDS	HOHL MACHINE and CONVEYOR CO NYD987020625	1580 NIAGARA ST BUFFALO NY 14213	0.02 SE	98
23	FINDS	HOHL MACHINE and CONVEYOR COMPANY 110004497394/FRS	1580 NIAGARA STREET BUFFALO NY 14213	0.02 SE	99
23	RCRANLR	HOHL MACHINE and CONVEYOR CO NYD987020625/NLR	1580 NIAGARA ST BUFFALO NY 14213	0.02 SE	100
26	SPILLS	WARD TRUCKING 0004878/CLOSED	198 AND I190 BUFFALO NY 14213	0.02 SE	101
26	SPILLS	ABANDONED DRUMS BLACKROCK 9305994/CLOSED	ROUTE 198 AND I190 BUFFALO NY 14213	0.02 SE	103
23	SPILLS80	HOHL MACHINE and CONVEYOR 8709761/CLOSED	1580 NIAGARA STREET BUFFALO NY 14213	0.02 SE	105
26	SPILLS80	TRUCK FUEL TANK LEAK 8605926/CLOSED	RT.198-E RAMP FROM I190-N BUFFALO NY 14213	0.02 SE	106
25	SPILLS	BUFFALO MUNICIPAL HOUSING 0375474/CLOSED	167 W. HUMBOLDT MAIN BUFFALO NY 14214	0.02 SW	107
25	SPILLS	PRIVATE RESIDENCE 0275447/CLOSED	167 HUMBOLDT APT 1014 BUFFALO NY 14214	0.02 SW	109
27	SPILLS80	MAINES MIDWEST 8909395/CLOSED	ROUTE 33 AT 281 HUMBOLT BUFFALO NY 14208	0.02 SW	111
33	SPILLS	SHEEN ON SCAJAQUADA 0075565/CLOSED	HOWELL STREET BUFFALO NY 14207	0.03 N-	112
31	FINDS	SEARS ROEBUCK and CO NYD982272577	420 E DELAVAN BUFFALO NY 14214	0.03 NE	114
31	FINDS	SLS 88854 110029261091/FRS	420 E DELAVAN AVE BUFFALO NY 14214	0.03 NE	115
31	FINDS	SEARS ROEBUCK and CO 110004417881/FRS	420 E DELAVAN AVE BUFFALO NY 14214	0.03 NE	116
31	LUST	SEARS WAREHOUSE 8704178/CLOSED	420 EAST DELAVAN BUFFALO NY 14214	0.03 NE	118
31	RCRAGN	SEARS ROEBUCK and CO NYD982272577/SGN	420 E DELAVAN AVE BUFFALO NY 14214	0.03 NE	119
31	SPILLS	SEARS ROEBUCK AND CO 9106064/CLOSED	420 EAST DELAVAN BUFFALO NY 14214	0.03 NE	120

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
31	SPILLS80	SEARS WAREHOUSE 8704178/CLOSED	420 EAST DELAVAN BUFFALO NY 14214	0.03 NE	122
31	UST	SEARS, ROEBUCK and CO. PBS9-446556/UNREGULATED	420 EAST DELAVAN AVE. BUFFALO NY 14214	0.03 NE	123
29	FINDS	NYS DOT BIN 1039899 110018888694/FRS	RTE 198 OVER WEST AVE and BUFFALO NY 14213	0.03 SE	125
29	RCRAGN	NYS DOT BIN 1039899 NYR000127696/LGN	RTE 198 OVER WEST AVE and BUFFALO NY 14213	0.03 SE	127
32	SPILLS	RICH PRODUCTS 9303110/CLOSED	I190 SB AT NIAGARA STREET BUFFALO NY 14213	0.03 SE	128
29	SPILLS	CHEMICAL SPILL 0485089/CLOSED	WEST AVE. SCAJAQUADA EXPRE BUFFALO NY 14213	0.03 SE	130
34	SPILLS80	SCAJAQUADA CREEK 8907285/CLOSED	DELAWARE AVENUE BUFFALO NY 14214	0.03 SE	132
30	FINDS	MEDAILLE COLLEGE 110004562198/FRS	18 AGASSIZ CIR BUFFALO NY 14214	0.03 SW	133
30	LUST	MEDAILLE COLLEGE 8709122/CLOSED	18 AGASSIZ CIRCLE BUFFALO NY 14214	0.03 SW	135
30	RCRAGN	MEDAILLE COLLEGE NYR000086207/VGN	18 AGASSIZ CIR BUFFALO NY 14214	0.03 SW	136
30	SPILLS80	MEDAILLE COLLEGE 8709122/CLOSED	18 AGASSIZ CIRCLE BUFFALO NY 14214	0.03 SW	138
30	UST	MEDAILLE COLLEGE PBS9-224383/UNREGULATED	AGASSIZ CIRCLE BUFFALO NY 14214	0.03 SW	139
35	FINDS	CANISIUS COLLEGE - CAMPION HALL 110014359568/FRS	2136 MAIN ST BUFFALO NY 14214	0.04 NE	141
35	RCRAGN	CANISIUS COLLEGE - CAMPION HALL NYR000113142/SGN	2136 MAIN ST BUFFALO NY 14214	0.04 NE	143
37	FINDS	BERGMAN TOOL MFG CO., INC NYD002108967	1573 NIAGARA ST BUFFALO NY 14213	0.04 SE	145
37	FINDS	BERGMAN TOOL MANUFACTURING CO INC 110004338681/FRS	1573 NIAGARA ST BUFFALO NY 14213	0.04 SE	146
37	RCRANLR	BERGMAN TOOL MANUFACTURING CO INC NYD002108967/NLR	1573 NIAGARA ST BUFFALO NY 14213	0.04 SE	147
37	SPILLS	BERGMAN MANUFACTURING 0275210/CLOSED	1573 NIAGARA STREET BUFFALO NY 14213	0.04 SE	148
36	AIRS	JEWETT INC NY0989228/AIRS DATABASE	750 GRANT ST BUFFALO NY 14213	0.04 SW	150
36	FINDS	JEWETT INC 110001611569/FRS	750 GRANT STREET BUFFALO NY 14213	0.04 SW	151

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
36	FINDS	JUEWITT CO 110028962647/FRS	750 GRANT ST BUFFALO NY 14213	0.04 SW	152
39	FINDS	MARCON ERECTORS INC 110000840127/FRS	1 HOWELL ST BUFFALO NY 14207	0.05 N-	153
39	FINDS	NYSDEC/MARCON ERECTORS 110017246675/FRS	SITE 9098 BUFFALO NY 14207	0.05 N-	155
39	FINDS	MARCON ERECTORS INC NY0002167385	1 HOWELL ST BUFFALO NY 14207	0.05 N-	157
39	RCRAGN	NYSDEC/MARCON ERECTORS NYP000948950/LGN	SITE 9098 BUFFALO NY 14207	0.05 N-	158
39	RCRAGN	MARCON ERECTORS INC NYR000044909/LGN	1 HOWELL ST BUFFALO NY 14207	0.05 N-	159
39	SPILLS	MARCON ERECTORS 9507939/ACTIVE	HOWELL STREET BUFFALO NY 14207	0.05 N-	161
39	STATE	MARCON ERECTORS 915173	1 HOWELL STREET BUFFALO NY 14207	0.05 N-	164
41	SPILLS	ABANDONED CONTAINERS 9704992/CLOSED	WEST AVENUE UNDER RT 198 BUFFALO NY 14207	0.05 NW	166
44	FINDS	WILLARD MACHINE CORP 110004441612/FRS	73 FOREST AVE BUFFALO NY 14213	0.05 SE	168
44	FINDS	WILLARD MACHINE CORP NYD986888659	73 FOREST AVE BUFFALO NY 14213	0.05 SE	169
43	FINDS	HOHL MACHINE and CONVEYOR CO 110019808449/FRS	1540 NIAGARA ST BUFFALO NY 14213	0.05 SE	170
45	FINDS	CONSOLIDATED PKG. MACHINERY CO NYD980531933	1400 WEST AV. BUFFALO NY 14213	0.05 SE	171
40	LUST	PRATT and LAMBERT 8906606/CLOSED	1451 WEST AVENUE BUFFALO NY 14213	0.05 SE	172
45	NFRAP	CONSOLIDATED PKG MACHINERY CORP NYD980531933/NFRAP-N	1400 WEST AVE BUFFALO NY 14213	0.05 SE	173
44	RCRANLR	WILLARD MACHINE CORP NYD986888659/NLR	73 FOREST AVE BUFFALO NY 14213	0.05 SE	174
38	SPILLS	RASCAL S RESTAURANT 0175253/CLOSED	1516 NIAGARA STREET BUFFALO NY 14213	0.05 SE	175
42	SPILLS	473 EAST DELAVAN 9501080/ACTIVE	1526 NIAGARA ST BUFFALO NY 14213	0.05 SE	177
40	SPILLS80	PRATT and LAMBERT 8906606/CLOSED	1451 WEST AVENUE BUFFALO NY 14213	0.05 SE	179
42	UST	473 EAST DELAVAN INC PBS9-221635/UNREGULATED	1526 NIAGARA ST BUFFALO NY 14213	0.05 SE	180

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
46	SPILLS	TAR TO ROADWAY 0103289/CLOSED	30 BURBANK TERRACE BUFFALO NY 14214	0.05 SW	183
47	SPILLS	LOCKPORT TRUCK REPAIR 9009320/CLOSED	NIAGARA AND TONAWANDA ST. BUFFALO NY 14207	0.06 NW	185
47	SPILLS	NIAGARA MOHAWK STATION 6 9604790/CLOSED	NIAGARA ST and TONAWANDA ST BUFFALO NY 14207	0.06 NW	187
50	SPILLS	NIAGARA MOHAWK TRANSFORME 9608474/CLOSED	1626 NIAGARA STREET BUFFALO NY 14207	0.06 NW	189
47	SPILLS	CAR IN SCAJAQUADA CREEK 9201726/CLOSED	NIAGARA STREET BUFFALO NY 14207	0.06 NW	191
47	SPILLS80	SCAJAQUADA CREEK 8902835/CLOSED	NIAGARA AND TONAWANDA BUFFALO NY 14207	0.06 NW	193
49	UST	CITY SERVICE TAXI PBS9-600053/ACTIVE	980 GRANT STREET BUFFALO NY 14207	0.06 NW	194
48	FINDS	G and G MART 110028215820/FRS	1531-1543 NIAGARA STREET BUFFALO NY 14213	0.06 SE	196
48	LUST	G and G PETROLEUM 9400660/ACTIVE	1543 NIAGARA STREET BUFFALO NY 14213	0.06 SE	197
48	LUST	SUNOCO - G and G PETROLEUM 9700094/CLOSED	NIAGARA STREET BUFFALO NY 14213	0.06 SE	200
48	SPILLS	G and G SUNOCO 9415155/CLOSED	1543 NIAGARA STREET BUFFALO NY 14213	0.06 SE	202
48	SPILLS	SUNOCO - G and G PETROLEUM 9700094/CLOSED	NIAGARA STREET BUFFALO NY 14213	0.06 SE	204
48	SPILLS	G and G PETROLEUM 9400660/ACTIVE	1543 NIAGARA STREET BUFFALO NY 14213	0.06 SE	206
48	SPILLS	G and G PETROLIUM 0110881/CLOSED	1543 NIARAGA ST BUFFALO NY 14213	0.06 SE	209
48	SPILLS80	VINNIES GULF SERVICE 8810060/CLOSED	1543 NIAGARA STREET BUFFALO NY 14213	0.06 SE	211
48	UST	G and G PETROLEUM PBS9-222658/ACTIVE	1531-1543 NIAGARA BUFFALO NY 14213	0.06 SE	212
53	SPILLS	NIMO-TRANSFORMER 0102953/CLOSED	215 NOTTINGHAM TERR BUFFALO NY 14216	0.07 NW	215
55	UST	2000 DELAWARE APARTMENTS PBS9-600814/UNREGISTERED	1960-2000 DELAWARE AVE BUFFALO NY 14216	0.07 NW	217
51	FINDS	VOLLAND ELECTRIC EQUIP CORP 110004339412/FRS	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	220
54	FINDS	BUFFALO TRANSFORMER CORP NYD013708359	1507 NIAGARA ST BUFFALO NY 14213	0.07 SE	222

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
51	FINDS	BUFFALO TRANSFORMER CO 110011757893/FRS	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	223
54	FINDS	BUFFALO TRANSFORMER CORP 110004350103/FRS	1507 NIAGARA ST BUFFALO NY 14213	0.07 SE	225
51	FINDS	VOLLAND ELECTRIC EQUIP CORP NYD002130060	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	227
51	NCDB	BUFFALO TRANSFORMER CO NCDB-0801-009126/TSCA	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	228
51	NCDB	VOLLARD ELECTRICAL EQUIPMENT CORP NCDB-0104-001476/TSCA	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	230
51	NCDB	VOLLARD ELECTRICAL EQUIPMENT CORP NCDB-198010221019/TSCA	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	231
54	RCRAGN	BUFFALO TRANSFORMER CORP NYD013708359/VGN	1507 NIAGARA ST BUFFALO NY 14213	0.07 SE	232
51	RCRANLR	VOLLAND ELECTRIC EQUIP CORP NYD002130060/NLR	1511 NIAGARA ST BUFFALO NY 14213	0.07 SE	233
52	LUST	CANISIUS COL. BOSCH HALL 0475017/CLOSED	EASTWOOD PLACE BUFFALO NY 14208	0.07 SW	235
52	SPILLS	CANISIUS COL. BOSCH HALL 0475017/CLOSED	EASTWOOD PLACE BUFFALO NY 14208	0.07 SW	236
57	AIRS	SISTERS OF CHARITY HOSPITAL NY0008030/AIRS DATABASE	2157 MAIN ST BUFFALO NY 14214	0.08 NE	238
57	FINDS	SISTERS OF CHARITY HOSPITAL NYD156390890	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	238
57	FINDS	SISTERS HOSPITAL 110001568465/FRS	2157 MAIN ST BUFFALO NY 14214	0.08 NE	239
57	HMIRS	CONSOLIDATED FRGHTWYS CORP DEL 1996040614/HIGHWAY (FOR HIRE)	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	241
57	LUST	SISTER S HOSPITAL 8705066/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	244
57	LUST	SISTERS HOSPITAL 9208731/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	246
57	LUST	SISTERS HOSPITAL 9205780/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	247
57	RCRAGN	SISTERS OF CHARITY HOSPITAL NYD156390890/SGN	2157 MAIN ST BUFFALO NY 14214	0.08 NE	248
57	SPILLS	SISTERS HOSPITAL 9208731/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	249
57	SPILLS	SISTERS HOSPITAL 9205780/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	251

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
57	SPILLS	SISTERS HOSPITAL 9608662/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	253
57	SPILLS80	SISTER S HOSPITAL 8705066/CLOSED	2157 MAIN STREET BUFFALO NY 14214	0.08 NE	255
57	UST	SISTERS OF CHARITY HOSPITAL PBS9-383252/ACTIVE	2157 MAIN ST BUFFALO NY 14214	0.08 NE	256
58	SPILLS	NIMO-POLE TRANSFORMER 0102941/CLOSED	232 LINCOLN PARKWAY BUFFALO NY 14216	0.08 NW	259
59	SPILLS	SOOT IN MADORE HOME 0075613/CLOSED	1966 DELAWARE AVE. APT 1 BUFFALO NY 14216	0.08 NW	261
56	SPILLS80	OIL IN SCAJAQUADA CREEK 8907953/CLOSED	TONAWANDA AND WEST STREET BUFFALO NY 14207	0.08 NW	263
60	DOCKET	S.A. DAY MFG. CO. INC. 02-2004-4202/ICIS	1489 NIAGARA STREET BUFFALO NY 14213	0.08 SE	264
60	FINDS	S A DAY MANUFACTURING 110017770697/FRS	1489 NIAGARA STREET BUFFALO NY 14213	0.08 SE	265
60	FINDS	S A DAY MANUFACTURING 110019426352/FRS	1489 NIAGARA ST BUFFALO NY 14213	0.08 SE	267
61	FINDS	DAY S A MFG CO NYD002110815	1483-85 NIAGARA ST BUFFALO NY 14213	0.08 SE	269
60	HMIRS	HUNT J B SPECIAL COMMODITIES I 1993090891/HIGHWAY (FOR HIRE)	1489 NIAGRA BUFFALO NY 14213	0.08 SE	270
61	RCRANLR	DAY S A MANUFACTURING CO NYD002110815/NLR	1483-85 NIAGARA ST BUFFALO NY 14213	0.08 SE	273
60	TRIS	S.A. DAY MANUFACTURING CO INC 14213SDYMF1489N/OPEN	1489 NIAGARA ST BUFFALO NY 14213	0.08 SE	274
63	SWL	SQUAW ISLAND SLF 9-15T07/INACTIVE	NIAGARA STREET BUFFALO NY 14206	0.08 SW	276
62	SWL	SQUAW ISLAND SLF 9-15Y17/INACTIVE	NIAGARA STREET BUFFALO NY 14202	0.08 SW	278
66	RCRAGN	NYSDOT BIN 103989B - D123456 NYR000127720/LGN	SCAJAQUADA CRK EXPWY I-190 BUFFALO NY 14207	0.09 NW	279
67	SPILLS	SCHOOL HOUSE COMMONS 0275096/CLOSED	1005 GRANT ST. BUFFALO NY 14207	0.09 NW	280
64	FINDS	NATL FUEL GAS - SCAJAQUADA CR NY0002421352	100 A FOREST AVE BUFFALO NY 14213	0.09 SE	282
64	FINDS	WESTWOOD SQUIBB PHARMACEUTICALS IN 110000327058/FRS	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	283
64	FINDS	SCAJAQUADA CREEK 110019388777/FRS	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	286

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
64	FINDS	WESTWOOD PHARMACEUTICALS NYD986930758	100 FOREST AVE BUFFALO NY 14213	0.09 SE	287
64	FINDS	NATIONAL FUEL GAS - SCAJAQUADA CRE 110004456044/FRS	100-A FOREST AVE BUFFALO NY 14213	0.09 SE	288
64	LUST	BRISTOL-MEYER-SQUIBB 0550407/CLOSED	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	290
64	RCRAGN	NATIONAL FUEL GAS - SCAJAQUADA CRE NYD986930758/SGN	100-A FOREST AVE BUFFALO NY 14213	0.09 SE	291
64	RCRAGN	CONTRACT PHARMACEUTICALS LTD NIAGA NYR000135780/LGN	100 FOREST AVE BUFFALO NY 14213	0.09 SE	293
64	RCRANLR	NATIONAL FUEL GAS - SCAJAQUADA CR NYD986930758/NLR	100-A FOREST AVE BUFFALO NY 14213	0.09 SE	295
64	SPILLS	BRISTOL-MEYER-SQUIBB 0550407/CLOSED	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	296
64	SPILLS	TRUCK AT WESTWOOD SQUIBB 9800516/CLOSED	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	298
64	TRIS	WESTWOOD-SQUIBB NYD986930758/OPEN	100 FOREST AVE. BUFFALO NY 14213	0.09 SE	300
64	TRIS	CONTRACT PHARMACEUTICALS LTD NIAGA 14213WSTWD100FO/OPEN	100 FOREST AVE BUFFALO NY 14213	0.09 SE	301
65	UST	BUFFALO STRUCTURAL STEEL PBS9-446939/ACTIVE	166 DART ST. BUFFALO NY 14213	0.09 SE	304
64	UST	WESTWOOD-SQUIBB PHARMACEUTICALS CBS9-000336/UNREGULATED	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	307
64	UST	CONTRACT PHARMACEUTICALS LIMITED N PBS9-027766/ACTIVE	100 FOREST AVENUE BUFFALO NY 14213	0.09 SE	308
69	AIRS	FEDCO AUTOMOTIVE COMPONENTS COMPAN NY0090691/AIRS DATABASE	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	311
69	DOCKET	FEDDERS AUTOMOTIVE COMPONENTS CO 02-1989-0103/ICIS	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	312
69	ERNS	184750/HIGHWAY RELATED	57 TONAWANDA ST. BUFFALO NY 14207	0.10 NW	313
69	FINDS	FEDCO AUTOMOTIVE COMPONENTS NY0000968867	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	314
69	FINDS	FEDDERS AUTOMOTIVE COMPONENTS NYD002115087	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	315
69	FINDS	FEDDERS AUTOMOTIVE CO 110000326898/FRS	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	316
69	NCDB	FEDCO AUTOMOTIVE COMPONENTS NCDB-0801-007259/EPCRA	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	319

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
69	NFRAP	FEDDERS AUTO CO NYD002115087/NFRAP-N	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	321
69	RCRAGN	FEDCO AUTOMOTIVE COMPONENTS CO NYD002115087/SGN	57 TONAWANDA ST BUFFALO NY 14207	0.10 NW	322
69	RCRANLR	GO/DAN INDUSTRIES INC NYD002115087/NLR	TONAWANDA ST BUFFALO NY 14207	0.10 NW	325
69	SPILLS	FEDCO AUTOMOTIVE COMPONEN 9975208/CLOSED	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	327
69	SPILLS80	FEDDER CORPORATION 8809528/CLOSED	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	329
69	STATE	FEDDERS AUTO COMPONENTS 915024	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	330
69	TRIS	FEDCO AUTOMOTIVE COMPONENTS CO. 14207FDCTM57TON/OPEN	57 TONAWANDA ST. BUFFALO NY 14207	0.10 NW	332
69	TRIS	FEDCO AUTOMOTIVE COMPONENTS NYD002115087/OPEN	57 TONAWANDA ST. BUFFALO NY 14207	0.10 NW	335
69	UST	FEDCO AUTOMOTIVE COMPONENTS CO. CBS9-000207/UNREGULATED	57 TONAWANDA ST. BUFFALO NY 14207	0.10 NW	336
69	UST	FEDCO AUTOMOTIVE COMPONENTS CO PBS9-448249/UNREGULATED	57 TONAWANDA STREET BUFFALO NY 14207	0.10 NW	339
70	SPILLS	RUAN TRANSPORT TRUCK 9707480/CLOSED	175 DART STREET BUFFALO NY 14213	0.10 SE	341
68	AIRS	BUFFALO STATE COLLEGE NY0007973/AIRS DATABASE	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	343
68	ERNS	BUFFALO STATE COLLEGE 641645/UNDERGROUND STORAGE	1300 ELMWOOD AVE CORNER OF BUFFALO NY 14222	0.10 SW	344
68	ERNS	BUFFALO STATE COLLEGE 640339/FIXED FACILITY	1300 ELMWOOD AVE CORNER OF BUFFALO NY 14222	0.10 SW	345
68	FINDS	ST UNIV-COLLEGE AT BUFFALO 110000880299/FRS	1300 ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	346
68	FINDS	STATE UNIVERSITY OF NY- BUFFALO(JT 110016839616/FRS	BUFFALO NY 14222	0.10 SW	349
68	FINDS	STATE UNIVERSITY COLLEGE AT BUFFAL NYD071486211	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	351
68	FINDS	CAMPUS WEST SCHOOL 110021748037/FRS	BUFFALO NY 14222	0.10 SW	352
68	FINDS	STATE UNIVERSITY OF NY- BUFFALO(JT 110016839607/FRS	BUFFALO NY 14222	0.10 SW	353
68	FINDS	STATE UNIVERSITY OF NY- BUFFALO(JT 110016839625/FRS	BUFFALO NY 14222	0.10 SW	355

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
68	LUST	BUFFALO STATE COLLEGE 9975398/CLOSED	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	357
68	LUST	BUFFALO STATE COLLEGE/NYS 9310026/CLOSED	ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	359
68	LUST	SUNY COLLEGE 9902022/CLOSED	1300 ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	360
68	LUST	BUFFALO STATE COLLEGE 8911283/CLOSED	ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	361
68	RCRAGN	STATE UNIVERSITY COLLEGE AT BUFFAL NYD071486211/LGN	ELMWOOD AVE BUFFALO NY 14222	0.10 SW	362
68	SPILLS	SUNY COLLEGE 9902022/CLOSED	1300 ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	364
68	SPILLS	SUNY COLLEGE 8911892/CLOSED	1300 ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	366
68	SPILLS	NEW BUILDING CONSTRUCTION AREA 0751064/ACTIVE	1300 ELMWOOD AVENUE BUFFALO NY 14213	0.10 SW	368
68	SPILLS	BUFFALO STATE COLLEGE 9975398/CLOSED	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	370
68	SPILLS	BUFFALO STATE COLLEGE/NYS 9310026/CLOSED	ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	372
68	SPILLS	BUFFALO STATE COLLEGE 0750778/CLOSED	1300 ELMWOOD AVE MOORE WEST BUFFALO NY 14213	0.10 SW	374
68	SPILLS	BUFFALO STATE COLLEGE 9906828/CLOSED	1300 ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	376
68	SPILLS	BUFFALO STATE COLLEGE 8911283/CLOSED	ELMWOOD AVENUE BUFFALO NY 14222	0.10 SW	378
68	SPILLS	BUFFALO STATE-UPTON HALL 0175417/CLOSED	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	380
68	SPILLS80	BUFFALO STATE COLLEGE 8605107/CLOSED	BUFFALO STATE COLLEGE BUFFALO NY 14222	0.10 SW	382
68	UST	BUFFALO STATE COLLEGE (SUNY) PBS9-049115/ACTIVE	1300 ELMWOOD AVE BUFFALO NY 14222	0.10 SW	383
75	HOSPITAL	SISTERS HOSPITAL NY-102984	NY	0.11 NE	386
76	SPILLS	ROADSIDE CONTAINER 0375104/CLOSED	5 NOTTINGHAM AMHERST BUFFALO NY 14216	0.11 NE	387
72	AIRS	FORMER PRATT AND LAMBERT FACILITY NY0008021/AIRS DATABASE	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	389
72	ERNS	LEHIGH CONSTRUCTION 396919/UNKNOWN	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	389

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
72	FINDS	PRATT and LAMBERT NYD002113322	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	390
72	FINDS	FORMER PRATT AND LAMBERT FACILITY 110000881109/FRS	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	391
72	LUST	PRATT AND LAMBERT 8908237/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	394
72	LUST	PRATT and LAMBERT 8707798/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	396
72	RCRA	PRATT and LAMBERT INC NYD002113322/TSD	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	397
72	RCRACOR	PRATT and LAMBERT INC NYD002113322/CA	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	398
72	RCRAGN	PRATT and LAMBERT INC NYD002113322/LGN	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	401
72	RELEASES	LEHIGH CONSTRUCTION 396919/FIXED FACILITY	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	402
72	SPILLS	PRATT and LAMBERT 9406685/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	403
72	SPILLS80	PRATT AND LAMBERT 8603542/CLOSED	NIAGARA STREET BUFFALO NY 14207	0.11 NW	404
72	SPILLS80	PRATT and LAMBERT 8603159/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	405
72	SPILLS80	PRATT and LAMBERT 8707798/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	406
72	SPILLS80	PRATT AND LAMBERT 8908237/CLOSED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	407
72	SPILLS80	PRATT AND LAMBERT 8701339/CLOSED	TONAWANDA STREET BUFFALO NY 14207	0.11 NW	408
72	TRIS	PRATT and LAMBERT UNITED INC. NYD002113322/OPEN	75 TONAWANDA ST. BUFFALO NY 14207	0.11 NW	409
72	TRIS	PRATT and LAMBERT UNITED INC. 14207PRTTL75TON/OPEN	75 TONAWANDA ST. BUFFALO NY 14207	0.11 NW	410
72	UST	PRATT and LAMBERT INC PBS9-079316/UNREGULATED	75 TONAWANDA ST BUFFALO NY 14207	0.11 NW	413
72	UST	PRATT and LAMBERT, INC. CBS9-000142/UNREGULATED	75 TONAWANDA STREET BUFFALO NY 14207	0.11 NW	416
74	FINDS	WESTWOOD PHARMACEUTICALS INC NYD048391080	468 DEWITT ST BUFFALO NY 14213	0.11 SE	419
73	FINDS	BUFFALO CITY OF - VACANT LOT 413 E 110004511724/FRS	413 E DELAVAN AVE - VACANT BUFFALO NY 14211	0.11 SE	420

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
71	FINDS	PINTO EQUIPMENT RENTAL INC NYD074009382	66 BIRD AVE BUFFALO NY 14213	0.11 SE	421
71	FINDS	PINTO EQUIPMENT RENTAL INC 110004368069/FRS	66 BIRD AVE BUFFALO NY 14213	0.11 SE	422
73	FINDS	BUFFALO CITY OF - VACANT LOT 413 E NY0001177286	413 E DELAVAN AVE - VACANT BUFFALO NY 14211	0.11 SE	423
74	RCRAGN	WESTWOOD-SQUIBB PHARMACEUTICALS IN NYD048391080/LGN	468 DEWITT ST BUFFALO NY 14213	0.11 SE	424
71	RCRAGN	PINTO EQUIPMENT RENTAL INC NYD074009382/TRANSPORTER	66 BIRD AVE BUFFALO NY 14213	0.11 SE	426
73	RCRANLR	BUFFALO CITY OF - VACANT LOT 413 E NYR000001453/NLR	413 E DELAVAN AVE - VACANT BUFFALO NY 14211	0.11 SE	427
77	SPILLS	JUNKYARD 0485102/CLOSED	NIAGARA and POTOMAC BUFFALO NY 14213	0.11 SE	428
71	SPILLS	AUTO RECOVERY SHOP 0650077/CLOSED	66 BIRD AVE BUFFALO NY 14213	0.11 SE	430
82	SCHOOL	STATE UNIVERSITY AT BUFFALO SCHOOL NY-103087	NY	0.12 NE	432
81	SPILLS	ABANDONED DRUMS ON RR 9501120/CLOSED	76 TONAWANDA STREET BUFFALO NY 14207	0.12 NW	433
78	FINDS	METAL BINDING INC 110017246425/FRS	1340 WEST AVE BUFFALO NY 14213	0.12 SE	435
79	FINDS	RUSLANDER and SONS 110001569794/FRS	18 LETCHWORTH ST BUFFALO NY 14213	0.12 SE	437
79	FINDS	RUSLANDER and SONS INC NYD002105666	18 LETCHWORTH BUFFALO NY 14213	0.12 SE	439
80	INSTCONTROL	IROQUOIS GAS/WESTWOOD PHARM. TERRE DART STREET 915141A/INSTITUTIONAL CONTRO	BUFFALO NY 14213	0.12 SE	440
79	RCRAGN	RUSLANDER and SONS INC NYD002105666/SGN	18 LETCHWORTH BUFFALO NY 14213	0.12 SE	442
78	RCRANLR	METAL BINDING INC NYN008013484/NLR	1340 WEST AVE BUFFALO NY 14213	0.12 SE	444
78	RCRANLR	METAL BINDING INC NYP000945006/NLR	1340 WEST AVE BUFFALO NY 14213	0.12 SE	445
78	SPILLS	METAL BINDING INC 9975145/CLOSED	1340 WEST AVENUE BUFFALO NY 14213	0.12 SE	446
80	STATE	IROQUOIS GAS/WESTWOOD PHARM. TERRE DART STREET 915141A	BUFFALO NY 14213	0.12 SE	449
80	STATE	IROQUOIS GAS/WESTWOOD PHARM. RIPAR 915141B	SCAJAQUADA CREEK, UPSTREAM BUFFALO NY 14213	0.12 SE	451

***Environmental FirstSearch
Sites Summary Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
80	STATE	IROQUOIS GAS/WESTWOOD PHARMACEUTIC 915141	DART STREET BUFFALO NY 14213	0.12 SE	453

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	CERCLIS	202 WALDEN AVENUE SITE NYN000206204/NOT PROPOSED	202 WALDEN AVENUE BUFFALO NY 14211	NON GC	N/A
	CERCLIS	MARLETTE PLATING NYN000206213/NOT PROPOSED	25 RANO STREET BUFFALO NY 14216	NON GC	N/A
	ERNS	CSX RAIL ROAD NRC-805180/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	NRC-598687/RAILROAD NON-RELEASE	N/A BUFFALO NY	NON GC	N/A
	ERNS	BUFFALO TO SYRACUSE PIPELINE NRC-700739/PIPELINE	BUFFALO NY	NON GC	N/A
	ERNS	COUNTY LINE ROAD NRC-791055/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	221664/UNKNOWN	IN THE SHIP CANAL AND IN TH BUFFALO NY	NON GC	N/A
	ERNS	NIAGRA MOWHAWK POWER 296882/FIXED FACILITY	POLE NO.72 CHANDLER ST BUFFALO NY 14207	NON GC	N/A
	ERNS	228451/UNKNOWN	BUFFALO SHIP CANAL BUFFALO NY	NON GC	N/A
	ERNS	239679/UNKNOWN	BUFFALO RIVER BUFFALO NY	NON GC	N/A
	ERNS	336623/UNKNOWN	BLACK ROCK CANAL BUFFALO NY	NON GC	N/A
	ERNS	342873/UNKNOWN	LITTLE NIAGRA RIVER BUFFALO NY	NON GC	N/A
	ERNS	NRC-648624/RAILROAD	NEAR LAKE AVE BUFFALO NY	NON GC	N/A
	ERNS	458315/UNKNOWN	7BUFFALO RIVER BUFFALO NY	NON GC	N/A
	ERNS	BUFFALO TERMINAL SUBDIVISION NRC-785974/RAILROAD NON-RELEASE	MILEPOST QD2 BUFFALO NY	NON GC	N/A
	ERNS	NRC-849320/MOBILE	1800 BLOCK OF SOUTH PARK AV BUFFALO NY	NON GC	N/A
	ERNS	NRC-851958/MOBILE	190 SOUTH BOUND NIAGRA ST. BUFFALO NY	NON GC	N/A
	ERNS	CSX MILE POST QDN4 NRC-751329/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	UNKNOWN 235502/UNKNOWN	GENESSE RIVER BUFFALO NY	NON GC	N/A
	ERNS	TRANSFER YARD NRC-820582/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	ERNS	MILE POST 6.36 NRC-801949/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	LEAD TRACK NRC-565082/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	INTERSTATE 190 MILE POST 4 NORTHBO NRC-713050/MOBILE	BUFFALO NY	NON GC	N/A
	ERNS	INTERNATIONAL RAILROAD BRIDGE NRC-851221/RAILROAD	INTERNATIONAL RR BRIDGE BLA BUFFALO NY	NON GC	N/A
	ERNS	HARRISBURG SUBDIVISION, MILEPOST S NRC-642313/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	HARRISBURG DIVISION / IN RAILYARD NRC-657054/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	CSX RAILROAD / MILE 16.51 / NIAGRA NRC-793434/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	NRC-820506/RAILROAD NON-RELEASE	UNION ROAD BUFFALO NY	NON GC	N/A
	ERNS	MILE POST QDN3.4 NRC-645465/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	CG MSO BUFFALO 515378/UNKNOWN	SMOKES CREEK BUFFALO NY	NON GC	N/A
	ERNS	BEST WAY INDUSTRY, TRACK 4 NRC-637126/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	MILE POST QC 434.5 NRC-772147/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	MILE QC434 / BUFFALO TERMINAL NRC-780716/MOBILE	BUFFALO NY	NON GC	N/A
	ERNS	MP QC 434.5 NRC-772140/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	MP: QRN 2.1 NRC-725563/RAILROAD NON-RELEASE	NEAR EXCHANGE ST STATION BUFFALO NY	NON GC	N/A
	ERNS	MP: SR419 NRC-843882/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	NIAGARA BRANCH NRC-798973/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	NIAGRA RIVER NRC-858144/MOBILE	NEAR SQA W ISLAND BUFFALO NY	NON GC	N/A
	ERNS	NORFOLK SOUTHERN RAILROAD NRC-799746/RAILROAD	BUFFALO NY	NON GC	N/A
	ERNS	ON THE MAIN LINE NRC-816278/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	ERNS	RAIL YARD NRC-854779/RAILROAD	MILEPOST: N0003 SUBDIVISION BUFFALO NY	NON GC	N/A
	ERNS	SOUTH PARK FINANCE STATION NRC-724676/RAILROAD	MILEPOST B4.0 BUFFALO NY	NON GC	N/A
	ERNS	TUTTLE TRUCKING 280340/UNKNOWN	I-190 BUFFALO NY 14207	NON GC	N/A
	ERNS	UNKNOWN 235344/UNKNOWN	ONTARIO STREET BUFFALO NY 14207	NON GC	N/A
	ERNS	TRANSTAR/PROLINE CARRIERS 504274/PLATFORM	FOURGERSON ST BUFFALO NY 14211	NON GC	N/A
	ERNS	NIAGARA MOHAWK POWER CO 291464/FIXED FACILITY	FULTON STREET BUFFALO NY 14214	NON GC	N/A
	ERNS	BUFFALO RAIL YARD NRC-766583/RAILROAD NON-RELEASE	BUFFALO NY	NON GC	N/A
	ERNS	SEE BELOW NRC-843828/VESSEL	BUFFALO NY	NON GC	N/A
	FED IC / EC	FOURTH STREET 54500924-37/EPA BROWNFIELD	FOURTH ST. BUFFALO NY	NON GC	N/A
	FED IC / EC	COLD SPRINGS NEIGHBORHOOD 54500924-63/EPA BROWNFIELD	BUFFALO NY	NON GC	N/A
	FED IC / EC	452 NORTHUMBERLAND 54500924-32/EPA BROWNFIELD	452 NORTHUMBERLAND BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 21 110026502452/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 22 110025931151/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 25 110026870429/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 26 110026347399/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 27 110026555895/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 2 110026347175/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 3 110026169919/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 30 110025944548/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 31 110026594442/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 34 110026594549/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 29 110025756411/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 19 110026161980/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 18 110026161882/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 18 110025571307/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MP N6.6-N10.8 110019399097/FRS	NIAGARA SECTION OF NYS THRU BUFFALO NY	NON GC	N/A
	FINDS	MOUNT SAINT MARYS ACADEMY 110025742392/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MOUNT SAINT JOSEPHS ACADEMY 110026001341/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MCMAHON HIGH SCHOOL 110025568124/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 36 110025489433/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 48 110025853627/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MEYERS CHEMICALS, INC. 110011785381/FRS	MAIN ST BUFFALO NY	NON GC	N/A
	FINDS	MOBIL PIPE LINE 110019346126/FRS	BUFFALO TO BATAVIA BUFFALO NY	NON GC	N/A
	FINDS	MOTHER OF DIVINE GRACE SCHOOL 110025577285/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MOUNT MERCY ACADEMY 110025742310/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 17 110025563218/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 48 110025853654/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MCKINLEY SCHOOL 110026001010/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 57 110026594754/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 59 110025855144/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 6 110025855304/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 60 110026170738/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 61 110025862939/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 54 110026894216/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 62 110025863153/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 52 110026503380/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 51 110026170612/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 45 110026170284/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 5 110026594727/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 37 110025489558/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BELLWOOD SCHOOL 110026376650/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 47 110026503291/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 44 110026594674/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 43 110026347674/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 42 110026170257/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 41 110026503228/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 40 110026817666/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 4 110026347576/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 4 110025489781/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 39 110026347479/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 38 110025913858/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 50 110025854083/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BLESSED TRINITY SCHOOL 110027031030/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BETHLEHEM PARK SCHOOL 110026376776/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CARROL HIGH SCHOOL 110025519348/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CANISIUS COLLEGE 110025519026/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CABLE - BLACK ROCK CANAL 110019467316/FRS	FOOT OF WEST FERRY ST BUFFALO NY	NON GC	N/A
	FINDS	BURGARD HIGH SCHOOL 110026377123/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO, NY 110015344064/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO SEWER AUTHORITY PROPERTY 110019490549/FRS	VICINITY OF POTOMAC AND BIR BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO SEMINARY 110027021185/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO RIVER HABITAT OHIO STREET 110019545697/FRS	OHIO ST BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO RIVER - SMITH ST 110019545759/FRS	SMITH ST BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO AND PITTSBURGH RAILROAD SI 110019543877/FRS	HOPKINS AND TIFFT BUFFALO NY	NON GC	N/A
	FINDS	CLEVELAND HILL SCHOOL 110026971533/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BOYS VOCATIONAL HIGH SCHOOL 110025973757/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CLEVELAND HILL SOUTH SCHOOL 110025932873/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BLESSED SACRAMENT SCHOOL 110025502043/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BLACK ROCK CANAL 110019613809/FRS	FOOT OF PORTER AVE and BLAC BUFFALO NY	NON GC	N/A
	FINDS	BETSY ROSS SCHOOL 110025953911/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	BENNETT HIGH SCHOOL 110025953608/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ANNUNCIATION SCHOOL 110025940374/FRS	BUFFALO NY	NON GC	N/A
	FINDS	AMHERST HIGH SCHOOL 110025835746/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ALL SAINTS SCHOOL 110025939849/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ALEXANDER SCHOOL 110025939661/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ADDAMS SCHOOL 110025939091/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 56 110025854788/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 63 110025738138/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BRIGHTON SCHOOL 110025974051/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HOLY CROSS SCHOOL 110025655397/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MARYVALE JUNIOR-SENIOR HIGH SCHOOL 110026073683/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MARTIN LUTHER SCHOOL 110025847467/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MAPLEMERE SCHOOL 110026863428/FRS	BUFFALO NY	NON GC	N/A
	FINDS	MACHNICA COMMUNITY CENTER 110020916473/FRS	1799 CLINTON S BUFFALO NY	NON GC	N/A
	FINDS	INFANT OF PRAGUE SCHOOL 110025656724/FRS	BUFFALO NY	NON GC	N/A
	FINDS	INDUSTRIAL SCHOOL 110026793780/FRS	BUFFALO NY	NON GC	N/A
	FINDS	IMMACULATE CONCEPTION SCHOOL 110025991489/FRS	BUFFALO NY	NON GC	N/A
	FINDS	IMMACULATA ACADEMY 110025656467/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HUTCHINSON HIGH SCHOOL 110025963296/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HORACE MANN SCHOOL 110025655985/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	HOLY NAME SCHOOL 110025963036/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CHEEKTOWAGA CENTRAL HIGH SCHOOL 110025545989/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HOLY FAMILY CHURCH 110020928558/FRS	920 TIFFT STREET BUFFALO NY	NON GC	N/A
	FINDS	MARYVALE SCHOOL 110026000976/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HOLY ANGELS ACADEMY 110025655342/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HEBREW ACADEMY 110025633704/FRS	BUFFALO NY	NON GC	N/A
	FINDS	GENESSE HUMBOLDT JUNIOR HIGH SCHOO 110025832552/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FROST SCHOOL 110025707803/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FRONTIER HIGH SCHOOL 110025707741/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CONCRETE RECYCLING CORP 110019294574/FRS	N/A BUFFALO NY	NON GC	N/A
	FINDS	COLTON HIGH SCHOOL 110026890844/FRS	BUFFALO NY	NON GC	N/A
	FINDS	COLD SPRINGS NEIGHBORHOOD 110025272318/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CLINTON SCHOOL 110026770867/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CLINTON JUNIOR HIGH SCHOOL 110026770821/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CLEVELAND SCHOOL 110025554629/FRS	BUFFALO NY	NON GC	N/A
	FINDS	HOLY FAMILY SCHOOL 110025708394/FRS	BUFFALO NY	NON GC	N/A
	FINDS	RAW WATER INTAKE 110019595847/FRS	N/A BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 80 110025875088/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 81 110025875186/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 82 110027078481/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 83 110025756956/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 84 110025875300/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 86 110026196952/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 88 110026197032/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 9 110026894519/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT JOHNS SCHOOL 110026195356/FRS	BUFFALO NY	NON GC	N/A
	FINDS	QUEEN OF PEACE SCHOOL 110026197158/FRS	BUFFALO NY	NON GC	N/A
	FINDS	BUFFALO CITY OF DPW PARKS and STRE 110014448268/FRS	MLK GREENHOUSE - HUMBOLDT P BUFFALO NY 14211	NON GC	N/A
	FINDS	RIVERMIST DEVELOPMENT 110019520311/FRS	RIVERMIST DR and OJIBWA CIR BUFFALO NY	NON GC	N/A
	FINDS	RIVERSIDE ACCESS ROAD 110019520918/FRS	FOOT OF ONTARIO STREET BUFFALO NY	NON GC	N/A
	FINDS	RIVERSIDE HIGH SCHOOL 110025508332/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT ELIZABETHS SCHOOL 110026895313/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT FRANCIS OF ASSISI SCHOOL 110025946001/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT FRANCIS SCHOOL 110026414592/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT FRANCIS SCHOOL 110026414636/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT GUALBERTS SCHOOL 110025946305/FRS	BUFFALO NY	NON GC	N/A
	FINDS	TEMPLE BETH-EL SCHOOL 110025610907/FRS	BUFFALO NY	NON GC	N/A
	FINDS	QUEEN OF MARTYRS SCHOOL 110025876210/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SCAJAQUADA PATHWAY PHASE II 110019388839/FRS	SCAJAQUADA CREEK WEST OF GR BUFFALO NY 14207	NON GC	N/A
	FINDS	TEMPLE BETH-ZION SCHOOL 110026119616/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	TOPS GRANT/AMHERST SUPERMARKET 110019730264/FRS	SOUTHWEST CORNER AMHERST an BUFFALO NY	NON GC	N/A
	FINDS	TURNER HIGH SCHOOL 110025645559/FRS	BUFFALO NY	NON GC	N/A
	FINDS	UNION FREE SCHOOL 110026870795/FRS	BUFFALO NY	NON GC	N/A
	FINDS	UNION ROAD SCHOOL 110026403309/FRS	BUFFALO NY	NON GC	N/A
	FINDS	VIRGIN MARY SCHOOL 110025889527/FRS	BUFFALO NY	NON GC	N/A
	FINDS	VISITATION SCHOOL 110025889616/FRS	BUFFALO NY	NON GC	N/A
	FINDS	WASHINGTON SCHOOL 110026120819/FRS	BUFFALO NY	NON GC	N/A
	FINDS	WASHINGTON SCHOOL 110026403915/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ELLCOTT CREEK AERO DR 110019180036/FRS	AERO DRIVE INTERSECTION OF CHEEKTOWAGA NY 14211	NON GC	N/A
	FINDS	WINDOM SCHOOL 110025540813/FRS	3870 SHELDON RD BUFFALO NY	NON GC	N/A
	FINDS	CHEEKTOWAGA MS4 STORM SEWERS 110019303742/FRS	TOWN-WIDE CHEEKTOWAGA NY 14211	NON GC	N/A
	FINDS	USARMY AFPLT NO 18 NY0001029529	ERIE BUFFALO NY 14207	NON GC	N/A
	FINDS	USCG-REAR LIGHT STRWBRY ISL NY9690312807	FULLER STREET BUFFALO NY 14207	NON GC	N/A
	FINDS	NIAGARA MOHAWK STA 171 NYD981486392	RIDGE RD N/O WILSON - BURT BURT NY 14208	NON GC	N/A
	FINDS	FOLLOW-THROUGH URBAN LEARNING LABO 110021563805/FRS	BUFFALO NY 14209	NON GC	N/A
	FINDS	NYSDOT BIN 1022670 NYD987008323	EB RAMP OVER RTE 33 BUFFALO NY 14209	NON GC	N/A
	FINDS	NYSDOT BIN 1022670 110008077197/FRS	EB RAMP OVER RTE 33 BUFFALO NY 14209	NON GC	N/A
	FINDS	THE KISSLING INTERESTS, LLC-1290-1 110022863481/FRS	1310 DELAWARE AVE. BUFFALO NY 14209	NON GC	N/A
	FINDS	218 ORLANDO - AMIRS VISION, INC. 110022880649/FRS	218 ORLANDO STREET BUFFALO NY 14211	NON GC	N/A
	FINDS	SAINT JOHNS SCHOOL 110026414725/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	WILLIAMSVILLE SCHOOL 110026404148/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NYS THRUWAY AUTH BIN 5512679 NYD987028289	I-190 OVER SERVICE RD AT BUFFALO NY 14213	NON GC	N/A
	FINDS	110020815046/FRS	MUSEUM OF NAT SCIENCE HUMBO BUFFALO NY	NON GC	N/A
	FINDS	ASHLAND OIL INC. BUFFALO REF NYD005003264	STATION B, BOX F BUFFALO NY 14207	NON GC	N/A
	FINDS	BASF CORP 110029087333/FRS	380 VHIGAN ST BUFFALO NY 14207	NON GC	N/A
	FINDS	BUFFALO HARBOR AND TONAWANDA HARBO 110019491343/FRS	BUFFALO HARBOR - BLACK ROCK BUFFALO NY 14207	NON GC	N/A
	FINDS	D T E TONAWANDA LLC 110014359167/FRS	180 VAW-GM BLVD BUFFALO NY 14207	NON GC	N/A
	FINDS	NYSTA C O OAKGROVE CONSTRUCTION 110007989267/FRS	I-190 NIAGARA THRUWAY BUFFALO NY 14207	NON GC	N/A
	FINDS	NYSTA OAKGROVE CONST NY0000903120	I-190 NIAGARA THRUWAY BUFFALO NY 14207	NON GC	N/A
	FINDS	ROOSEVELT ACADEMY 110010614861/FRS	SKELLEN STREET BUFFALO NY 14207	NON GC	N/A
	FINDS	SAINT JAMES SCHOOL 110026414690/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NYS THRUWAY AUTH BIN 5512669 110008084713/FRS	I 190 OVER ERIE and BLACK R BUFFALO NY 14213	NON GC	N/A
	FINDS	WOODROW WILSON SCHOOL 110025549556/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NYS THRUWAY AUTH BIN 5512679 110004501003/FRS	I 190 OVER SERVICE RD AT BUFFALO NY 14213	NON GC	N/A
	FINDS	PEACE BRIDGE 110019733207/FRS	PEACE BRIDGE PLZ BUFFALO NY 14213	NON GC	N/A
	FINDS	USARMY STERLING ENGINE CO NY0001029537	ERIE BUFFALO NY 14213	NON GC	N/A
	FINDS	USEPA REGION II BUFFALO SEWER AUTH 110029026211/FRS	UNKNOWN BUFFALO NY 14213	NON GC	N/A
	FINDS	BUFFALO CITY OF PARKS DEPT NYD986975464	SCAJAQUADA EXPWY RTE 198 BUFFALO NY 14214	NON GC	N/A
	FINDS	BUFFALO CITY OF PARKS DEPT 110008068287/FRS	SCAJAQUADA EXPWY RTE 198 BUFFALO NY 14214	NON GC	N/A
	FINDS	YOUTH DEVEL CTR 110022220185/FRS	BUFFALO NY 14214	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 66 110025863484/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 53 110025737870/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NYS THRUWAY AUTH BIN 5512669 NYD987028271	I-190 OVER ERIE and BLACK R BUFFALO NY 14213	NON GC	N/A
	FINDS	SOUTH PARK SCHOOL 110025588102/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT JOHNS SCHOOL 110026195436/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT JOSAPHATS SCHOOL 110025947251/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT JOSEPHS COLLEGIATE INSTITUTE 110026414912/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT JOSEPHS SCHOOL 110027079104/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT LAWRENCE SCHOOL 110025958104/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT LEOS SCHOOL 110026415065/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT VALENTINES SCHOOL 110025909818/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT WILLIAMS SCHOOL 110025910030/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT XAVIER SCHOOL 110025910076/FRS	BUFFALO NY	NON GC	N/A
	FINDS	110020928549/FRS	ELMWOOD AVE.and CARLTON STR BUFFALO NY	NON GC	N/A
	FINDS	SENECA HIGH SCHOOL 110026870072/FRS	BUFFALO NY	NON GC	N/A
	FINDS	110020815019/FRS	TRAILER,185 DINGENS STREET BUFFALO NY	NON GC	N/A
	FINDS	SOUTHSIDE JUNIOR HIGH SCHOOL 110026665936/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SQUAW ISLAND 110019191328/FRS	BLACK ROCK CANAL BUFFALO NY	NON GC	N/A
	FINDS	SQUAW ISLAND COMPOSTING 110019191373/FRS	SQUAW ISLAND BUFFALO NY	NON GC	N/A
	FINDS	STATE UNIVERSITY AT BUFFALO 110026665981/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	STATE UNIVERSITY AT BUFFALO SCHOOL 110026666141/FRS	BUFFALO NY	NON GC	N/A
	FINDS	STATE UNIVERSITY COLLEGE 11002558816/FRS	BUFFALO NY	NON GC	N/A
	FINDS	WOODLAWN JUNIOR HIGH SCHOOL 110026414146/FRS	BUFFALO NY	NON GC	N/A
	FINDS	WOODLAWN SCHOOL 110025549486/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SHERIDAN SCHOOL 110025743480/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SCAJAQUADA CREEK DREDGING 110019388786/FRS	BETWEEN MIRROR LAKE AND HO BUFFALO NY	NON GC	N/A
	FINDS	OUR LADY OF LOURDES SCHOOL 110025843434/FRS	BUFFALO NY	NON GC	N/A
	FINDS	LANDSOWNE PADDLEWHEEL FERRY 110019589300/FRS	FOOT OF PORTER AVE BUFFALO NY	NON GC	N/A
	FINDS	LINCOLN SCHOOL 110026794529/FRS	BUFFALO NY	NON GC	N/A
	FINDS	LINDBERGH SCHOOL 110025767016/FRS	BUFFALO NY	NON GC	N/A
	FINDS	LONGFELLOW SCHOOL 110025939215/FRS	BUFFALO NY	NON GC	N/A
	FINDS	LOSSON ROAD SCHOOL 110025767640/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NARDIN SCHOOL 110025712628/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NICHOLS SCHOOL 110026554182/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NORTH HILL SCHOOL 110026001662/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NY TELEPHONE BLDG 110020928656/FRS	1861 S. PARK AVE BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 68 110025756778/FRS	BUFFALO NY	NON GC	N/A
	FINDS	O HERN HIGH SCHOOL 110025848331/FRS	BUFFALO NY	NON GC	N/A
	FINDS	KENSINGTON HIGH SCHOOL 110026794164/FRS	BUFFALO NY	NON GC	N/A
	FINDS	OUTER HARBOR 110019765770/FRS	FUHRMANN BLVD BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PARK SCHOOL 110025844512/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PARKSIDE SCHOOL 110025851460/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PINE HILL SCHOOL 110025674928/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 11 110026161588/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 12 110025539344/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 15 110025562415/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 16 110025562923/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 67 110026817862/FRS	BUFFALO NY	NON GC	N/A
	FINDS	NYSDOT BIN 1022650 NYD986948545	HUMBOLDT PKWY RTE 33 PED BUFFALO NY 14216	NON GC	N/A
	FINDS	FISHER SCHOOL 110025827979/FRS	BUFFALO NY	NON GC	N/A
	FINDS	CREA CONSTRUCTION 110020928576/FRS	276 HINMAN AVE. BUFFALO NY	NON GC	N/A
	FINDS	D YOUVILLE COLLEGE 110025892899/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SOUTH PARKWAY SCHOOL 110025588139/FRS	BUFFALO NY	NON GC	N/A
	FINDS	EAST HIGH SCHOOL 110025901424/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SWEET HOME JUNIOR HIGH SCHOOL 110025636783/FRS	BUFFALO NY	NON GC	N/A
	FINDS	EGGERT ROAD SCHOOL 110026972006/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ELMWOOD FRANKLIN SCHOOL 110026972079/FRS	BUFFALO NY	NON GC	N/A
	FINDS	EMERSON HIGH SCHOOL 110026897936/FRS	BUFFALO NY	NON GC	N/A
	FINDS	EXPWY YMCA 110020928610/FRS	260 EGGERT RD. BUFFALO NY	NON GC	N/A
	FINDS	LAFAYETTE HIGH SCHOOL 110026000388/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	FILLMORE JUNIOR HIGH SCHOOL 110027025323/FRS	BUFFALO NY	NON GC	N/A
	FINDS	LACKAWANNA HIGH SCHOOL 110025586612/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FOREST SCHOOL 110025944682/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FOSDICK-MASTEN PARK HIGH SCHOOL 110027066993/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FOURTH STREET 110025270962/FRS	BUFFALO NY	NON GC	N/A
	FINDS	INNER HARBOR 110019772003/FRS	FOOT OF MAIN ST WEST OF ST BUFFALO NY	NON GC	N/A
	FINDS	JEFFERSON SCHOOL 110026793959/FRS	BUFFALO NY	NON GC	N/A
	FINDS	JOHN F KENNEDY HIGH SCHOOL 110025708848/FRS	BUFFALO NY	NON GC	N/A
	FINDS	KENMORE EAST HIGH SCHOOL 110026000164/FRS	BUFFALO NY	NON GC	N/A
	FINDS	KENMORE JUNIOR HIGH SCHOOL 110026700782/FRS	BUFFALO NY	NON GC	N/A
	FINDS	KENMORE WEST HIGH SCHOOL 110025586042/FRS	BUFFALO NY	NON GC	N/A
	FINDS	EGGERT ROAD SCHOOL 110025922385/FRS	BUFFALO NY	NON GC	N/A
	FINDS	FALLEN HIGH SCHOOL 110027025314/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARY MAGDALENES SCHOOL 110025874221/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ROSARY HILL COLLEGE 110026894895/FRS	BUFFALO NY	NON GC	N/A
	FINDS	RYAN HIGH SCHOOL 110026206433/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SACRED HEART ACADEMY 110026735674/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT ALOYSIUS SCHOOL 110025529177/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT ANDREWS SCHOOL 110025573127/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT ANDREWS SCHOOL 110026195034/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	SAINT BARBARDS SCHOOL 110026078438/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT BARNARDS SCHOOL 110025580501/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT BONIFACE SCHOOL 110025580672/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT CASIMIRS SCHOOL 110025580805/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT LUKES SCHOOL 110025958275/FRS	BUFFALO NY	NON GC	N/A
	FINDS	ROOSEVELT SCHOOL 110025551463/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARKS SCHOOL 110026415109/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT AGNES SCHOOL 110026895019/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARY OF SORROWS SCHOOL 110026371049/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARYS SCHOOL 110025959309/FRS	BUFFALO NY	NON GC	N/A
	FINDS	DOUGHERTY HIGH SCHOOL 110026971882/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 69 110025756821/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARYS SCHOOL 110026736780/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT NICHOLAS SCHOOL 110025904813/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT PAULS SCHOOL 110025905242/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT ROSE OF LIMA SCHOOL 110025905938/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT STEPHENS SCHOOL 110026195917/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT TERESAS SCHOOL 110026195962/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT THOMAS SCHOOL 110025906312/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT MARGARETS SCHOOL 110027079168/FRS	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	FINDS	PUBLIC SCHOOL 75 110026818102/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 7 110025863956/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 70 110026594861/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 71 110025864198/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 72 110025864232/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 73 110025864303/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT AMELIAS SCHOOL 110025573056/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 74 110026196836/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 77 110025864544/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 78 110025874837/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 79 110025756947/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 79 110025874944/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SAINT TIMOTHYS SCHOOL 110025874533/FRS	BUFFALO NY	NON GC	N/A
	FINDS	PUBLIC SCHOOL 8 110026348085/FRS	BUFFALO NY	NON GC	N/A
	FINDS	RIVERWALK 110019743786/FRS	RIVERSIDE PARK TO LASALLE P BUFFALO NY	NON GC	N/A
	FINDS	ROOSEVELT SCHOOL 110025520639/FRS	BUFFALO NY	NON GC	N/A
	FINDS	SWEET HOME CENTRAL SCHOOL 110026870697/FRS	BUFFALO NY	NON GC	N/A
	HMIRS	CONWAY CENTRAL EXPRESS 2001040394/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	MONTGOMERY TANK LINES INC 1999010098/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 2004090042/4	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	HMIRS	BUFFALO and PITTSBURGH RAILROAD 1995061149/RAILWAY	BandP MILE POST BUFFALO NY	NON GC	N/A
	HMIRS	CHEMICAL LEAMAN TANK LINES INC 1993020618/HIGHWAY (FOR HIRE)	CUSTOMERS PREMISES BUFFALO NY	NON GC	N/A
	HMIRS	CHEMICAL LEAMAN TANK LINES INC 1995040163/HIGHWAY (FOR HIRE)	CUSTOMER S PREMISES BUFFALO NY	NON GC	N/A
	HMIRS	SAVAGE SERVICES INC 2004071245/6	BAILEY STREET BUFFALO NY	NON GC	N/A
	HMIRS	ROADWAY EXPRESS INC 399635/HIGHWAY (FOR HIRE)	90 RANSIER BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 2003110061/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	NORFOLK SOUTHERN RAILROAD 2004061380/6	SOUTHPARK FINANCE STATION BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 1999090910/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	D and H RAILROAD 1997120783/RAILWAY	BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 2004091337/4	BUFFALO NY	NON GC	N/A
	HMIRS	MONTGOMERY TANK LINES INC 1998070292/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	PRESTON TRUCKING CO INC 1993060761/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	FEDEX GROUND PACKAGE SYSTEM, I 410773/HIGHWAY (FOR HIRE)	BUFFALO BUFFALO NY 14211	NON GC	N/A
	HMIRS	MONTGOMERY TANK LINES INC 1997041203/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	MONTGOMERY TANK LINES INC 1999010101/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	D and H RAILROAD 1997120489/RAILWAY	BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 2003071095/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	HMIRS	QUALITY CARRIERS INC 1999070032/HIGHWAY (FOR HIRE)	BUFFALO NY	NON GC	N/A
	LUST	UNKNOWN TRUCK 9206074/CLOSED	ROUTE 198 EAST BUFFALO NY 14214	NON GC	N/A
	LUST	BETH. STL. OLD FIREHOUSE AT 1 GATE 0551524/CLOSED	HAMBURG TURNPIKE BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	LUST	HARRISON RADIATOR 8806466/CLOSED	KEIL STREET BUFFALO NY 14207	NON GC	N/A
	LUST	NSI GAS STATION 8601579/CLOSED	ELMWOOD AVENUE BUFFALO NY 14213	NON GC	N/A
	LUST	BUFFALO POLICE RADIO TOWE 9910557/CLOSED	ROUTE 198 WB BUFFALO NY 14214	NON GC	N/A
	LUST	BUFFALO POLICE RADIO TOWE 9910558/CLOSED	ROUTE 198 WB BUFFALO NY 14214	NON GC	N/A
	NPDES	LEXINGTON VILLAGE CANTERBURY WOO NYR10J574/MINOR	BUFFALO NY	NON GC	N/A
	NPDES	NYU900036/MINOR	BUFFALO NY 14209	NON GC	N/A
	NPDES	NY0259055/MINOR	BUFFALO NY 14207	NON GC	N/A
	NPDES	NYU900180/MINOR	BUFFALO NY	NON GC	N/A
	NPDES	NYU900179/MINOR	BUFFALO NY	NON GC	N/A
	NPDES	NYU900126/MINOR	BUFFALO NY 14216	NON GC	N/A
	PADS	U.S. ARMY CORPS OF ENGINEERS TRD-1456/TRANSFORM REG	BUILDING 4 BUFFALO NY 14207	NON GC	N/A
	PERMITS	CLUB and BOATHOUSES 9-0170348/NSIGPCI	BUFFALO NY	NON GC	N/A
	RCRAGN	EXXONMOBIL OIL CORPORATION 11333 NYR000141820/VGN	1507 FILMORE AVE BUFFALO NY 14211	NON GC	N/A
	RCRAGN	NYSDOT BIN 103989A - D123456 NYR000127738/LGN	SCAJAQUADA CRK EXPWY INT W BUFFALO NY 14213	NON GC	N/A
	RCRAGN	NYSDOT BIN 103989D - D123456 NYR000127704/LGN	SCAJAQUADA CRK EXPWY INT BUFFALO NY 14213	NON GC	N/A
	RCRAGN	NYSDOT BIN 1039990 NYR000062364/LGN	PEDRESTRIAN BRG OVER RTE 19 BUFFALO NY 14222	NON GC	N/A
	RCRAGN	D T E TONAWANDA LLC NYR000113290/VGN	180 VAW-GM BLVD BUFFALO NY 14207	NON GC	N/A
	RCRAGN	BUFFALO CITY OF DPW PARKS and STRE NYR000114801/SGN	MLK GREENHOUSE - HUMBOLDT P BUFFALO NY 14211	NON GC	N/A
	RCRANLR	NYS THRUWAY AUTH BIN 5512679 NYD987028289/NLR	I 190 OVER SERVICE RD AT BUFFALO NY 14213	NON GC	N/A
	RCRANLR	BUFFALO CITY OF PARKS DEPT NYD986975464/NLR	SCAJAQUADA EXPWY RTE 198 BUFFALO NY 14214	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	RCRANLR	NYS THRUWAY AUTH BIN 5512669 NYD987028271/NLR	I 190 OVER ERIE and BLACK R BUFFALO NY 14213	NON GC	N/A
	RCRANLR	FORMERLY INTERSTATE BRANDS CORPORA NYD981134000/NLR	FOUGERON STREET BUFFALO NY 14211	NON GC	N/A
	RCRANLR	NYSDOT BIN 1022670 NYD987008323/NLR	EB RAMP OVER RTE 33 BUFFALO NY 14209	NON GC	N/A
	RCRANLR	NIAGARA MOHAWK STATION 171 NYD981486392/NLR	RIDGE RD N WILSON - BURT RD BURT NY 14208	NON GC	N/A
	RCRANLR	NYSTA C O OAKGROVE CONSTRUCTION NY0000903120/NLR	I-190 NIAGARA THRUWAY BUFFALO NY 14207	NON GC	N/A
	RCRANLR	NYSDOT BIN 1022650 NYD986948545/NLR	HUMBOLDT PKWY RTE 33 PED BUFFALO NY 14216	NON GC	N/A
	RELEASES	LOCATED IN THE SCAJAQUADA RIVER. NRC-637685/MOBILE	BUFFALO NY	NON GC	N/A
	RELEASES	BUFFALO RIVER NRC-727458/STORAGE TANK	BUFFALO NY	NON GC	N/A
	RELEASES	BUFFALO RIVER NRC-650047/VESSEL	BUFFALO NY	NON GC	N/A
	RELEASES	BUFFALO RIVER NRC-637974/STORAGE TANK	BUFFALO NY	NON GC	N/A
	RELEASES	DP YARD NRC-603112/RAILROAD	BUFFALO NY	NON GC	N/A
	RELEASES	ELLCOTT CREEK NRC-740758/UNKNOWN SHEEN	BUFFALO NY	NON GC	N/A
	RELEASES	BUFFALO SEWER AUTHORITY 643847/UNKNOWN (NRC)	FOOT OF BABCOCK STREET OFF BUFFALO NY	NON GC	N/A
	RELEASES	USCG STATION BUFFALO NRC-843765/VESSEL	BUFFALO NY	NON GC	N/A
	RELEASES	228451/UNKNOWN (NRC)	BUFFALO SHIP CANAL BUFFALO NY	NON GC	N/A
	RELEASES	458315/UNKNOWN (NRC)	7BUFFALO RIVER BUFFALO NY	NON GC	N/A
	RELEASES	NRC-835266/STORAGE TANK	1 FERMAN BLVD BUFFALO NY	NON GC	N/A
	RELEASES	NRC-836874/FIXED	125 GARDENVILLE PRKWY BUFFALO NY	NON GC	N/A
	RELEASES	NIAGRA RIVER NRC-707209/UNKNOWN SHEEN	BLACK ROCK BLOCK BUFFALO NY	NON GC	N/A
	RELEASES	UNKNOWN SHEEN INCIDENT OHIO ST AT NRC-762579/UNKNOWN SHEEN	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	RELEASES	4353 PAILIY NRC-814665/FIXED	BUFFALO NY	NON GC	N/A
	RELEASES	NRC-814720/FIXED	GLIDER AVE DELAVAN AVE (C BUFFALO NY	NON GC	N/A
	RELEASES	NORFOLK SOUTHERN 484333/RAILROAD	MILEPOST B5.7 BUFFALO NY	NON GC	N/A
	RELEASES	LUEDTKE ENGINEERING CO. 642129/MARINE- RELEASED FRO	MOUTH OF BUFFALO RIVER BUFFALO NY	NON GC	N/A
	RELEASES	POLE 124 NRC-814708/FIXED	NORTH ST BUFFALO NY	NON GC	N/A
	RELEASES	PORT OF BUFFALO NRC-741569/UNKNOWN SHEEN	BUFFALO NY	NON GC	N/A
	RELEASES	SMALL BOAT HARBOR NRC-650270/VESSEL	BUFFALO NY	NON GC	N/A
	RELEASES	TUTTLE TRUCKING 280340/HIGHWAY RELATED	I-190 BUFFALO NY	NON GC	N/A
	RELEASES	UNKNOWN 235502/UNKNOWN (NRC)	GENESSE RIVER BUFFALO NY	NON GC	N/A
	RELEASES	POLE 26 R NRC-822914/FIXED	CLEVELAND DRIVE BUFFALO NY	NON GC	N/A
	RELEASES	TRANSTAR/PROLINE CARRIERS 504274/HIGHWAY RELATED	FOURGERSON ST BUFFALO NY 14211	NON GC	N/A
	RELEASES	NRC-642344/FIXED	20460 CHANDLER STREET BUFFALO NY 14207	NON GC	N/A
	RELEASES	UNKNOWN 235344/PIPELINE RELATED	ONTARIO STREET BUFFALO NY 14207	NON GC	N/A
	RELEASES	239679/UNKNOWN (NRC)	BUFFALO RIVER BUFFALO NY	NON GC	N/A
	RELEASES	336623/MARINE- RELEASED FRO	BLACK ROCK CANAL BUFFALO NY	NON GC	N/A
	RELEASES	MILE POST - QC434 NRC-841332/RAILROAD	1836 BROADWAY BUFFALO NY	NON GC	N/A
	SPILLS	ST. JOHNS HOSPICE SITE 0550592/ACTIVE	113 MAPLE BUFFALO NY	NON GC	N/A
	SPILLS	SKYWAY ROAD SPILL 0209193/CLOSED	SOUTH OF CITY SHIP CANAL BUFFALO NY	NON GC	N/A
	SPILLS	CID REFUSE 9501629/CLOSED	ELMWOOD AVENUE BUFFALO NY 14213	NON GC	N/A
	SPILLS	8503120/CLOSED	DART STREET BUFFALO NY 14213	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	SUNK BOAT IN LAKE ERIE 9906081/CLOSED	NIAGARA STREET BUFFALO NY	NON GC	N/A
	SPILLS	BUFFALO POLICE RADIO TOWE 9910558/CLOSED	ROUTE 198 WB BUFFALO NY 14214	NON GC	N/A
	SPILLS	BUFFALO POLICE RADIO TOWE 9910557/CLOSED	ROUTE 198 WB BUFFALO NY 14214	NON GC	N/A
	SPILLS	SILVER LAKE 0212346/CLOSED	SAME BUFFALO NY	NON GC	N/A
	SPILLS	SHAUCHNESSY AUTO 9005904/CLOSED	PORTER AVENUE BUFFALO NY 14213	NON GC	N/A
	SPILLS	NI MO - POLE 530R 0107037/CLOSED	AUBURN ROAD BUFFALO NY 14213	NON GC	N/A
	SPILLS	MURIATIC ACID 0275194/CLOSED	GRANT STREET BUFFALO NY 14213	NON GC	N/A
	SPILLS	CITY OF BFLO PARKS DEPT 0075655/CLOSED	ROUTE 198 SCAJAQUADA EXPR BUFFALO NY 14213	NON GC	N/A
	SPILLS	SUNYAB 0375356/CLOSED	JUNKYARD NEAR DUMPSTER BUFFALO NY	NON GC	N/A
	SPILLS	BUFFALO FUEL TRUCK 9802486/CLOSED	ELMWOOD AVENUE BUFFALO NY 14213	NON GC	N/A
	SPILLS	BENCHMARK 9506014/CLOSED	ELMWOOD AVENUE BUFFALO NY 14213	NON GC	N/A
	SPILLS	TRANS STAR / PROLINE CARR 9606134/CLOSED	URBAN STREET BUFFALO NY 14211	NON GC	N/A
	SPILLS	STOLEN TRU-GREEN VAN 9806272/CLOSED	WESTSHORE ROAD BUFFALO NY 14211	NON GC	N/A
	SPILLS	M. WILEY COMPANY DRUMS 0175045/CLOSED	RACE ROAD BUFFALO NY 14207	NON GC	N/A
	SPILLS	NIAGARA MOHAWK POLE 15 9809712/CLOSED	GREAT ARROW STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS	8502418/CLOSED	RICHMOND AVE. BUFFALO NY 14222	NON GC	N/A
	SPILLS	DAVE THE HANDYMAN 9312535/CLOSED	NIAGARA STREET BUFFALO NY 14213	NON GC	N/A
	SPILLS	MOTOR OIL ON KENSINGTON 9000895/CLOSED	ROUTE 33 BUFFALO NY 14209	NON GC	N/A
	SPILLS	INLINE PLANT 0505086/CLOSED	VULCAN ST BUFFALO NY 14207	NON GC	N/A
	SPILLS	NIAGARA MOHAWK 0406917/CLOSED	SOUTH PARK AVENUE BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	UNKNOWN TRUCK 9206074/CLOSED	ROUTE 198 EAST BUFFALO NY 14214	NON GC	N/A
	SPILLS	NFTA BUS 9704655/CLOSED	MAIN STREET NEAR PARKSIDE BUFFALO NY 14214	NON GC	N/A
	SPILLS	RAPIN PLACE SPILLAGE 9108307/CLOSED	RAPIN PLACE BUFFALO NY 14211	NON GC	N/A
	SPILLS	POLE 118 0706267/CLOSED	DUTTON AVE BUFFALO NY 14211	NON GC	N/A
	SPILLS	NIAGARA MOHAWK TRANSFORME 9606007/CLOSED	ROGERS ROAD BUFFALO NY 14211	NON GC	N/A
	SPILLS	NIAGARA MOHAWK 9000477/CLOSED	URBAN STREET BUFFALO NY 14211	NON GC	N/A
	SPILLS	METRO BUS 9101397/CLOSED	FILLMORE AVENUE BUFFALO NY 14211	NON GC	N/A
	SPILLS	DUMPING ON COLORADO STR. 9209337/CLOSED	COLORADO STREET BUFFALO NY 14211	NON GC	N/A
	SPILLS	TAR ON ROAD 9400947/CLOSED	ROUTE 198 BUFFALO NY 14214	NON GC	N/A
	SPILLS	VICTOR S MOTORS 9300772/CLOSED	MAIN STREET BUFFALO NY 14209	NON GC	N/A
	SPILLS	T-WAY/NIAGARA SECT 0312383/CLOSED	.2 I190 NORTHBOUND BUFFALO NY	NON GC	N/A
	SPILLS	AMERICANA 9106228/CLOSED	MAIN STREET BUFFALO NY 14209	NON GC	N/A
	SPILLS	NIAGARA MOHAWK POLE 9605512/CLOSED	EAST DELAVAN STREET BUFFALO NY 14208	NON GC	N/A
	SPILLS	SPIRIT EXPRESS 9516240/CLOSED	VULCAN STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS	POSSIBLE REMEDIAL WORK 0475060/CLOSED	VULCAN BUFFALO NY 14207	NON GC	N/A
	SPILLS	UNDER SKYWAY 0550603/CLOSED	RT 5 (SKYWAY) BUFFALO NY	NON GC	N/A
	SPILLS	UNDER NYSTA 190 BRIDGE 0485362/CLOSED	ACCESS RD OFF OF EXCHANGE BUFFALO NY	NON GC	N/A
	SPILLS	TRANSFORMER VAULT 4109 0400837/CLOSED	DELAWARE AV BUFFALO NY	NON GC	N/A
	SPILLS	TRACTOR TRAILER 0275489/CLOSED	ROUTE 219 NB (NEAR RIDGE) BUFFALO NY	NON GC	N/A
	SPILLS	TOWN/WEST SENECA COMPOST 9975247/CLOSED	CLINTON AND MINERAL SPRIN BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	TOWN OF CHEEKTOWAGA 0475088/CLOSED	UNION ROAD BUFFALO NY	NON GC	N/A
	SPILLS	TIRE FIRE IN CANADA 8910776/CLOSED	ROUTE 70 BUFFALO NY	NON GC	N/A
	SPILLS	BUFFALO DPW 0305769/CLOSED	ANTWERP STREET BUFFALO NY 14211	NON GC	N/A
	SPILLS	I-90 DRUM SPILL 0275364/CLOSED	I-90 (WESTBOUND) BUFFALO NY	NON GC	N/A
	SPILLS	NEW GARDENVILLE TRANSMISSION SUBST 0700816/CLOSED	INDIAN CHURCH RD/JENNINGS BUFFALO NY	NON GC	N/A
	SPILLS	NERVE GAS BOTTLE 9004149/CLOSED	SOUTH PARK LAKE BUFFALO NY	NON GC	N/A
	SPILLS	OLD BETHLEHEM STEEL PLANT 0507604/CLOSED	HAMBURG TURNPIKE BUFFALO NY	NON GC	N/A
	SPILLS	NATIONAL GRID TRUCK 0702184/CLOSED	PERRY STREET BUFFALO NY	NON GC	N/A
	SPILLS	FUMES FROM TRUCK 9401818/CLOSED	ONTARIO STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS	NATIONAL GRID - RIGHT OF WAY 0510971/CLOSED	LINE 145/146 BUFFALO NY	NON GC	N/A
	SPILLS	NAT GRID 0608064/CLOSED	1023 COLLINGWOOD AVE BUFFALO NY	NON GC	N/A
	SPILLS	GAIL WINNS 9004824/CLOSED	BLACK ROCK I190 BUFFALO NY	NON GC	N/A
	SPILLS	GATE 3 0710129/ACTIVE	GENESEE STREET BUFFALO NY	NON GC	N/A
	SPILLS	GBIA (NEW REMOTE) 0275283/CLOSED	GENESSEE STREET BUFFALO NY	NON GC	N/A
	SPILLS	AIR COMPLAINT ODORS 9104271/CLOSED	609 CURIOR STREET BUFFALO NY	NON GC	N/A
	SPILLS	HYDRAULIC SPILL FROM SWEEPER 0750523/CLOSED	PENNSYLVANIA and ORTON HUDS BUFFALO NY	NON GC	N/A
	SPILLS	ON ROADWAY 0514998/CLOSED	NORTH LEGION STREET BUFFALO NY	NON GC	N/A
	SPILLS	IN ROAD 0550698/CLOSED	WASHINGTON BUFFALO NY	NON GC	N/A
	SPILLS	IN STREET 0750398/CLOSED	ELLCOTT ST. BUFFALO NY	NON GC	N/A
	SPILLS	INSIDE SALT BARN 0608813/CLOSED	SWEET HOME ROAD BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	INTEGRATED TIRE 0103501/CLOSED	MILLERS CT/TONAWANDA CREE BUFFALO NY	NON GC	N/A
	SPILLS	JB HUNT 0710654/ACTIVE	INTERSTATE 190 EXIT 5 NB BUFFALO NY	NON GC	N/A
	SPILLS	KINSMAN INDEPENDENT 9416562/CLOSED	HAMBURG STREET BUFFALO NY	NON GC	N/A
	SPILLS	LAKE ERIE 9402329/CLOSED	LAKE ERIE BUFFALO NY	NON GC	N/A
	SPILLS	LUCARELLI S 0550573/CLOSED	1818 ABBOTT ROAD BUFFALO NY	NON GC	N/A
	SPILLS	NIMO TRUCK 0504678/CLOSED	SHERATON PARKSIDE/EMZINGE BUFFALO NY	NON GC	N/A
	SPILLS	NIMO VAULT 0501616/CLOSED	MAIN STREET BUFFALO NY	NON GC	N/A
	SPILLS	NIMO VEHICLE 4794 0500832/CLOSED	WILLET ROAD BUFFALO NY	NON GC	N/A
	SPILLS	GREEN MATERIAL IN CREEK 9101245/CLOSED	HERITAGE STREET BUFFALO NY	NON GC	N/A
	SPILLS	POLE 124 0608047/CLOSED	NORRIS STREET BUFFALO NY	NON GC	N/A
	SPILLS	AROUND 0511290/CLOSED	PURDY ST BUFFALO NY	NON GC	N/A
	SPILLS	AT WATER INTAKE 0275390/CLOSED	FUHRMANN BLVD BRIC STATIO BUFFALO NY	NON GC	N/A
	SPILLS	AT-6 AIRCRAFT 9004216/CLOSED	NIAGARA RIVER - ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS	AUTO PART STORE SIDEWALK 0514697/CLOSED	OAKMONT AVE NEAR 2845 BAILE BUFFALO NY	NON GC	N/A
	SPILLS	BEHIND LAFAYETTE TAP RM ON ELLICOT 0650101/CLOSED	ELLICOTT ST BETWEEN CLINTON BUFFALO NY	NON GC	N/A
	SPILLS	BETH. STL. OLD FIREHOUSE AT 1 GATE 0551524/CLOSED	HAMBURG TURNPIKE BUFFALO NY	NON GC	N/A
	SPILLS	BLASDAL PUMP STATION 0506679/CLOSED	270 MILESTRIP ROAD BUFFALO NY	NON GC	N/A
	SPILLS	BLASDELL PUMP STATION 0608009/CLOSED	270 MILESTRIP ROAD BUFFALO NY	NON GC	N/A
	SPILLS	BUBBLES IN CREEK 9975064/CLOSED	TRANSIT AND BRENTWOOD BUFFALO NY	NON GC	N/A
	SPILLS	BUFFALO CEMENT COMPANY 0608250/CLOSED	MAIN STREET POLE 242 BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	BUFFALO CREEK ROAD 0201468/CLOSED	SOUTH STATION BUFFALO NY	NON GC	N/A
	SPILLS	NFTA BUS 0275121/CLOSED	SENECA and RILEY STREET BUFFALO NY	NON GC	N/A
	SPILLS	POLE 240 0707943/CLOSED	GOLD ST BUFFALO NY	NON GC	N/A
	SPILLS	NIAGARA STREET PLAZA 0650684/CLOSED	NIAGARA BUFFALO NY	NON GC	N/A
	SPILLS	POLE 26R 0611122/CLOSED	CLEVELAND DRIVE BUFFALO NY	NON GC	N/A
	SPILLS	POLE 145 0608453/CLOSED	EAST PARADE ST/ NORTHAMPTON BUFFALO NY	NON GC	N/A
	SPILLS	POLE 233R 0504074/CLOSED	CORONATION 450 CORPORATE BUFFALO NY	NON GC	N/A
	SPILLS	POLE 170 0411824/CLOSED	CHELSEA BUFFALO NY	NON GC	N/A
	SPILLS	PLANE CRASH 0475152/CLOSED	LAKE ERIE BUFFALO NY	NON GC	N/A
	SPILLS	PILOT AIR FREIGHT 9100978/CLOSED	UNNAMMED CREEK BUFFALO NY	NON GC	N/A
	SPILLS	P and P TRANSPORT 0701920/CLOSED	BAILEY and OLD BAILEY AVE L BUFFALO NY	NON GC	N/A
	SPILLS	ON THE STREET 0750185/CLOSED	EUGENE AVENUE BUFFALO NY	NON GC	N/A
	SPILLS	ON THE ROAD 0705406/CLOSED	CHADDUCK ST BUFFALO NY	NON GC	N/A
	SPILLS	ON ROADWAY and SIDEWALK 0511858/CLOSED	MILITARY RD BUFFALO NY	NON GC	N/A
	SPILLS	NYSDOT GENESEE ST. 0175479/CLOSED	GENESEE ST CORRIDOR PROJ BUFFALO NY	NON GC	N/A
	SPILLS	ABANDONED DRUM 9003482/CLOSED	FURHMAN BLVD. - ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS	SHEEN ON BUFFALO RIVER 0551040/CLOSED	MOUTH OF THE BUFFALO RIVER BUFFALO NY	NON GC	N/A
	SPILLS	NYSDOT - RTE 33 0375117/CLOSED	ROUTE 33 BUFFALO NY	NON GC	N/A
	SPILLS	DRUM 0475179/CLOSED	BUFFALO RIVER BUFFALO NY	NON GC	N/A
	SPILLS	CYLINDER FROM ESTATE 0075286/CLOSED	UNION ROAD BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	CSX- CP1 DRAWBRIDGE 0708610/CLOSED	QD MILE POST 1 TRACK 3 BUFFALO NY	NON GC	N/A
	SPILLS	CORNIELUS CREEK 0504435/CLOSED	ONTARIO STREET BUFFALO NY	NON GC	N/A
	SPILLS	CORNELIUS CREEK 0750733/CLOSED	FOOT OF ONTARIO ST BUFFALO NY	NON GC	N/A
	SPILLS	CENTER MEDIUM 0551510/CLOSED	RT.400 BUFFALO NY	NON GC	N/A
	SPILLS	BUFFALO RIVER/SHIP CANAL 9103435/CLOSED	FURHMAN BLVD BUFFALO NY	NON GC	N/A
	SPILLS	ABANDONED BATTERIES 9509514/CLOSED	FUHRMAN BLVD BUFFALO NY	NON GC	N/A
	SPILLS	3 PHSE TRANSFORMER 14 0711416/CLOSED	FEDERAL AVE BUFFALO NY	NON GC	N/A
	SPILLS	SCAJAQUADA CREEK 9104597/CLOSED	SCAJAQUADA EXPRY - RT 198 BUFFALO NY	NON GC	N/A
	SPILLS	EBENEZER BROOK 0701487/CLOSED	MILTON ST BUFFALO NY	NON GC	N/A
	SPILLS	SHEEN IN BLACK ROCK CANAL 9005299/CLOSED	BLACK ROCK CANAL - I190 BUFFALO NY	NON GC	N/A
	SPILLS	ELLCOTT CREEK 9209190/CLOSED	ISLAND PARK BUFFALO NY	NON GC	N/A
	SPILLS	SIDE OF ROADWAY 0711462/ACTIVE	SENECA PARKSIDE BUFFALO NY	NON GC	N/A
	SPILLS	UNDER THE SKYWAY 0403156/CLOSED	RT.5 BUFFALO NY	NON GC	N/A
	SPILLS	VACANT HOME 0750519/CLOSED	14TH STREET BUFFALO NY	NON GC	N/A
	SPILLS	8502685/CLOSED	CAYUGA RD BUFFALO NY	NON GC	N/A
	SPILLS	8504080/CLOSED	GENESEE STREET BUFFALO NY	NON GC	N/A
	SPILLS	8504710/CLOSED	ABBOTT ROAD BUFFALO NY	NON GC	N/A
	SPILLS	8504207/CLOSED	FUHRMAN BLVD. RT 5 BUFFALO NY	NON GC	N/A
	SPILLS	250 EAST OF AMHERST AVE 9705109/CLOSED	RAILROAD TRACKS BUFFALO NY 14207	NON GC	N/A
	SPILLS	BAG ON VACANT LOT 9801950/CLOSED	PACIFIC STREET BUFFALO NY 14207	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	CARMELO PARISI PROPERTY 0475153/CLOSED	END OF HOWELL, WEST SIDE BUFFALO NY 14207	NON GC	N/A
	SPILLS	DRUMS IN A SHOPPING CART 0485088/CLOSED	NEWFIELD STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS	SEEP INTO CAZENOVIA CREEK 9402884/CLOSED	HARLEM ROAD BRIDGE BUFFALO NY	NON GC	N/A
	SPILLS	RED MATERIAL IN SMOKES CR 9606333/CLOSED	SOUTH PARK AVENUE BUFFALO NY	NON GC	N/A
	SPILLS	NYSEG SPILL 0711461/ACTIVE	TADIO PARKWAY BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN A STREAM 9702688/CLOSED	ROUTE 33 EB WEST GENESEE BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN CAYUGA CREEK 9709266/CLOSED	CAYUGA CREEK BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN CAZENOVIA CREEK 9610264/CLOSED	SENECA STREET BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN HARBOUR POINT COM 9905868/CLOSED	HARBOUR POINT COMMON BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN NIAGARA RIVER 9505576/CLOSED	ONTARIO STREET BUFFALO NY	NON GC	N/A
	SPILLS	OIL IN STREET 0750965/CLOSED	336 MAPLE BUFFALO NY	NON GC	N/A
	SPILLS	POLE 304 0207758/CLOSED	BAILEY AV BUFFALO NY	NON GC	N/A
	SPILLS	POLE 30RR1 0608357/CLOSED	GETZVILLE ROAD BUFFALO NY	NON GC	N/A
	SPILLS	POLE 240 0709072/ACTIVE	CORNWALL AVE BUFFALO NY	NON GC	N/A
	SPILLS	DRUM ON LAKE ERIE 9209900/CLOSED	ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS	RAW SEWAGE IN CREEK 9304835/CLOSED	30 HIGH BANK DRIVE BUFFALO NY	NON GC	N/A
	SPILLS	NYSDOT BORING 0550368/CLOSED	OHIO ST AT CANAL BUFFALO NY	NON GC	N/A
	SPILLS	RESIDENCE 0751411/ACTIVE	471 7TH AVE BUFFALO NY	NON GC	N/A
	SPILLS	ROADWAY CONSTRUCTION 0651581/CLOSED	ABBY STREET EXTENSION FROM BUFFALO NY	NON GC	N/A
	SPILLS	MUD IN ROAD 0711292/CLOSED	WALDEN AVE BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS	METRO PORT 0503643/CLOSED	FUHRMAN BLVD BUFFALO NY	NON GC	N/A
	SPILLS	MARK TWAIN MV NY9104GH 9105876/CLOSED	FURHMANN BLVD - ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS	MANHOLE 232 0703844/ACTIVE	PERRY STREET BUFFALO NY	NON GC	N/A
	SPILLS	MAIN LINE ON UNION ROAD 0709419/ACTIVE	MILE MARKER QC433 BUFFALO NY	NON GC	N/A
	SPILLS	FORMER AMES PLAZA 0750035/CLOSED	LAKE BUFFALO NY	NON GC	N/A
	SPILLS	FOAM IN NIAGARA RIVER 9806690/CLOSED	EAST FERRY SREETT BUFFALO NY	NON GC	N/A
	SPILLS	ERIE CO SEWER 0500144/CLOSED	270 MILE STRIP ROAD BUFFALO NY	NON GC	N/A
	SPILLS	EMPTY LOT 0501172/CLOSED	TOWNSEND/DETROIT BUFFALO NY	NON GC	N/A
	SPILLS	PRIOR AVIATION 0707672/CLOSED	AIRPORT DRIVE BUFFALO NY	NON GC	N/A
	SPILLS80	ABANDONED DRUM 8906455/CLOSED	FURHMAN BLVD. - ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS80	OIL AT TOMCYN STREET 8901217/CLOSED	TOMCYN STREET BUFFALO NY	NON GC	N/A
	SPILLS80	BRENTON - BLUE LIQUID 8700003/CLOSED	ROUTE 198 BUFFALO NY 14214	NON GC	N/A
	SPILLS80	8503120/UNKNOWN	DART STREET BUFFALO NY 14213	NON GC	N/A
	SPILLS80	NSI GAS STATION 8601579/CLOSED	ELMWOOD AVENUE BUFFALO NY 14213	NON GC	N/A
	SPILLS80	DOWNING CONTAINER COMPANY 8602793/CLOSED	NIAGARA STREET BUFFALO NY 14213	NON GC	N/A
	SPILLS80	SCAJAQUADA EXPRY. OIL 8701374/CLOSED	ROUTE 98 BUFFALO NY 14211	NON GC	N/A
	SPILLS80	AUTO EYZ 535 8903892/CLOSED	PINE RIDGE ROAD BUFFALO NY 14211	NON GC	N/A
	SPILLS80	TANKER KHISLA 8909426/CLOSED	ROUTE 5 - LAKE ERIE BUFFALO NY	NON GC	N/A
	SPILLS80	RUSH CREEK 8704873/CLOSED	RUSH CREEK BUFFALO NY	NON GC	N/A
	SPILLS80	BUFFALO RIVER 8702544/CLOSED	MARINA BUFFALO RIVER BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS80	OIL IN BUFFALO RIVER 8801426/CLOSED	SERVICEMANS PARK BUFFALO NY	NON GC	N/A
	SPILLS80	ABANDONED DRUM 8900054/CLOSED	FUHRMAN BLVD BUFFALO NY	NON GC	N/A
	SPILLS80	MV STEINBRENNER 8909034/CLOSED	ROUTE 5 BUFFALO HARBOR BUFFALO NY	NON GC	N/A
	SPILLS80	KIELSA TANKER 8909457/CLOSED	ROUTE 5 - BUFFALO HARBOR BUFFALO NY	NON GC	N/A
	SPILLS80	KELSEY AVE SEWERS 8700961/CLOSED	KELSEY AVENUE BUFFALO NY	NON GC	N/A
	SPILLS80	HENRY STEINBRENNER SHIP 8804421/CLOSED	OHIO STREET BUFFALO NY	NON GC	N/A
	SPILLS80	HENRY STEINBRENNER 8901350/CLOSED	GANSON STREET BUFFALO NY	NON GC	N/A
	SPILLS80	FORT ERIE SEWAGE DEPT. 8803400/CLOSED	CRESCENT PARK BUFFALO NY	NON GC	N/A
	SPILLS80	FOAM IN ELLICOTT CREEK 8801276/CLOSED	AERO DRIVE BUFFALO NY	NON GC	N/A
	SPILLS80	FISH KILL 8902702/CLOSED	DELAWARE PARK LAKE BUFFALO NY	NON GC	N/A
	SPILLS80	OXY CHEMICAL CO. 8703719/CLOSED	I190 BUFFALO NY	NON GC	N/A
	SPILLS80	7800699/GAS STATION	STORM SEWER BUFFALO NY	NON GC	N/A
	SPILLS80	NSYDOT PUMPHOUSE RT. 33 8606393/CLOSED	ROUTE 33 BUFFALO NY 14209	NON GC	N/A
	SPILLS80	MILLARD FILLMORE RAMP 8900851/CLOSED	LINWOOD AVENUE BUFFALO NY 14209	NON GC	N/A
	SPILLS80	BAD GASOLINE 8904258/CLOSED	MAIN STREET BUFFALO NY 14209	NON GC	N/A
	SPILLS80	SAFETY KLEEN CORP. 8705905/CLOSED	HERTEL AVENUE BUFFALO NY 14207	NON GC	N/A
	SPILLS80	PARISH STREET 8603182/CLOSED	PARISH STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS80	HARRISON RADIATOR 8806466/CLOSED	KEIL STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS80	AMERICAN PAVING and EXCAV. 8806267/CLOSED	MILITARY STREET BUFFALO NY 14207	NON GC	N/A
	SPILLS80	8101932/UNKNOWN	BUFFALO NY	NON GC	N/A

Environmental FirstSearch

Sites Summary Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TOTAL: 895 **GEOCODED:** 282 **NON GEOCODED:** 613 **SELECTED:** 0

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SPILLS80	LOSURDO FOOD TRUCK 8907247/CLOSED	ROUTE 33 - KENSINGTON EXP BUFFALO NY 14214	NON GC	N/A
	SPILLS80	8504207/UNKNOWN	FUHRMAN BLVD. RT 5 BUFFALO NY	NON GC	N/A
	SPILLS80	TOTAL FACILITIES SERVICES 8606394/CLOSED	KENSINGTON RD BUFFALO NY 14214	NON GC	N/A
	SPILLS80	8000840/UNKNOWN	BUFFALO NY	NON GC	N/A
	SPILLS80	8000154/UNKNOWN	BUFFALO NY	NON GC	N/A
	SPILLS80	ELLCOTT CREEK 8800374/CLOSED	NORTH ELLICOTT CREEK ROAD BUFFALO NY	NON GC	N/A
	SPILLS80	DRUM IN SLATE BOTTOM CR. 8607861/CLOSED	FRENCH ROAD BUFFALO NY	NON GC	N/A
	SPILLS80	COKE BREEZE 8907362/CLOSED	ROUTE 5, FURHMAN BUFFALO NY	NON GC	N/A
	SPILLS80	CANADIAN NATIONAL RAILWAY 8807076/CLOSED	FORT ERIE RAILYARD BUFFALO NY	NON GC	N/A
	SPILLS80	BIZER CREEK 8807860/CLOSED	BIZER CREEK BUFFALO NY	NON GC	N/A
	SPILLS80	ABANDONED DRUM 8903039/CLOSED	FURHMAN BLVD - ROUTE 5 BUFFALO NY	NON GC	N/A
	SPILLS80	TAB CONTRACTOR 8805444/CLOSED	DELAWARE AVENUE BUFFALO NY 14209	NON GC	N/A
	SPILLS80	8001338/UNKNOWN	BUFFALO NY	NON GC	N/A

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 107 **DIST/DIR:** 0.00 -- **MAP ID:** 8

NAME: NYSDOT BIN 1039970 ADDRESS: NY RTE 198 BRG OVER SCAJAQUADA BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110007983744 ID2: NY0000098400 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 10/20/1998 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NY0000098400 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:46:52 AM NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110007983744 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/5/2006 9:04:05 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 71 **DIST/DIR:** 0.00 -- **MAP ID:** 2

NAME: NYSDOT BIN 103989B - D123456	REV: 11/1/06
ADDRESS: SCAJAQUADA CRK EXPWY I-190	ID1: 110018888747
BUFFALO NY 14213	ID2: NYR000127720
ERIE	STATUS: FRS
CONTACT:	PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO	PROGRAM ID: NYR000127720
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED:
AGENCY INT QUAL:	INTEREST ENDED:
INT END QUAL:	SOURCE OF DATA: RCRAINFO
LAST REPORTED: 7/16/2004	LAST EXTRACTED: 11/8/2004 7:48:40 AM

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: FRS	PROGRAM ID: 110018888747
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED: 11/8/2004 7:48:39 AM
AGENCY INT QUAL:	INTEREST ENDED:
INT END QUAL:	SOURCE OF DATA: RCRAINFO
LAST REPORTED: 11/8/2004 7:48:40 AM	LAST EXTRACTED:

ENFORCEMENT ACT:

REG PROGRAM: FACILITY -

SITE TYPE: STATIONARY

INTEREST STATUS: ACTIVE

DATA QUALITY: V

LOCATION DESC:

ADDRESS TYPE: IRREGULAR

LAST REPORTED:

POSTED TO DATABASE: 11/8/2004 7:48:40 AM

DATA UPDATED: 1/5/2006 2:20:36 PM

ENTERED PERSON/METHOD: REFRESH

PARENT REG ID:

CONFIDENCE IN ADDR:

ENFORCEMENT SENSITIVE:

REQ MANUAL REVIEW:

REASON MAN REVIEW:

SMALL BUS POLICY:

ENFORCEMENT ACTION:

DATA PUB ACCESS: YES

INTERNAL SYS ID:

FEDERAL FACILITY: NO

FEDERAL AGENCY:

TRIBAL LAND: NO

TRIBAL LAND NAME:

CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 71	DIST/DIR: 0.00 --	MAP ID: 2
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 103989B - D123456 ADDRESS: SCAJAQUADA CRK EXPWY I-190 BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888747 ID2: NYR000127720 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 115 **DIST/DIR:** 0.00 -- **MAP ID:** 3

NAME: NYSDOT BIN 1001590 ADDRESS: MAIN ST OVER NY RT 198 BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110008066172 ID2: NYD986968659 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110008066172 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/18/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD986968659 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:44:02 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 10:01:40 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 114	DIST/DIR: 0.00 --	MAP ID: 3
-----------------------	--------------------------	------------------

NAME: NYSDOT ADDRESS: RTE 5 MAIN ST OVER RTE 198 BUFFALO NY 14214 Erie CONTACT:	REV: ID1: NYD986968659 ID2: STATUS: PHONE:
------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

RCRIS : NYD986968659
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 111 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: BUFFALO CITY OF PARKS DEPT ADDRESS: 17 MEADOWVIEW PL BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110012242019 ID2: NY0000057240 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110012242019 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 10/9/2001 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000100982 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/8/1999 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NY0000057240 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:46:55 AM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 1:53:33 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 111

DIST/DIR: 0.00 --

MAP ID: 1

NAME: BUFFALO CITY OF PARKS DEPT
ADDRESS: 17 MEADOWVIEW PL
BUFFALO NY 14214
ERIE

REV: 11/1/06
ID1: 110012242019
ID2: NY0000057240
STATUS: FRS
PHONE:

CONTACT:

ENFORCEMENT ACTION:

DATA PUB ACCESS: YES

INTERNAL SYS ID:

FEDERAL FACILITY: NO

FEDERAL AGENCY:

TRIBAL LAND: NO

TRIBAL LAND NAME:

CONGRESSIONAL DIST: 29

LEGISLATIVE DIST: NY

HYDROLOGICAL UNTIS: 04120104

EPA REGION: 02

AIRSHED:

CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 110	DIST/DIR: 0.00 --	MAP ID: 1
-----------------------	--------------------------	------------------

NAME: BUFFALO CITY OF DEPT OF PARKS
ADDRESS: 17 MEADOW VIEW DR
 BUFFALO NY 14214
 Erie
CONTACT:

REV:
ID1: NY0000057240
ID2:
STATUS:
PHONE:

RCRIS : NY0000057240
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 108	DIST/DIR: 0.00 --	MAP ID: 8
-----------------------	--------------------------	------------------

NAME: NYSDOT CONTRACT D254888 ADDRESS: RTE 198 OVER SCAJAQUADA CREEK BUFFALO NY 14222 Erie CONTACT:	REV: ID1: NY0000098400 ID2: STATUS: PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

RCRIS : NY0000098400
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 106 **DIST/DIR:** 0.00 -- **MAP ID:** 8

NAME: NYSDOT BIN 1039959 D256194 ADDRESS: RTE 198 RAMP C BRIDGE OVER BUFFALO NY 14208 ERIE CONTACT:	REV: 11/1/06 ID1: 110007986386 ID2: NY0000347013 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110007986386 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 6/1/1994 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NY0000347013 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:46:48 AM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 9:26:57 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120103
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 105	DIST/DIR: 0.00 --	MAP ID: 8
-----------------------	--------------------------	------------------

NAME: NYSDOT BIN 1039959 D256194 ADDRESS: RTE 198 RAMP C BRG OVER SCAJAQUADA CREEK BUFFALO NY 14208 Erie CONTACT:	REV: ID1: NY0000347013 ID2: STATUS: PHONE:
----------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

RCRIS : NY0000347013
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 72 **DIST/DIR:** 0.00 -- **MAP ID:** 2

NAME: NYSDOT BIN 103989C - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT I-190 BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888710 ID2: NYR000127712 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/8/2004 7:48:36 AM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110018888710 AGENCY INTERESTED: 11/8/2004 7:48:34 AM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/16/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000127712 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 7:48:36 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:36 AM
DATA UPDATED: 1/5/2006 2:20:33 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 72	DIST/DIR: 0.00 --	MAP ID: 2
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 103989C - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT I-190 BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888710 ID2: NYR000127712 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 70 **DIST/DIR:** 0.00 -- **MAP ID:** 2

NAME: NYSDOT BIN 103989A - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT W BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888756 ID2: NYR000127738 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/8/2004 7:48:45 AM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110018888756 AGENCY INTERESTED: 11/8/2004 7:48:44 AM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/16/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000127738 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 7:48:45 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:45 AM
DATA UPDATED: 1/5/2006 2:20:39 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 70	DIST/DIR: 0.00 --	MAP ID: 2
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 103989A - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT W BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888756 ID2: NYR000127738 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 73 **DIST/DIR:** 0.00 -- **MAP ID:** 2

NAME: NYSDOT BIN 103989D - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888701 ID2: NYR000127704 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/8/2004 7:48:31 AM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110018888701 AGENCY INTERESTED: 11/8/2004 7:48:29 AM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/16/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000127704 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 7:48:31 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:31 AM
DATA UPDATED: 1/5/2006 2:20:30 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 73	DIST/DIR: 0.00 --	MAP ID: 2
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 103989D - D123456 ADDRESS: SCAJAQUADA CRK EXPWY INT BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888701 ID2: NYR000127704 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 258 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: CITY OF BUFFALO PARKS ADDRESS: 17 MEADOWVIEW PLACE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9875365 ID2: 308235 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 1/28/1999	DATE REPORTED: 1/28/1999
CLOSED DATE: 12/10/1999	INSP DATE: 2/8/1999

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

MATERIAL SPILLED: WASTE OIL/USED OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 9875365 CONTAMINATED SOIL DISCOVERED WHILE UPGRADING TANKS
END CALLERREMARK - 9875365

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER: CITY OF BUFFALO
RON CARNAVLE
ADDRESS: 2001 CITY HALL
BUFFALO, NY 14202-

TELEPHONE: (716) 851-4144

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/15/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9875365 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 01/29/99: JFO SITE INPECTION, MET MARSHALL KIMMINS AND DAN COKELAND OF R and G ENGINEERING. CONTAMINATED SOIL DISCOVERED IN ABOUT THREE FEET BELOW PAVEMENT (FLYASH). 02/02/99: JFO SITE INSPECTION, MET MARSHALL. EXCAVATING CONTINUES. APPROXIMATELY THREE FEET TO VISUALLY CLEAN CLAY TYPE SOIL. CONTAMINATED SOIL AND FLY ASH BEING PLACED ON PLASTIC FOR DISPOSAL. 02/08/99: JFO RECEIVED FAX OF SAMPLE RESULTS FOR EXCAVATION WEST OF PUMPS, (NORTH AND SOUTH SAMPLES), RESULTS INDICATE INACTIVE STATUS. 02/08/99: JFO SITE INPECTION, EXCAVATION ABOUT THREE FEET DEEP, LOOKS CLEAN. MARSHALL WILL BACKFILL AND START DIGGING ON EAST SIDE OF PUMPS. ALSO NEXT WEEK HE WILL BE REMOVING WASTE OIL TANK AT THIS SITE. 02/09/99: JFO SITE INPECTION, MET MARSHALL. MORE SOIL MUST BE REMOVED. 02/10/99: JFO SITEINPECTION, MET MARSHALL, ABOUT TWO FEET OF THE PERIMETER REMOVED, LOOKS OK. HE WILL SAMPLE AND ANALYSE FOR 8021 AND 8270. THEN BACKFILL. HE WILL NOTIFY ME WHEN HE REMOVES WASTE OIL TANK. 02/17/99: JFO TELECON TO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 258	DIST/DIR: 0.00 --	MAP ID: 1
-----------------------	--------------------------	------------------

NAME: CITY OF BUFFALO PARKS ADDRESS: 17 MEADOWVIEW PLACE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9875365 ID2: 308235 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

MARSHALL, HE SAID NO DATE SET FOR WASTE OIL TANK REMOVAL. PROBABLY ABOUT 1-2 WEEKS, HE WILL NOTIFY ME. 03/30/99: JFO SITE INPSECTION, MET MARSHALL. REMOVING WASTE OIL TANK. JFO WILL INSPECT PIT THURSDAY WHEN TANK IS OUT OF THE GROUND. 04/01/99: JFO SITE INSPECTION, MET MARSHALL. TANK IS OUT, PIT LOOKS OK. MARSHALL TOOK BOTTOM SAMPLE, ANALYZE FOR 8021 AND 8270. SOIL FROM TANK UPGRADE WILL BE DISPOSED NEXT WEEK. 06/09/99: JFO RECEIVED DISPOSAL RECEIPTS. NEED ANALYTICAL FROM WASTE OIL EXCAVATION. 06/14/99: JFO TELECON TO MARSHALL KIMMINS. HE WILL FAX ANALYTICAL TONIGHT. 12/10/99: JFO RECEIVED SAMPLE RESULTS FROM THE WASTE OIL PIT. ALL BELOW STARS. THIS SITE CAN BE MADE INACTIVE DUE TO BENZENE IN THE INITIAL TANK UPGRADING AREAS. NO FURTHER ACTION REQUIRED AT THIS TIME. JFO SENT INACTIVE LETTER. CLOSED END DECRemark - 9875365

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 11	DIST/DIR: 0.00 --	MAP ID: 6
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 103989C - D123456	REV: 6/6/06
ADDRESS: SCAJAQUADA CRK EXPWY INT I-190	ID1: NYR000127712
BUFFALO NY 14213	ID2:
ERIE	STATUS: LGN
CONTACT: TOM MOORE	PHONE: 7166356291

SITE INFORMATION

CONTACT INFORMATION: TOM MOORE
CAYUGA ST SUITE 800
CHEEKTOWAGA NY 14225

PHONE: 7166356291

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 22 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: BUFFALO CITY OF PARKS DEPT	REV: 6/6/06
ADDRESS: 17 MEADOWVIEW PL	ID1: NYR000100982
BUFFALO NY 14214	ID2:
ERIE	STATUS: LGN
CONTACT: FRANK SALVO	PHONE: 7168849669

SITE INFORMATION

CONTACT INFORMATION: FRANK SALVO
17 MEADOWVIEW PL
BUFFALO NY 14214

PHONE: 7168849669

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Ignitable waste
D000
Methyl ethyl ketone

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 40 **DIST/DIR:** 0.00 -- **MAP ID:** 3

NAME: NYSDOT BIN 1001590	REV: 6/6/06
ADDRESS: MAIN ST OVER NY RT 198	ID1: NYD986968659
BUFFALO NY 14214	ID2:
ERIE	STATUS: NLR
CONTACT: DAVID R TACKLEY	PHONE: 7168473036

SITE INFORMATION

CONTACT INFORMATION: LARRY GRAZIANO
125 MAIN ST - GEN WJ DONOVAN
BUFFALO NY 14203

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

23412 - BRIDGE AND TUNNEL CONSTRUCTION
92119 - OTHER GENERAL GOVERNMENT SUPPORT

ENFORCEMENT INFORMATION:

AGENCY:	E - EPA	DATE:	10/5/1994
TYPE:	110 - VERBAL INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	E - EPA
DETERMINED:	9/29/1992	DETERMINED BY:	E - EPA

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 40	DIST/DIR: 0.00 --	MAP ID: 3
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 1001590 ADDRESS: MAIN ST OVER NY RT 198 BUFFALO NY 14214 ERIE CONTACT: DAVID R TACKLEY	REV: 6/6/06 ID1: NYD986968659 ID2: STATUS: NLR PHONE: 7168473036
------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

CITATION: 40 cfr 268.7(a)(1)
RESOLVED: 8/17/1994
TYPE: GENERATOR-LAND BAN REQUIREMENTS

HAZARDOUS WASTE INFORMATION:

Lead
D000
NONE

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 39 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: BUFFALO CITY OF DEPT OF PARKS	REV: 6/6/06
ADDRESS: 17 MEADOW VIEW DR	ID1: NY0000057240
BUFFALO NY 14214	ID2:
ERIE	STATUS: NLR
CONTACT:	PHONE:

SITE INFORMATION

CONTACT INFORMATION: JOSEPH STASZCZYK
17 MEADOW VIEW DR
BUFFALO NY 14214

PHONE: 7168849664

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

3,6-Pyridazinedione, 1,2-dihydro- (OR) Maleic hydrazide
Lindane (1,2,3,4,5,6-hexa-chlorocyclohexane, gamma isomer)
Ignitable waste
Cadmium
Nicotine, and salts (OR) Pyridine, 3-(1-methyl-2-pyrrolidinyl)-,(S)-, and salts

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 39	DIST/DIR: 0.00 --	MAP ID: 1
----------------------	--------------------------	------------------

NAME: BUFFALO CITY OF DEPT OF PARKS ADDRESS: 17 MEADOW VIEW DR BUFFALO NY 14214 ERIE CONTACT:	REV: 6/6/06 ID1: NY0000057240 ID2: STATUS: NLR PHONE:
--------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

Diphosphoric acid, tetraethyl ester (OR) Tetraethyl pyrophosphate
D000

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 38	DIST/DIR: 0.00 --	MAP ID: 8
----------------------	--------------------------	------------------

NAME: NYSDOT BIN 1039970 ADDRESS: NY RTE 198 BRG OVER SCAJAQUADA BUFFALO NY 14222 ERIE CONTACT: LARRY R GRAZIANO	REV: 6/6/06 ID1: NY0000098400 ID2: STATUS: NLR PHONE: 7168473122
---------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: LARRY R GRAZIANO
GEN DONOVAN BLDG 125 MAIN ST
BUFFALO NY 142033088

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

D000
Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 37 **DIST/DIR:** 0.00 -- **MAP ID:** 8

NAME: NYSDOT BIN 1039959 D256194	REV: 6/6/06
ADDRESS: RTE 198 RAMP C BRIDGE OVER BUFFALO NY 14222	ID1: NY0000347013
ERIE	ID2:
CONTACT: L R GRAZIANO	STATUS: NLR
	PHONE: 7168473122

SITE INFORMATION

CONTACT INFORMATION: L R GRAZIANO
GEN DONOVAN BLDG 125 MAIN
BUFFALO NY 142033088

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

D000
Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 172 **DIST/DIR:** 0.00 -- **MAP ID:** 5

NAME: FOAM IN CREEK ADDRESS: GERMAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9315020 ID2: 139335 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 3/23/1994	DATE REPORTED: 3/23/1994
CLOSED DATE: 3/23/1994	INSP DATE: 12:00:00 AM

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: UNKNOWN
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
 , ZZ

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 3/31/1994
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9315020 COMPLAINT OF FOAM IN CREEK. END CALLERREMARK - 9315020

DEC REMARKS:

Start DECRemark - 9315020 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 03/23/94: MF 3/23/94 RECEIVED REPORT FROM LAW ENFORCEMENT. SPILL REFERRED TO WATER DIVISION. NO PETROLEUM INVOLVED. NO FURTHER ACTION NECESSARY. 09/29/95: This is additional information about material spilled from the translation of the old spill file: FOAM IN CREEK. END DECRemark - 9315020

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 153 **DIST/DIR:** 0.00 -- **MAP ID:** 7

NAME: CYLINDER UNDER ROUTE 198	REV: 2/5/08
ADDRESS: NIAGARA, FOREST, RT 198	ID1: 9806367
BUFFALO NY	ID2: 120356
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 8/23/1998	DATE REPORTED: 8/23/1998
CLOSED DATE: 9/23/1998	INSP DATE: 8/23/1998

MATERIAL SPILLED: UNKNOWN HAZARDOUS MATERIAL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT: BUFFALO FD
TELEPHONE: (716) 851-5510

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 12/15/1998
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9806367 100 LB CYLINDER CONTAINING UNK MATERIAL W/A DEFECTIVE VALVE END CALLERREMARK - 9806367

DEC REMARKS:
Start DECRemark - 9806367 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 8/23/98: SAC INSPECTION, MET BUFFALO POLICE, CYLINDER WAS DUCT TAPED TO CONCRETE SUPPORT FOR ROUTE 198 OVERPASS, SAC HIRED PAUL SUOZZI,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 153	DIST/DIR: 0.00 --	MAP ID: 7
-----------------------	--------------------------	------------------

NAME: CYLINDER UNDER ROUTE 198
ADDRESS: NIAGARA, FOREST, RT 198
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 9806367
ID2: 120356
STATUS: CLOSED
PHONE:

ENVIRONMETAL SERVICE GROUP, (ESG), TO REMOVE CYLINDER, CYLINDER HAS NO VALVE OR COVER, IS STAMPED NATIONAL AMMONIA, PHILADELPHIA, PA. NO LEAKAGE, TOM FITZPATRICK, BUFFALO FIRE DEPT. WILL ALLOW US TO STAGE CYLINDER AT BUFFALO FIRE DEPT. HEADQUARTERS ON COURT STREET, HE REQUESTED WE THEN SECURE TO FENCE, PAUL SUOZZI TRANSPORTED CYLINDER TO THIS LOCATION WHERE IT IS SECURED, HE WILL CONTACT STRATE WELDING TO HANDLE AND DISPOSE OF CYLINDER, BASED ON LABELING AND ODORS THAT WERE DETECTED, IT APPEARS TO BE AN AMMONIA CYLINDER. 8/26/98: TELECON FROM PAUL SUOZZI - ESG, HE LEFT MESSAGE INDICATING THAT HE WAS ABLE TO GET IN TOUCH WITH STRATE WELDING and THEY WILL BE FOLLOWING UP. 9/1/98: SAC SPOKE TO MF, MF HAD TELECON PAUL SUOZZI, STRATE WELDING DISPOSED CYLINDER, CLOSEOUT. END DECRemark - 9806367

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 171 **DIST/DIR:** 0.00 -- **MAP ID:** 4

NAME: WASTE OIL CONTAINERS	REV: 2/5/08
ADDRESS: DART STREET SO OF RT198	ID1: 9875028
BUFFALO NY	ID2: 129481
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/15/1998	DATE REPORTED: 9/15/1998
CLOSED DATE: 1/11/1999	INSP DATE: 9/15/1998

MATERIAL SPILLED: WASTE OIL/USED OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: TOM FITZPATRICK
TELEPHONE: (716) 851-5333

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 3/19/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9875028 11 CONTAINERS OF WASTE OIL ABANDONED AT FOOT OF DART STREET END CALLERREMARK - 9875028

DEC REMARKS:
Start DECRemark - 9875028 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 09/15/98 JFO ON SITE MET DON SNELL OF RUSLANDER CO. THEY DISCOVERED SEVEN 15 GALLON AND TWO 5 GALLON CONTAINERS, AND TWO 55 GALLON DRUMS ON THE

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 171	DIST/DIR: 0.00 --	MAP ID: 4
-----------------------	--------------------------	------------------

NAME: WASTE OIL CONTAINERS ADDRESS: DART STREET SO OF RT198 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9875028 ID2: 129481 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

WEST SIDE OF THEIR BUILDING AT 5 AM. CONTENTS UNKNOWN BUT APPEAR TO BE WASTE OIL ONLY MINOR SPILLAGE. BECI NOTIFIED, JIM GROEBE IS INVESTIGATING. 09/16/98 JFO HIRED A STATE CONTRACTOR, NATURE S WAY, TO CLEANUP AND REMOVE CONTAINERS 09/23/98 JFO RECEIVED ANALYTICAL. HARZARDOUS FOR IGNITABILITY 10/01/98 JFO RECEIVED AND REVIEWED PAYMENT PACK, SIGNED BY FG. DISPOSAL RECEIPTS AND FINAL PAYENMT PACKAGE TO FOLLOW. 01/11/99 JFO RECEIVED DISPOSAL RECEIPTS AND FINAL PAYMENT PACKAGE, SUBMITTED TO FG. NO FURTHER ACTION REQUIRED. CLOSEOUT SPILL END DECRemark - 9875028

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 194 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: CITY OF BUFFALO PARKS ADDRESS: 17 MEADOWVIEW PLACE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9875365 ID2: 308235 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 1/28/1999 CLOSED DATE: 12/10/1999	DATE REPORTED: 1/28/1999 INSP DATE: 2/8/1999
----------------------------------------------------------------	---------------------------------------------------------------

MATERIAL SPILLED: DIESEL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------	------------------------------------------------------------

MATERIAL SPILLED: WASTE OIL/USED OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: NO INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: YES DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------

RESOURCE AFFECTED

SOIL: NO INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: YES DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER: CITY OF BUFFALO
RON CARNAVLE
ADDRESS: 2001 CITY HALL
BUFFALO, NY 14202-

TELEPHONE: (716) 851-4144

REPORTED BY: RESPONSIBLE PARTY

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 194 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: CITY OF BUFFALO PARKS	REV: 2/5/08
ADDRESS: 17 MEADOWVIEW PLACE	ID1: 9875365
BUFFALO NY	ID2: 308235
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

LAST DEC UPDATE: 3/15/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9875365 CONTAMINATED SOIL DISCOVERED WHILE UPGRADING TANKS END CALLERREMARK - 9875365

DEC REMARKS:

Start DECRemark - 9875365 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 01/29/99: JFO SITE INPECTION, MET MARSHALL KIMMINS AND DAN COKELAND OF R and G ENGINEERING. CONTAMINATED SOIL DISCOVERED IN ABOUT THREE FEET BELOW PAVEMENT (FLYASH). 02/02/99: JFO SITE INSPECTION, MET MARSHALL. EXCAVATING CONTINUES. APPROXIMATELY THREE FEET TO VISUALLY CLEAN CLAY TYPE SOIL. CONTAMINATED SOIL AND FLY ASH BEING PLACED ON PLASTIC FOR DISPOSAL. 02/08/99: JFO RECEIVED FAX OF SAMPLE RESULTS FOR EXCAVATION WEST OF PUMPS, (NORTH AND SOUTH SAMPLES), RESULTS INDICATE INACTIVE STATUS. 02/08/99: JFO SITE INPECTION, EXCAVATION ABOUT THREE FEET DEEP, LOOKS CLEAN. MARSHALL WILL BACKFILL AND START DIGGING ON EAST SIDE OF PUMPS. ALSO NEXT WEEK HE WILL BE REMOVING WASTE OIL TANK AT THIS SITE. 02/09/99: JFO SITE INPSECTION, MET MARSHALL. MORE SOIL MUST BE REMOVED. 02/10/99: JFO SITEINPSECTION, MET MARSHALL, ABOUT TWO FEET OF THE PERIMETER REMOVED, LOOKS OK. HE WILL SAMPLE AND ANALYSE FOR 8021 AND 8270. THEN BACKFILL. HE WILL NOTIFY ME WHEN HE REMOVES WASTE OIL TANK. 02/17/99: JFO TELECON TO MARSHALL, HE SAID NO DATE SET FOR WASTE OIL TANK REMOVAL. PROBABLY ABOUT 1-2 WEEKS, HE WILL NOTIFY ME. 03/30/99: JFO SITE INPSECTION, MET MARSHALL. REMOVING WASTE OIL TANK. JFO WILL INSPECT PIT THURSDAY WHEN TANK IS OUT OF THE GROUND. 04/01/99: JFO SITE INSPECTION, MET MARSHALL. TANK IS OUT, PIT LOOKS OK. MARSHALL TOOK BOTTOM SAMPLE, ANALYZE FOR 8021 AND 8270. SOIL FROM TANK UPGRADE WILL BE DISPOSED NEXT WEEK. 06/09/99: JFO RECEIVED DISPOSAL RECEIPTS. NEED ANALYTICAL FROM WASTE OIL EXCAVATION. 06/14/99: JFO TELECON TO MARSHALL KIMMINS. HE WILL FAX ANALYTICAL TONIGHT. 12/10/99: JFO RECEIVED SAMPLE RESULTS FROM THE WASTE OIL PIT. ALL BELOW STARS. THIS SITE CAN BE MADE INACTIVE DUE TO BENZENE IN THE INITIAL TANK UPGRADING AREAS. NO FURTHER ACTION REQUIRED AT THIS TIME. JFO SENT INACTIVE LETTER. CLOSED END DECRemark - 9875365

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 243 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: DELAWARE LABOR CENTER ADDRESS: 17 MEADOWVIEW PL BUFFALO NY 14214 ERIE CONTACT: DAVID LAWLER	REV: 2/5/08 ID1: PBS9-427268 ID2: STATUS: ACTIVE PHONE: (716) 851-4144
------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: OTHER
TYPE NAME:
TOTAL NUMBER OF TANKS: 6
NUMBER OF ACTIVE TANKS: 3
NUMBER OF INACTIVE TANKS: 3
TOTAL FACILITY CAPACITY: 8550 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: LOCAL GOVERNMENT
COMPANY: CITY OF BUFFALO - DEPT. OF INVENTORY AND STORES
TITLE: SUPT. AUTO SUPPLIES
NAME: DAVID LAWLER
ADDRESS: 2001 CITY HALL
NY 14202
PHONE: (716) 851-4144
EMERGENCY CONTACT: DAVID LAWLER
PHONE: (716) 851-4144

MAILING INFORMATION

COMPANY: DEPARTMENT OF INVENTORY AND STORES
TITLE:
CONTACT: DAVID LAWLER
ADDRESS: 2001 CITY HALL 65 NIAGARA STREET
BUFFALO NY 14202
PHONE: (716) 851-4144
EMAIL:

EXP. DATE: 12/14/2007
RENEWAL DATE: 8/5/2002

COMMENTS: 8/4/99 4k gas tank and 4k diesel tank have been upgraded. 550 gal w aste oil tank has been removed. Need paperwork on upgrades. Need ana lytical for waste oil tank removal.(no prior notification) AES

TANK INFORMATION

<u>TANK NUMBER:</u>	001	TANK STATUS:	IN SERVICE
ACTIVE STATUS:	ACTIVE	INSTALLED:	12:00:00 AM
CLOSED:	12:00:00 AM	TANK CAPACITY:	550 GALLONS
PRODUCT:	WASTE OIL/USED OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 243 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: DELAWARE LABOR CENTER ADDRESS: 17 MEADOWVIEW PL BUFFALO NY 14214 ERIE CONTACT: DAVID LAWLER	REV: 2/5/08 ID1: PBS9-427268 ID2: STATUS: ACTIVE PHONE: (716) 851-4144
------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: ABOVEGROUND/UNDERGROUND COMBINATION
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 1	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91	
ACTIVE STATUS: INACTIVE	INSTALLED: 10/1/1971	
CLOSED: 12:00:00 AM	TANK CAPACITY: 3000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 11/1/1987
NEXT TEST: 12:00:00 AM
TEST METHOD: HORNER EZ CHECK I OR II

<u>TANK NUMBER:</u> 2	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91	
ACTIVE STATUS: INACTIVE	INSTALLED: 10/1/1971	
CLOSED: 12:00:00 AM	TANK CAPACITY: 3000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 243 **DIST/DIR:** 0.00 -- **MAP ID:** 1

NAME: DELAWARE LABOR CENTER ADDRESS: 17 MEADOWVIEW PL BUFFALO NY 14214 ERIE CONTACT: DAVID LAWLER	REV: 2/5/08 ID1: PBS9-427268 ID2: STATUS: ACTIVE PHONE: (716) 851-4144
------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 11/1/1987
NEXT TEST: 12:00:00 AM
TEST METHOD: HORNER EZ CHECK I OR II

<u>TANK NUMBER:</u> 3	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91	
ACTIVE STATUS: INACTIVE	INSTALLED: 10/1/1971	
CLOSED: 12:00:00 AM	TANK CAPACITY: 3000 GALLONS	
PRODUCT: DIESEL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 11/1/1987
NEXT TEST: 12:00:00 AM
TEST METHOD: HORNER EZ CHECK I OR II

<u>TANK NUMBER:</u> 891	TANK STATUS: IN SERVICE	
--------------------------------	--------------------------------	--

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 118

DIST/DIR: 0.01 NE

MAP ID: 13

NAME: PARKWAY CYTOLOGY LABORATORY INC
ADDRESS: 2121 MAIN ST
BUFFALO NY 14214
Erie
CONTACT:

REV:
ID1: NYD080328883
ID2:
STATUS:
PHONE:

RCRIS : NYD080328883
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 119 **DIST/DIR:** 0.01 NE **MAP ID:** 13

NAME: PARKWAY CYTOLOGY LABORATORY INC ADDRESS: 2121 MAIN ST BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110004370975 ID2: NYD080328883 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110004370975 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/8/1999 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD080328883 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:45:59 AM
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 11:20:06 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 42 **DIST/DIR:** 0.01 NE **MAP ID:** 13

NAME: PARKWAY CYTOLOGY LABORATORY INC ADDRESS: 2121 MAIN ST BUFFALO NY 14214 ERIE CONTACT:	REV: 6/6/06 ID1: NYD080328883 ID2: STATUS: NLR PHONE:
-----------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: ANN BRACCO
2121 MAIN ST
BUFFALO NY 14214

PHONE: 7168379336

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

621511 - MEDICAL LABORATORIES

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Ignitable waste
Benzene, dimethyl- (I,T) (OR) Xylene (I)

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 174 **DIST/DIR:** 0.01 NE **MAP ID:** 20

NAME: POLE TOP ADDRESS: AMHERST ST GRANT BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0608235 ID2: 372140 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/18/2006	DATE REPORTED: 10/18/2006
CLOSED DATE: 1/26/2007	INSP DATE: 10/23/2006

MATERIAL SPILLED: TRANSFORMER OIL	AMOUNT SPILLED: 10 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 10 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: YES
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: OTHER
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: LISA FREDERICKS
TELEPHONE: (716) 479-5339

SPILLER: POLE TOP
LISA FREDERICKS
ADDRESS: AMHURST / GRANT
BUFFALO, NY

TELEPHONE: (716) 479-5339

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 1/26/2007
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0608235 DUE TO STORM AND CREW ENROUTE TO CLEAN UP: END
CALLERREMARK - 0608235

DEC REMARKS:
Start DECRemark - 0608235 10/23/06 JFO ON SITE THE SPILL IS CLEANED UP. 1 DRUMS ON SITE FOR DISPOSAL. NATIONAL GRID REPORT INDICATES SPILL IS CLEANED UP AND INCLUDED IS A RECEIPT FOR 1 DRUM. CLOSED FOR MORE INFORMATION SEE

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 174	DIST/DIR: 0.01 NE	MAP ID: 20
-----------------------	--------------------------	-------------------

NAME: POLE TOP ADDRESS: AMHERST ST GRANT BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0608235 ID2: 372140 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SPILL 0607997. END DECRemark - 0608235

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 173 **DIST/DIR:** 0.01 NE **MAP ID:** 20

NAME: BUFFALO FIRE LADDER 12	REV: 2/5/08
ADDRESS: AMHERST ST and GRANT ST	ID1: 9911520
BUFFALO NY	ID2: 77250
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 1/3/2000	DATE REPORTED: 1/3/2000
CLOSED DATE: 12/4/2000	INSP DATE: 1/25/2000

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: OTHER
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: OTHER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: DAN KOLKMANN
TELEPHONE: (716) 856-2142

SPILLER: CITY OF BUFFALO
DAN KOLKMANN
ADDRESS: 1100 CITY HALL
BUFFALO, NY 14202-

TELEPHONE: (716) 856-2142

REPORTED BY: OTHER

LAST DEC UPDATE: 12/29/2000
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9911520 DURING A SCHEDULED TANK REMOVAL TANK WAS UNCOVERED TODAY AND THEY FOUND CONTAMINATED SOIL END CALLERREMARK - 9911520

DEC REMARKS:
Start DECRemark - 9911520 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 01/25/00: FG SITE INSPECTION. UST REMOVED. SOILS WERE CLAY. MINOR AMOUNT OF CONTAMINATION REMAINED UNDER THE BUILDING. 08/09/00: FG RECEIVED

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 173	DIST/DIR: 0.01 NE	MAP ID: 20
-----------------------	--------------------------	-------------------

NAME: BUFFALO FIRE LADDER 12 ADDRESS: AMHERST ST and GRANT ST BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9911520 ID2: 77250 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

LADDER 12 CLOSURE REPORT. IT INCLUDES DISPOSAL RECEIPTS and BORING DATA. B2 DATA IS ABOVE STARS 8021 AT 3878 PPB. B1 DATA IS BELOW STARS. ONLY B1 ANALYTICAL DATA FROM THE LAB IS PROVIDED. FG TELECON TO JENNIFER MURRAY TO DISCUSS POSSIBLE REMEDIAL OPTIONS/RESAMPLING AND WHY B2 ANALYTICAL IS NOT INCLUDED. 08/09/00: FG TELECON FROM JENNIFER MURRAY, SHE SAID THAT THE B1 DATA IS FROM ANOTHER SITE AND SHE WASN T SURE ABOUT THE REMEDIATION AT THE SITE. SHE WILL TRY TO DO THE RESAMPLING. SHE WILL SUBMIT THE CORRECT DATA FOR THE SITE. 09/14/00: FG TELECON FROM JENNIFER MURRAY, SHE SAID SHE WILL BE COLLECTING SAMPLES FOR TCLP ANALYSIS TODAY. PETER MERLO WILL ALSO BE ON SITE - CELL PHONE 510-5470. 12/04/00: FG RECEIVED RESULTS OF RESAMPLING AT B1 AND B2. THERE WAS NOTHING ABOVE STARS AT LOCATION B1. AT LOCATION B2, THERE WAS A SLIGHT EXCEEDANCE OF STARS AT THE 11 - 12 FT INTERVAL. ETHYLBENZENE AT 11 PPB, XYLENES AT 30 PPB, 1,2,4-TRIMETHYLBENZENE AT 21 PPB. ALL DISPOSAL RECEIPTS HAVE BEEN SUBMITTED AS WELL AS ALL ANALYTICAL RESULTS. NO FURTHER WORK IS REQUIRED. THE SITE CAN BE MADE INACTIVE. END DECRemark - 9911520

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 74 **DIST/DIR:** 0.01 NW **MAP ID:** 11

NAME: NYSDOT BRIDGE BIN 103989E	REV: 11/1/06
ADDRESS: RTE 198 OFF RAMP TO NIAGARA ST	ID1: 110018888658
BUFFALO NY 14203	ID2: NYR000127670
ERIE	STATUS: FRS
CONTACT:	PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO	PROGRAM ID: NYR000127670
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED:
AGENCY INT QUAL:	INTEREST ENDED:
INT END QUAL:	SOURCE OF DATA: RCRAINFO
LAST REPORTED: 7/16/2004	LAST EXTRACTED: 11/8/2004 7:48:16 AM

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: FRS	PROGRAM ID: 110018888658
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED: 11/8/2004 7:48:16 AM
AGENCY INT QUAL:	INTEREST ENDED:
INT END QUAL:	SOURCE OF DATA: RCRAINFO
LAST REPORTED: 11/8/2004 7:48:16 AM	LAST EXTRACTED:
ENFORCEMENT ACT:	
REG PROGRAM: FACILITY -	

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: DIRECTION
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:16 AM
DATA UPDATED: 1/5/2006 2:20:22 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 74	DIST/DIR: 0.01 NW	MAP ID: 11
----------------------	--------------------------	-------------------

NAME: NYSDOT BRIDGE BIN 103989E ADDRESS: RTE 198 OFF RAMP TO NIAGARA ST BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888658 ID2: NYR000127670 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 109 **DIST/DIR:** 0.01 NW **MAP ID:** 15

NAME: NYSDOT BIN 1039990 ADDRESS: PEDRESTRIAN BRG OVER RTE 198 BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110008105380 ID2: NYR000062364 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 10/20/1998 ENFORCEMENT ACT:	PROGRAM ID: NYR000062364 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110008105380 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 1:22:37 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 109	DIST/DIR: 0.01 NW	MAP ID: 15
-----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 1039990 ADDRESS: PEDRESTRIAN BRG OVER RTE 198 BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110008105380 ID2: NYR000062364 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 12 **DIST/DIR:** 0.01 NW **MAP ID:** 11

NAME: NYSDOT BRIDGE BIN 103989E	REV: 6/6/06
ADDRESS: RTE 198 OFF RAMP TO NIAGARA ST	ID1: NYR000127670
BUFFALO NY 14213	ID2:
ERIE	STATUS: LGN
CONTACT: DAVID R TACKLEY	PHONE: 7168473036

SITE INFORMATION

CONTACT INFORMATION: DAVID TACKLEY
MAIN ST
BUFFALO NY 142033088

PHONE: 7168473036

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 126

DIST/DIR: 0.01 SE

MAP ID: 18

NAME: NYSDOT BIN 1022680

REV:

ADDRESS: RTE 33EB RAMP TO RTE 198WB
 BUFFALO NY 14204
 Erie

ID1: NYD982797276

ID2:

STATUS:

CONTACT:

PHONE:

RCRIS : NYD982797276

PCS :

AFS/AIRS :

SSTS :

CERCLIS :

NCDB :

ENF DOCKET :

CONTR LIST :

CRIM DOCKET :

FFIS :

CICIS :

STATE :

PADS :

TRIS :

DandB :

UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 75 **DIST/DIR:** 0.01 SE **MAP ID:** 9

NAME: NYSDOT BRIDGE BIN 103989F ADDRESS: RTE 198 ON RAMP FROM NIAGARA BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888676 ID2: NYR000127688 STATUS: FRS PHONE:
---------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/8/2004 7:48:21 AM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110018888676 AGENCY INTERESTED: 11/8/2004 7:48:21 AM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/16/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000127688 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 7:48:22 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: DIRECTION
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:21 AM
DATA UPDATED: 1/5/2006 2:20:23 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 75	DIST/DIR: 0.01 SE	MAP ID: 9
----------------------	--------------------------	------------------

NAME: NYSDOT BRIDGE BIN 103989F ADDRESS: RTE 198 ON RAMP FROM NIAGARA BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888676 ID2: NYR000127688 STATUS: FRS PHONE:
---------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 125 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: NYSDOT BIN 1022660 ADDRESS: DELEVAN AVE OVER RTE 33 BUFFALO NY 14209 ERIE CONTACT:	REV: 11/1/06 ID1: 110008077204 ID2: NYD987008331 STATUS: FRS PHONE:
---------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110008077204 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/10/1992 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NYD987008331 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:43:39 AM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/5/2006 9:25:56 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 127 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: NYSDOT BIN 1022680 ADDRESS: HUMBOLDT PKY OVER RT 33 BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110008033706 ID2: NYD982797276 STATUS: FRS PHONE:
---------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110008033706 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/18/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD982797276 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:44:53 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/5/2006 2:20:47 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120103
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 124

DIST/DIR: 0.01 SE

MAP ID: 18

NAME: NYSDOT BIN 1022660

REV:

ADDRESS: DELEVAN AVE OVER RTE 33
BUFFALO NY 14209
Erie

ID1: NYD987008331

ID2:

STATUS:

CONTACT:

PHONE:

RCRIS : NYD987008331

PCS :

AFS/AIRS :

SSTS :

CERCLIS :

NCDB :

ENF DOCKET :

CONTR LIST :

CRIM DOCKET :

FFIS :

CICIS :

STATE :

PADS :

TRIS :

DandB :

UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 13	DIST/DIR: 0.01 SE	MAP ID: 9
----------------------	--------------------------	------------------

NAME: NYSDOT BRIDGE BIN 103989F ADDRESS: RTE 198 ON RAMP FROM NIAGARA BUFFALO NY 14213 ERIE CONTACT: DAVID R TACKLEY	REV: 6/6/06 ID1: NYR000127688 ID2: STATUS: LGN PHONE: 7168473036
-------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: DAVID TACKLEY
MAIN ST
BUFFALO NY 142033088

PHONE: 7168473036

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 44 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: NYSDOT BIN 1022660	REV: 6/6/06
ADDRESS: DELEVAN AVE OVER RTE 33	ID1: NYD987008331
BUFFALO NY 14208	ID2:
ERIE	STATUS: NLR
CONTACT: EDWARD WALEK	PHONE: 7168473122

SITE INFORMATION

CONTACT INFORMATION: EDWARD WALEK
GEN WM J DONOVAN BLDG 125 MAIN ST
BUFFALO NY 14203

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead
D000

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 45 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: NYSDOT BIN 1022680	REV: 6/6/06
ADDRESS: HUMBOLDT PKY OVER RT 33	ID1: NYD982797276
BUFFALO NY 14208	ID2:
ERIE	STATUS: NLR
CONTACT: DAVID R TACKLEY	PHONE: 7168473036

SITE INFORMATION

CONTACT INFORMATION: JOSEPH INGALLS
RTE 33EB RAMP TO RTE 198WB
BUFFALO NY 14204

PHONE: 6073247580

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 169 **DIST/DIR:** 0.01 SE **MAP ID:** 22

NAME: WARD TRUCKING	REV: 2/5/08
ADDRESS: ROUTE 198 EB	ID1: 0075255
BUFFALO NY	ID2: 207925
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 7/24/2000	DATE REPORTED: 7/24/2000
CLOSED DATE: 7/24/2000	INSP DATE: 7/24/2000

MATERIAL SPILLED: LITHIUM	AMOUNT SPILLED: 1000 L
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 1000 L

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RJJONAK
SPILL CONTACT: PETE VANKERTHOVEN
TELEPHONE: (716) 874-3688

SPILLER: WARD TRUCKING
THOMAS REGER
ADDRESS: 4885 RIVER ROAD
TONAWANDA, NY 14150-

TELEPHONE: (716) 874-3688

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 10/5/2000
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0075255 TRACTOR TRAILER ROLLOVER. NO SPILLAGE FROM TANKS ON TRUCK, BUT CARGO WAS FOUR 1,000-LB. CONTAINERS OF LITHIUM. ONE OF THE CONTAINERS SPLIT AND CONTENTS SPILLED. HAZMAT TEAM ON-SCENE. END CALLERREMARK - 0075255

DEC REMARKS:
Start DECRemark - 0075255 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RJJ 07/24/2000: RJJ SITE INVESTIGATION AT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 169	DIST/DIR: 0.01 SE	MAP ID: 22
-----------------------	--------------------------	-------------------

NAME: WARD TRUCKING ADDRESS: ROUTE 198 EB BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0075255 ID2: 207925 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

1530...A WARD TRUCKING TRUCK OVERTURNED ON THE EASTBOUND ROUTE 198 RAMP OVER NIAGARA ST...HE WAS TRANSPORTING FIVE 1000 POUND CONTAINERS OF LITHIUM LUBE GREASE...ONE OF THE CONTAINERS OPENED AND ABOUT 400 LBS OF GREASE WAS SPILLED ALL OVER THE ROAD...NO FUEL OR ANY TRUCK FLUIDS LEAKED...THE TRUCK WAS HANGING OVER THE RAMP, OVER NIAGARA ST...THE STATE POLICE CLOSED ROUTE 198 IN BOTH DIRECTIONS AND NIAGARA ST. WAS CLOSED UNDER THE RAMP...I MEET WITH WARD TRUCKING REPRESENTATIVE PETE VANKERKHOVEN, HE SAID THAT THEY WILL DO WHATEVER THEY HAVE TO CLEAN UP THE GREASE...BUFFALO FIRE DEPT. AND THE HAZ-MAT TEAMS WERE THERE AND HELPED IN THE CLEAN UP...JOHN S WRECKING WAS HIRED TO UPLIFT THE TRUCK AND CLEAN UP THE GREASE...THE NYS THRUWAY ALSO HELPED WITH BRINGING SAND AND A SWEEPER TO CLEAN UP THE GREASE, WHICH WAS VERY DIFFICULT TO COMPLETELY GET OFF THE ROAD, WHICH WAS VERY SLIPPERY...AFTER A LONG CLEAN UP PROJECT, THE ROAD WAS REOPENED...SINCE THERE WAS NO PETROLEUM SPILLAGE OF ANY KIND, AND THE GREASE WAS ALL CLEANED UP, NO FURTHER ACTION NEEDED...SPILL CLOSED OUT. 09/22/2000: RJJ RECEIVED THE DISPOSAL RECEIPTS FROM EPandS FOR TEN DRUMS OF SPEEDI-DRY/GREASE, DISPOSED AT ENVIRONMENTAL PRODUCTS and SERVICES IN SYRACUSE,....ALL THE RECEIPTS ARE IN ORDER. END DECRemark - 0075255

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 207 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: BUFFALO FUEL - HAZ WASTE	REV: 2/5/08
ADDRESS: ROUTE 33 RAMP ROUTE 198	ID1: 0001030
BUFFALO NY	ID2: 198314
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/25/2000	DATE REPORTED: 4/25/2000
CLOSED DATE: 5/12/2000	INSP DATE: 4/26/2000

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 3 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 3 G

MATERIAL SPILLED: LEAD	AMOUNT SPILLED: 0 L
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0 L

MATERIAL SPILLED: CADMIUM	AMOUNT SPILLED: 0 L
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0 L

MATERIAL SPILLED: SELENIUM	AMOUNT SPILLED: 0 L
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 207 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: BUFFALO FUEL - HAZ WASTE ADDRESS: ROUTE 33 RAMP ROUTE 198 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0001030 ID2: 198314 STATUS: CLOSED PHONE:
---------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SEWER: NO SUBWAY: NO	IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------	-------------------------------------------------------------------

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: BUFFALO FUEL CORP
 SAM SANTAROSA
ADDRESS: 344 VALCAN STREET
 BUFFALO, NY 14207-1327

TELEPHONE: (716) 873-7196

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 6/2/2000
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0001030 REQ CALL BACK ASAP FD ON SCENE UN 3077
 PLACARDED ON REAR OF TRK INC 00009581 END CALLERREMARK - 0001030

DEC REMARKS:

Start DECRemark - 0001030 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 04/24/00: MF SITE INSPECTION, MET SAM SANTAROSA, JIM BUCKI, ETC, BUFFALO FUEL/BFD/BPD. OPEN TRAILER CARRYING C and D DEBRIS CONTAMINATED WITH LEAD, CADMIUM and SELENIUM FAILED TO NEGOTIATE TURN ONTO ROUTE 198 WHILE TRAVELING WEST ON ROUTE 33. TIPPED OVER and SPILLED CONTENTS, RQ HAZ WASTE SOLID NOS 9 NA 3077 III, (LEAD CADMIUM SELENIUM), CL4979 D008, D010. ALONG WITH MOTOR OIL, HYDRAULIC FLUID and MINOR AMOUNT OF DIESEL. TRUCKER WAS WORKING FOR BUFFALO FUEL TAKING WASTE FROM PHELPS DODGE REFINING CORP, 42-02 56TH RD, MESPETH NY 11378-2003. USEPA ID 001293489, 718-482-3928 TO CWM CHEMICAL, 1515 BALMER RD, MODEL CITY, NY 14107. ROUTE 198 RAMP SHUT DOWN WHILE RUSINIAK TOWING RIGHTED THE TRACTOR TRAILER, IWR, JIM BUCKI WILL CLEAN UP ROAD and TRANSFER WASTE FOR TRANSPORT TO MODEL CITY. DIESEL and WASTE OIL CLEANUP DEBRIS WILL BE PLACED WITH HAZ WASTE FOR DISPOSAL. WIPE SAMPLES WILL THEN BE TAKEN OF SPILL AREA. SAM TO PROVIDE ME WITH COPY OF LANDFILL SIGNED HAZ WASTE MANIFEST and SAMPLING RESULTS. 04/25/00: MF SITE INSPECTION, AREA CLEANED and OPEN TO TRAFFIC. 05/10/00: MF RECEIVED FAX OF WIPE SAMPLE RESULTS. ND FOR CADMIUM and SELENIUM, LEAD IN DUST WIPE 7.56 and 35.5 MICRO GRAMS/WIPE, TCLP. 05/12/00: MF DISCUSSION WITH TOM CORBETT, HE TOLD ME WE DO NOT REGULATE ANYTHING BUT PCB S WITH WIPE SAMPLES. HIS CONCLUSION IS THAT LEAD IS FORM VEHICLES FROM OVER THE YEARS. ALSO RECEIVED SIGNED HAZ WASTE MANIFEST. NO FURTHER ACTION NECESSARY. END DECRemark - 0001030

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 205 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: AMHERST PAVING	REV: 2/5/08
ADDRESS: ROUTE 33-WB AT ROUTE 198	ID1: 9410366
BUFFALO NY	ID2: 129765
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/3/1994	DATE REPORTED: 11/3/1994
CLOSED DATE: 3/29/1995	INSP DATE: 2/17/1995

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 75 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 70 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: PRINGLE
SPILL CONTACT:
TELEPHONE:

SPILLER: AMHERST PAVING
ADDRESS: 330 MYER ROAD
AMHERST, NY 14226

TELEPHONE: (716) 834-4961

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 4/25/1995
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9410366 TRAFFIC ACCIDENT CAUSED SPILL OF DIESEL FUEL FROM SADDLE TANK ON DUMP TRUCK. END CALLERREMARK - 9410366

DEC REMARKS:
Start DECRemark - 9410366 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 11/03/94: 11/3/94 MNP RESPONSE. BUFFALO FD ON SCENE CONTAINING SPILL W/ EARTHEN DIKES and COLLECTING PRODUCT W/ BUCKETS. RESP. PARTY HIRED CARMEN

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 205	DIST/DIR: 0.01 SE	MAP ID: 18
-----------------------	--------------------------	-------------------

NAME: AMHERST PAVING ADDRESS: ROUTE 33-WB AT ROUTE 198 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9410366 ID2: 129765 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

COSTA TO DO CLEANUP. DRUMS OF FUEL and DEBRIS LEFT ON SITE. 11/04/94: 11/4/94 MNP INSP. 1 DRUM OF DIESEL FUEL and 2 DRUMS OF DEBRIS ON SITE NEXT TO ROCK ABUTEMENT. 01/25/95: 1/25/95 MNP INSP. 1 DRUM OF DIESEL FUEL and 2 DRUMS OF DEBRIS REMAIN ON SITE NEXT TO ROCK ABUTEMENT. 02/14/95: 2/9,10/95 MNP TELECONS TO DAVE ROETZER - AMHERST PAVING. UNABLE TO CONTACT. HE TRIED TO RETURN CALL ON 2/13/95. 2/14/95 TELECON W/ SECRETARY, ROETZER OUT UNTIL END OF WEEK, LEFT MESSAGE ABOUT DRUMS. 02/16/95: 2/16/95 LETTER TO ROETZER - AMHERST. REQUESTED DISPOSAL BY 3/15/95. 02/17/95: 2/17/95 MNP TELECON W/ DAVE ROETZER - AMHERST PAVING. HE WILL PICKUP OIL DRUM and REUSE, THEN RETURN DRUM TO BUFFALO FD. TO CONTACT CONTRACTOR ABOUT DISPOSAL OF OTHER DRUMS. 03/01/95: 3/1/95 PHONE MESSAGE FROM SNIDERHAN - BUFFALO FD. CONTRACTOR RETURNED THEIR OVERPACK DRUM. 03/15/95: 3/15/95 MNP TELECON W/ LEONARD LITWIN - AMHERST PAVING. 3/13/95 DEC RECEIVED WASTE APPROVAL LETTERS and INVOICE FOR DISPOSAL, ETC. FROM CES. STILL NEED DISPOSAL RECEIPT FROM MODERN LANDFILL. 03/21/95: 3/21/95 MNP TELECON W/ CARMEN COSTA - CES. DRUMS OF DEBRIS NOT DISPOSED AT MODERN LANDFILL YET. DRUMS STAGED AT CES, WAITING FOR APPROVAL and CONTAINER FROM MODERN LANDFILL. 03/29/95: 3/29/95 RECEIVED FAX COPY OF SOIL DISPOSAL RECEIPT FROM CES. DEBRIS DISPOSED AT MODERN LANDFILL 3/23/95. NO FURTHER ACTION NEEDED, COMPLETE. END DECRemark - 9410366

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 147 **DIST/DIR:** 0.01 SE **MAP ID:** 21

NAME: ABANDONED DRUMS VACANT LO	REV: 2/5/08
ADDRESS: 1590 NIAGARA ST	ID1: 0175459
BUFFALO NY	ID2: 93405
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 12/1/2001	DATE REPORTED: 12/19/2001
CLOSED DATE: 12/20/2001	INSP DATE: 12/19/2001

MATERIAL SPILLED: UNKNOWN HAZARDOUS MATERIAL	AMOUNT SPILLED: 165 G
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 165 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: VESSEL
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
 , ZZ

TELEPHONE:

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 12/21/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0175459 MR FITZPATRICK SAID 3-55 GALLON DRUMS ARE ABANDONED ON THIS LOT. 2 ARE STAINLESS STEEL AND 1 IS STEEL. NOT LEAKING AT THIS TIME. END CALLERREMARK - 0175459

DEC REMARKS:
Start DECRemark - 0175459 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 12/19/01 JFO ON SITE NO DRUMS IN THE AREA. 1 SPOKE WITH RICH FROM HOHL INDUSTRIES NEXT DOOR. HE SAID A RED DODGE PICKUP LICENSE 58330AU PULLED UP

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 147	DIST/DIR: 0.01 SE	MAP ID: 21
-----------------------	--------------------------	-------------------

NAME: ABANDONED DRUMS VACANT LO
ADDRESS: 1590 NIAGARA ST
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 0175459
ID2: 93405
STATUS: CLOSED
PHONE:

AND TOOK THE 3 DRUMS. I FOUND NO SIGN OF SPILLAGE. NO FURTHER ACTION NECESSARY. CLOSED THERE IS NO PAPER FILE FOR THIS SPILL END DECRemark - 0175459

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 206 **DIST/DIR:** 0.01 SE **MAP ID:** 18

NAME: AUTO ACCIDENT	REV: 2/5/08
ADDRESS: RT 198 and RT 33	ID1: 9006316
BUFFALO NY	ID2: 272259
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/9/1990	DATE REPORTED: 9/9/1990
CLOSED DATE: 9/12/1990	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: SAND	AMOUNT SPILLED: 0 L
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: PASSENGER VEHICLE
REPORTED BY: POLICE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MJHINTON
SPILL CONTACT:
TELEPHONE:

SPILLER: PRIVATE VEHICLE

ADDRESS:
 , ZZ

TELEPHONE:

REPORTED BY: POLICE DEPARTMENT

LAST DEC UPDATE: 12/2/2003
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9006316 CAR HIT SAND FILLED TRAFFIC BARRIERS END
CALLERREMARK - 9006316

DEC REMARKS:
Start DECRemark - 9006316 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJH 09/12/90: NO SPILL NO ACTION BY SPILL
UNIT NEEDED. END DECRemark - 9006316

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 206

DIST/DIR: 0.01 SE

MAP ID: 18

NAME: AUTO ACCIDENT

REV: 2/5/08

ADDRESS: RT 198 and RT 33

ID1: 9006316

BUFFALO NY

ID2: 272259

ERIE

STATUS: CLOSED

CONTACT:

PHONE:

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 219 **DIST/DIR:** 0.01 SE **MAP ID:** 17

NAME: SCAJAQUADA CREEK ADDRESS: WEST AVE BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8603086 ID2: STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 08/08/86	DATE REPORTED: 08/08/86
SPILL TIME: 11:00	TIME REPORTED: 11:45

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: 100 G
MATERIAL CLASS: UNKNOWN	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL:	OTHER
RESOURCE AFFECTED:	SURFACE WATER
WATERBODY AFFECTED:	SCAJAQUADA CREEK
SOURCE OF SPILL:	COMMERCIAL/INDUSTRIAL
REPORTED BY:	OTHER

CALLER REMARKS:
OVERFLOW FROM CLOGGED SEWER, OVERFLOW HAD DISCHARGE FROM PRATT and LAMBERT, REPORTED BY PRATT and LAMBERT

REGION: 9	UST TRUST? NO	
------------------	----------------------	--

SPILL INVESTIGATOR: RNL	
SPILL CONTACT:	TELEPHONE:

SPILLER: PRATT and LAMBERT ADDRESS: WEST AVENUE BUFFALO, N. Y.,	
SPILLER CONTACT:	TELEPHONE: (716) 873-6000

CALLER: AGENCY: TELEPHONE:	NOTIFIER: AGENCY: TELEPHONE:
-------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 01/14/87	CLOSE DATE: 01/13/87
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO

DEC REMARKS:
/ / : REFERRED TO AREA ENGINEER, T. WANTUCK INVESTIGATING. / / : REFERRED TO WATER, T. WANTUCK, 08/08/86; WATER, T. WANTUCK, SATISFIED 01/13/87, CLOGGED SEWER CLEANED. / / : REFERRED TO WATER, T. WANTUCK 8/8/86.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 247 **DIST/DIR:** 0.01 SE **MAP ID:** 19

NAME: WM C MAUNZ CO INC ADDRESS: 387 E DELAVAN AVE BUFFALO NY 14214 ERIE CONTACT: WM C MAUNZ CO INC	REV: 1/1/02 ID1: PBS9-224375 ID2: STATUS: UNREGULATED BY PBS PHONE: (716) 886-3130
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
TOTAL ACTIVE TANKS ON SITE:	4		
TOTAL FACILITY CAPACITY:	990 GALLONS		
OLD PBS NUMBER:	CBS NUMBER:		SPDES NUMBER:
ADDITIONAL ADDRESS INFO:			
TYPE OF OWNER:	CORPORATE/COMMERCIAL		
OWNER SUB TYPE:			
OWNER ADDRESS:	387 E DELAVAN AVE BUFFALO NY 14214		
PHONE:	(716) 886-3130		
EMERGENCY CONTACT:	WM C MAUNZ CO INC 24 ANS SERV		
PHONE:	(716) 886-3130		
MAILING NAME:	WM C MAUNZ CO INC		
ADDRESS:	387 E DELAVAN AVE BUFFALO NY 14214		
ATTENTION:			
PHONE:	(716) 886-3130		
CERTIFICATE DATE:	7/23/92	EXP. DATE:	8/17/97
RENEWAL DATE:	5/27/92		

TANK INFORMATION

TANK NUMBER:	1	TANK STATUS:	CLOSED - REMOVED
INSTALLED:	1/1/49	CLOSED:	6/1/96
TANK CAPACITY:	20000 GALLONS		
PRODUCT:	1, 2, OR 4 FUEL OIL		
TANK TYPE:	STEEL/CARBON STEEL		
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE		
INTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING		
PIPE TYPE:	STEEL/IRON		
PIPE LOCATION:	ABOVE GROUND		
INTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING		
SECONDARY CONTAINMENT:	CONCRETE DIKE, NONE		
LEAK DETECTION:	OTHER, NONE		
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE, NONE		
DISPENSER:	GRAVITY		
DATE TESTED:			
NEXT TEST:			
TEST METHOD:			
TANK NUMBER:	2	TANK STATUS:	CLOSED - REMOVED
INSTALLED:	1/1/50	CLOSED:	6/1/96
TANK CAPACITY:	20000 GALLONS		

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 247 **DIST/DIR:** 0.01 SE **MAP ID:** 19

NAME: WM C MAUNZ CO INC ADDRESS: 387 E DELAVAN AVE BUFFALO NY 14214 ERIE CONTACT: WM C MAUNZ CO INC	REV: 1/1/02 ID1: PBS9-224375 ID2: STATUS: UNREGULATED BY PBS PHONE: (716) 886-3130
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------

PRODUCT: 1, 2, OR 4 FUEL OIL

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING, NONE
PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING, NONE
SECONDARY CONTAINMENT:	CONCRETE DIKE, NONE
LEAK DETECTION:	OTHER, NONE
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE, NONE
DISPENSER:	GRAVITY
DATE TESTED:	
NEXT TEST:	
TEST METHOD:	

TANK NUMBER: 3 PLACE OR REMOVED)		TANK STATUS:	CLOSED PRIOR TO 04/91 (IT IS EITHER IN
INSTALLED: 8/1/59		CLOSED:	
TANK CAPACITY: 3000 GALLONS			
PRODUCT: UNLEADED GASOLINE			

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	UNDERGROUND
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	NONE
LEAK DETECTION:	NONE
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE
DISPENSER:	SUCTION
DATE TESTED:	
NEXT TEST:	
TEST METHOD:	

TANK NUMBER: 4 PLACE OR REMOVED)		TANK STATUS:	CLOSED PRIOR TO 04/91 (IT IS EITHER IN
INSTALLED: 8/1/59		CLOSED:	
TANK CAPACITY: 3000 GALLONS			
PRODUCT: UNLEADED GASOLINE			

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	UNDERGROUND
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	
INTERNAL PROTECTION:	

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 247 **DIST/DIR:** 0.01 SE **MAP ID:** 19

NAME: WM C MAUNZ CO INC ADDRESS: 387 E DELAVAN AVE BUFFALO NY 14214 ERIE CONTACT: WM C MAUNZ CO INC	REV: 1/1/02 ID1: PBS9-224375 ID2: STATUS: UNREGULATED BY PBS PHONE: (716) 886-3130
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------

EXTERNAL PROTECTION:
SECONDARY CONTAINMENT: NONE
LEAK DETECTION: NONE
OVERFILL PROTECTION: PRODUCT LEVEL GAUGE
DISPENSER: SUCTION
DATE TESTED:
NEXT TEST:
TEST METHOD:

TANK NUMBER: 5 PLACE OR REMOVED)	TANK STATUS: CLOSED PRIOR TO 04/91 (IT IS EITHER IN	
INSTALLED: 1/1/46	CLOSED:	
TANK CAPACITY: 1000 GALLONS		
PRODUCT: 1, 2, OR 4 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL
TANK LOCATION: UNDERGROUND

INTERNAL PROTECTION:
EXTERNAL PROTECTION:
PIPE TYPE: STEEL/IRON

PIPE LOCATION:
INTERNAL PROTECTION:
EXTERNAL PROTECTION:
SECONDARY CONTAINMENT: NONE
LEAK DETECTION: NONE
OVERFILL PROTECTION: PRODUCT LEVEL GAUGE
DISPENSER: SUCTION
DATE TESTED:
NEXT TEST:
TEST METHOD:

TANK NUMBER: 6 INSTALLED: 1/1/81 TANK CAPACITY: 275 GALLONS PRODUCT: 1, 2, OR 4 FUEL OIL	TANK STATUS: IN SERVICE CLOSED:	
-------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------	--

TANK TYPE: STEEL/CARBON STEEL
TANK LOCATION: ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE

INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
PIPE TYPE: STEEL/IRON
PIPE LOCATION: ABOVE GROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE
LEAK DETECTION: OTHER
OVERFILL PROTECTION: PRODUCT LEVEL GAUGE
DISPENSER: SUCTION
DATE TESTED:
NEXT TEST:
TEST METHOD:

TANK NUMBER: 7	TANK STATUS: IN SERVICE	
-----------------------	--------------------------------	--

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

ERNS

SEARCH ID: 50 **DIST/DIR:** 0.01 SW **MAP ID:** 12

NAME: ADDRESS: HUMBOLDT PARKWAY AND MAIN ST. BUFFALO NY 14214 ERIE	REV: 6/7/99 ID1: 625983 ID2: STATUS: HIGHWAY RELATED PHONE:
CONTACT:	

SPILL INFORMATION

DATE OF SPILL: 6/7/99 **TIME OF SPILL:** 0904

PRODUCT RELEASED (1): RADIOACTIVE MATERIAL
QUANTITY (1): 0
UNITS (1): UNK

PRODUCT RELEASED (2):
QUANTITY (2):
UNITS (2):

PRODUCT RELEASED (3):
QUANTITY (3):
UNITS (3):

MEDIUM/MEDIA AFFECTED

AIR: NO	GROUNDWATER: NO
LAND: YES	FIXED FACILITY: NO
WATER: NO	OTHER: NO
WATERBODY AFFECTED BY RELEASE:	GROUND

CAUSE OF RELEASE

DUMPING: NO	EQUIPMENT FAILURE: NO
NATURAL PHENOMENON: NO	OPERATOR ERROR: NO
OTHER CAUSE: NO	TRANSP. ACCIDENT: NO
UNKNOWN: NO	

ACTIONS TAKEN: CONTAINER ON GROUND AND NO TRUCK IN SITE / BUFFALO FIRE DEPT ON SCENE UNIVERSITY BUFFALO
ON SCENE TEL: (716) 829-3301/SPILL CONTAINED

RELEASE DETECTION: SEMI TRUCK CARRING 2X2 LEAD CONTAINER OF RADIOACTIVE MATERIALS/ TRUCK IN ACCIDENT
RELEASED MATERIALS ON STREET

MISC. NOTES: TEMP: 90F / CLOUD COVER: CLEAR WIND: SW AT 17-23 MPH 2 PEOPLE ISOLATED DUE TO CONTACT WITH
MATERIALS

DISCHARGER INFORMATION

DISCHARGER ID: 625983	DUN and BRADSTREET :
TYPE OF DISCHARGER:	
NAME OF DISCHARGER:	
ADDRESS:	

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 117 **DIST/DIR:** 0.01 SW **MAP ID:** 14

NAME: NYSDOT BIN 1040000 ADDRESS: KENSINGTON AVE OVER NY RT 198 BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110008036188 ID2: NYD986885879 STATUS: FRS PHONE:
---------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110008036188 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/18/2004 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NYD986885879 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:44:47 AM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/5/2006 4:51:47 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120103
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 99 **DIST/DIR:** 0.01 SW **MAP ID:** 10

NAME: NYSDOT BIN 1039969 ADDRESS: ELMWOOD AVE OVER RTE 198 BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110008083849 ID2: NYD987025467 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 1/7/1993 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD987025467 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/18/2003 1:43:28 AM NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 1/1/2001 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD987025467 AGENCY INTERESTED: 12/31/1993 INTEREST ENDED: 1/1/2001 SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:28 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110008083849 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 1:40:57 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 99	DIST/DIR: 0.01 SW	MAP ID: 10
----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 1039969 ADDRESS: ELMWOOD AVE OVER RTE 198 BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110008083849 ID2: NYD987025467 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 98	DIST/DIR: 0.01 SW	MAP ID: 10
----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 1039969 ADDRESS: ELMWOOD AVE OVER RTE 198 BUFFALO NY 14207 Erie CONTACT:	REV: ID1: NYD987025467 ID2: STATUS: PHONE:
----------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

RCRIS : NYD987025467
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 116

DIST/DIR: 0.01 SW

MAP ID: 14

NAME: NYSDOT BIN 1040000
ADDRESS: KENSINGTON AVE OVER RTE 198
BUFFALO NY 14215
Erie
CONTACT:

REV:
ID1: NYD986885879
ID2:
STATUS:
PHONE:

RCRIS : NYD986885879
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 259 **DIST/DIR:** 0.01 SW **MAP ID:** 16

NAME: DELAWARE PARK LABOR CENT. ADDRESS: 25 MEADOW VIEW PLACE BUFFALO NY ERIE	REV: 2/5/08 ID1: 8809536 ID2: 194303 STATUS: CLOSED PHONE:
CONTACT:	

SITE INFORMATION

SPILL DATE: 3/10/1989	DATE REPORTED: 3/10/1989
CLOSED DATE: 5/3/1989	INSP DATE: 5/2/1989

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 2 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 2 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 8809536 UNABLE TO PERFORM TANK TEST ON 2-3K TANKS
MANIFOLDED TOGETHER. ALSO TANKS TAKING ON WATER. END CALLERREMARK - 8809536

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: CITY OF BUFFALO
ADDRESS: 2001 CITY HALL
BUFFALO, NY 14202

TELEPHONE: (716) 851-4144

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 5/5/1989
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8809536 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 03/10/89: MF TELECON FRANK FABER, HE CLAIMED TANKS WILL BE REPLACED. TOLD HIM WHAT HAS TO BE DONE, ALSO SENT HIM A LETTER. 03/15/89: MF CITY OF BUFFALO TELECON, TANKS WILL BE EMPTIED FRIDAY 3/17/89. BIDS TO REMOVE and REPLACE TANKS WILL BE IN TOMORROW and DATE FOR WORK WILL BE KNOWN NEXT WEEK. 04/03/89: MF GREGORY BUNICH TELECON, TANKS EMPTIED, PROBLEM WITH COMMON COUNCEL APPROPRIATING MONEY, GREG WILL KEEP ME INFORMED. DATE FOR WORK WILL BE KNOWN NEXT WEEK. 04/14/89: MF GREG BUNICH TELECON, HE CLAIMED MARSHALL WILL REMOVE THE TANK 4/24/89. 05/03/89: MF SITE VISIT, TANK REMOVAL, NO PRODUCT/SHEEN ON GROUND WATER. NO SHEEN WHEN SOIL TESTED. NO HOLES NOTICED IN THE TANKS. NO FUTHER ACTION NECESSARY BY SPILLS. END DECRemark - 8809536

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 41 **DIST/DIR:** 0.01 SW **MAP ID:** 14

NAME: NYSDOT BIN 1040000	REV: 6/6/06
ADDRESS: KENSINGTON AVE OVER NY RT 198	ID1: NYD986885879
BUFFALO NY 14214	ID2:
ERIE	STATUS: NLR
CONTACT: DAVID R TACKLEY	PHONE: 7168473036

SITE INFORMATION

CONTACT INFORMATION: JOSEPH INGALLS
KENSINGTON AVE OVER RTE 198
BUFFALO NY 14215

PHONE: 6073247580

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 36 **DIST/DIR:** 0.01 SW **MAP ID:** 10

NAME: NYSDOT BIN 1039969	REV: 6/6/06
ADDRESS: ELMWOOD AVE OVER RTE 198	ID1: NYD987025467
BUFFALO NY 14216	ID2:
ERIE	STATUS: NLR
CONTACT: EDWARD WALEK	PHONE: 7168473122

SITE INFORMATION

CONTACT INFORMATION: EDWARD WALEK
GEN WM J DONOVAN BLDG 125 MAIN
BUFFALO NY 14203

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

92119 - OTHER GENERAL GOVERNMENT SUPPORT
23412 - BRIDGE AND TUNNEL CONSTRUCTION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead
D000

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 188 **DIST/DIR:** 0.01 SW **MAP ID:** 10

NAME: TRASH FROM AUTO	REV: 2/5/08
ADDRESS: ROUTE 198 AND ELMWOOD	ID1: 9514722
BUFFALO NY	ID2: 321660
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 2/15/1996	DATE REPORTED: 2/15/1996
CLOSED DATE: 2/21/1996	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: YES	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: DELIBERATE
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: PASSENGER VEHICLE
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: BRENNAN
SPILL CONTACT:
TELEPHONE:

SPILLER: AUTO LP H584RP

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 2/22/1996
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9514722 BLUE BLAZER LP H584RP WAS PARKED UNDER BRIDGE AND TOSSED SOMETHING OUT WINDOW OVER GUARDRAIL CALLER NOT SURE WHAT WAS THROWN END CALLERREMARK - 9514722

DEC REMARKS:
Start DECRemark - 9514722 Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAH 2/15/96 - KAH RECEIVED REPORT THAT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 188	DIST/DIR: 0.01 SW	MAP ID: 10
-----------------------	--------------------------	-------------------

NAME: TRASH FROM AUTO ADDRESS: ROUTE 198 AND ELMWOOD BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9514722 ID2: 321660 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

OPERATOR OF VEHICLE LP H584RP TOSSED SOMETHING OUT WINDOW OF VEHICLE. CALLER UNABLE TO IDENTIFY WHAT WAS THROWN OUT (THOUGH OBJECT WAS APPARENTLY RELATIVELY SMALL; MAY HAVE BEEN TRASH) AND UNABLE TO PINPOINT EXACT LOCATION. NO FURTHER ACTION NECESSARY. END DECRemark - 9514722

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 197 **DIST/DIR:** 0.01 SW **MAP ID:** 12

NAME: NYSDOT PROJECT/TANK ADDRESS: MAIN ST and HUMBOLDT PKWY BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0007497 ID2: 303469 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 9/26/2000 CLOSED DATE: 12/20/2000	DATE REPORTED: 9/26/2000 INSP DATE: 9/26/2000
----------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: 2 FUEL OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: NO INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: YES DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: MICHAEL SMITH
TELEPHONE: (716) 870-7116

SPILLER: NYSDOT
JANINE SHEPARD
ADDRESS: 125 MAIN STREET
BUFFALO, NY

TELEPHONE: (716) 847-3375

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 2/5/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0007497 CALLER STATES DOT WAS EXCAVATING AND CAME ACROSS AN UST - THERE APPEARS TO BE NO LEAK END CALLERREMARK - 0007497

DEC REMARKS:
Start DECRemark - 0007497 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 09/26/00: FG MET MICHAEL SMITH WITH THE NYSDOT ON SITE. AN UST, APPROX 1000 GALLONS WAS DISCOVERED WHILE THEY WERE EXCAVATING AT THE CORNER OF MAIN

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 197	DIST/DIR: 0.01 SW	MAP ID: 12
-----------------------	--------------------------	-------------------

NAME: NYSDOT PROJECT/TANK	REV: 2/5/08
ADDRESS: MAIN ST and HUMBOLDT PKWY	ID1: 0007497
BUFFALO NY	ID2: 303469
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

AND HUMBOLDT. THE MATERIAL APPEARED TO BE FUEL OIL. MR. SMITH SAID THAT NYSDOT PURCHASED THE PROPERTY. DOT WILL SAMPLE AND PROPERLY DISPOSE OF THE WATER IN THE UST. THEY WILL THEN REMOVE THE UST AND COLLECT EXCAVATION SAMPLES FOR 8021 AND 8270. 09/27/00: FG TELECON TO MICHAEL SMITH. HE SAID THEY WILL PROBABLY NOT START WORK UNTIL TOMORROW. 10/17/00: FG TELECON TO MICHAEL SMITH WHO SAID THE RESULTS CAME BACK AS KEROSENE AND THEY WILL STAGE THE WATER ON SITE AND DISPOSE OF IT. THEY WILL THEN REMOVE THE UST. HE WILL CONTACT THIS OFFICE ONCE THE WORK STARTS. 11/1/00: FG SITE INSPECTION. NO CONTAMINATION IN EXCAVATION. THE UST HAD NO HOLES. THE WATERS WERE PUMPED OFF BY BISON FOR DISPOSAL. THE TANK WILL BE CUT OPEN AND CLEANED OUT. A SAMPLE WILL BE COLLECTED FROM THE EXCAVATION AND ANALYZED FOR 8021 AND 8270. 12/13/00: FG SENT LETTER SENT TO NYSDOT REQUESTING THE EXCAVATION ANALYTICAL AND THE TANK WATERS DISPOSAL RECPT BY 12/27/00. 12/20/00: FG RTECEIVED EXCAVATION ANALYTICAL WHICH IS BELOW STARS. ALSO RECEIVED THE WATER DISPOSAL RECEIPTS FROM THE TANK. NO FURTHER WORK IS REQUIRED. THE SITE CAN BE CLOSED. END DECRemark - 0007497

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 199 **DIST/DIR:** 0.01 SW **MAP ID:** 12

NAME: RADIOACTIVE CONTAINERS ADDRESS: HUMBOLDT AND MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9902593 ID2: 138963 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 6/7/1999	DATE REPORTED: 6/7/1999
CLOSED DATE: 6/7/1999	INSP DATE: 6/7/1999

MATERIAL SPILLED: RADIOACTIVE ISOTOPE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: LOCAL AGENCY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN TRUCK

ADDRESS:
 , NY

TELEPHONE:

REPORTED BY: LOCAL AGENCY

LAST DEC UPDATE: 6/11/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9902593 ABOUT 50 - 60 2 X2 CONTAINERS OF RADIOACTIVE MATERIAL - AREA IS 20 X20 - WINDS ARE SW 17-23KNOTS - BUFFALO MATERIALS RESEARCH FROM BUFFALO UNIVERSITY WAS ADVISED 716-829-3301 END CALLERREMARK - 9902593

DEC REMARKS:
Start DECRemark - 9902593 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 06/07/99: RMC NOTE, THIS SPILL IS A

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 199	DIST/DIR: 0.01 SW	MAP ID: 12
-----------------------	--------------------------	-------------------

NAME: RADIOACTIVE CONTAINERS ADDRESS: HUMBOLDT AND MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9902593 ID2: 138963 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

DUPLICATE OF 9975173, CLOSEOUT THIS SPILL, FOLLOWUP UNDER 9975173. END DECRemark - 9902593

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 185 **DIST/DIR:** 0.01 SW **MAP ID:** 10

NAME: SCAJAQUADA CREEK	REV: 2/5/08
ADDRESS: ROUTE 198 and ELMWOOD AVE.	ID1: 9314227
BUFFALO NY	ID2: 286331
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 3/5/1994	DATE REPORTED: 3/5/1994
CLOSED DATE: 11/27/1995	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 0 L
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: YES	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SORGI
SPILL CONTACT:
TELEPHONE:

SPILLER: CITY OF BUFFALO PUBLIC SC

ADDRESS:
BUFFALO, NY

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 7/2/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9314227 OIL IN SCAJAQUADA CREEK END CALLERREMARK - 9314227

DEC REMARKS:
Start DECRemark - 9314227 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 03/05/94: MJS/SITE (1530 HRS.) - SPILL STILL FLOWING IN SCAJAQUADA CREEK. WILL NEED CONTRACTOR TO BOOM OFF. SUSPECT SOURCE IS HISTORICAL BLDG. ON BUF.

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 185 **DIST/DIR:** 0.01 SW **MAP ID:** 10

NAME: SCAJAQUADA CREEK ADDRESS: ROUTE 198 and ELMWOOD AVE. BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9314227 ID2: 286331 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

STATE CAMPUS. 03/05/94: MJS/SITE (2015 HRS.) - CONTRACTOR BOOMING UP and DOWNSTREAM. SUSPECTS 6 HEATING OIL. WILL FINISH PLACING BOOMS AND RETURN IN AM. 03/06/94: MJS/CONTACTOR/SITE. WALKED CREEK AND FOUND OIL COMING FROM DISCHARGE PIPE BEHIND MCKINLEY HIGH SCHOOL. INSTALLED, REPLACED BOOM. CHECKED BOILER ROOM AT SCHOOL FOUND OIL AT FLOOR DRAIN BELOW BLOW DOWN. 03/07/94: MJS/PAUL SUOZZI/SITE. EPS SWEEPING CREEK W/ SMALL BOAT. SPENT MATERIALS PLACED IN PLASTIC BAGS ON SHORE. 03/08/94: MJS SITE INSPECT. EPS SWEEPING CREEK BEHIND BFLO HISTORICAL SOCIETY AND BEHIND MCKINLEY HIGH SCHOOL. POM-POMS APPLIED ALONG SHORELINE. 03/09/94: MJS SITE INSPECT. CONTINUING TO SWEEP AND CHANGE SORBENTS. CLEANUP CEASED TEMPORARILY - EPS RESPONDED TO OTHER SPILL AT REQUEST OF R9. 03/11/94: MJS SITE INSPECT - MET W/ PAUL SUOZZI. EPS CONTINUING CLEANUP. CHANGING SORBENTS AS REQUIRED. 03/15/94: MJS SITE INSPECT. EPS SWEEPING. BOATS DECONNED. PLACING BAGGED DEBRIS IN ROLLOFF. 03/21/94: MJS SITE INSPECT. EPS PADDING OIL. PLACING SPENT SORBENTS IN ROLLOFF. 03/29/94: MJS SITE INSPECT. EPS CHANGING BOOM. 04/05/94: RECEIVED PAY-PACK FROM EPS. 04/28/94: RECEIVED PAY-PACK FOR ANALYTICAL WORK FROM ELS. 05/05/94: RECEIVED PAY-PACK FROM EPS FOR WORK PERFORMED ON 4/11/94. ALL SORBENTS REMOVED FROM CREEK AND PLACED IN ROLLOFF FOR DISPOSAL. 05/23/94: RECEIVED PAY-PACK FOR DISPOSAL FROM EPS. DEBRIS DISPOSED AT WASTE MANAGEMENT. 09/26/95: MJS REVIEW FILE. NEED DISPOSAL DOCUMENTATION FOR CLOSURE OF FILE. MJS MEETING WITH LINDA SCOTT(EPS). SHE WILL CONTACT FACILITY AND GET COPY OF DISPOSAL CERTIFICATE. 11/01/95: MJS REVIEW FILE. DISPOSAL RECEIPT NOT YET RECEIVED. MJS CONTACT LINDA SCOTT - SHE WILL CHECK ON STATUS. 11/27/95: MJS RECEIVED MESSAGE FROM LINDA SCOTT. WEIGHT SLIPS UNATTAINABLE FROM LANDFILL AT THIS POINT. INVOICE FROM WASTE MANAGEMENT IN PAY-PACK INDICATES TONNAGE AND CHARGES. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE. END DECRemark - 9314227

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 200 **DIST/DIR:** 0.01 SW **MAP ID:** 12

NAME: RADIOACTIVE CONTAINERS ADDRESS: HUMBOLDT AND MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9975173 ID2: 138964 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 6/7/1999	DATE REPORTED: 6/7/1999
CLOSED DATE: 6/7/1999	INSP DATE: 6/7/1999

MATERIAL SPILLED: RADIOACTIVE ISOTOPE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: LOCAL AGENCY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT: TOM FITZPATRIC
TELEPHONE: (716) 851-5333

SPILLER: UNKNOWN TRUCK

ADDRESS:
 , NY

TELEPHONE:

REPORTED BY: LOCAL AGENCY

LAST DEC UPDATE: 6/11/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9975173 20 LEAD SEALED CONTAINERS FELL OFF TRUCK MARKED RADIOACTIVE, SOME MATERIALS HAVE SPILLED OUT END CALLERREMARK - 9975173

DEC REMARKS:
Start DECRemark - 9975173 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 06/07/99: RMC NOTIFIED RNL, PJB, RD, DOH ROCHESTER, SISTERS RAD UNIT RMC SITE INSPECTION, MET WITH DEAN MESSING OF ERIE COUNTY EMERGENCY SERVICES,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 200	DIST/DIR: 0.01 SW	MAP ID: 12
-----------------------	--------------------------	-------------------

NAME: RADIOACTIVE CONTAINERS ADDRESS: HUMBOLDT AND MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9975173 ID2: 138964 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

TOMMY FITZPATRIC CITY OF BUFFALO HAZMAT, PETER COPPOLA ERIE COUNTY HEALTH DEPT, MATERIAL TESTED NEGATIVE FOR ANY RADIATION BY UB RAD UNIT, MATERIALS ARE EMPTY PIGS USED FOR STORING YTTERBIUM, 5 PICO CURIE, CONTAINERS WERE PROPERLY DEFACED AND IT APPEARS THEY FELL OFF A TRUCK ON THE WAY TO BEING RECYCLED, SOURCE AND DESTINATION UNKNOWN, CITY OF BUFFALO OVERPACKED, UB TOOK, NO ACTION REQUIRED BY SPILLS, CLOSEOUT END
DECRemark - 9975173

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 224 **DIST/DIR:** 0.01 SW **MAP ID:** 16

NAME: DELAWARE PARK LABOR CENT.
ADDRESS: 25 MEADOW VIEW PLACE
BUFFALO NY
ERIE
CONTACT:

REV: 10/18/00
ID1: 8809536
ID2:
STATUS: CLOSED
PHONE:

SPILL DATE: 03/10/89 **DATE REPORTED:** 03/10/89
SPILL TIME: 11:00 **TIME REPORTED:** 12:00

MATERIAL SPILLED: GASOLINE **AMOUNT SPILLED:** 2 G
MATERIAL CLASS: PETROLEUM **AMOUNT RECOVERED:** 2 G

CAUSE OF SPILL: TANK TEST FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: NON-COMMERCIAL/INSTITUTIONAL
REPORTED BY: TANK TESTER
CALLER REMARKS:

UNABLE TO PERFORM TANK TEST ON 2-3K TANKS MANIFOLDED TOGETHER. ALSO TANKS TAKING ON WATER.

REGION: 9 **UST TRUST?** YES

SPILL INVESTIGATOR: MF
SPILL CONTACT: **TELEPHONE:**

SPILLER: CITY OF BUFFALO
ADDRESS: 2001 CITY HALL
BUFFALO, NY 14202
SPILLER CONTACT: **TELEPHONE:** (716) 851-4144

CALLER: BRUCE CORNELL
AGENCY: CERTIFIED TANK TESTING
TELEPHONE: (607) 566-8491

NOTIFIER:
AGENCY:
TELEPHONE:

LAST DEC UPDATE: 05/05/89 **CLOSE DATE:** 05/03/89
DOES CLEAN UP MEET STANDARDS? YES **PENALTY RECOMMENDED?** NO
DEC REMARKS:

03/10/89: MF TELECON FRANK FABER, HE CLAIMED TANKS WILL BE REPLACED. TOLD HIM WHAT HAS TO BE DONE, ALSO SENT HIM A LETTER. 03/15/89: MF CITY OF BUFFALO TELECON, TANKS WILL BE EMPTIED FRIDAY 3/17/89. BIDS TO REMOVE and REPLACE TANKS WILL BE IN TOMORROW and DATE FOR WORK WILL BE KNOWN NEXT WEEK. 04/03/89: MF GREGORY BUNICH TELECON, TANKS EMPTIED, PROBLEM WITH COMMON COUNCEL APPROPRIATING MONEY, GREG WILL KEEP ME INFORMED. DATE FOR WORK WILL BE KNOWN NEXT WEEK. 04/14/89: MF GREG BUNICH TELECON, HE CLAIMED MARSHALL WILL REMOVE THE TANK 4/24/89. 05/03/89: MF SITE VISIT, TANK REMOVAL, NO PRODUCT/SHEEN ON GROUND WATER. NO SHEEN WHEN SOIL TESTED. NO HOLES NOTICED IN THE TANKS. NO FUTHER ACTION NECESSARY BY SPILLS.

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 93 **DIST/DIR:** 0.02 NE **MAP ID:** 28

NAME: NYSDOT BIN 1033910 ADDRESS: GRANT ST BRG OVER RTE 198 BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110008105399 ID2: NYR000062372 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 1/1/2001 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000062372 AGENCY INTERESTED: 12/31/1999 INTEREST ENDED: 1/1/2001 SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:35 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 10/20/1998 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000062372 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110008105399 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 1:22:40 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 93	DIST/DIR: 0.02 NE	MAP ID: 28
----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 1033910 ADDRESS: GRANT ST BRG OVER RTE 198 BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110008105399 ID2: NYR000062372 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 18 **DIST/DIR:** 0.02 NE **MAP ID:** 28

NAME: NYSDOT BIN 1033910 ADDRESS: GRANT ST BRG OVER RTE 198 BUFFALO NY 14213 ERIE CONTACT: LARRY R GRAZIANO	REV: 6/6/06 ID1: NYR000062372 ID2: STATUS: LGN PHONE: 7168473122
----------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: LARRY R GRAZIANO
GEN DONOVAN BLDG 125 MAIN ST
BUFFALO NY 142033088

PHONE: 7168473122

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

92119 - OTHER GENERAL GOVERNMENT SUPPORT

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

D000
Lead

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 192 **DIST/DIR:** 0.02 NE **MAP ID:** 24

NAME: FRANK HOUSE ADDRESS: 1910 DELAWARE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0375312 ID2: 176064 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 9/1/2003 CLOSED DATE: 9/23/2003	DATE REPORTED: 9/22/2003 INSP DATE: 12:00:00 AM
--------------------------------------------------------------	------------------------------------------------------------------

MATERIAL SPILLED: UNKNOWN MATERIAL MATERIAL CLASS: OTHER	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: DELIBERATE
WATERBODY AFFECTED:
SOURCE OF SPILL: PRIVATE DWELLING
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT:
TELEPHONE:

SPILLER: DR. MILLER

ADDRESS: 104 MIDDLESEX
BUFFALO, NY

TELEPHONE:

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 9/23/2003
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0375312 CALLER CLAIMS HE SAW NEIGHBORS SON DUMP CHEMIALS WITH STRONG ODOR ON PROPERTY LINE. HE ALSO STATED THAT ODORS WERE STRONG AND MADE HIM SICK. HE THINKS SEVERAL TREES DIED BECAUSE OF THIS. END CALLERREMARK - 0375312

DEC REMARKS:
Start DECRemark - 0375312 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 9/22/03 FG SITE INSPECTION. MR. FRANK

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 192 **DIST/DIR:** 0.02 NE **MAP ID:** 24

NAME: FRANK HOUSE ADDRESS: 1910 DELAWARE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0375312 ID2: 176064 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

WAS NOT HOME. DID NOT NOTICE ANY EVIDENCE OF DEAD TREES OR STRESSED VEGETATION ON THE PROPERTY LINE BETWEEN HIS AND 102 MIDDLESEX PROPERTIES. NOBODY WAS HOME AT 102 MIDDLESEX EITHER BUT I WALKED ALONG THE FENCE LINE IN THE BACK YARD, ADJACENT TO THE FRANK HOME AND FOUND NO EVIDENCE OF ANY DUMPING, ANY STRESSED VEGETATION OR ANY EVIDENCE ALONG THE FENCE. FG SPOKE TO MR. FRANK WHO SAID THAT HE WAS NOT HOME BECAUSE HE COULDN T STAY THERE DUE TO THE ODORS. HE SAID THE PROPERTY IS 104 MIDDLESEX, THE PROPERTY NEXT TO 102 MIDDLESEX. I TOLD HIM I DIDN T NOTICE ANYTHING AND IF HE HAD TO MOVE OUT, HE SHOULD NOTIFY THE HEALTH DEPT. FG REINSPECTED AND COULD NOT FIND A 104 MIDDLESEX. THE PROPERTY ADJACENT TO 102 MIDDLESEX IS 114 MIDDLESEX. THERE WAS NOBODY HOME AND I COULD NOT ACCESS THEIR BACKYARD BECAUSE THERE WAS A LOCKED GATE. I REINSPECTED MR. FRANK S PROPERTY AND AGAIN NOTICED NO STRESSED VEGETATION OR ANY ODORS. 9/23/03 CALLED THE CITY OF BUFFALO REAL PROPERTY OFFICE AND FOUND THE OWNER OF 114 MIDDLESEX IS JONATHAN AND ROBIN LAZAR-MILLER. THE NUMBER FOR DR. ROBIN LAZAR-MILLER IS 883-1366. I PHONED HER OFFICE AND FOUND SHE IS ON VACATION. LEFT A MESSAGE FOR HER TO CALL BACK. IF SHE AND HER FAMILY ARE ON VACATION THEN THE ACCUSATION OF DUMPING MAY BE UNFOUNDED. 9/23/03 DR. ROBIN LAZAR-MILLER CALLED AND SAID SHE IS IN FLORIDA RIGHT NOW AND HER SON HAS BEEN AWAY SINCE AUGUST 24, 2003. NEITHER IS HER HUSBAND AT HOME. SHE SAID THEY DO NOT DUMP ANYTHING. SINCE THEY HAVE NOT BEEN HOME, IT DOES NOT APPEAR THAT THE COMPLAINTS ARE LEGITIMATE. THE SITE CAN BE CLOSED WITH NO FURTHER ACTION. THIS IS AN ELECTRONIC FILE. NO PAPER FILE EXISTS. END DECRemark - 0375312

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 64	DIST/DIR: 0.02 SE	MAP ID: 23
----------------------	--------------------------	-------------------

NAME: HOHL MACHINE and CONVEYOR CO
ADDRESS: 1580 NIAGARA ST
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD987020625
ID2:
STATUS:
PHONE:

RCRIS : NYD987020625
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB : 002106193
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 65 **DIST/DIR:** 0.02 SE **MAP ID:** 23

NAME: HOHL MACHINE and CONVEYOR COMPANY INC ADDRESS: 1580 NIAGARA STREET BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004497394 ID2: NYD987020625 STATUS: FRS PHONE:
------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110004497394 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 12/29/1992 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD987020625 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:43:32 AM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 12/11/2002 8:49:18 AM
ENTERED PERSON/METHOD: TIGERBEE
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 30 **DIST/DIR:** 0.02 SE **MAP ID:** 23

NAME: HOHL MACHINE and CONVEYOR CO ADDRESS: 1580 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 6/6/06 ID1: NYD987020625 ID2: STATUS: NLR PHONE:
-----------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: TIMOTHY TERRANA
1580 NIAGARA ST
BUFFALO NY 14213

PHONE: 7168827210

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b
Ignitable waste
NONE

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 168 **DIST/DIR:** 0.02 SE **MAP ID:** 26

NAME: WARD TRUCKING	REV: 2/5/08
ADDRESS: 198 AND I190	ID1: 0004878
BUFFALO NY	ID2: 281039
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 7/24/2000	DATE REPORTED: 7/24/2000
CLOSED DATE: 7/24/2000	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: LUBE OIL	AMOUNT SPILLED: 400 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 400 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: TANK TRUCK
REPORTED BY: POLICE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RJJONAK
SPILL CONTACT:
TELEPHONE:

SPILLER: WARD TRUCKING
THOMAS REGER
ADDRESS: 4885 RIVER ROAD
TONAWANDA, NY 14150-

TELEPHONE: (716) 874-3688

REPORTED BY: POLICE DEPARTMENT

LAST DEC UPDATE: 8/4/2000
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0004878 TRUCK OVERTURNED NOW HANGING OVER A BRIDGE
BRIDGE IS OVER ANOTHER ROADWAY REQUEST A RESPONSE ASAP END CALLERREMARK - 0004878

DEC REMARKS:
Start DECRemark - 0004878 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RJJ 07/24/00: KAB RECEIVED CALL FROM
HOTLINE CONFIRMING RESPONSE BY REGION 9. KAB ADVISED HOTLINE THAT SHE HAD SPOKEN WITH FD ALREADY AND

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 168	DIST/DIR: 0.02 SE	MAP ID: 26
-----------------------	--------------------------	-------------------

NAME: WARD TRUCKING ADDRESS: 198 AND I190 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0004878 ID2: 281039 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

RESPONDER WAS ENROUTE. NO RESPONSE NECESSARY UNDER THIS SPILL NUMBER. RJJ RESPONDING TO INCIDENT UNDER SPILL 0075255. REFER TO THAT NUMBER FOR FURTHER INFORMATION. CLOSE THIS SPILL NUMBER OUT. END DECRemark - 0004878

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 145 **DIST/DIR:** 0.02 SE **MAP ID:** 26

NAME: ABANDONED DRUMS BLACKROCK	REV: 2/5/08
ADDRESS: ROUTE 198 AND I190	ID1: 9305994
BUFFALO NY	ID2: 315177
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 8/1/1993	DATE REPORTED: 8/13/1993
CLOSED DATE: 9/23/1993	INSP DATE: 9/20/1993

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 250 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 250 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED: BLACK ROCK CANAL
SOURCE OF SPILL: UNKNOWN
REPORTED BY: FEDERAL GOVERNMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: FEDERAL GOVERNMENT

LAST DEC UPDATE: 10/18/1993
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9305994 5 ABANDONED DRUMS ON BANK AND AT WATER S EDGE.
SEE ALSO SPILL NUMBER 9306169 END CALLERREMARK - 9305994

DEC REMARKS:

Start DECRemark - 9305994 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 08/16/93: RMC/DAVE DOMBKOWSKI/SITE - 6
DRUMS VIEWED FROM BOAT. USCG SAY 3 CONTAIN PRODUCT. SITE UNDER 198 ON RAMP BRIDGE FROM 190 SB. 08/30/93: RMC/JIM

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 145	DIST/DIR: 0.02 SE	MAP ID: 26
-----------------------	--------------------------	-------------------

NAME: ABANDONED DRUMS BLACKROCK
ADDRESS: ROUTE 198 AND I190
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9305994
ID2: 315177
STATUS: CLOSED
PHONE:

V./SITE TO REMOVE WHEN PICK UP BUFFALO RIVER DRUMS.

BY 10/15. 09/23/93: RMC/FILE DRUMS REMOVED UNDER BUFFALO RIVER 9306169 SPILL AND PIN NUMBER REFER TO THAT SPILL
FOR DISPOSAL INFORMATION, CLOSE OUT. 09/29/95: This is additional information about material spilled from the translation of the old spill file:
DRUMS. END DECRemark - 9305994

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 210 **DIST/DIR:** 0.02 SE **MAP ID:** 23

NAME: HOHL MACHINE and CONVEYOR **REV:** 10/18/00
ADDRESS: 1580 NIAGARA STREET **ID1:** 8709761
BUFFALO NY **ID2:**
ERIE **STATUS:** CLOSED
CONTACT: **PHONE:**

SPILL DATE: 02/17/88 **DATE REPORTED:** 02/18/88
SPILL TIME: 12:00 **TIME REPORTED:** 11:15

MATERIAL SPILLED: HYDRAULIC OIL **AMOUNT SPILLED:** 0 G
MATERIAL CLASS: PETROLEUM **AMOUNT RECOVERED:** 0 G

CAUSE OF SPILL: DELIBERATE
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: AFFECTED PERSONS
CALLER REMARKS:
HYDRAULIC OIL AND METAL SHAVINGS DUMPED ON RAILROAD TRACK

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: JDC
SPILL CONTACT: **TELEPHONE:**

SPILLER: HOHL MACHINE and CONVEYOR
ADDRESS: 1580 NIAGARA STREET
BUFFALO, NY 14213
SPILLER CONTACT: **TELEPHONE:** (716) 882-7210

CALLER: JOE KLEINFEL **NOTIFIER:**
AGENCY: CONRAIL **AGENCY:**
TELEPHONE: (716) 686-4180 **TELEPHONE:**

LAST DEC UPDATE: 05/19/88 **CLOSE DATE:** 05/06/88
DOES CLEAN UP MEET STANDARDS? YES **PENALTY RECOMMENDED?** NO
DEC REMARKS:

02/18/88: JDC AND BECI, J. GROBE, SITE INSP. 02/18/88, SITE HAD BEEN CLEANED UP BY SPILLER, SPILLER CLAIMS SPILLAGE WAS CAUSED BY A EMPLOYEE UNFAMILIAR WITH DISPOSAL PROCEDURES, WILL SEND REPORT ON SPILL. 03/08/88: JDC TELCON W/ MR MILAZZO, PLT MGR - REQUESTED SUMMATION LETTER RELATIVE TO DUMPING INCIDENT THAT WILL INCLUDE INFO ON FINAL DISPOSAL ACTION. 05/02/88: JDC TELCON W/ R. MILLAZZO, HOHL MACHINE AND REQUESTED DISPOSAL VARIFICATION LETTER. HE STATED THAT LETTER SENT TO JIM GROBEE, BECI. WILL CONTACT MR GROBEE FOR LETTER.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 220 **DIST/DIR:** 0.02 SE **MAP ID:** 26

NAME: TRUCK FUEL TANK LEAK ADDRESS: RT.198-E RAMP FROM I190-N BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8605926 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 12/17/86	DATE REPORTED: 12/17/86
SPILL TIME: 07:14	TIME REPORTED: 07:45

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 30 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 30 G

CAUSE OF SPILL: EQUIPMENT FAILURE
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: DEC
CALLER REMARKS:
FUEL LEAK FROM TRUCK TANK

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MNP	TELEPHONE:
SPILL CONTACT:	

SPILLER: UNKNOWN
ADDRESS:

SPILLER CONTACT:	TELEPHONE:
-------------------------	-------------------

CALLER:	NOTIFIER:
AGENCY:	AGENCY:
TELEPHONE:	TELEPHONE:

LAST DEC UPDATE: / /	CLOSE DATE: 12/17/86
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

/ / : SITE INSP. 12/17/86, NOTHING FOUND;TELECON W/BUFFALO POLICE 12/17/86, FIRE DEPT. CLEANED UP SPILL W/PADS and WASHED DOWN REMAINDER OF PRODUCT.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 196 **DIST/DIR:** 0.02 SW **MAP ID:** 25

NAME: BUFFALO MUNICIPAL HOUSING	REV: 2/5/08
ADDRESS: 167 W. HUMBOLDT MAIN	ID1: 0375474
BUFFALO NY	ID2: 305385
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 2/17/2004	DATE REPORTED: 2/17/2004
CLOSED DATE: 5/27/2004	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL:	EQUIPMENT FAILURE
WATERBODY AFFECTED:	
SOURCE OF SPILL:	COMMERCIAL/INDUSTRIAL
REPORTED BY:	OTHER

REGION:	9
UST TRUST?	NO

SPILL INVESTIGATOR:	FXGALLEG
SPILL CONTACT:	CALLER
TELEPHONE:	

SPILLER:	BUFFALO MUNICIPAL HOUSING
	MICHAEL LYONS
ADDRESS:	300 PERRY ST
	BUFFALO, NY 14204-

TELEPHONE:	(716) 836-4994 210
-------------------	--------------------

REPORTED BY:	OTHER
---------------------	-------

LAST DEC UPDATE:	5/27/2004
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

CALLER REMARKS: START CALLERREMARK - 0375474 FOUND CONTAMINATION WHILE REMOVING 500 TO 700 GALLON UST. TANK WAS PUMPED OUT LAST WEEK. HAS TAKEN ON WATER SINCE. CONTAMINATION NOTED IN EXCAVATION. END CALLERREMARK - 0375474

DEC REMARKS:
Start DECRemark - 0375474 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 2/18/04 FG SPOKE TO BILL GALLOWAY,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 196	DIST/DIR: 0.02 SW	MAP ID: 25
-----------------------	--------------------------	-------------------

NAME: BUFFALO MUNICIPAL HOUSING
ADDRESS: 167 W. HUMBOLDT MAIN
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 0375474
ID2: 305385
STATUS: CLOSED
PHONE:

CONSULTANT AND JOE BUSCAGLIA - BMHA. THEY REMOVED THE TANK, WILL COLLECT A SAMPLE FOR LANDFILL CHARACTERIZATION AND THEN REMOVE THE CONTAMINATION ONCE THEY HAVE APPROVAL. 3/5/04 FG SITE INSPECTION. CONTAMINATION EXISTS ON THE EAST WALL. THE BOTTOM OF THE HOLE IS COMPETENT SHALE WITH NO WATER IN THE EXCAVATION. MR. GALLOWAY WILL COLLECT 4 SIDEWALL SAMPLES FOR ANALYSIS. ALL SOIL HAS BEEN DISPOSED. 4/28/04 FG SPOKE TO BILL GALLOWAY WHO SAID HE WILL HAVE A FINAL REPORT IN BY THE END OF NEXT WEEK. 5/27/04 RECD CLOSURE REPORT WHICH INCLUDES DISPOSAL RECPT AND EXCAVATION SAMPLING WHICH SHOWS THE EXCAVATION TO BE BELOW TAGM 4046 LEVELS. NO FURTHER WORK IS REQUIRED. THE SITE IS CLOSED. END DECRemark - 0375474

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 198 **DIST/DIR:** 0.02 SW **MAP ID:** 25

NAME: PRIVATE RESIDENCE ADDRESS: 167 HUMBOLDT APT 1014 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0275447 ID2: 69103 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 12/13/2002	DATE REPORTED: 12/13/2002
CLOSED DATE: 12/16/2002	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: MERCURY	AMOUNT SPILLED: 1 G
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: HUMAN ERROR
WATERBODY AFFECTED:
SOURCE OF SPILL: PRIVATE DWELLING
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: BRENNAN
SPILL CONTACT: DAN GOUPIL
TELEPHONE: (716) 881-6509

SPILLER: DAN GOUPIL
DAN GOUPIL
ADDRESS: 167 HUMBOLDT APT 1014
BUFFALO, NY

TELEPHONE: (716) 881-6509

REPORTED BY: CITIZEN

LAST DEC UPDATE: 12/16/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0275447 DROPPED THERMOMETER ONTO FLOOR SPILLING VERY SMALL AMOUNT OF MERCURY. IN TRYING TO USE PAPER TOWEL TO DETERMINE WHETHER OR NOT SUBSTANCE WAS ACTUALLY MERCURY, SMEARED IT ONTO FLOOR. END CALLERREMARK - 0275447

DEC REMARKS:
Start DECRemark - 0275447 Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAB 12/13/02: KAB/MR. GOUPIL/TELECON - MR.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 198	DIST/DIR: 0.02 SW	MAP ID: 25
-----------------------	--------------------------	-------------------

NAME: PRIVATE RESIDENCE
ADDRESS: 167 HUMBOLDT APT 1014
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 0275447
ID2: 69103
STATUS: CLOSED
PHONE:

GOUPIL INDICATED THAT HE HAD ATTEMPTED TO CLEAN UP THE MINOR SPILLAGE OF MERCURY WITH PAPER TOWELS AND THAT SOME HAD SMEARED ON FLOOR. ADVISED HIM TO TAKE THE PAPER TOWELS, WITHOUT TOUCHING THE AFFECTED PORTIONS AND AVOIDING BREATHING VAPORS IN, AND CLEAN UP TO THE EXTENT POSSIBLE PLACING THE USED PAPER TOWELS INTO A GLASS JAR AND CLOSE IT. ADVISED HIM THAT SOMEONE WOULD CONTACT HIM ON MONDAY TO DISPOSE OF IT. 12/16/02: KAB/LOU BREHM, ERIE CO. ENV. and PLANNING/TELECON - ADVISED MR. BREHM WHAT HAD TRANSPIRED AT RESIDENCE ON FRIDAY. HE WILL HAVE MARY ROSSI OF HIS DEPT. CONTACT MR. GOUPIL AND ARRANGE FOR DISPOSAL. NO FURTHER ACTION NECESSARY. CLOSE OUT. *****NO PAPER FILE EXISTS FOR THIS SPILL***** END DECRemark - 0275447

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 226 **DIST/DIR:** 0.02 SW **MAP ID:** 27

NAME: MAINES MIDWEST ADDRESS: ROUTE 33 AT 281 HUMBOLT BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8909395 ID2: STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 12/27/89	DATE REPORTED: 12/27/89
SPILL TIME: 13:00	TIME REPORTED: 13:15

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 20 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TRAFFIC ACCIDENT
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: FIRE DEPARTMENT
CALLER REMARKS:

TRACTOR TRAILER RODE UP ON GUARDRAIL RUPTURING SADDLE TANK SPILLING 20GAL. DIESEL TO ROAD.

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: CAF	TELEPHONE:
SPILL CONTACT:	

SPILLER: MAINES MIDWEST ADDRESS: 1355 VALLEY BELT ROAD BROOKLYN HEIGHTS, OH 44131 SPILLER CONTACT:	TELEPHONE: (800) 942-7922
----------------------------------------------------------------------------------------------------------------------------------	----------------------------------

CALLER: DICK STEEN AGENCY: BUFFALO FIRE DEPT. TELEPHONE: (716) 851-5510	NOTIFIER: AGENCY: TELEPHONE:
----------------------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 01/12/90	CLOSE DATE: 01/08/90
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

12/27/89: CAF SITE VISIT PADS and PILLOWS USED ON CLEANUP BY BUFFALO FIRE DEPT. BUFFALO SEWER AUTHORITY REMOVED CLEANUP MATERIALS FOR FUTURE DISPOSAL. 01/08/90: CAF HAVE DISPOSAL RECEIPT FROM BUFFALO SEWER AUTHORITY,RECEIVED ACCIDENT REPORT FROM FIRE COMM. DUKE.NO FURTHER ACTION PLANNED.

JOB: 5466

Site Details Page - 112

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 177

DIST/DIR: 0.03 N-

MAP ID: 33

NAME: SHEEN ON SCAJAQUADA
ADDRESS: HOWELL STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 0075565
ID2: 290417
STATUS: CLOSED
PHONE:

SHEEN AT WEIR. NO SOURCE DISCOVERED, ONLY THE SHEEN SITTING BEHIND THE BARRIER. WILL CHECK AGAIN TOMORROW TO SEE IF IT IS STILL THERE. 01/18/01: FG TELECON TO US COAST GUARD AND NOTIFIED THEM THAT A SHEEN EXISTS IN THE SCAJAQUADA CREEK. THEY SAID THEY WILL LOOK AT THE SHEEN AND GET BACK TO ME. 01/18/01: FG TELECON FROM PETTY OFFICER RALPH CRANE WITH THE US COAST GUARD, SAID THAT THE COAST GUARD WILL HANDLE THE REMEDIATION OF THE SPILL. THEY ARE INVESTIGATING POSSIBLE SOURCES. NO FURTHER WORK BY SPILLS IS NECESSARY. THE SITE CAN BE CLOSED. END DECRemark - 0075565

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 128

DIST/DIR: 0.03 NE

MAP ID: 31

NAME: SEARS ROEBUCK and CO

REV:

ADDRESS: 420 E DELAVAN
BUFFALO NY 14214
Erie

ID1: NYD982272577

ID2:

STATUS:

CONTACT:

PHONE:

RCRIS : NYD982272577

PCS :

AFS/AIRS :

SSTS :

CERCLIS :

NCDB :

ENF DOCKET :

CONTR LIST :

CRIM DOCKET :

FFIS :

CICIS :

STATE :

PADS :

TRIS :

DandB : 615426202

UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 130 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SLS 88854 ADDRESS: 420 E DELAVAN AVE BUFFALO NY 14214 Erie CONTACT:	REV: 11/1/06 ID1: 110029261091 ID2: STATUS: FRS PHONE:
------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 4/24/2007 8:09:20 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110029261091 AGENCY INTERESTED: 4/24/2007 8:09:19 PM INTEREST ENDED: SOURCE OF DATA: NJ-NJEMS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 325295 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 4/24/2007 8:09:20 PM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 4/24/2007 8:09:19 PM
DATA UPDATED:
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 129 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS ROEBUCK and CO ADDRESS: 420 E DELAVAN AVE BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110004417881 ID2: NYD982272577 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110004417881 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/14/1999 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD982272577 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: EPA INSPECTION LAST EXTRACTED:
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: SQG - HAZARDOUS WASTE SMALL QUANTITY GENERATORS GENERATE: (A) MORE THAN 100 AND LESS THAN 1000 KILOGRAMS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH AND ACCUMULATE LESS THAN 6000 KG OF HAZARDOUS WASTE AT ANY TIME; OR (B) 100 KG OR LESS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1000 KG OF HAZARDOUS WASTE AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 1:32:04 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 129

DIST/DIR: 0.03 NE

MAP ID: 31

NAME: SEARS ROEBUCK and CO
ADDRESS: 420 E DELAVAN AVE
 BUFFALO NY 14214
 ERIE

REV: 11/1/06
ID1: 110004417881
ID2: NYD982272577
STATUS: FRS
PHONE:

CONTACT:

CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 265 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS WAREHOUSE ADDRESS: 420 EAST DELAVAN BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8704178 ID2: 190084 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 8/19/1987 CLOSED DATE: 3/29/1988	DATE REPORTED: 8/19/1987 INSP DATE: 3/29/1988
---------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: DIESEL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------	------------------------------------------------------------

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 8704178 CONTAMINATED SOIL FOUND IN TANK EXCAVATION END
CALLERREMARK - 8704178

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: PRINGLE
SPILL CONTACT:
TELEPHONE:

SPILLER: SEARS WAREHOUSE

ADDRESS: 420 EAST DELAVAN
BUFFALO, NY 14208

TELEPHONE: (716) 881-9211

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 1/10/1996
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8704178 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP / / : 3000 GAL TANK REMOVED, CONTAMINATED SOIL IS BEING REMOVED, MONITORING WELL TO BE INSTALLED. / / : LQR 09/09/87 TELECON W/GRAPER, ENV. OIL.,MW BEING PLACED HIT POCKET OF METHANE GAS. / / : 8/24/87 TELECON W/GRAPER, ENV. OIL., SOIL FLASHED, TO BE AERATED and DISPOSED, GASOLINE IN SOIL, MW TO BE INSTALLED. / / : 11/12/87 MNP INSP. ENV. OIL ON SITE, MW - O.K.:INSP. NEEDED. / / : 3/29/88 MNP INSP. CHECKED MW -O.K. NO SHEEN, SEPTIC ODOR NOTED;NO FURTHER ACTION NEEDED, COMPLETE. END DECRemark - 8704178

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 26 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS ROEBUCK and CO ADDRESS: 420 E DELAVAN AVE BUFFALO NY 14214 ERIE CONTACT:	REV: 6/6/06 ID1: NYD982272577 ID2: STATUS: SGN PHONE:
-----------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: JOEL DALY
420 E DELAVAN AVE
BUFFALO NY 14214

PHONE: 7168865810

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

X002

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 208 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS ROEBUCK AND CO ADDRESS: 420 EAST DELAVAN BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9106064 ID2: 190085 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 9/5/1991	DATE REPORTED: 9/5/1991
CLOSED DATE: 3/12/1992	INSP DATE: 9/6/1991

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 25 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 25 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: OTHER
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SORGI
SPILL CONTACT:
TELEPHONE:

SPILLER: PRODUCT DISTRIBUTION CO

ADDRESS: 4500 PROGRESS ROAD
LOUISVILLE, KY 40218

TELEPHONE: (800) 452-3362

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 1/10/1996
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9106064 TRACTOR TRAILER WITH LEAKING FUEL TANK. SEARS PUT DOWN SPEEDI-DRI TO CONTAIN. TRUCKING CO THEY WILL ASSUME CLEANUP RESPONSIBILITY. END CALLERREMARK - 9106064

DEC REMARKS:
Start DECRemark - 9106064 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 09/05/91: MJS SITE INSPECT. SADDLE TANK

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 208	DIST/DIR: 0.03 NE	MAP ID: 31
-----------------------	--------------------------	-------------------

NAME: SEARS ROEBUCK AND CO ADDRESS: 420 EAST DELAVAN BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9106064 ID2: 190085 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

RUPTURED. SPEEDI DRI APPLIED IN LOT. NO PRODUCT REACHED SEWERS. FAXED CONTRACTOR LIST TO SPILLER. 09/05/91: MJS RECHECK SITE. EPS ON SITE DOING CLEANUP. MATERIAL PLACED IN DRUMS. TO BE STAGED ON SITE AND SAMPLED. 09/06/91: LETTER TO PRODUCT DISTRIBUTION CO. 03/03/92: DRUM ADDED TO SOIL AT GOOD AND FAIR MOVING - SPILL 9106869. MJS WAITING FOR PAPERWORK. 03/12/92: RECEIVED HAZ-WASTE MANIFEST FOR THREE DRUMS OF DIESEL CONTAMINATED SPEEDI DRI. DRUMS WENT TO CHEM MET SERVICES IN MIICHIGAN. END DECRemark - 9106064

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 228 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS WAREHOUSE ADDRESS: 420 EAST DELAVAN BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8704178 ID2: STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 08/19/87	DATE REPORTED: 08/19/87
SPILL TIME: 14:30	TIME REPORTED: 14:45

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
CONTAMINATED SOIL FOUND IN TANK EXCAVATION

REGION: 9 **UST TRUST?** YES

SPILL INVESTIGATOR: MNP	TELEPHONE:
SPILL CONTACT:	

SPILLER: SEARS WAREHOUSE ADDRESS: 420 EAST DELAVAN BUFFALO, NY 14208	TELEPHONE: (716) 881-9211
SPILLER CONTACT:	

CALLER: DAVE GRAPER AGENCY: ENVIRONMENTAL OIL TELEPHONE:	NOTIFIER: AGENCY: TELEPHONE:
-------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 01/10/96	CLOSE DATE: 03/29/88
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

// : 3000 GAL TANK REMOVED, CONTAMINATED SOIL IS BEING REMOVED, MONITORING WELL TO BE INSTALLED. // : LQR
09/09/87 TELECON W/GRAPER, ENV. OIL.,MW BEING PLACED HIT POCKET OF METHANE GAS. // : 8/24/87 TELECON W/GRAPER,
ENV. OIL., SOIL FLASHED, TO BE AERATED and DISPOSED, GASOLINE IN SOIL, MW TO BE INSTALLED. // : 11/12/87 MNP INSP. ENV.
OIL ON SITE, MW - O.K.;INSP. NEEDED. // : 3/29/88 MNP INSP. CHECKED MW -O.K. NO SHEEN, SEPTIC ODOR NOTED;NO FURTHER
ACTION NEEDED, COMPLETE.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 246 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS, ROEBUCK and CO. ADDRESS: 420 EAST DELAVAN AVE. BUFFALO NY 14214 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-446556 ID2: STATUS: UNREGULATED PHONE: (716) 886-5810
-----------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: OTHER WHOLESALE/RETAIL SALES
TYPE NAME:
TOTAL NUMBER OF TANKS: 2
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 2
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: SEARS, ROEBUCK and CO.
TITLE:
NAME:
ADDRESS: 420 E. DELAVAN AVE.
NY 14214
PHONE: (716) 886-5810
EMERGENCY CONTACT: MIKE PFOHL
PHONE: (716) 886-5810

MAILING INFORMATION

COMPANY: SEARS, ROEBUCK and CO.
TITLE:
CONTACT:
ADDRESS: 420 E. DELAVAN AVE.
BUFFALO NY 14214
PHONE: (716) 886-5810
EMAIL:

EXP. DATE: 6/28/1993
RENEWAL DATE: 12:00:00 AM

COMMENTS: Archived

TANK INFORMATION

<u>TANK NUMBER:</u>	R01	TANK STATUS:	CLOSED - REMOVED
ACTIVE STATUS:	INACTIVE	INSTALLED:	1/1/1966
CLOSED:	11/1/1992	TANK CAPACITY:	5000 GALLONS
PRODUCT:	GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 246 **DIST/DIR:** 0.03 NE **MAP ID:** 31

NAME: SEARS, ROEBUCK and CO. ADDRESS: 420 EAST DELAVAN AVE. BUFFALO NY 14214 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-446556 ID2: STATUS: UNREGULATED PHONE: (716) 886-5810
-----------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PIPE LOCATION:	NO PIPING
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	NONE
LEAK DETECTION 2:	
OVERFILL PROTECTION:	NONE
OVERFILL PROTECTION 2:	
DISPENSER:	SUCTION
SPILL PREVENTION:	
DATE TESTED:	12:00:00 AM
NEXT TEST:	12:00:00 AM
TEST METHOD:	TESTING NOT REQUIRED

<u>TANK NUMBER:</u>	U02	TANK STATUS:	CLOSED - REMOVED
ACTIVE STATUS:	INACTIVE	INSTALLED:	11/1/1979
CLOSED:	11/1/1992	TANK CAPACITY:	6000 GALLONS
PRODUCT:	GASOLINE		

TANK TYPE:	FIBERGLASS COATED STEEL
TANK LOCATION:	UNDERGROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	FIBERGLASS
EXTERNAL PROTECTION 2:	

PIPE TYPE:	GALVANIZED STEEL
PIPE LOCATION:	NO PIPING
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	

SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	NONE
LEAK DETECTION 2:	

OVERFILL PROTECTION:	NONE
OVERFILL PROTECTION 2:	
DISPENSER:	SUCTION
SPILL PREVENTION:	
DATE TESTED:	12:00:00 AM
NEXT TEST:	12:00:00 AM
TEST METHOD:	TESTING NOT REQUIRED

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 69 **DIST/DIR:** 0.03 SE **MAP ID:** 29

NAME: NYSDOT BIN 1039899 ADDRESS: RTE 198 OVER WEST AVE and BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888694 ID2: NYR000127696 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/8/2004 7:48:26 AM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110018888694 AGENCY INTERESTED: 11/8/2004 7:48:26 AM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/16/2004 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000127696 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 7:48:26 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: DIRECTION
LAST REPORTED:
POSTED TO DATABASE: 11/8/2004 7:48:26 AM
DATA UPDATED: 1/5/2006 2:20:26 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 69	DIST/DIR: 0.03 SE	MAP ID: 29
----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 1039899 ADDRESS: RTE 198 OVER WEST AVE and BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110018888694 ID2: NYR000127696 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 9 **DIST/DIR:** 0.03 SE **MAP ID:** 29

NAME: NYSDOT BIN 1039899	REV: 6/6/06
ADDRESS: RTE 198 OVER WEST AVE and BUFFALO NY 14213	ID1: NYR000127696
ERIE	ID2:
CONTACT: DAVID R TACKLEY	STATUS: LGN
	PHONE: 7168473036

SITE INFORMATION

CONTACT INFORMATION: DAVID TACKLEY
MAIN ST
BUFFALO NY 142033088

PHONE: 7168473036

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 165 **DIST/DIR:** 0.03 SE **MAP ID:** 32

NAME: RICH PRODUCTS	REV: 2/5/08
ADDRESS: I190 SB AT NIAGARA STREET	ID1: 9303110
BUFFALO NY	ID2: 207667
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 6/8/1993	DATE REPORTED: 6/8/1993
CLOSED DATE: 10/21/1993	INSP DATE: 6/16/1993

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL:	TRAFFIC ACCIDENT
WATERBODY AFFECTED:	
SOURCE OF SPILL:	COMMERCIAL VEHICLE
REPORTED BY:	FIRE DEPARTMENT

REGION:	9
UST TRUST?	NO

SPILL INVESTIGATOR:	SORGI
SPILL CONTACT:	
TELEPHONE:	

SPILLER:	RICH PRODUCTS
-----------------	---------------

ADDRESS:	BUFFALO, NY
-----------------	-------------

TELEPHONE:

REPORTED BY:	FIRE DEPARTMENT
---------------------	-----------------

LAST DEC UPDATE:	11/5/1993
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

CALLER REMARKS:	START CALLERREMARK - 9303110 TRAFFIC ACCIDENT SPILLING DIESEL FUEL TO GROUND.
END CALLERREMARK - 9303110	

DEC REMARKS:
Start DECRemark - 9303110 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 06/08/93; MJS PAGED BY MARTY DOSTER.
UNABLE TO CONTACT CALLER FOR FURTHER DETAILS. SOME SOIL CONTAMINATION FOUND DURING SITE INSPECTION. NO WORK

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 165 **DIST/DIR:** 0.03 SE **MAP ID:** 32

NAME: RICH PRODUCTS ADDRESS: I190 SB AT NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9303110 ID2: 207667 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

TO BE DONE TONIGHT. 06/08/93: MJS - NUMEROUS PHONE CALLS W/DAN DOWD, LAUGHLIN SERVICE AND DAVE FITZPATRICK, NYS THRUWAY. MR. FITZPATRICK UNCOMFORTABLE W/LAUGHLIN DOING WORK; LAUGHLIN HAVING DIFFICULTY OBTAINING PERMIT FOR WORK. 06/15/93: MJS/DAN DOWD/TELECON - PERMIT OBTAINED. LAUGHLIN TO REMEDIATE ON 6/16/93. 06/15/93: MJS/DAN DOWD, LAUGHLIN/TELECON - PERMIT OBTAINED. LAUGHLIN TO REMEDIATE ON 6/16/93. 06/16/93: MJS/SITE - LAUGHLIN DONE W/JOB. SOIL REMOVAL SATISFACTORY. 06/17/93: MJS RECEIVED MESSAGE AND MAP FROM DAN DOWD EXPLAINING THAT NYS THRUWAY WANTED DRUMS STAGED AT NIAGARA STREET EXIT. 06/21/93: MJS/DAN DOWD/TELECON - SAMPLES SUBMITTED FOR ANALYSIS. EXCAVATION BROUGHT BACK TO GRADE W/TOPSOIL AND SEEDED. 06/21/93: MJS/DAN DOWD, LAUGHLIN/TELECON - SAMPLES SUBMITTED FOR ANALYSIS. EXCAVATION BROUGHT BACK TO GRADE W/TOPSOIL AND SEEDED. 06/23/93: MJS/SITE (2000 HRS) - SOME SOIL CONTAMINATION FOUND. NO WORK TO BE DONE TONIGHT. 06/23/93: MJS - NUMEROUS PHONE CONVERSATIONS W/DAN DOWD (LAUGHLIN SERVICE) and DAVE FITZPATRICK (NYS THRUWAY). NYS THRUWAY UNCOMFORTABLE W/LAUGHLIN DOING JOB. LAUGHLIN HAVING TROUBLE GETTING PERMIT FROM THRUWAY. 08/20/93: MJS TELECON TO DAN DOWD. SOIL NOT YET DISPOSED. HE WILL FORWARD ANALYTICAL RESULTS. AND RECEIPTS WHEN AVAILABLE. 10/04/93: MJS/DAN DOWD/TELECON - HE INFORMS THAT SOIL IS SCHEDULED FOR PICKUP THIS WEEK. HE WILL FORWARD DISPOSAL RECEIPT WHEN AVAILABLE. 10/05/93: MJS RECEIVED COPY OF LETTER FROM NYS THRUWAY TO LAUGHLIN SERVICES STATING THAT SOIL MUST BE REMOVED FROM STAGING SITE BY 10/15/93 OR THRUWAY WILL DO WORK. 10/18/93: MJS RECEIVED DISPOSAL RECEIPT FROM LAUGHLIN SERVICE. NO FURTHER ACTION NECESSARY. MJS TO CLOSE FILE. END DECRemark - 9303110

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 152 **DIST/DIR:** 0.03 SE **MAP ID:** 29

NAME: CHEMICAL SPILL ADDRESS: WEST AVE. SCAJAQUADA EXPRESSWAY BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: 0485089 ID2: 333074 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/29/2004 CLOSED DATE: 10/29/2004	DATE REPORTED: 10/29/2004 INSP DATE: 12:00:00 AM
-----------------------------------------------------------------	-------------------------------------------------------------------

MATERIAL SPILLED: UNKNOWN MATERIAL MATERIAL CLASS: OTHER	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: UNKNOWN
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: ROBERT CHAMBERS
TELEPHONE: (716) 876-9815

SPILLER:

ADDRESS:

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 11/2/2004
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0485089 CALLER SAID THAT THERE IS EVIDENCE OF A CHEMICAL SPILL, DEAD VEGETATION, UNDER THE WEST AVE. BRIDGE OVER THE SCAJAQUADA CREEK, BETWEEN WESTWOOD PHARMACEUTICAL AND FEDCO CO....REQUESTS THAT DEC CONTACTS HIM BACK. END CALLERREMARK - 0485089

DEC REMARKS:
Start DECRemark - 0485089 10/29/04 FG SITE INSPECTION. FOUND AN AREA OF GRASS THAT WAS DISTRESSED IN A PERFECT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 152	DIST/DIR: 0.03 SE	MAP ID: 29
-----------------------	--------------------------	-------------------

NAME: CHEMICAL SPILL ADDRESS: WEST AVE. SCAJAQUADA EXPRESSWAY BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: 0485089 ID2: 333074 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

RECTANGULAR AREA OVER THE MIDDLE OF THE WEST AVE BRIDGE OVER SCAJAQUADA CREEK, ON THE EAST SIDE. NO EVIDENCE OF PETROLEUM SPILL, NO ODOR NOTICED. UNSURE OF CAUSE. NO ACTION POSSIBLE. SPILL IS CLOSED. ELECTRONIC FILE ONLY. END DECRemark - 0485089

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 223 **DIST/DIR:** 0.03 SE **MAP ID:** 34

NAME: SCAJAQUADA CREEK ADDRESS: DELAWARE AVENUE BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8907285 ID2: STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 10/23/89	DATE REPORTED: 10/24/89
SPILL TIME: 18:00	TIME REPORTED: 11:45

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: UNKNOWN
RESOURCE AFFECTED: SURFACE WATER
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: UNKNOWN
REPORTED BY: OTHER
CALLER REMARKS:
SHEEN AND PRODUCT ON CREEK.

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: CAF	TELEPHONE:
SPILL CONTACT:	

SPILLER: UNKNOWN
ADDRESS:

SPILLER CONTACT:	TELEPHONE:
-------------------------	-------------------

CALLER: MARGARET WOSTER AGENCY: ERIE COUNTY PLANNING TELEPHONE:	NOTIFIER: AGENCY: TELEPHONE:
--------------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 11/02/89	CLOSE DATE: 10/24/89
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO

DEC REMARKS:
10/24/89: CAF SITE VISIT-WALKED MOST OF CREEK FROM MAIN ST.TO DELAWARE AVE. NO SHEEN FOUND.NO FURTHER ACTION PLANNED.

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 112 **DIST/DIR:** 0.03 SW **MAP ID:** 30

NAME: MEDAILLE COLLEGE ADDRESS: 18 AGASSIZ CIR BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110004562198 ID2: NYR000086207 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM:	FRS	PROGRAM ID:	110004562198
PROVIDED BY:	FEDERAL AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:		INTEREST ENDED:	
INT END QUAL:		SOURCE OF DATA:	FRS
LAST REPORTED:		LAST EXTRACTED:	
ENFORCEMENT ACT:			
REG PROGRAM:	FACILITY -		

PROGRAM:	RCRAINFO	PROGRAM ID:	NYR000086207
PROVIDED BY:	FEDERAL AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:		INTEREST ENDED:	
INT END QUAL:		SOURCE OF DATA:	NOTIFICATION (RCRA)
LAST REPORTED:	5/25/2000	LAST EXTRACTED:	
ENFORCEMENT ACT:			

REG PROGRAM: CESQG - HAZARDOUS WASTE CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS
 GENERATE: A) 100 KILOGRAMS OR LESS OF HAZARDOUS WASTE PER CALENDAR MONTH, AND ACCUMULATE 1000 KG OR LESS OF HAZARDOUS WASTE AT ANY TIME; OR (B) ONE KILOGRAM OR LESS OF ACUTELY HAZARDOUS WASTE PER CALENDAR MONTH, AND ACCUMULATE AT ANY TIME: 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE; OR 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE; OR (C) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE AT ANY TIME: 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE; OR 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE.

SITE TYPE:	STATIONARY
INTEREST STATUS:	ACTIVE
DATA QUALITY:	V
LOCATION DESC:	
ADDRESS TYPE:	REGULAR URBAN
LAST REPORTED:	
POSTED TO DATABASE:	3/1/2000
DATA UPDATED:	1/6/2006 3:28:07 PM
ENTERED PERSON/METHOD:	REFRESH
PARENT REG ID:	
CONFIDENCE IN ADDR:	MEDIUM
ENFORCEMENT SENSITIVE:	N
REQ MANUAL REVIEW:	
REASON MAN REVIEW:	
SMALL BUS POLICY:	
ENFORCEMENT ACTION:	
DATA PUB ACCESS:	YES
INTERNAL SYS ID:	
FEDERAL FACILITY:	NO
FEDERAL AGENCY:	
TRIBAL LAND:	NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 112

DIST/DIR: 0.03 SW

MAP ID: 30

NAME: MEDAILLE COLLEGE
ADDRESS: 18 AGASSIZ CIR
BUFFALO NY 14214
ERIE

REV: 11/1/06
ID1: 110004562198
ID2: NYR000086207
STATUS: FRS
PHONE:

CONTACT:

TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 260 **DIST/DIR:** 0.03 SW **MAP ID:** 30

NAME: MEDAILLE COLLEGE	REV: 2/5/08
ADDRESS: 18 AGASSIZ CIRCLE	ID1: 8709122
BUFFALO NY	ID2: 284661
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 1/25/1988	DATE REPORTED: 1/26/1988
CLOSED DATE: 2/19/1988	INSP DATE: 2/19/1988

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 8709122 10K UST FAILED SYSTEM TANK TEST .152, TANK TO BE ISOLATED and RETESTED.ASAP END CALLERREMARK - 8709122

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: MEDAILLE COLLEGE

ADDRESS: 18 AGASSIZ CIRCLE
BUFFALO, NY 14214

TELEPHONE: (716) 884-3281

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 2/19/1988
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8709122 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF / / : MF DEC TO INVESTIGATE. / / : MF 1/26/88 TELECON JOE DUERMAYER, PART OF LINE REPLACED, WILL TEST LINE, THEN TEST TANK (ISOLATION). / / : MF 1/29/88 ELMWOOD TANK TELECONED, TANK FAILED RETEST. PRODUCT TO BE PUMPED AS SOON AS THEY GET A SKID TANK. / / : MF 2/1/88 TELECON JOEL DUERMAYER, TANK FAILED ISOLATION RETEST -.19. TANK IS ONLY SOURCE OF HEATING. WILL GET A SKID TANK ASAP. 02/11/88: MF TELECON JOEL, TANK TO BE PUMPED NEXT WEEK BY NOCO, SKID TANK TO BE INSTALLED. TANK TO BE REMOVED BY ELMWOOD TANK ASAP. LETTER SENT. 02/19/88: MF SITE VISIT TANK REMOVAL (ELMWOOD), NO HOLES NOTICED IN TANK, NO ODOR OR SHEEN PRESENT IN THE SOIL. ELMWOOD CLEANING TANK. END DECRemark - 8709122

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 23 **DIST/DIR:** 0.03 SW **MAP ID:** 30

NAME: MEDAILLE COLLEGE	REV: 6/6/06
ADDRESS: 18 AGASSIZ CIR	ID1: NYR000086207
BUFFALO NY 14214	ID2:
ERIE	STATUS: VGN
CONTACT: GARY BRITTAIN	PHONE: 7168843281

SITE INFORMATION

CONTACT INFORMATION: GARY BRITTAIN
18 AGASSIZ CIR
BUFFALO NY 14214

PHONE: 7168843281

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO

GENERATOR STATUS: CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZA

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Chromium
D000

The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane
Ignitable waste

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 23	DIST/DIR: 0.03 SW	MAP ID: 30
----------------------	--------------------------	-------------------

NAME: MEDAILLE COLLEGE
ADDRESS: 18 AGASSIZ CIR
BUFFALO NY 14214
ERIE
CONTACT: GARY BRITTAIN

REV: 6/6/06
ID1: NYR000086207
ID2:
STATUS: VGN
PHONE: 7168843281

Cadmium
1,4-Dichlorobenzene
Corrosive waste
Benzene
Barium
Selenium
The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b
The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to
Silver
Chloroform
Methyl ethyl ketone
Arsenic
Mercury
Lead

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 225 **DIST/DIR:** 0.03 SW **MAP ID:** 30

NAME: MEDAILLE COLLEGE ADDRESS: 18 AGASSIZ CIRCLE BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8709122 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 01/25/88	DATE REPORTED: 01/26/88
SPILL TIME: 15:30	TIME REPORTED: 09:03

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL:	TANK TEST FAILURE
RESOURCE AFFECTED:	GROUNDWATER
WATERBODY AFFECTED:	
SOURCE OF SPILL:	NON-COMMERCIAL/INSTITUTIONAL
REPORTED BY:	TANK TESTER

CALLER REMARKS:
10K UST FAILED SYSTEM TANK TEST .152, TANK TO BE ISOLATED and RETESTED.ASAP

REGION: 9	UST TRUST? YES
------------------	-----------------------

SPILL INVESTIGATOR: MF	TELEPHONE:
SPILL CONTACT:	

SPILLER: MEDAILLE COLLEGE	TELEPHONE: (716) 884-3281
ADDRESS: 18 AGASSIZ CIRCLE	
BUFFALO, NY 14214	
SPILLER CONTACT:	

CALLER: JOHN KUDLA	NOTIFIER:
AGENCY: ELMWOOD TANK	AGENCY:
TELEPHONE: (716) 694-0106	TELEPHONE:

LAST DEC UPDATE: 02/19/88	CLOSE DATE: 02/19/88
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

// : MF DEC TO INVESTIGATE. // : MF 1/26/88 TELECON JOE DUERMAYER, PART OF LINE REPLACED, WILL TEST LINE, THEN TEST TANK (ISOLATION). // : MF 1/29/88 ELMWOOD TANK TELECONED, TANK FAILED RETEST. PRODUCT TO BE PUMPED AS SOON AS THEY GET A SKID TANK. // : MF 2/1/88 TELECON JOEL DUERMAYER, TANK FAILED ISOLATION RETEST -.19. TANK IS ONLY SOURCE OF HEATING. WILL GET A SKID TANK ASAP. 02/11/88: MF TELECON JOEL, TANK TO BE PUMPED NEXT WEEK BY NOCO, SKID TANK TO BE INSTALLED. TANK TO BE REMOVED BY ELMWOOD TANK ASAP. LETTER SENT. 02/19/88: MF SITE VISIT TANK REMOVAL (ELMWOOD), NO HOLES NOTICED IN TANK, NO ODOR OR SHEEN PRESENT IN THE SOIL. ELMWOOD CLEANING TANK.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 244 **DIST/DIR:** 0.03 SW **MAP ID:** 30

NAME: MEDAILLE COLLEGE ADDRESS: AGASSIZ CIRCLE BUFFALO NY 14214 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-224383 ID2: STATUS: UNREGULATED PHONE: (716) 884-3281
----------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: SCHOOL
TYPE NAME:
TOTAL NUMBER OF TANKS: 1
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 1
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: MEDAILLE COLLEGE
TITLE:
NAME:
ADDRESS: AGASSIZ CIRCLE
NY 14214
PHONE: (716) 884-3281
EMERGENCY CONTACT: JOEL DUERMAYER
PHONE: (716) 835-8453

MAILING INFORMATION

COMPANY: MEDAILLE COLLEGE
TITLE:
CONTACT:
ADDRESS: AGASSIZ CIRCLE
BUFFALO NY 14214
PHONE: (716) 884-3281
EMAIL:

EXP. DATE: 8/17/1992
RENEWAL DATE: 12:00:00 AM

COMMENTS: Archived 10+yrs

TANK INFORMATION

TANK NUMBER: 001	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91
ACTIVE STATUS: INACTIVE	INSTALLED: 1/1/1945
CLOSED: 3/1/1988	TANK CAPACITY: 10000 GALLONS
PRODUCT: 2 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 244	DIST/DIR: 0.03 SW	MAP ID: 30
-----------------------	--------------------------	-------------------

NAME: MEDAILLE COLLEGE ADDRESS: AGASSIZ CIRCLE BUFFALO NY 14214 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-224383 ID2: STATUS: UNREGULATED PHONE: (716) 884-3281
----------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PIPE LOCATION:	NO PIPING
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	NONE
LEAK DETECTION 2:	
OVERFILL PROTECTION:	NONE
OVERFILL PROTECTION 2:	
DISPENSER:	SUCTION
SPILL PREVENTION:	
DATE TESTED:	12:00:00 AM
NEXT TEST:	12:00:00 AM
TEST METHOD:	TESTING NOT REQUIRED

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 113 **DIST/DIR:** 0.04 NE **MAP ID:** 35

NAME: CANISIUS COLLEGE - CAMPION HALL ADDRESS: 2136 MAIN ST BUFFALO NY 14208 ERIE CONTACT:	REV: 11/1/06 ID1: 110014359568 ID2: NYR000113142 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 5/17/2003 10:39:49 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110014359568 AGENCY INTERESTED: 5/17/2003 10:39:49 PM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 1/30/2003 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000113142 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION LAST EXTRACTED: 5/17/2003 10:39:49 PM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: SQG - HAZARDOUS WASTE SMALL QUANTITY GENERATORS GENERATE: (A) MORE THAN 100 AND LESS THAN 1000 KILOGRAMS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH AND ACCUMULATE LESS THAN 6000 KG OF HAZARDOUS WASTE AT ANY TIME; OR (B) 100 KG OR LESS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1000 KG OF HAZARDOUS WASTE AT ANY TIME.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 5/17/2003 10:39:49 PM
DATA UPDATED: 5/27/2003 10:08:20 AM
ENTERED PERSON/METHOD: BEAR
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 113

DIST/DIR: 0.04 NE

MAP ID: 35

NAME: CANISIUS COLLEGE - CAMPION HALL
ADDRESS: 2136 MAIN ST
 BUFFALO NY 14208
 ERIE

REV: 11/1/06
ID1: 110014359568
ID2: NYR000113142
STATUS: FRS
PHONE:

CONTACT:

CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 24 **DIST/DIR:** 0.04 NE **MAP ID:** 35

NAME: CANISIUS COLLEGE - CAMPION HALL	REV: 6/6/06
ADDRESS: 2136 MAIN ST	ID1: NYR000113142
BUFFALO NY 14214	ID2:
ERIE	STATUS: SGN
CONTACT: ED COGAN	PHONE: 7168886600

SITE INFORMATION

CONTACT INFORMATION: ED COGAN
MAIN ST
BUFFALO NY 14208

PHONE: 7168886600

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 24	DIST/DIR: 0.04 NE	MAP ID: 35
----------------------	--------------------------	-------------------

NAME: CANISIUS COLLEGE - CAMPION HALL
ADDRESS: 2136 MAIN ST
BUFFALO NY 14214
ERIE
CONTACT: ED COGAN

REV: 6/6/06
ID1: NYR000113142
ID2:
STATUS: SGN
PHONE: 7168886600

cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b
Lead

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 52	DIST/DIR: 0.04 SE	MAP ID: 37
----------------------	--------------------------	-------------------

NAME: BERGMAN TOOL MFG CO., INC
ADDRESS: 1573 NIAGARA ST
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD002108967
ID2:
STATUS:
PHONE:

RCRIS : NYD002108967
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 51 **DIST/DIR:** 0.04 SE **MAP ID:** 37

NAME: BERGMAN TOOL MANUFACTURING CO INC ADDRESS: 1573 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004338681 ID2: NYD002108967 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/8/1999 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002108967 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:46:24 AM NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110004338681 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 11:40:15 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 27 **DIST/DIR:** 0.04 SE **MAP ID:** 37

NAME: BERGMAN TOOL MANUFACTURING CO INC	REV: 6/6/06
ADDRESS: 1573 NIAGARA ST	ID1: NYD002108967
BUFFALO NY 14213	ID2:
ERIE	STATUS: NLR
CONTACT:	PHONE:

SITE INFORMATION

CONTACT INFORMATION: ALAN FREEDMAN
1573 NIAGARA ST
BUFFALO NY 14213

PHONE: 7168855974

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

332212 - HAND AND EDGE TOOL MANUFACTURING

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

F017

Spent cyanide solutions from salt bath pot cleaning from metal heat treating operations.
Quenching wastewater treatment sludges from metal heat treating operations in which cyanides are used in the process.
Quenching bath residues from oil baths from metal heat treating operations in which cyanides are used in the process.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 149 **DIST/DIR:** 0.04 SE **MAP ID:** 37

NAME: BERGMAN MANUFACTURING	REV: 2/5/08
ADDRESS: 1573 NIAGARA STREET	ID1: 0275210
BUFFALO NY	ID2: 130754
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 7/19/2002	DATE REPORTED: 7/22/2002
CLOSED DATE: 4/7/2003	INSP DATE: 12/5/2002

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: OTHER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: ROBERT DENUNZIO
TELEPHONE: (716) 885-5974

SPILLER: NEWELL RUBBERMAID, INC
PETER SCHULTZ
ADDRESS: 6833 STALTER DR, STE 101
ROCKFORD, IL 61108-

TELEPHONE: (815) 381-8121

REPORTED BY: OTHER

LAST DEC UPDATE: 8/6/2003
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0275210 CONTAMINATION FOUND IN AREA OF FORMER
KEROSENE UST. END CALLERREMARK - 0275210

DEC REMARKS:
Start DECRemark - 0275210 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 07/22/02 AS PER THE NOTE FROM KAB, URS
WILL BE SENDING THE PHASE II REPORT. 08/05/02 JFO CALL TO MARK COLMERAUER OF URS. NOT IN I LEFT A MESSAGE ON HIS

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 149 **DIST/DIR:** 0.04 SE **MAP ID:** 37

NAME: BERGMAN MANUFACTURING ADDRESS: 1573 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0275210 ID2: 130754 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

MACHINE. 08/08/02 JFO REC D A MESSAGE FROM MARK C. HE WILL BE DROPPING OFF THE REPORT TO OUR OFFICE THIS WEEK. 08/12/02 JFO REC D A COPY OF THE REPORT. AS PER THE COVER LETTER A WORK PLAN WILL BE FORWARDED TO THIS OFFICE WHEN COMPLETED. 09/11/02 JFO REC D A COPY OF THE WORK PLAN. THEY WILL NOTIFY US 1 WEEK BEFORE THEY BEGIN WORK. 10/28/02 JFO ON SITE TO DISCUSS REMEDIATION. MET WITH MR DENUNZIO, MARK COLMERAUER AND SCOTT BOTH OF URS CORP. WORK WILL BEGIN IN THE YARD BY THE 2ND WEEK OF NOVEMBER. THEY WILL ALSO DIG TEST PITS. MARK WILL CONTACT ME BEFORE WORK BEGINS. ALSO THE COMPANY WILL BE REPLACING THE FLOOR IN THE FOUNDRY. THEY WILL THEN REMOVE ANY CONTAMINATION AFTER THE FURNACES ARE MOVED. BECAUSE THE RESULTS IN THE PHASE II REPORT ARE SLIGHTLY ABOVE OUR GUIDANCE, REMEDIATION IS NOT BEING REQUIRED BY DEC. 12/05/02 JFO ON SITE MET WITH MARK COLMERAUER. THEY FOUND THE FORMER TANK PIT IN THE SOUTH EAST CORNER OF THE SOUTH LOT. THEY WILL NOT DIG ANY CLOSER TO THE BUILDING OR THE FENCE. CONTAMINATION IS IN THE SOUTH AND EAST WALLS. SAMPLES COLLECTED AND BACKFILLING HAS BEGUN. DEPENDENT ON THE SAMPLE RESULTS, THEY WILL GEOPROBE THE AREAS BETWEEN THE PIT AND THE BUILDING AND THE FENCE AT A LATER DATE. 02/05/03 JFO RECEIVED THE ANALYTICAL RESULTS FROM THE TANK PIT. THE SOUTH SIDEWALL SAMPLE RESULTS ARE SLIGHTLY ABOVE TAGMS. THE NORTH, EAST, WEST AND BOTTOM SAMPLE RESULTS ARE BELOW TAGMS. 02/06/03 JFO DISCUSSED RESULTS WITH SAC. NO SOIL BORINGS WILL BE NECESSARY. I CALLED MARK COLMERAUER OF URS AND INFORMED HIM OF OUR DECISION. HE WILL CONTACT ME WHEN THEY WILL BEGIN REMEDIATION INSIDE THE BUILDING. HE SAID APPROX 1 MONTH. 03/20/03 JFO RECEIVED THE DISPOSAL RECEIPTS FOR 139.52 TONS OF THE SOIL. NO FURTHER ACTION REQUIRED AT THIS TIME THIS SITE WILL BE INACTIVE. CLOSED 07/11/03 JFO RECEIVED THE DISPOSAL RECEIPTS AND THE ANALYTICAL RESULTS FROM THE FOUNDRY EXCAVATION. THE CONFIRMATORY RESULTS ARE CLEAN. DUE TO THE OUTSIDE TANK EXCAVATION S SOUTH SIDEWALL SAMPLE RESULTS THE SITE WILL REMAIN INACTIVE. 08/06/03 JFO SENT INACTIVE LETTER. END DECRemark - 0275210

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

AIRS

SEARCH ID: 276	DIST/DIR: 0.04 SW	MAP ID: 36
-----------------------	--------------------------	-------------------

NAME: JEWETT INC ADDRESS: 750 GRANT ST BUFFALO NY 14213 ERIE CONTACT:	REV: 1/12/08 ID1: NY0989228 ID2: 9140200890 STATUS: AIRS DATABASE PHONE:
--------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------

OPERATING STATUS: X
YEAR MEASURED:
PRINCIPAL PRODUCT:
LAST UPDATED: 11/23/2005
AMBIENT MONITORING:
SOURCE MONITORING EQUIP:
STATE IMPLIMENTED PROG:
PLANT DESC:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 91 **DIST/DIR:** 0.04 SW **MAP ID:** 36

NAME:	JEWETT INC	REV:	11/1/06
ADDRESS:	750 GRANT STREET	ID1:	110001611569
	BUFFALO NY 14213	ID2:	3602900506
	ERIE	STATUS:	FRS
CONTACT:		PHONE:	

FACILITY REGISTRATION INFORMATION:

PROGRAM:	FRS	PROGRAM ID:	110001611569
PROVIDED BY:	FEDERAL AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:		INTEREST ENDED:	
INT END QUAL:		SOURCE OF DATA:	FRS
LAST REPORTED:		LAST EXTRACTED:	
ENFORCEMENT ACT:			
REG PROGRAM:	FACILITY -		

PROGRAM:	FIS	PROGRAM ID:	9-1402-00890
PROVIDED BY:	STATE AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:		INTEREST ENDED:	
INT END QUAL:		SOURCE OF DATA:	FIS
LAST REPORTED:		LAST EXTRACTED:	11/22/2004 12:23:11 PM
ENFORCEMENT ACT:			
REG PROGRAM:	STATE MASTER -		

SITE TYPE:	STATIONARY
INTEREST STATUS:	ACTIVE
DATA QUALITY:	V
LOCATION DESC:	
ADDRESS TYPE:	REGULAR URBAN
LAST REPORTED:	
POSTED TO DATABASE:	3/1/2000
DATA UPDATED:	2/2/2007 6:52:42 AM
ENTERED PERSON/METHOD:	REFRESH
PARENT REG ID:	
CONFIDENCE IN ADDR:	MEDIUM
ENFORCEMENT SENSITIVE:	N
REQ MANUAL REVIEW:	
REASON MAN REVIEW:	
SMALL BUS POLICY:	
ENFORCEMENT ACTION:	
DATA PUB ACCESS:	YES
INTERNAL SYS ID:	

FEDERAL FACILITY:	NO
FEDERAL AGENCY:	
TRIBAL LAND:	NO
TRIBAL LAND NAME:	
CONGRESSIONAL DIST:	29
LEGISLATIVE DIST:	
HYDROLOGICAL UNTIS:	04120104
EPA REGION:	02
AIRSHED:	
CENSUS BLOCK:	

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 92 **DIST/DIR:** 0.04 SW **MAP ID:** 36

NAME: JUEWITT CO ADDRESS: 750 GRANT ST BUFFALO NY 14216 Erie CONTACT:	REV: 11/1/06 ID1: 110028962647 ID2: STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 296455 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 4/21/2007 3:53:23 PM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 4/21/2007 3:53:23 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110028962647 AGENCY INTERESTED: 4/21/2007 3:53:22 PM INTEREST ENDED: SOURCE OF DATA: NJ-NJEMS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 4/21/2007 3:53:23 PM
DATA UPDATED: 6/9/2007 10:53:36 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW: Y
REASON MAN REVIEW: , COUNTY MISMATCH-NJ-NJEMS
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 95 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: MARCON ERECTORS INC ADDRESS: 1 HOWELL ST BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000840127 ID2: NYR000044909 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 5/14/1998 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000044909 AGENCY INTERESTED: 12/31/1997 INTEREST ENDED: 1/1/1999 SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:34 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110000840127 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 9/17/1997 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000044909 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: INTEREST STATUS: DATA QUALITY: LOCATION DESC: ADDRESS TYPE: LAST REPORTED: POSTED TO DATABASE: DATA UPDATED: ENTERED PERSON/METHOD: PARENT REG ID: CONFIDENCE IN ADDR: ENFORCEMENT SENSITIVE: REQ MANUAL REVIEW: REASON MAN REVIEW: SMALL BUS POLICY:	STATIONARY ACTIVE V REGULAR URBAN 3/1/2000 1/5/2006 2:25:27 PM REFRESH MEDIUM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 95	DIST/DIR: 0.05 N-	MAP ID: 39
----------------------	--------------------------	-------------------

NAME: MARCON ERECTORS INC ADDRESS: 1 HOWELL ST BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000840127 ID2: NYR000044909 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 96 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: NYSDEC/MARCON ERECTORS ADDRESS: SITE 9098 BUFFALO NY 12233 ERIE CONTACT:	REV: 11/1/06 ID1: 110017246675 ID2: NYP000948950 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: LAST REPORTED: 6/10/2002 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYP000948950 AGENCY INTERESTED: 12/31/2001 INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 3/11/2004 10:20:35 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 6/10/2002 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYP000948950 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 3/11/2004 10:20:35 PM LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 3/11/2004 10:20:35 PM ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110017246675 AGENCY INTERESTED: 3/11/2004 10:20:34 PM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: FACILITY -
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: iZ
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/11/2004 10:20:35 PM
DATA UPDATED: 1/6/2006 6:27:44 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 96	DIST/DIR: 0.05 N-	MAP ID: 39
----------------------	--------------------------	-------------------

NAME: NYSDEC/MARCON ERECTORS
ADDRESS: SITE 9098
BUFFALO NY 12233
ERIE
CONTACT:

REV: 11/1/06
ID1: 110017246675
ID2: NYP000948950
STATUS: FRS
PHONE:

ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 94	DIST/DIR: 0.05 N-	MAP ID: 39
----------------------	--------------------------	-------------------

NAME: MARCON ERECTORS INC
ADDRESS: 1 HOWELL ST
 BUFFALO NY 14207
 Erie
CONTACT:

REV:
ID1: NY0002167385
ID2:
STATUS:
PHONE:

RCRIS : NYR000044909
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 20 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: NYSDEC/MARCON ERECTORS	REV: 6/6/06
ADDRESS: SITE 9098	ID1: NYP000948950
BUFFALO NY 14207	ID2:
ERIE	STATUS: LGN
CONTACT: REPORTING SECTION	PHONE: 5184028730

SITE INFORMATION

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

56291 - REMEDIATION SERVICES

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 19 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: MARCON ERECTORS INC ADDRESS: 1 HOWELL ST BUFFALO NY 14207 ERIE CONTACT: DOUGLAS GIAMBRONE	REV: 6/6/06 ID1: NYR000044909 ID2: STATUS: LGN PHONE: 7168731051
----------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: DOUGLAS GIAMBRONE
1 HOWELL ST
BUFFALO NY 14207

PHONE: 7168731051

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

23331 - MANUFACTURING AND INDUSTRIAL BUILDING CONSTRUCTION

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	3/27/1998
TYPE:	210 - INITIAL 3008(A) COMPLIANCE ORDER		

AGENCY:	S - STATE	DATE:	12/31/2000
TYPE:	310 - FINAL 3008(A) COMPLIANCE ORDER		

VIOLATION INFORMATION:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 19	DIST/DIR: 0.05 N-	MAP ID: 39
----------------------	--------------------------	-------------------

NAME: MARCON ERECTORS INC ADDRESS: 1 HOWELL ST BUFFALO NY 14207 ERIE CONTACT: DOUGLAS GIAMBRONE	REV: 6/6/06 ID1: NYR000044909 ID2: STATUS: LGN PHONE: 7168731051
----------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	12/2/1997	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	1/3/2002		
TYPE:	GENERATOR-LAND BAN REQUIREMENTS		

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	12/2/1997	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	1/3/2002		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

HAZARDOUS WASTE INFORMATION:

B007

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 175 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: MARCON ERECTORS ADDRESS: HOWELL STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9507939 ID2: 290418 STATUS: ACTIVE PHONE:
--------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 9/1/1995 CLOSED DATE: 12:00:00 AM	DATE REPORTED: 9/28/1995 INSP DATE: 10/9/1997
----------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: UNKNOWN PETROLEUM MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
--------------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: DELIBERATE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: fxgalleg
SPILL CONTACT:
TELEPHONE:

SPILLER: MARCON ERECTORS
DOUGLAS GIAMBRONE
ADDRESS: ONE HOWELL STREET
BUFFALO, NY

TELEPHONE: (716) 873-1051

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 1/3/2008
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9507939 COMPLAINANT HIRED TO SCRAP TANKS. FOUND TANKS CUT OPEN (1 MARKED XYLENE; APPROX. 25,000 GAL.) AND LEAKING ALL OVER PROPERTY. REFUSED TO REMOVE. END CALLERREMARK - 9507939

DEC REMARKS:
Start DECRemark - 9507939 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 1/24/96 DOUG GIAMBRONE FROM ONE

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 175 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME:	MARCON ERECTORS	REV:	2/5/08
ADDRESS:	HOWELL STREET	ID1:	9507939
	BUFFALO NY	ID2:	290418
	ERIE	STATUS:	ACTIVE
CONTACT:		PHONE:	

HOWELL STREET SAID HE WILL HAVE MATERIAL ANALYSED AND WILL THEN SUBMIT A REMEDIATION PLAN, WILL CONTACT US WITH ALL INFORMATION 3/15/96 PAUL MATHIAS, ATTY FOR MR. GIAMBRONE CALLED TO SAY THAT THEY ARE PROCEEDING WITH GETTING BIDS FOR TANK CLOSURE AND CONTAMINATION REMOVAL. HE SAID THAT THE TANKS ARE STAGED ON CONCRETE. HE WILL KEEP US INFORMED OF HIS PROGRESS. 4/26/96 SENT A LTR TO D. GIAMBRONE REQUESTING AN UPDATE ON THE STATUS OF THE SITE WORK BY 5/15/96. 5/24/96 RECD LTR FROM ATTY FOR SITE. THEY HAVE BEEN IN TOUCH W/ RUSS SAVAGE OF NATURE S WAY. MR. MATHIAS WILL CONTACT ME WHEN THEY DECIDE ON A REMEDIATION PLAN. 9/20/96 LTR TO D. GIAMBRONE REQUESTING REMEDIATION UPDATE BY 10/15/96. 10/18/96 PAUL MATHIAS, ATTY FOR SITE, CC D ME ON A LTR TO RUSS SAVAGE REQUESTING A PLAN TO COMPLETE THE SITE WORK. NO DEADLINE GIVEN. 11/18/96 PAUL MATHIAS, ATTY FOR SITE, CC D ME ON A LTR TO R. SAVAGE REQUESTING A PLAN TO COMPLETE THE SITE WORK. 11/22/96 D. GIAMBRONE CALLED TO SAY THAT HE WILL HAVE A CONTRACT W/ A COMPANY TO REMOVE THE AST S BY THE BEGINNING OF JANUARY 1997. 2/5/97 LTR SENT TO D. GIAMBRONE REQUESTING ROE FOR NYSDEC TO DO WORK OR A SCHEDULE OF WORK FROM HIM. RESPONSE IS DUE BY 3/4/97. 2/21/97 FG SPOKE TO DAN REID WITH CHOPRA LEE(773-7625). HE SAID HE WILL BE SAMPLING ON SITE ON MONDAY, 2/24/97. I TOLD HIM THAT SAMPLING MUST BE WHATEVER IS NECESSARY FOR DISPOSAL. HE SAID THERE IS ANOTHER FIRM THAT WILL BE DOING THE SOIL DISPOSAL. 3/3/97 RECD LTR BACK, COMPANY WOULD NOT ACCEPT CERTIFIED LETTER. SENT LETTER FOR ROE OUT REGULAR MAIL. REQUESTING THEIR RESPONSE BY 3/31/97. 3/4/97 RECD LTR FROM D. GIAMBRONE STATING THE PROCEDURE FOR DISPOSAL OF CONTAMINATION ON HIS PROPERTY. ALL WORK IS TO BE COMPLETED WITHIN 180 DAYS. LTR SENT IN RESPONSE TO HIS APPROVING PROPOSAL and ASKING FOR ANALYTICAL, DISPOSAL RECPTS AND NOTIFICATION OF WORK DATES SO THAT DEC CAN INSPECT ONCE WORK IS COMPLETE TO CONFIRM CLEANUP. 4/8/97 LTR SENT REQUIRING A RESPONSE TO MY 3/5/97 LTR WHICH REQUIRES ADDITIONS TO MARCON S ORIGINAL WORK PROPOSAL. RESPONSE IS DUE 5/7/97. 4/23/97 FG RNL SITE VISIT. NO WORK HAS BEEN DONE ON SITE. NO ONE WAS AT THE SITE. WE ATTEMPTED TO TALK TO MR. GIAMBRONE BUT NO ONE ANSWERED THE DOOR. 8/26/97 NO RESPONSE RECD. LTR SENT REQUESTING ROE FROM MR. GIAMBRONE. RESPONSE DUE 9/19/97. 9/4/97 DOUG GIAMBRONE, SITE OWNER CALLED AND SAID THAT HE HAS HIRED SAFETY KLEEN TO DO THE WORK ON SITE. HE HAS CALLED THEM SEVERAL TIMES AND DOES NOT HAVE A FIRM DATE FOR THE WORK. HE HAS BEEN DEALING WITH TERRY DIXON 826-8931. 9/4/97 FG SPOKE TO TERRY DIXON WHO SAID WORK WILL BEGIN EARLY NEXT WEEK. HE PLANS ON REMOVING ALL SLUDGES AND SPILLAGE FROM SITE. HE WILL CALL ME WHEN THEY PLAN ON GOING OUT. 9/12/97 FG SITE VISIT. SAFETY KLEEN ON SITE CLEANING OUT TANKS. THEY INDICATED THAT THE WORK WILL CONTINUE UNTIL NEXT WEEK. THEY ARE ONLY CLEANING OUT THE TANKS. THEY WERE NOT HIRED TO CLEAN ANYTHING ELSE. THEY SAID IT IS VERY DIFFICULT GETTING THE HARDENED OLD PRODUCT OUT OF THE TANKS AND BOTTOM. 9/15/97 FG SITE INSPECTION. THE TWO TANKS HAVE BEEN CLEANED OUT. SAFETY KLEEN WILL COMPLETE THE CLEANOUT OF THE TANK BOTTOM ON WED 9/17/97. 9/16/97 TERRY DICKSON OF SAFETY KLEEN CALLED AND SAID HE DIDN T YET GET AN EPA GENERATOR S ID NUMBER AND NEEDS TO HAUL THE ROLLOFF BOXES FROM THE SITE TO WASTE MANAGEMENT FOR DISPOSAL. HE WAS WONDERING IF I COULD GIVE HIM A HAULER S PERMIT OR SOME AUTHORIZATION TO HAUL THE WASTE WITHOUT THE GENERATOR S NUMBER. I ASKED HIM WHY HE NEEDED A HAZ WASTE AND HE SAID BECAUSE THE LOAD IS CONTAMINATED WITH PCB S ABOVE 50PPM. I TOLD HIM I WAS NOT AWARE THAT THE MATERIAL WAS HAZARDOUS. I TOLD HIM THAT WE COULD NOT GIVE HIM AUTHORIZATION OR A HAULER S PERMIT. HE WOULD HAVE TO WAIT UNTIL HE RECEIVED THE GENERATOR ID NUMBER. I REQUESTED THAT HE FAX OVER RESULTS. EACH TANK WAS SAMPLED AND ALL WERE APPROX 200 PPM. I TOLD HIM THAT I WOULD CONTACT THE OWNER REGARDING FURTHER REMEDIATION REQUIREMENTS. HE SAID HE WAS GOING TO CONTINUE WORK ON FRIDAY. 9/17/97 FG RNL SITE INSPECTION. NO ONE ON SITE. ROLLOFFS STAGED ON SITE. NO ANSWER WHEN WE KNOCKED ON THE DOOR. 9/19/97 FG SITE INSPECTION. ROLLOFFS WERE GONE. NO ONE WAS ON SITE. I LATER CALLED TERRY DIXON WITH SAFETY KLEEN WHO SAID THAT THE SITE IS FENCED AND SECURE. HE SAID THAT WORK WILL BEGIN AGAIN ON MONDAY. THEY DIDNT DO ANY MORE WORK TODAY. THE ROLLOFFS WERE SENT TO WASTE MANAGEMENT FOR DISPOSAL. 9/22/97 FG, TOM CORBETT(HAZ SUBST REG) SITE INSPECTION. TOM MCINERNEY WITH NATIONAL VACCUUM ON SITE. HE SAID THAT HIS COMPANY CONSOLIDATED THE MATERIAL IN THE ROLLOFFS USING SAWDUST. HE SAID HE WAS ORIGINALLY TOLD THAT THE CONTAMINATION WAS UNDER 5PPM PCB S. HE SAID THAT CHEM WASTE HAS REJECTED THE TWO ROLLOFFS THAT WERE SENT THERE BECAUSE THE CONSOLIDATION MATERIAL WAS INAPPROPRIATE FOR DISPOSAL AND QUOTED AN INCINERATION PRICE OF \$11,000 PER ROLLOFF. MR. MCINERNEY S COMPANY, NATIONAL VACCUUM, WAS VACCUING THE BOTTOMS FROM THE OPEN TANK INTO A ROLLOFF ON SITE AND IT WAS 1/4 FULL. WE TOLD HIM THAT HE CANNOT CONSOLIDATE MATERIAL ANY LONGER. MR. MCINERNEY SAID THE THE SLUDGE WHEN IT MIXES WITH WATER TURNS PURPLE/BLUE. IT WAS APPARENT THAT THE SLUDGE HAD SEEPED UNDER THE RETAINING WALL TO THE SOILS. IT WAS APPARENT BECAUSE THE BRICKS SURROUNDING THE RETAINING WALL HAD BEEN MOVED AND THE SOIL WAS STAINED. MR. MCINERNEY SAID THAT HE NOTICED A GOLF BALL and KIDS FOOTPRINTS IN THE SLUDGE AND SAID THAT KIDS HANG OUT IN THIS AREA. 9/22/97 FG SPOKE TO TERRY DIXON WITH SAFETY KLEEN. HE SAID THERE IS A BARBED WIRE FENCE IN THE BACK. WE TOLD HIM TO STOP WORK UNTIL A REMEDIATION PLAN IS SUBMITTED. HE SAID HE HAS TWO ROLLOFFS FILLED WITH THE SLUDGE FROM THE OPEN TANK. I TOLD HIM TO PUT COVERS ON THE ROLLOFFS. 9/22/97 FG CALLED DOUG GIAMBRONE AND LEFT A MESSAGE FOR HIM TO RETURN THE CALL. 9/23/97 BRENDA JOYCE WITH JAECKLE FLEISCHMANN

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 175 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME:	MARCON ERECTORS	REV:	2/5/08
ADDRESS:	HOWELL STREET	ID1:	9507939
	BUFFALO NY	ID2:	290418
	ERIE	STATUS:	ACTIVE
CONTACT:		PHONE:	

CALLED. SHE SAID THEY WILL SUBMIT AN INVESTIGATION PLAN AND NOT A REMEDIATION PLAN. I TOLD HER THAT SHE MUST ADDRESS THE TWO REJECTED ROLLOFFS FROM CHEM WASTE AND THE TWO ROLLOFFS ON SITE. SHE SAID THAT IT WILL. 9/23/97 FG CALLED DAN REID WITH CHOPRA LEE. HE SAID HE WAS NEVER RETAINED BY MR. GIAMBRONE AND NEVER DID THE SAMPLING SO HE HAS NO ADDITIONAL DATA. 9/24/97 TOM CORBETT, HSR, SAID THAT TERRY DIXON CALLED AND ASKED IF THE BOXES AT CHEM WASTE CAN BE TRANSFERRED TO OTHER BOXES. MR. CORBETT TOLD HIM THAT WHATEVER IS TO BE DONE MUST BE SUBMITTED IN WRITING IN A PROPOSAL TO THIS OFFICE. 9/24/97 FG CALLED MATT FORCUCCI WITH THE NYSDOH TO MAKE HIM AWARE OF THIS SITE. HE SAID HE WILL VISIT IT EITHER TODAY OR TOMORROW MORNING. 282-8815. 9/24/97 THE CITY OF BUFFALO WHILE DIGGING A WATER LINE ON BUSH ST WHICH IS EAST OF HOWELL ST UNCOVERED SOME CONTAMINATION WHICH THEY DISPOSED OF AND HAVE SUBMITTED A SOIL GAS SURVEY PROPOSAL. THE SPILL NUMBER IS 9706464. SPOKE TO MR. SCOTT MCCONE WITH URS WHO DID THE WORK FOR THE CITY 856-5636. HE SAID THAT THE CONTAMINATION IS COMING FROM THE DRAINS FROM THE CONCRETE RETAINING WALL. HE IS ALSO CONCERNED ABOUT SITE SAFETY MEASURES. HE SAID THAT THE CONTAMINATION ON BUSH ST IS ALL SUBSURFACE. THE CITY HAS TO CONTINUE INSTALLING THE WATER LINE AND TIME IS CRITICAL. TOLD HIM THAT HE MAY WISH HOLD OFF FOR A WHILE ON THE STUDY UNTIL MARCON HAS SUBMITTED THEIR PROPOSAL. 9/25/97 FG SITE VISIT. FOUND THAT THE RETAINING WALL BACKS RIGHT UP TO BUSH ST WHICH IS A PAPER ST IN THIS AREA. THE FENCE IS PUSHED IN AT ONE SECTION AND ACCESS TO THE SITE IS RELATIVELY EASY THERE. THE REST OF THE WALL HAS 4FT OF FENCE ON TOP OF IT AND BARBED WIRE ON TOP OF THAT. 9/25/97 FG SPOKE TO BRENDA JOYCE WITH JAECKLE FLEISHMANN. I TOLD HER OF THE SUBSURFACE CONTAMINATION AND THAT THEIR PROPOSAL WILL HAVE TO ADDRESS THIS NEW INFORMATION. I EXPLAINED THAT SITE ACCESS IS A CONCERN DUE TO THE BREAK IN THE FENCE AND THAT SHE SHOULD ADDRESS THAT ASAP. I TOLD HER THAT IF MARCON CANNOT AFFORD THE WORK ON SITE THAT SHE SHOULD INFORM THEM NYSDEC WILL DO THE WORK AND THEN REQUIRE COST RECOVERY. SHE SAID THAT THE CITY OF BUFFALO MAY OWN THE TANK AREA. SHE WILL GET BACK TO ME AS SOON AS SHE KNOWS MORE INFO. SHE IS HAVING A MEETING WITH MARCON THIS MORNING. MS. JOYCE S ADDRESS IS: JAECKLE FLEISCHMANN ETC, FLEET BANK BUILDING, 12 FOUNTAIN PLAZA, BUFFALO, NY 14202. 9/25/97 FG SPOKE TO SCOTT MCCONE 856-5636 WHO WAS TO HAVE A MTG WITH THE CITY OF BUFFALO THIS MORNING. I TOLD HIM THAT THE RP IS TO ADDRESS SITE ACCESS. I ALSO TOLD HIM THAT THEY HAVE INDICATED THAT THE CITY MAY OWN A PORTION OF THE HOWELL ST PROPERTY. HE SAID THAT THE CITY DOES NOT OWN THE HOWELL ST PROPERTY. BASED ON THE PROPERTY MAP HE HAS, WITH LOT BLOCK SECTION 088-36-2-6, DOUGLAS GIAMBRONE, ONE HOWELL ST, BUFFALO NEW YORK OWNS THE ENTIRE PARCEL FROM HOWELL TO BUSH TO PARISH TO RAILROAD(WHICH IS OWNED BY NEW YORK STATE) TO SCAJAQUADA AREA. HE WILL PROVIDE A COPY OF THE TAX MAP TO THIS OFFICE. 9/25/97 MATT FORCUCCI VISITED THE SITE AND SAID THAT THE PUSHED IN FENCE SHOULD BE SECURED. HE SAID THAT IF THERE IS SURFACE CONTAMINATION THAT THE SCAJAQUADA PATH WILL BE AN ISSUE. HE WOULD LIKE TO REVIEW THE INVESTIGATION PROPOSAL ONCE IT IS SUBMITTED. 10/2/97 BRENDA JOYCE CALLED AND SAID SHE WILL SUBMIT A COST ESTIMATE ON WHAT NEEDS TO BE DONE. SHE WILL GIVE NYSDEC A STATEMENT OF WHETHER MARCON CAN AFFORD THE WORK OR NOT. SHE SAID THAT THE CITY OF BUFFALO WILL LOOK AT THE FENCE THAT IS DOWN AND DECIDE WHETHER OR NOT THEY WILL FIX IT. 10/3/97 JAECKLE FLEISCHMANN, BRENDA JOYCE, SUBMITTED A LETTER ALONG WITH ANALYTICAL DATA. THE LETTER INDICATED THAT MARCON WILL COMPLETE THE DISPOSAL OF THE MATERIAL IN THE ROLLOFFS AT CHEM WASTE MGT AND AT ONE HOWELL ST ALONG WITH THE MATERIAL LEFT IN THE TANK BOTTOM. THE ASSESSMENT WILL BE COMPLETED THE WEEK OF OCTOBER 6, 1997. DATA FROM JANUARY 1996 COLLECTED BY NFCS WAS INCLUDED IN THE PACKAGE. THIS DATA PACKAGE HAD NOT BEEN PREVIOUSLY SUBMITTED AND SHOWED TETRACHLOROETHENE AT 87PPM. 10/6/97 FG SPOKE TO DAWN HAMILTON WITH WNED NEWS, 845-7040. I TOLD HER THAT MARCON WILL BE ASSESSING THE SITE THIS WEEK. I TOLD HER THAT WE DID NOT BELIEVE THAT SCAJAQUADA CREEK HAS BEEN IMPACTED BUT FURTHER STUDY IS NEEDED. I SAID A REPORT MAY BE AVAILABLE BY THE END OF THE MONTH. 10/6/97 FG SPOKE TO BRENDA JOYCE. I TOLD HER THAT HER SUBMISSION WAS NOT WHAT WE WERE EXPECTING. THERE IS NO WORK PLAN AND NO SPECIFICS ON WHAT WILL BE DONE TO ASSESS SURFACE AND SUBSURFACE CONTAMINATION. THERE IS NO SPECIFICS ON DISPOSAL OF THE WASTE ALREADY REMOVED. SHE SAID SHE WILL HAVE PAUL KELLER FROM ARRIC CORP CALL. ARRIC HAS BEEN HIRED BY MARCON TO COMPLETE THE WORK ON SITE. MS. JOYCE REQUESTED A COPY OF THE FACT SHEET THE DEC SENT OUT(FAX 856-0432). SHE IS EXPECTING THAT THE CITY OF BUFFALO WILL FIX THE FENCE ON TOP OF THE CONCRETE RETAINING WALL BECAUSE SHE CLAIMS THAT THE CITY CONTRACTOR BROKE IT. 10/6/97 FG SPOKE TO PAUL KELLER WITH ARRIC CORP, 681-3535. HE SAID THAT CHEM WASTE MGT WILL BE ON SITE TO SAMPLE THE CONTAINERS FOR DISPOSAL. THEY HAVE ALREADY PROFILED THE MATERIAL STAGED AT CHEM WASTE MGT. DISPOSAL WILL PROBABLY BE AT AN INCINERATOR IN TEXAS. THEY WILL ALSO CHARACTERIZE WASTE LEFT IN THE OPEN TANK BOTTOM. APPROXIMATELY 1/3 OF THE WASTE REMAINS. MR. KELLER WILL MEET CHOPRA LEE ON SITE ON WED TO ASSESS THE SITE FOR FURTHER SURFACE AND SUBSURFACE SAMPLING REQUIREMENTS. MR. KELLER SAID HE WILL HAVE A PLAN INTO THIS OFFICE BY THE END OF THIS WEEK. 10/7/97 SCOTT MCCONE WITH URS CALLED AND ASKED IF THE NYSDEC WOULD APPROVE THE PROPOSAL SUBMITTED FOR FURTHER STUDY AROUND THE WATER LINE SO THAT THEY CAN INSTALL THE WATER LINE. THEY EXPECTED MARCON TO GET BACK TO THEM WITH A PROPOSAL FOR FURTHER STUDY BUT HAVE NOT RECEIVED ONE YET. I

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 142 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME: MARCON ERECTORS ADDRESS: 1 HOWELL STREET BUFFALO NY 14048 ERIE CONTACT:	REV: 2/5/08 ID1: 915173 ID2: 58705.00 STATUS: PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------

SITE INFORMATION

REGION: 9 **SIZE (ACRES):** 1.300

SITE TYPE:

OPEN DUMP: NO	STRUCTURE: YES
LAGOON: NO	LANDFILL: NO
POND: NO	

SITE OWNER/OPERATOR INFORMATION:

NAME:
COMPANY: DOUGLAS GIAMBRONE
ADDRESS: ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: DOUGLAS GIAMBRONE
ADDRESS: 1 HOWELL STREET
BUFFALO NY 14248
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: DOUGLAS GIAMBRONE
ADDRESS: 1 HOWELL STREET
BUFFALO NY 14248
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: DOUGLAS GIAMBRONE
ADDRESS: 1 HOWELL ST.
BUFFALO NY 14048
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: DOUGLAS GIAMBRONE
ADDRESS: 1 HOWELL STREET
BUFFALO NY 14248
COUNTRY: UNITED STATES OF AMERICA

HAZARDOUS WASTE:
AROCHLOR 1260 (PCBS) B007 WASTE

QUANTITY:
UNKNOWN

HAZARDOUS WASTE DISPOSAL PERIOD: unknown TO unknown

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

A removal action completed in February 2000 mitigated environmental problems that were attributable to the hazardous waste (PCBs). Petroleum impacts are being addressed under the Spills Program. Excavation of petroleum source areas are planned.

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 142 **DIST/DIR:** 0.05 N- **MAP ID:** 39

NAME:	MARCON ERECTORS	REV:	2/5/08
ADDRESS:	1 HOWELL STREET	ID1:	915173
	BUFFALO NY 14048	ID2:	58705.00
	ERIE	STATUS:	
CONTACT:		PHONE:	

ASSESSMENT OF HEALTH PROBLEMS:

An elementary school, a playground, and a residential area are near the site. All PCB-contaminated sludges and soil have been removed and disposed off-site. The remedial activities at the site have eliminated potential exposure routes. Exposures via drinking water are not expected because public water serves the area.

DESCRIPTION:

MarCon Erectors occupies a parcel of property approximately 1.3 acres in size in a mixed residential, commercial, industrial area. The site is a triangular shaped parcel of land with a multi-storied brick, frame and block building and a concrete containment area that had two, horizontal, 10,000 gallon, above ground storage tanks (AST) in saddles and one 25,000 gallon AST which had been cut down to about 18 inches in height. Recent operations of this facility was the re-manufacture of windows. Past uses of the facility included fuel blending operations by a company affiliated with Ashland Petroleum Company (approx. 1915 - 1971) and occupation by a roofing company, B. Hoffman Roofers 1971 to 1980. The site had been abandoned when MarCon purchased the property. The cut down tank contained sludge contaminated with VOCs and PCBs. Sampling of this sludge revealed PCB contamination as high as 16,000 ppm. Sampling of the oil/water in the sludge within the cut off tank revealed PCB contamination as high as 122 ppm. Sampling directly outside of the cracks in the structure revealed PCB contamination as high as 5.8 ppm. Improper removal practices during a sludge removal effort in 1997 has resulted in a RCRA enforcement action against the owner and contractor. An interim remedial measure (IRM) to remove source contamination was completed in early 2001. An environmental assessment was conducted in 2001 to determine soil and groundwater impacts. The assessment found all PCB contamination had been removed but petroleum contamination existed both on and off-site. A ROD was issued in March 2002 detailing no further remedial action necessary for the hazardous waste (PCBs). Petroleum contamination remains and is being addressed under the State s Oil Spill Program. Since hazardous waste no longer existed at the site, it was delisted in January 2003.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 144 **DIST/DIR:** 0.05 NW **MAP ID:** 41

NAME: ABANDONED CONTAINERS	REV: 2/5/08
ADDRESS: WEST AVENUE UNDER RT 198	ID1: 9704992
BUFFALO NY	ID2: 202508
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 7/25/1997	DATE REPORTED: 7/25/1997
CLOSED DATE: 12/1/1997	INSP DATE: 7/25/1997

MATERIAL SPILLED: WASTE OIL/USED OIL	AMOUNT SPILLED: 55 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 55 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 1/13/1998
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9704992 11 5 GALLON PAILS WERE ABANDONED SOME WERE KNOCKED OVER AND LEAKING IN TO THE SEWER. END CALLERREMARK - 9704992

DEC REMARKS:
Start DECRemark - 9704992 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 7/25/97: SAC INSPECTION, FOUND NUMEROUS 5 GALS.PLASTIC CONTAINERS OF WASTE OIL AND WATER, NO DISTINCT MARKINGS EXCEPT THE CONTAINERS

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 144	DIST/DIR: 0.05 NW	MAP ID: 41
-----------------------	--------------------------	-------------------

NAME: ABANDONED CONTAINERS
ADDRESS: WEST AVENUE UNDER RT 198
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 9704992
ID2: 202508
STATUS: CLOSED
PHONE:

INDICATED THEY ORIGINALLY CONTAINED COOKING OIL, PLACED DOWN PADS AND SPEEDI-DRY TO ABSORB OIL, GREEN ENVIRONMENT HIRED TO PICK-UP WASTE ABSORBENT AND CONTAINERS, THIN LAYER OF CLAY-SORB PLACED DOWN TO HELP PROVIDE TRACTION FOR CARS AND PEDESTRIANS, 6 DRUMS OF WASTE GENERATED. 7/28/97: SAC TELECON WITH JOE JORDAN/BSA AND JOHN TORRE/GREEN ENV., WILL ARRANGE TO HAVE DRUMS MOVED FROM STAGING AREA ON WEST AVE. TO BSA. 7/31/97: SAC TELECON MATT SCHIMPF, GREEN ENVIRONMENT, DRUMS HAVE BEEN MOVED TO BSA BUT ONLY 5 OF THE 6 DRUMS REMAINED WHEN THEY WENT TO RESTAGE THE DRUMS. 9/16/97: RECEIVED PAYMENT PACKAGE WHICH INCLUDED DISPOSAL RECEIPT. 10/1/97: PROCESSED FINAL PAY PACKAGE. END DECRemark - 9704992

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 88 **DIST/DIR:** 0.05 SE **MAP ID:** 44

NAME: WILLARD MACHINE CORP ADDRESS: 73 FOREST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004441612 ID2: NYD986888659 STATUS: FRS PHONE:
-------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 3/17/1995 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD986888659 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:44:44 AM NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110004441612 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 9:29:34 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 87	DIST/DIR: 0.05 SE	MAP ID: 44
----------------------	--------------------------	-------------------

NAME: WILLARD MACHINE CORP
ADDRESS: 73 FOREST AVE
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD986888659
ID2:
STATUS:
PHONE:

RCRIS : NYD986888659
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB : 002105815
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 63 **DIST/DIR:** 0.05 SE **MAP ID:** 43

NAME: HOHL MACHINE and CONVEYOR CO
ADDRESS: 1540 NIAGARA ST
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110019808449
ID2:
STATUS: FRS
PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS
PROVIDED BY: FEDERAL AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED: 11/22/2004 4:08:09 PM
ENFORCEMENT ACT:
REG PROGRAM: FACILITY -

PROGRAM ID: 110019808449
AGENCY INTERESTED: 11/22/2004 4:08:08 PM
INTEREST ENDED:
SOURCE OF DATA: FIS
LAST EXTRACTED:

PROGRAM: FIS
PROVIDED BY: STATE AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED:
ENFORCEMENT ACT:
REG PROGRAM: STATE MASTER -

PROGRAM ID: 9-1402-00293
AGENCY INTERESTED:
INTEREST ENDED:
SOURCE OF DATA: FIS
LAST EXTRACTED: 11/22/2004 4:08:09 PM

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC: 1540 NIAGARA ST
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 11/22/2004 4:08:09 PM
DATA UPDATED: 12/21/2005 2:53:41 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 56	DIST/DIR: 0.05 SE	MAP ID: 45
----------------------	--------------------------	-------------------

NAME: CONSOLIDATED PKG. MACHINERY CO
ADDRESS: 1400 WEST AV.
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD980531933
ID2:
STATUS:
PHONE:

RCRIS :
PCS :
AFS/AIRS :
SSTS :
CERCLIS : NYD980531933
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 251	DIST/DIR: 0.05 SE	MAP ID: 40
-----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT ADDRESS: 1451 WEST AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8906606 ID2: 230409 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/1/1989	DATE REPORTED: 10/6/1989
CLOSED DATE: 10/10/1989	INSP DATE: 10/6/1989

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: 0
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0

CAUSE OF SPILL:	TANK FAILURE
WATERBODY AFFECTED:	
SOURCE OF SPILL:	COMMERCIAL/INDUSTRIAL
REPORTED BY:	RESPONSIBLE PARTY
CALLER REMARKS:	START CALLERREMARK - 8906606 TEN CHEMICAL TANKS REMOVED, SandHW INVOLVED
END CALLERREMARK - 8906606	

REGION:	9
UST TRUST?	NO

SPILL INVESTIGATOR:	PRINGLE
SPILL CONTACT:	
TELEPHONE:	

SPILLER:	PRATT and LAMBERT
-----------------	-------------------

ADDRESS:	75 TONAWANDA STREET BUFFALO, NY 14207
-----------------	------------------------------------------

TELEPHONE:	(716) 873-6000
-------------------	----------------

REPORTED BY:	RESPONSIBLE PARTY
---------------------	-------------------

LAST DEC UPDATE:	3/5/1990
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

DEC REMARKS:

Start DECRemark - 8906606 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 10/10/89: 10/10/89 MNP TELECONS W/ JOHSTONE - PRATT, SPILL BEING REFERRED TO SandHW FOR FOLLOWUP; DRAFT MEMO TO BEUCHI - SandHW. END DECRemark - 8906606

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NFRAP

SEARCH ID: 1	DIST/DIR: 0.05 SE	MAP ID: 45
---------------------	--------------------------	-------------------

NAME: CONSOLIDATED PKG MACHINERY CORP ADDRESS: 1400 WEST AVE BUFFALO NY 14201 ERIE CONTACT:	REV: 1/23/08 ID1: NYD980531933 ID2: 0201970 STATUS: NFRAP-N PHONE:
------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------

DESCRIPTION:
UNKNOWN

ACTION/QUALITY	AGENCY/RPS	START/RAA	END
ARCHIVE SITE	EPA In-House		03-24-1986
DISCOVERY	EPA Fund-Financed		06-01-1981
PRELIMINARY ASSESSMENT NFRAP (No Futher Remedial Action Planned)	EPA Fund-Financed		03-24-1986

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 35 **DIST/DIR:** 0.05 SE **MAP ID:** 44

NAME: WILLARD MACHINE CORP ADDRESS: 73 FOREST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 6/6/06 ID1: NYD986888659 ID2: STATUS: NLR PHONE:
-------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: WILSON HEDLEY
73 FOREST AVE
BUFFALO NY 14213

PHONE: 7168851630

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

NONE
Ignitable waste

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 164 **DIST/DIR:** 0.05 SE **MAP ID:** 38

NAME: RASCAL S RESTAURANT ADDRESS: 1516 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0175253 ID2: 206242 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 8/9/2001 CLOSED DATE: 8/13/2001	DATE REPORTED: 8/9/2001 INSP DATE: 8/10/2001
--------------------------------------------------------------	---------------------------------------------------------------

MATERIAL SPILLED: COOKING GREASE MATERIAL CLASS: OTHER	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: HOUSEKEEPING
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: DEC

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT: PETER GRACE
TELEPHONE: (716) 883-8840

SPILLER: RASCAL S RESTAURANT
PETER GRACE
ADDRESS: 1516 NIAGARA STREET
BUFFALO, NY 14213-

TELEPHONE: (716) 883-8840

REPORTED BY: DEC

LAST DEC UPDATE: 5/7/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0175253 ECO PHELPS WITNESSED EMPLOYEES AT RASCAL S
POURING COOKING GREASE INTO A DUMPSTER THAT IS ALREADY OVERFLOWING TO PAVEMENT. END CALLERREMARK - 0175253

DEC REMARKS:
Start DECRemark - 0175253 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 08/10/01: MF S/I/MANAGER, EMPLOYEE
DUMPED GREASE INTO OVERFLOWING GREASE CONTAINER. APPX 3 GALLONS ON THE BLACKTOP. SANITARY SEWER MANWAY

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 164	DIST/DIR: 0.05 SE	MAP ID: 38
-----------------------	--------------------------	-------------------

NAME: RASCAL S RESTAURANT ADDRESS: 1516 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0175253 ID2: 206242 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

NEXT TO SPILLAGE. DISCUSSED WITH THE MANAGER, OWNEN NOT ON SITE. THEY WILL HAVE AREA CLEANED TODAY and WILL CALL DARLING TO HAVE THE GREASE CONTAINER CHANGED. LEFT MESSAGE WITH MARIA FOR ECO PHELPS REGARDING MY INSPECTION. NO FURTHER ACTION NECESSARY. OWNER TO GET FINED BY ECO. END DECRemark - 0175253

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 143 **DIST/DIR:** 0.05 SE **MAP ID:** 42

NAME: 473 EAST DELAVAN ADDRESS: 1526 NIAGARA ST BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9501080 ID2: 223138 STATUS: ACTIVE PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 4/25/1995 CLOSED DATE: 12:00:00 AM	DATE REPORTED: 4/25/1995 INSP DATE: 4/27/1995
-----------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: MTBE (METHYL-TERT-BUTYL ETHER) MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT SPILLED: 0 AMOUNT RECOVERED: 0
------------------------------------------------------------------------------------------------------	--------------------------------------------------------

MATERIAL SPILLED: GASOLINE MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 L AMOUNT RECOVERED: 0 L
-----------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: NO INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: YES DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------

RESOURCE AFFECTED

SOIL: NO INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: YES DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
---------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: DEC

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER: MDM PETROLEUM

ADDRESS: 2920 W. OAKFIELD RD
GRAND ISLAND, NY 14072

TELEPHONE:

REPORTED BY: DEC

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 143 **DIST/DIR:** 0.05 SE **MAP ID:** 42

NAME: 473 EAST DELAVAN ADDRESS: 1526 NIAGARA ST BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9501080 ID2: 223138 STATUS: ACTIVE PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

LAST DEC UPDATE: 9/15/2004
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9501080 CONTAMINATED SOIL and GROUNDWATER DISCOVERED WHILE REMOVING 3 GASOLINE TANKS. 1-2K and 2-12K. END CALLERREMARK - 9501080

DEC REMARKS:

Start DECRemark - 9501080 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 04/25/95: JFO SITE VISIT 4/25/95. RMC ON SITE ALSO. CONTAMIN IN EXCAV FOUND 2 WELLS TO BE PLACED IN EXCAV. 1 WELL OUTSIDE. REMED PROPOSAL TO BE SUBMITTED. CONTAMIN SOIL TO BE DISPOSED. 04/25/95: JFO SITE VISIT 04/27/95 TWO 6 MW INSTALLED IN TANK PIT. 04/25/95: 05/01/95 JFO SENT LETTER TO MR GEIGER AND MR GERACE REQUESTING SAMP RESULTS AND WORK SCHEDULE DEADLINE MAY 29, 1995. 04/25/95: 06/08/95 JFO SITE VISIT CES INSTALLED 4 MW IN NORTHWEST CORNER OF PROPERTY OUT SIDE FORMER TANK PIT. 08/18/95: JFO SENT LETTER TO MDM (FURTHER REMEDIATION AND INVESTIGATION REQUIRED) AND RIGHT OF ENTRY FORM RESPONSE DEADLINE SEPT 1, 1995. 03/25/96: REFERRED TO LEGAL DEPARTMENT. 12/15/98 JFO SENT MEMO TO DAVE STEVER DEC ATTY. REQUESTING STATUS UPDATE. CC:ABBY SNYDER. 12/10/01 JFO MET WITH BILL H OF AFI AND MIKE GEIGER. BILL IS SAMPLING THE 3 WELLS AND WILL ANALYZE FOR 8021 STARS. HE MARKED OUT 6 SPOTS WHERE HE WILL SAMPLE THE SOIL USING A GEOPROBE. 01/14/02 JFO REC D A WORK PLAN ALONG WITH THE ANALYTICAL RESULTS. MW-1 AND MW-2 ARE CONTAMINATED. MW-3 IS OUTSIDE THE FORMER TANK PIT AND IS CLEAN. IN THE PLAN THEY AGREED TO DO 4 GEOPROBES. 01/22/02 JFO SPOKE WITH DAVE STEVER. HE WILL CONTACT BILL HEITZENRATER AND INFORM HIM OF THE PROBLEM ALSO I WANT A SCHEDULE FOR THE WORK. TELCON WITH PETER GRASSO 08/20/03 09/15/04 JFO TELCON WITH HAROLD GEIGER ON ANOTHER MATTER. I TOLD HIM NOTHING HAS BEEN DONE WITH THIS SITE. HE SAID HE WOULD CONTACT HIS SON. END DECRemark - 9501080

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 213 **DIST/DIR:** 0.05 SE **MAP ID:** 40

NAME: PRATT and LAMBERT ADDRESS: 1451 WEST AVENUE BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8906606 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 10/01/89	DATE REPORTED: 10/06/89	
SPILL TIME: 12:00	TIME REPORTED: 10:30	

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: UNK
MATERIAL CLASS: UNKNOWN	AMOUNT RECOVERED: UNK

CAUSE OF SPILL: TANK FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
TEN CHEMICAL TANKS REMOVED, SandHW INVOLVED

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MNP SPILL CONTACT:	TELEPHONE:
---------------------------------------------------------	-------------------

SPILLER: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO, NY 14207 SPILLER CONTACT:	TELEPHONE: (716) 873-6000
--------------------------------------------------------------------------------------------------------------------------	----------------------------------

CALLER: KEVIN JOHNSTON AGENCY: PRATT and LAMBERT TELEPHONE: (716) 873-6000	NOTIFIER: AGENCY: TELEPHONE:
-------------------------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 03/05/90 DOES CLEAN UP MEET STANDARDS? YES DEC REMARKS:	CLOSE DATE: 10/10/89 PENALTY RECOMMENDED? NO
-----------------------------------------------------------------------------------------------------	---------------------------------------------------------------

10/10/89: 10/10/89 MNP TELECONS W/ JOHSTONE - PRATT, SPILL BEING REFERRED TO SandHW FOR FOLLOWUP; DRAFT MEMO TO BEUCHI - SandHW.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 231 **DIST/DIR:** 0.05 SE **MAP ID:** 42

NAME: 473 EAST DELAVAN INC ADDRESS: 1526 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-221635 ID2: STATUS: UNREGULATED PHONE: (716) 773-1677
---------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: RETAIL GASOLINE SALES
TYPE NAME:
TOTAL NUMBER OF TANKS: 3
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 3
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: MDM PETROLEUM INC
TITLE:
NAME:
ADDRESS: 2320 WEST OAKFIELD RD
NY 14072
PHONE: (716) 773-1677
EMERGENCY CONTACT: JAMES E BRIER JR
PHONE: (716) 773-1872

MAILING INFORMATION

COMPANY: MDM PETROLEUM INC
TITLE:
CONTACT:
ADDRESS: 2320 WEST OAKFIELD RD
GRAND ISLAND NY 14072
PHONE: (716) 773-1677
EMAIL:

EXP. DATE: 7/20/1997
RENEWAL DATE: 5/1/1992

COMMENTS: **ARCHIVED**

TANK INFORMATION

<u>TANK NUMBER:</u> 1	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1971
CLOSED: 4/1/1995	TANK CAPACITY: 12000 GALLONS
PRODUCT: GASOLINE	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 231 **DIST/DIR:** 0.05 SE **MAP ID:** 42

NAME: 473 EAST DELAVAN INC ADDRESS: 1526 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-221635 ID2: STATUS: UNREGULATED PHONE: (716) 773-1677
---------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUBMERSIBLE
SPILL PREVENTION:
DATE TESTED: 8/1/1993
NEXT TEST: 12:00:00 AM
TEST METHOD: HORNER EZ CHECK I OR II

<u>TANK NUMBER:</u> 2	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1971	
CLOSED: 4/1/1995	TANK CAPACITY: 12000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUBMERSIBLE
SPILL PREVENTION:
DATE TESTED: 8/1/1993
NEXT TEST: 12:00:00 AM
TEST METHOD: SOILTEST AINLAY TANK TEGRITY TESTER

<u>TANK NUMBER:</u> 3	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1971	
CLOSED: 4/1/1995	TANK CAPACITY: 2000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 231	DIST/DIR: 0.05 SE	MAP ID: 42
-----------------------	--------------------------	-------------------

NAME: 473 EAST DELAVAN INC ADDRESS: 1526 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-221635 ID2: STATUS: UNREGULATED PHONE: (716) 773-1677
---------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:	
 PIPE TYPE:	GALVANIZED STEEL
PIPE LOCATION:	UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
 SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	NONE
LEAK DETECTION 2:	
 OVERFILL PROTECTION:	NONE
OVERFILL PROTECTION 2:	
DISPENSER:	SUBMERSIBLE
SPILL PREVENTION:	
DATE TESTED:	8/1/1993
NEXT TEST:	12:00:00 AM
TEST METHOD:	HORNER EZ CHECK I OR II

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 195 **DIST/DIR:** 0.05 SW **MAP ID:** 46

NAME: TAR TO ROADWAY ADDRESS: 30 BURBANK TERRACE BUFFALO NY ERIE	REV: 2/5/08 ID1: 0103289 ID2: 140261 STATUS: CLOSED PHONE:
CONTACT:	

SITE INFORMATION

SPILL DATE: 6/25/2001	DATE REPORTED: 6/26/2001
CLOSED DATE: 7/2/2001	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: TAR	AMOUNT SPILLED: 1 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: BRENNAN
SPILL CONTACT: LYNN COCORAN
TELEPHONE: (716) 881-3401

SPILLER: UNKNOWN PAVING CONTRACTOR
CITY OF BUFFALO

ADDRESS:
ZZ

TELEPHONE: (716) 851-5619

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 11/16/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0103289 CALLER STATES CITY CONTRACTED WITH PAVING COMPANY WHO SPILLED WHAT APPEARS TO BE TAR IN FRONT OF RESIDENCE - THERE HAS BEEN NO CLEAN UP - COMPANY PLACED LEAVES OVER SITE END CALLERREMARK - 0103289

DEC REMARKS:
Start DECRemark - 0103289 Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAB 06/26/01: KAB RECEIVED REPORT OF

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 195	DIST/DIR: 0.05 SW	MAP ID: 46
-----------------------	--------------------------	-------------------

NAME: TAR TO ROADWAY ADDRESS: 30 BURBANK TERRACE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0103289 ID2: 140261 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

MINOR SPILLAGE OF 1 GAL. OF TAR TO ROADWAY. BECAUSE OF MINIMAL SPILLAGE AND SUBSTANCE SPILLED, NO CLEANUP POSSIBLE. NO FURTHER ACTION NECESSARY. CLOSE OUT. *****NO PAPER FILE FOR THIS SPILL***** END DECRemark - 0103289

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 159 **DIST/DIR:** 0.06 NW **MAP ID:** 47

NAME: LOCKPORT TRUCK REPAIR	REV: 2/5/08
ADDRESS: NIAGARA AND TONAWANDA ST. BUFFALO NY ERIE	ID1: 9009320 ID2: 87260 STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/2/1990	DATE REPORTED: 11/2/1990
CLOSED DATE: 5/27/1992	INSP DATE: 11/8/1990

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 100 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 50 G

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: YES	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TRAFFIC ACCIDENT
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: PRINGLE
SPILL CONTACT:
TELEPHONE:

SPILLER: LOCKPORT TRUCK REPAIR

ADDRESS: 640 RICHFIELD STREET
LOCKPORT, NY 14094

TELEPHONE: (716) 433-6613

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 11/11/1992
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9009320 TRAFFIC ACCIDENT INVOLVING 3 VEHICLES, DIESEL FUEL SPILLED ON ROAD, SIDEWALK, GRASS, IN COMBINED SEWER. END CALLERREMARK - 9009320

DEC REMARKS:
Start DECRemark - 9009320 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 11/08/90: 11/8/90 MNP INSP. SPILL CLEANUP SATISFACTORY, 3 DRUMS OF DEBRIS STILL ON SITE, HOLD FOR DISPOSAL and RECEIPTS. 02/01/91: 12/5/90 LETTER SENT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 159	DIST/DIR: 0.06 NW	MAP ID: 47
-----------------------	--------------------------	-------------------

NAME: LOCKPORT TRUCK REPAIR ADDRESS: NIAGARA AND TONAWANDA ST. BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9009320 ID2: 87260 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

REQUESTING DISPOSAL BY 2/1/91. 05/27/92: 5/27/92 RECEIVED DISPOSAL RECEIPT FOR DEBRIS DISPOSED AT MODERN. NO FURTHER ACTION NEEDED, COMPLETE. END DECRemark - 9009320

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 161 **DIST/DIR:** 0.06 NW **MAP ID:** 47

NAME: NIAGARA MOHAWK STATION 6	REV: 2/5/08
ADDRESS: NIAGARA ST and TONAWANDA ST	ID1: 9604790
BUFFALO NY	ID2: 135859
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 7/12/1996	DATE REPORTED: 7/12/1996
CLOSED DATE: 11/18/1996	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: TRANSFORMER OIL	AMOUNT SPILLED: 20 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 20 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: COOKE
SPILL CONTACT: DAVID KULAK
TELEPHONE: (716) 831-7325

SPILLER: NIAGARA MOHAWK
JOHN BAIO
ADDRESS: 144 KENSINGTON AVENUE
BUFFALO, NY -

TELEPHONE: (716) 831-7477

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 11/29/1996
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9604790 TWO SPILLS AT SAME ADDRESS TWO LARGE TRANSFORMER THAT HAS LEAKED THIS AMOUNT OVER THE YEARS TRANSFORMER TO BE TAKEN OUT OF SERVICE CLEAN UP UNDERWAY ON BOTH SPILLS END CALLERREMARK - 9604790

DEC REMARKS:
Start DECRemark - 9604790 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 7/15/96: JDC ON SITE W/ JOHN

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 161	DIST/DIR: 0.06 NW	MAP ID: 47
-----------------------	--------------------------	-------------------

NAME: NIAGARA MOHAWK STATION 6
ADDRESS: NIAGARA ST and TONAWANDA ST
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9604790
ID2: 135859
STATUS: CLOSED
PHONE:

OTABAUCHIAN, NIMO AND FOUNDS SMALL PUDDLES AROUND TRANSFORMERS. ALL TRANSFORMER CONTAINED IN BRICK BLDGS. WORK ANTICIPATED THIS YEAR TO HAVE TRANSFORMERS REMOVED AND DISPOSED OF. 9/5/96: JDC LEFT PHONE MESSAGE W/ MR OTABACHIAN TO UPDATE ME ON CLEANUP STATUS. JDC TELCON W/ MR JOHN BAIO, NIMO - SITE WORK BEGAN MID AUGUST, CONTAMINATED SOILS NO YET REMOVED. REQUESTED NOTIFICATION WHEN EXCAVATION WORK WOULD BEGIN. 10/11/96: JDC TELCON W/ JOHN BAIO, NIMO, NEW PROJECT MGR FOR THE SITE. MINOR SPILL OF NON-PCB OIL TO SIDEWALK AT THE FACILITY OCCURRED WHEN TRANSFORMER WAS BEING MOVED (SN:9608474). CLAYSORB WAS APPLIED, DEBRIS WILL BE DISPOSED OF THROUGH NIMO WASTE STREAM AS NON-PCB. SPILL WILL BE CLOSED WHEN INCIDENT REPORT IS RECEIVED. ONE OF THREE TRANSFORMERS HAS BEEN REMOVED TO DATE, NO COMPLETION DATE FOR PROJECT ACCORDING TO MR BAIO. 11/18/96: JDC RECEIVED TEST RESULTS ON TRANSFORMER OIL SHOWING NON-PCB. REVIEWD FILE AND FOUND COMPLETE. NO FURTHER ACTION REQUIRED, SITE CLOSED. END DECRemark - 9604790

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 162 **DIST/DIR:** 0.06 NW **MAP ID:** 50

NAME: NIAGARA MOHAWK TRANSFORME	REV: 2/5/08
ADDRESS: 1626 NIAGARA STREET	ID1: 9608474
BUFFALO NY	ID2: 184461
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 10/8/1996	DATE REPORTED: 10/8/1996
CLOSED DATE: 10/15/1996	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: TRANSFORMER OIL	AMOUNT SPILLED: 10 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 10 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: HUMAN ERROR

WATERBODY AFFECTED:

SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER

REPORTED BY: RESPONSIBLE PARTY

REGION: 9

UST TRUST? NO

SPILL INVESTIGATOR: COOKE

SPILL CONTACT:

TELEPHONE:

SPILLER: NIAGARA MOHAWK

ADDRESS: JAMES ERICKSON

535 WASHINGTON STREET

BUFFALO, NY

TELEPHONE: (716) 831-7325

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 10/21/1996

CLEAN UP MEET STANDARDS? YES

PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9608474 WHILE MOVING TRANSFORMER IT TIPPED OVER - SPILL
CLEANED UP NON PCB OIL END CALLERREMARK - 9608474

DEC REMARKS:
Start DECRemark - 9608474 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 10/11/96: JDC TELCON W/ JOHN BAIO, NIMO
AND REQUESTED INCIDENT REPORT. LESS THAN 10 GALLONS SPILLED TO SIDEWALK, NO SEWERS AFFECTED. CLAY SORB USED TO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 162	DIST/DIR: 0.06 NW	MAP ID: 50
-----------------------	--------------------------	-------------------

NAME: NIAGARA MOHAWK TRANSFORME
ADDRESS: 1626 NIAGARA STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9608474
ID2: 184461
STATUS: CLOSED
PHONE:

COLLECT SPILL MATERIAL TO BE DISPOSED OF SEPARATELY THROUGH NIMO S WASTE STREAM. 10/15/96: RECEIVED INITIAL REPORT AND FOUND INFO SATISFACTORY, NO FURTHER ACTION REQUIRED. END DECRemark - 9608474

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 151 **DIST/DIR:** 0.06 NW **MAP ID:** 47

NAME: CAR IN SCAJAQUADA CREEK	REV: 2/5/08
ADDRESS: NIAGARA STREET	ID1: 9201726
BUFFALO NY	ID2: 80770
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 5/1/1992	DATE REPORTED: 5/11/1992
CLOSED DATE: 5/12/1992	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 5 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

MATERIAL SPILLED: WASTE OIL/USED OIL	AMOUNT SPILLED: 0
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: YES	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: YES	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: OTHER
WATERBODY AFFECTED:
SOURCE OF SPILL: PASSENGER VEHICLE
REPORTED BY: OTHER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: COOKE
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: OTHER

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 151	DIST/DIR: 0.06 NW	MAP ID: 47
-----------------------	--------------------------	-------------------

NAME: CAR IN SCAJAQUADA CREEK ADDRESS: NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9201726 ID2: 80770 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

LAST DEC UPDATE:	5/14/1993
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

CALLER REMARKS: START CALLERREMARK - 9201726 ABANDONED CAR IN CREEK LEAKING AUTO FLUIDS END
CALLERREMARK - 9201726

DEC REMARKS:

Start DECRemark - 9201726 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 05/11/92: MJH CONTACTED LT. CMDR. CUMMING - THEY WILL SEND AN INSPECTOR TO SITE AND WILL GET BACK TO DEC IF OUR ASSISTANCE IS NEEDED. NO ACTION BY SPILL UNIT NECESSARY AT THIS TIME. 05/12/92: JDC TELECON W/LT. CUMMINGS. NO PETROLEUM CONTAMINATION; NO FURTHER ACTION REQUIRED. 04/08/93: REPORT LOST IN FILE AND RECOVERED. SHOULD HAVE BEEN CLOSED ON COMPUTER. CLOSED OUT NOW. END DECRemark - 9201726

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 218 **DIST/DIR:** 0.06 NW **MAP ID:** 47

NAME: SCAJAQUADA CREEK ADDRESS: NIAGARA AND TONAWANDA BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8902835 ID2: STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 06/19/89	DATE REPORTED: 06/19/89
SPILL TIME: 10:00	TIME REPORTED: 11:30

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: UNKNOWN
RESOURCE AFFECTED: SURFACE WATER
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: CITIZEN
CALLER REMARKS:
DEBRIS IN CREEK FROM RECENT RUNOFF

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MJH	TELEPHONE:
SPILL CONTACT:	

SPILLER: UNKNOWN
ADDRESS:

SPILLER CONTACT:	TELEPHONE:
-------------------------	-------------------

CALLER: DAVE ANDERSON	NOTIFIER:
AGENCY: USCG-MSO	AGENCY:
TELEPHONE: (716) 846-4168	TELEPHONE:

LAST DEC UPDATE: 06/28/89	CLOSE DATE: 06/22/89
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS: 06/26/89: FOLLOWUP REFERRED TO AREA ENGINEER, NO ACTION NEEDED BY SPILL GROUP NO SPILL.	

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 240 **DIST/DIR:** 0.06 NW **MAP ID:** 49

NAME: CITY SERVICE TAXI ADDRESS: 980 GRANT STREET BUFFALO NY 14207 ERIE CONTACT: VICTOR CANNAROZZO, JR	REV: 2/5/08 ID1: PBS9-600053 ID2: STATUS: ACTIVE PHONE:
-----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: TRUCKING/TRANSPORTATION/FLEET OPERATION
TYPE NAME:
TOTAL NUMBER OF TANKS: 2
NUMBER OF ACTIVE TANKS: 2
NUMBER OF INACTIVE TANKS:
TOTAL FACILITY CAPACITY: 10500 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: PRIVATE RESIDENT
COMPANY: VICTOR CANNAROZZO JR
TITLE: OWNER
NAME: VICTOR CANNAROZZO, JR
ADDRESS: 40 TRISTAN LANE
NY 14221
PHONE:
EMERGENCY CONTACT: RAYMOND SWARTZMEYER
PHONE:

MAILING INFORMATION

COMPANY: CITY SERVICE TAXICAB OF BUFFALO, INC.
TITLE:
CONTACT: VICTOR CANNAROZZO JR
ADDRESS: 980 GRANT STREET
BUFFALO NY 14207
PHONE:
EMAIL:

EXP. DATE: 10/11/2011
RENEWAL DATE: 12:00:00 AM

COMMENTS: 09/09/03 UST is temp. closed - need to verify monitoring. pfk 11/21/03 Received CP test result for anode:
(-1.09 mv) pfk

TANK INFORMATION

<u>TANK NUMBER:</u> 1	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 1/1/1985	
CLOSED: 12:00:00 AM	TANK CAPACITY: 10000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: EPOXY LINER
EXTERNAL PROTECTION: RETROFITTED SACRIFICIAL ANODE
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 240 **DIST/DIR:** 0.06 NW **MAP ID:** 49

NAME: CITY SERVICE TAXI ADDRESS: 980 GRANT STREET BUFFALO NY 14207 ERIE CONTACT: VICTOR CANNAROZZO, JR	REV: 2/5/08 ID1: PBS9-600053 ID2: STATUS: ACTIVE PHONE:
-----------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------

PIPE TYPE: EQUIVALENT TECHNOLOGY
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: OTHER
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: IN-TANK SYSTEM (ATG)
LEAK DETECTION 2: OTHER

OVERFILL PROTECTION: FLOAT VENT VALVE
OVERFILL PROTECTION 2:
DISPENSER: SUBMERSIBLE
SPILL PREVENTION: CATCH BASIN
DATE TESTED: 10/21/2005
NEXT TEST: 10/21/2010
TEST METHOD: USTEST 2000/P/LL PLUS USTEST 2000/U

<u>TANK NUMBER:</u>	2	TANK STATUS:	IN SERVICE
ACTIVE STATUS:	ACTIVE	INSTALLED:	1/1/1999
CLOSED:	12:00:00 AM	TANK CAPACITY:	500 GALLONS
PRODUCT:	WASTE OIL/USED OIL (HEATING)		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND ON CRIB, RACK, OR CRADLE
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: COPPER
PIPE LOCATION: ABOVEGROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 62 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G MART ADDRESS: 1531-1543 NIAGARA STREET BUFFALO NY 14213 Erie CONTACT:	REV: 11/1/06 ID1: 110028215820 ID2: STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/20/2007 3:31:57 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110028215820 AGENCY INTERESTED: 2/20/2007 3:31:56 PM INTEREST ENDED: SOURCE OF DATA: ICIS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: ICIS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: ACTUAL ACTIVITY DATE INT END QUAL: LAST REPORTED: 11/27/2006 3:29:30 PM ENFORCEMENT ACT: REG PROGRAM: ENFORCEMENT/COMPLIANCE ACTIVITY - ENFORCEMENT/COMPLIANCE ACTIVITY	PROGRAM ID: 600011587 AGENCY INTERESTED: 10/9/2006 INTEREST ENDED: SOURCE OF DATA: ICIS LAST EXTRACTED: 2/20/2007 3:31:57 PM
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 2/20/2007 3:31:57 PM
DATA UPDATED: 6/6/2007 4:07:56 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY: N
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 249 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9400660 ID2: 284152 STATUS: ACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 4/11/1994 CLOSED DATE: 12:00:00 AM	DATE REPORTED: 4/11/1994 INSP DATE: 4/18/1996
-----------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: MTBE (METHYL-TERT-BUTYL ETHER) MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT SPILLED: 0 AMOUNT RECOVERED: 0
------------------------------------------------------------------------------------------------------	--------------------------------------------------------

MATERIAL SPILLED: GASOLINE MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 L AMOUNT RECOVERED: 0 L
-----------------------------------------------------------------------	------------------------------------------------------------

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: OTHER
CALLER REMARKS: START CALLERREMARK - 9400660 CONTAMINATION FOUND DURING TANK PULL. END
CALLERREMARK - 9400660

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT: MR PETER GERACE
TELEPHONE: (716) 867-1339

SPILLER: QUAL-ECON LEASE CO. INC.
MR MICHAEL G. PACHE
ADDRESS: 14 COLONIAL DRIVE
TONAWANDA, NY 14150-

TELEPHONE: (716) 695-0935

REPORTED BY: OTHER

LAST DEC UPDATE: 1/7/2008
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9400660 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 04/11/94: JDC ON SITE W/ MR GERACE, RP AND MR COSTA OF CES. NO CONTAMINATED SOILS REMOVED, ALL TO BE INSITUE TREATMENT. SENT STATARD FORM LETTER W/ RESPONSE DATE OF 5/16/94. 04/21/94: JDC/SAC/ MR GERACE, RP MET ON SITE TO DISCUSS CLEANUP ACTION. MR JAMES GIEGER WAS ON SITE, BUT DID NOT MEET WITH HIM. DO NOT KNOW THE RELATIONSHIP, IF ANY BETWEEN MR GEIGER AND GERACE. AGREED THAT FURTHER ANALYSIS WOULD BE REQUIRED BEFORE TYPE OF REMEDIATION WOULD BE DETERMINED. DECISION BY 5/16/94. 05/05/94: JDC MET ON SITE W/ RP AND MR COSTA, GROUNDWATER TO BE PUMPED AND DISPOSED OF AT SAFTEY CLEAN. SOIL REMOVED FOR STAGING AND BIO-TREAT. COMPLAINT OF PETROLEUM ODORS BY NEIBORS, WILL MONITOR SITE. (3) MONITORING/ RECOVERY WELLS HAVE BEEN INSTALLED IN THE TANK FIELD. 05/06/94: ANALYSIS DATED 4/22/94 INDICATES SOILS TO BE HAZARDOUS UNDER BENZENE AND LEAD. 05/06/94: JDC/COSTA/GERACE ON SITE WELLS PLACED TO REMOVE GROUNDWATER FOR TREATMENT ON SITE. COMPLAINT OF ODORS BY NEIGHBOR AT 1332 WEST AVE. ADVISED TO COVER

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 249 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9400660 ID2: 284152 STATUS: ACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

REMOVED SOIL BEING STAGED FOR TREATMENT. 05/09/94: JDC TELCON W/ OFFICER DIAZ, BFD ON ODOR COMPLAINT FROM 1332/34 WEST AVE. NO FIRE SAFTY CONCERN, WILL INSPECT SITE W/ HNU FOR ODOR CONCENTRATIONS. 05/10/94: JDC ON SITE COLLECTED HNU READINGS DUE TO RESIDENT COMPLAINTS, FOUND LOW PPM INDICATIONS. WAITING FOR REMEDIATION PLAN FROM R.P. 5/16/94. 05/19/94: JDC/ C. COSTA, SAMPLES FROM EXCAVATION TAKEN. WILL SUBMIT ANALYSIS W/ REMEDIATION PLAN. CK BACK 6/1/94. 06/27/94: SENT LETTER TO RP REQUESTING REMEDIATION PLAN. CK BK 7/16/94. 06/28/94: JDC TELCON W/ P GERACE AND REQUESTED CLEANUP STATUS IN WRITING. HE SAID LETTER WOULD BE FORWARDED. CK BK 7/14. 07/13/94: JDC TELCON W/ PETER GERACE-BIOTREAT GOING OUT TO BID THIS WEEK. WHEN QUOTES EXPECTED BY END OF THIS MONTH. CK BK 7/29/94. 07/29/94: SENT NO RESPONSE LETTER W/ LEGAL ACTION. CK BK 8/12/94. 08/19/94: RECEIVED RESPONSE FROM RP STATING CONTRACTOR BIDS NOT RETURNED AND RIGHT OF ENTRY FROM LOCAL RESIDENT NOT RECEIVED. 11/10/94: SENT LETTER REQUESTING STATUS BY 11/18/94. 03/13/95: JDC TELCON W/ P GERACE, REQUESTED SITE REMEDIATION PLAN BY 3/17/95, IF NOT RECEIVED LEGAL ACTION WILL BEGIN. 03/23/95: RECEIVED LETTER FROM CES THAT THEY WILL BE SAMPLING GW AND BIOTREATING SOILS ON SITE, PLAN WILL BE FORWARDED. CK BK 4/17/95. 03/27/95: RECEIVED LETTER FROM CES THAT THEY WILL BE SAMPLING GW AND BIOTREATING SOILS ON SITE, PLAN WILL BE FORWARDED. CK BK 4/17/95. 04/20/95: SENT LETTER TO RP REQUESTING BIOTREATMENT PLAN AND GW ANALYSIS AS PROMISED IN CES LETTER DATED 3/23/95. 07/17/95: RECEIVED ANALYSIS AND FOUND EXTREME EXCEEDENCES OF GW STANDARDS. SENT FOLLOWUP LETTER RP REQUESTING STATUS. 11/16/95: JDC SENT LETTER TO RP REQUESTING SITE REMEDIATION PLAN. WILL INITIATE LEGAL ACTION IF NO RESPONSE BY 12/14/95. 12/28/95: NO RESPONSE FROM RP REGARDING CLEANUP ACTION AS REQUESTED LETTER DATED 11/16/95. INITIATED LEGAL ACTION. 1/19/96: ACCORDING TO CURRENT TAX RECORDS. QUALECON LEASE CO INC, 2320 W. OAKFIELD DR. GRAND ISLAND IS CURRENT ADDRESS WHERE TAX BILL IS MAILED. 1/22/96: LOCATED 2320 OAKFIELD ST., FOUND TO BE LOCAL RESIDENCE, NO BUSINESS SIGN OR MAILBOX NAME. 1/24/96: OBTAINED PHONE NUMBER FOR SPILL SITE UNDER GandG PETROLEUM, 1543 NIAGARA ST, BUFFALO. LEFT MESSAGE FOR MR GERACE TO RETURN MY CALL. 1/25/96: SENT FINAL LETTER TO RP REQUESTING REMEDIATION PLAN. 1/26/96: RECEIVED CERT MAIL RECEIPT. 2/14/96: NO RESPONSE FROM RP WILL INITIATE LEGAL ACTION. 4/18/96: INSPECTED PROPERTY, NO REMEDIAL ACTIVITY. 4/2/97: COMPLAINT RECEIVED UNDER SPILL NUMBER 9700094 THAT SHEEN, AND STRONG PETROLEUM ODORS WERE PRESENT IN HIS BACK AT 58 BIRD AVE. FG RESPONDED AND MET W/ MR ARTHUR SMITH AND CONFIRMED SITE CONDITIONS. 4/3/97: SAC CONTACTED ABBY SNYDER, LEGAL AND ARRANGED TO HAVE A LETTER SERVED TO MR GERACE, RP W/ A R.O.E FORM TO ALL DEC TO REMOVE SOIL. LEGAL ACTION IS ONGOING AGAINST RP. 4/10/97: JDC MET W/ DAVE STEVER AND MARK PHELPS, ECO, ORDER OF ROE WILL BE SERVED TODAY. MR GERACE HAS UNTIL THE END OF THIS MONTH TO RESPOND TO ORDER, OTHERWISE CONTRACTOR WILL BE HIRED VIA COURT ORDER ALLOWING ACCESS. 6/17/97: JDC TELCON W/ TODD DAVISON, MODERN - HE STATED THAT PINTO WAS TO COLLECT THEIR OWN SAMPLES AND SUBMIT VIRGIN LETTER STATING THE CONTAMINATE WAS GASOLINE. LEFT MESSAGE FOR GEORGE PINTO TO RETURN MY CALL. 6/18/97: JDC TELCON W/ GEORGE PINTO WHO HAD AGREED TO ARRANGE AND TRANSPORT CONTAMINATED SOILS FROM THE SITE FOR THE RP. THIS WAS PER SEVERAL CONFERENCE CALLS W/ PETER GERACE, SAL CALANDRA AND DAVE STEVER. ACCORDING TO MR PINTO HE AGREED TO LOAD THE SOIL NOT TRANSPORT OR ARRANGE DISPOSAL. MR GERACE WAS TO CONTACT JOE HICKMAN AT MODERN AND ARRANGE W/ MODERN TRANSPORTATION AND DISPOSAL. JDC TELCON W/ P GERACE - MODERN HAS NOT CONTACTED HIM REGARDING DISPOSAL, HE HAS DONE ALL THAT WAS REQUESTED BY MODERN. HE WILL CALL JOE HICKMAN AND RETURN A CALL W/ UPDATE. 7/2/97: JDC LEFT MESSAGE FOR G PINTO TO RETURN MY CALL. 7/2/97: JDC TELCON W/ JOE HICKMAN, MODERN - SAMPLE RESULTS ARE ACCEPTABLE, HE WILL ADVISE P GERACE TO DETERMINE DATE FOR SOILS TO BE TRANSPORTED. SOME FINANCIAL ASPECTS NEEDED TO BE WORKED OUT BETWEEN MODERN AND RP. 7/30/97: JDC INSPECTED SITE AND FOUND ONLY A MINOR AMOUNT OF SOIL REMOVED. WILL FOLLOWUP W/ MODERN TO DETERMINE HOW MUCH SOIL WAS RECEIVED. 8/6/97: JDC LEFT MESSAGE FOR J HICKMAN TO RETURN MY CALL. 8/13/97: JDC LEFT MESSAGE FOR JOE HICKMAN TO RETURN MY CALL. SENT LETTER TO PETER GERACE REQUESTING DISPOSAL RECEIPTS. 8/14/97: ACCORDING TO MR HICKMAN 800 TONS OF SOIL WAS REMOVED. WILL NEED DISPOSAL RECEIPTS TO CONFIRM. 8/26/97: RECEIVED PRINT OUT OF SOIL RECEIVED AT MODERN. REQUESTED COVER LETTER FROM JOE HICKMAN TO ASSOCIATE OWNERSHIP. 8/29/97: JDC INSPECTED SITE AND CONFIRMED ALL BUT 100 TRDS OF SOIL HAS BEEN REMOVED. WILL REQUESTED GandG TO SAMPLE SOILS TO CONFIRM CLEAN. SENT LETTER REQUESTING WORK CONTINUE TO REMEDIATE SUBSURFACE CONTAMINATION. 9/3/97: RECEIVED DISPOSAL CONFIRMATION OF 832 TONS TO MODERN DISPOSAL. 3/12/98: LEFT MESSAGE FOR MR GERACE TO RETURN MY CALL REGARDING STATUS. JDC ON SITE AND MET W/ PETER GERACE, WALKED THE PROPERTY AND DISCUSSED CLEANUP REQUIREMENTS. REQUESTED HE SAMPLE SOIL PILE UNDER 8021 TO ENSURE NO CONTAMINATION IS PRESENT. HE STATED THAT THE SOIL WAS CLEAN FROM EARLY STORE CONTRUCTION AT RESCALS AT 1516 NIAGARA. WILL SEND LETTER OUTLINING/ RESTATING REQUIREMENTS. SPOKE W/ A MR ART SMITH, RESIDENT AT 58 BIRD REGARDING COMPLAINT OF FREE PETROLEUM PRODUCT CONTAMINATING HIS KIDS CLOTHS. STATES THE SOURCE TO BE GERACE PROPERTY. CLAIMS THERE IS A LARGE ROCK THAT IS COVERING AN AREA OF CONTAMINATION. AGREED TO MEET HIM ON SITE TO INSPECT THIS AREA. SPOKE W/ HIS WIFE AND REQUESTED HE CONTACT ME W/ A TIME AT HIS CONVICIENCE. 10/2/98: REVIEWD FILE AND DISCUSSED CURENT STATUS W/ DAVE STEVER AND B LEARY. WAS

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 249 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9400660 ID2: 284152 STATUS: ACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

DETERMINED TO ADVISE MR GERACE THAT HE MUST PROVIDE REQUESTED SAMPLING DATA AND SITE REMEDIATION PLAN OR ROW WOULD BE REQUIRED TO ALLOW DEC TO DO THE WORK. WILL SEND LETTER. 2/8/99: JDC TELCON W/ PETER GERACE WHO REQUESTED A STATEMENT LETTER TO SHOW CLEANUP PROGRESS. INTENDED TO REFINANCE THE PROPERTY. REQUESTED HE FORWARD SAMPLE RESULTS W/ A REMEDIATION PLAN. HE CLAIMS THAT CES HAS REFUSED TO DO THE WORK, HOWEVER HE HAS MADE ARRANGMENTS W/ A LAB TO PERFORM TESTING ON ALL SITE WELLS. HE STATED THAT ALL CORRISPONDANCE HAD BEEN GIVEN TO GES, THEREFORE HE HAS NONE OF OUR CLEANUP LETTERS. ADVISED THAT WE WOULD FAX THEM OVER FOR HIS RECORDS. 2/9/99: FAXED FILE LETTERS TO RP. 2/24/99: JDC TELCON W/ BRENDA EDWARDS, NEW COURT LENDING (973-606-4934), SHE WAS REQUESTING CURRENT INFO ON THE SITE REMEDIATION AND CLEANUP. RP IS LOOKING TO CONSOLIDATE DEBT TO GENERATE FUNDS TO DO CLEANUP WORK. SHE ALSO SPOKE W/ JOHN OTTO REGARDING RASCALS, ADVISED DAVE STEVER OF SAME. 12/5/01:SAC MET W/BILL HEITZENRATER OF AFI, MR. HEITZENRATER MET W/DAVE STEVER TO DISCUSS WORK TO BE DONE ON SITE ACROSS THE STREET AND THIS ONE, HE IS GOING TO SAMPLE THE FOUR ON-SITE WELLS NEXT WEEK INCLUDING TAKING A HEADSPACE OF THE SAMPLES AND THEN SUBMIT THEM FOR ANALYSIS, HE WILL LOOK INTO THE ADDITIONAL SOIL OUT BACK AND POSSIBILITY OF PERFORMING A SITE ASSESSMENT AT THE SITE. 12/10/01:SAC SPOKE TO JFO WHO INSPECTED SITE, PID METER READINGS ARE ELEVATED FOR THE WATER SAMPLES THAT WERE TAKEN, 3 OF THE 4 SAMPLES HAD READINGS IN EXCESS OF 500 ppm AND ONE WELL HAD A READING OF 230 ppm. 1/7/02:RECEIVED ANALYTICAL RESULTS FROM THE WELL SAMPLES FROM THE TANK FIELD, THE RESULTS EXCEED GW STANDARDS IN ALL 4 WELLS AND ARE HIGHEST IN MW-1 and MW-2. 1/9/02:SAC MET W/DAVE STEVER - DEC LEGAL AFFAIRS AND BILL HEITZENRATER, AFTER DISCUSSING AND REVIEWING THE FILE IT WAS DETERMINED THAT ORIGINAL SPILL WAS AROUND THE CANOPY WHICH IS WHERE THE OLD TANK FARM AND PUMP ISLAND WERE, THE SAMPLES WERE TAKEN FROM WELLS AROUND NEW TANK FIELD, SO IT IS UNCLEAR WHETHER LEVELS THAT WERE FOUND IN THE WELLS WERE FROM CONTAMINATION FOUND WHEN THE TANKS WERE REMOVED OR FROM A NEW SPILL FROM THE OPERATION OF THE NEW TANKS, MR. HEITZENRATER PROPOSED SAMPLING AND ARRANGING THE DISPOSAL OF SOIL THAT REMAINS STAGED IN THE BACK OF THE SITE, HE WILL INSTALL 3 WELLS AROUND THE SITE TO TRIANGULATE AND DETERMINE GW QUALITY OF THE SITE, THIS WORK WILL TAKE PLACE IN SPRING 02, THEN HE WILL INSTALL GEO PROBES TO DETERMINE LEVELS OF CONTAMINATION IN THE SOIL. 1/14/02:RECEIVED COPY OF LETTER FROM BILL HEITZENRATER TO DAVID STEVER REGARDING WHAT WAS AGREED TO AT 1/9/02 MEETING. 11/21/02:SAC TELECON BILL HEITZENRATER, MR. HEITZENRATER SAID HE NO WORK HAS BEEN DONE THAT WAS PROPOSED AND AGREED TO AT THE 1/9/02 MEETING AND STATED IN 1/9/02 LETTER. 11/29/02:DRAFTED LETTER TO HAROLD GEIGER REQUIRING WORK SCHEDULE BY 1/15/03 FOR THE WORKPLAN DATED 1/9/02 SUBMITTED BY AFI ENVIRONMENTAL. 2/17/03:LETTER DRAFTED ON 11/29/02 AND SENT ON 12/2/02 WAS CERTIFIED BUT RETURNED AS UNDELIVERABLE, SAC SPOKE TO HAROLD GEIGER ON 1/14/03 DURING SAMPLING EVENT AT 473 EAST DELAVAN, MR. GEIGER SAID THAT 1060 SHERIDAN DRIVE ADDRESS WAS THE CORRECT ADDRESS, SAC DRAFTED SAME LETTER THAT WAS SENT ON 12/2/02 ONLY THIS TIME RESPONSE REQUIRED BY 3/31/03. 4/2/03:SAC AND DAVE STEVER MET W/HAROLD GEIGER, THE LETTER DRAFTED ON 2/17/03 WAS ALSO UNDELIVERABLE, SO SAC HAND DELIVERED THE LETTER TO MR. GEIGER, MR. STEVER TOLD MR. GEIGER HE NEEDS TO SPEAK TO PETER GERACE AND TELL HIM WORK MUST BEGIN SOON WITH A POSSIBLE STIPULATION BEING SIGNED OR ELSE FILE WILL BE REFERRED TO THE ATTORNEY GENERAL S OFFICE, SAC LETTER REQUIRED RESPONSE ON 5/30/03. 4/6/06:SAC SPOKE TO DAVE STEVER. HE WILL CONTACT HAROLD GEIGER. 6/21/06:DAVE STEVER, SAC MET W/HAROLD GEIGER REGARDING SITE. MR. GEIGER WILL CONTACT JOHN BATTAGLIA W/ENSOL REGARDING SITE. HE WILL HAVE MR.BATTAGLIA DISCUSS REQUIREMENTS W/SAC REGARDING SITE. MR. STEVER TO FOLLOWUP WITH A LETTER. 8/8/06:SAC SPOKE TO DAVE STEVER. MR. GEIGER REQUESTED ANOTHER MEETING. MEETING SET UP FOR 8/29/06. 8/29/06:DAVE STEVER, SAC MET W/HAROLD AND MICHAEL GEIGER. DISCUSS SITE. MAY SAMPLE SOIL PILES IN THE BACK TO SHOW NOT CONTAMINATED. GAVE COPY OF AFI WORKPLAN AND TANK FIELD MONITORING WELL RESULTS. WILL CONTACT JOHN BATTAGLIA OF ENSOL TO FOLLOWUP. 9/20/06:SAC TELECON JOHN BATTAGLIA. MR. BATTAGLIA TO MEET W/SAC TO DISCUSS SITE ON 9/28/06. 9/28/06:SAC MET W/JOHN BATTAGLIA TO DISCUSS SITE. MR. BATTAGLIA ARRANGED TO COPY FILE FOR REVIEW OF THE SITE TO COMPRISE WORKPLAN. 11/15/06:RECEIVED COPY OF WORKPLAN FROM ENSOL. 11/17/06:SAC CALLED KRISTIN PRICE - ENSOL. SAC LEFT MESSAGE REQUESTING ADDRESS BEING USED TO SEND CORRESPONDENCE TO MR. GEIGER. MS. PRICE CALLED BACK AND LEFT MESSAGE THAT THE ADDRESS THEY HAVE BEEN USING IS: P.O. BOX 473, WEST OAKFIELD, GRAND ISLAND, NEW YORK 14072. 11/17/06:DRAFTED COMMENT LETTER FOR WORKPLAN. 12/27/06:SAC CALLED KRISTIN PRICE TO GET WORK SCHEDULE. LEFT MESSAGE FOR A CALLBACK. 1/3/07:RECEIVED LETTER FROM KRISTIN PRICE THAT WORK WILL BEGIN IN NEXT TWO TO THREE WEEKS. 1/12/07:RECEIVED NOTIFICATION THAT THE WORK WOULD BEGIN ON 1/16/07. 1/16/07:SAC TELECON KRISTIN PRICE. FIRST GEOPROBE WAS INSTALLED. HIGHEST PID METER READING WAS 27 ppm AT THE 5 TO 6 FT. RANGE. AGREED TO HAVE MICROWELL INSTALLED THERE. 1/16/07:SAC INSPECT SITE MET W/KRISTIN PRICE. SAMPLES FROM THE PILES IN THE BACK HAVE BEEN TAKEN. TWO GEOPROBES HAVE BEEN INSTALLED TO A DEPTH OF 20 FT. AROUND PUMP ISLANDS NEAR SIDEWALK. TWO WELLS INSTALLED AROUND PUMP ISLAND HAVE BEEN SAMPLED. WELL FURTHEST FROM STREET HAD A SHEEN. ANOTHER BORING TO BE INSTALLED ON SIDE OF PUMP ISLAND FURRTHEST FROM THE STREET. OWNER DID NOT WANT GEOPROBE TO BE INSTALLED NEAR BIRD AVE SIDE OF PUMP ISLAND BECAUSE OF PRODUCT LINES IN THE AREA.

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 253 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: SUNOCO - G and G PETROLEUM	REV: 2/5/08
ADDRESS: NIAGARA STREET	ID1: 9700094
BUFFALO NY	ID2: 80774
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/1/1997	DATE REPORTED: 4/2/1997
CLOSED DATE: 4/3/1997	INSP DATE: 4/2/1997

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: CITIZEN
CALLER REMARKS: START CALLERREMARK - 9700094 CALLER STATES THAT CONTAMINATED SOIL IS BEHIND HIS PROPERTY AND IS RUNNING OFF INTO HIS PROPERTY CALLER STATED THAT MOBIL REPLACED UST S LAND THE SOIL WAS AFFECTED AT THAT TIME END CALLERREMARK - 9700094

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: MICHAEL GEIGER
TELEPHONE:

SPILLER: QUAL ECON LEASE
MICHAEL GEIGER
ADDRESS: 14 COLONIAL DRIVE
TONAWANDA, NY 14150-

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 10/8/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9700094 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 4/2/97 SITE VISIT. SITE IS AN EXISTING SPILL. OWNER IS GandG PETROLEUM. MET MICHAEL GEIGER ON SITE, STATION OWNER. HE SAID CARMEN COSTA IS CLEANING UP SOIL STAGED BEHIND STATION. SOIL PILE IS MASSIVE AND LOOKS VERY OLD. DOES NOT LOOK LIKE ANY WORK HAS BEEN DONE ON SITE FOR A LONG TIME. WENT TO SPEAK TO THE CALLER, ARTHUR SMITH. HE SAID THAT GASOLINE WAS RUNNING OFF THE PILE THAT BUTTS UP ALONG THE BACK OF HIS PROPERTY. HIS CHILDREN WERE IN THE YARD PLAYING. mR. SMITH SAID THAT HIS CHILDREN S CLOTHES SMELLED LIKE GASOLINE WHENEVER THEY WENT OUT TO PLAY. HE SAID HE MAY CALL CALL 4 ACTION BECAUSE HE IS CONCERNED ABOUT HIS CHILDREN S WELFARE AND HIS PROPERTY. HE IS UNHAPPY ABOUT A SHED BEING PUT UP ON THE SOIL PILES. 4/3/97 SITE REFERRED TO SPILL 9400660. SITE CAN BE CLOSED. END DECRemark - 9700094

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 253	DIST/DIR: 0.06 SE	MAP ID: 48
-----------------------	--------------------------	-------------------

NAME: SUNOCO - G and G PETROLEUM
ADDRESS: NIAGARA STREET
 BUFFALO NY
 ERIE

REV: 2/5/08
ID1: 9700094
ID2: 80774
STATUS: CLOSED
PHONE:

CONTACT:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 157 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G SUNOCO ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9415155 ID2: 284153 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 2/18/1995 CLOSED DATE: 2/21/1995	DATE REPORTED: 2/18/1995 INSP DATE: 2/21/1995
---------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: KEROSENE MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 6 G AMOUNT RECOVERED: 0 G
-----------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: HUMAN ERROR
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT:
TELEPHONE:

SPILLER: G and G SUNOCO
ADDRESS: 370 ESSER AVENUE
BUFFALO, NY 14207

TELEPHONE:

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/18/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9415155 TANKER TRUCK SPILLED 5-6 GALLONS OF KEROSENE.
END CALLERREMARK - 9415155

DEC REMARKS:
Start DECRemark - 9415155 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 02/21/95: SAC INSPECT, SPILL HAS BEEN
CLEANED UP. END DECRemark - 9415155

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 157	DIST/DIR: 0.06 SE	MAP ID: 48
-----------------------	--------------------------	-------------------

NAME: G and G SUNOCO ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9415155 ID2: 284153 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 166 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: SUNOCO - G and G PETROLEUM	REV: 2/5/08
ADDRESS: NIAGARA STREET	ID1: 9700094
BUFFALO NY	ID2: 80774
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/1/1997	DATE REPORTED: 4/2/1997
CLOSED DATE: 4/3/1997	INSP DATE: 4/2/1997

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: CITIZEN

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: MICHAEL GEIGER
TELEPHONE:

SPILLER: QUAL ECON LEASE
MICHAEL GEIGER
ADDRESS: 14 COLONIAL DRIVE
TONAWANDA, NY 14150-

TELEPHONE:

REPORTED BY: CITIZEN

LAST DEC UPDATE: 10/8/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9700094 CALLER STATES THAT CONTAMINATED SOIL IS BEHIND HIS PROPERTY AND IS RUNNING OFF INTO HIS PROPERTY CALLER STATED THAT MOBIL REPLACED UST S LAND THE SOIL WAS AFFECTED AT THAT TIME END CALLERREMARK - 9700094

DEC REMARKS:
Start DECRemark - 9700094 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 4/2/97 SITE VISIT. SITE IS AN EXISTING SPILL.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 166	DIST/DIR: 0.06 SE	MAP ID: 48
-----------------------	--------------------------	-------------------

NAME: SUNOCO - G and G PETROLEUM
ADDRESS: NIAGARA STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9700094
ID2: 80774
STATUS: CLOSED
PHONE:

OWNER IS GandG PETROLEUM. MET MICHAEL GEIGER ON SITE, STATION OWNER. HE SAID CARMEN COSTA IS CLEANING UP SOIL STAGED BEHIND STATION. SOIL PILE IS MASSIVE AND LOOKS VERY OLD. DOES NOT LOOK LIKE ANY WORK HAS BEEN DONE ON SITE FOR A LONG TIME. WENT TO SPEAK TO THE CALLER, ARTHUR SMITH. HE SAID THAT GASOLINE WAS RUNNING OFF THE PILE THAT BUTTS UP ALONG THE BACK OF HIS PROPERTY. HIS CHILDREN WERE IN THE YARD PLAYING. mR. SMITH SAID THAT HIS CHILDREN S CLOTHES SMELLED LIKE GASOLINE WHENEVER THEY WENT OUT TO PLAY. HE SAID HE MAY CALL CALL 4 ACTION BECAUSE HE IS CONCERNED ABOUT HIS CHILDREN S WELFARE AND HIS PROPERTY. HE IS UNHAPPY ABOUT A SHED BEING PUT UP ON THE SOIL PILES. 4/3/97 SITE REFERRED TO SPILL 9400660. SITE CAN BE CLOSED. END DECRemark - 9700094

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 155 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM	REV: 2/5/08
ADDRESS: 1543 NIAGARA STREET	ID1: 9400660
BUFFALO NY	ID2: 284152
ERIE	STATUS: ACTIVE
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/11/1994	DATE REPORTED: 4/11/1994
CLOSED DATE: 12:00:00 AM	INSP DATE: 4/18/1996

MATERIAL SPILLED: MTBE (METHYL-TERT-BUTYL ETHER)	AMOUNT SPILLED: 0
MATERIAL CLASS: HAZARDOUS MATERIAL	AMOUNT RECOVERED: 0

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 L
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: YES
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: YES
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: OTHER

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT: MR PETER GERACE
TELEPHONE: (716) 867-1339

SPILLER: QUAL-ECON LEASE CO. INC.
MR MICHAEL G. PACHE
ADDRESS: 14 COLONIAL DRIVE
TONAWANDA, NY 14150-

TELEPHONE: (716) 695-0935

REPORTED BY: OTHER

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 155 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9400660 ID2: 284152 STATUS: ACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

LAST DEC UPDATE: 1/7/2008
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9400660 CONTAMINATION FOUND DURING TANK PULL. END
 CALLERREMARK - 9400660

DEC REMARKS:

Start DECRemark - 9400660 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 04/11/94: JDC ON SITE W/ MR GERACE, RP AND MR COSTA OF CES. NO CONTAMINATED SOILS REMOVED, ALL TO BE INSITUE TREATMENT. SENT STATARD FORM LETTER W/ RESPONSE DATE OF 5/16/94. 04/21/94: JDC/SAC/ MR GERACE, RP MET ON SITE TO DISCUSS CLEANUP ACTION. MR JAMES GIEGER WAS ON SITE, BUT DID NOT MEET WITH HIM. DO NOT KNOW THE RELATIONSHIP, IF ANY BETWEEN MR GEIGER AND GERACE. AGREED THAT FURTHER ANALYSIS WOULD BE REQUIRED BEFORE TYPE OF REMEDIATION WOULD BE DETERMINED. DECISION BY 5/16/94. 05/05/94: JDC MET ON SITE W/ RP AND MR COSTA, GROUNDWATER TO BE PUMPED AND DISPOSED OF AT SAFTEY CLEAN. SOIL REMOVED FOR STAGING AND BIO-TREAT. COMPLAINT OF PETROLEUM ODORS BY NEIBORS, WILL MONITOR SITE. (3) MONITORING/ RECOVERY WELLS HAVE BEEN INSTALLED IN THE TANK FIELD. 05/06/94: ANALYSIS DATED 4/22/94 INDICATES SOILS TO BE HAZARDOUS UNDER BENZENE AND LEAD. 05/06/94: JDC/COSTA/GERACE ON SITE WELLS PLACED TO REMOVE GROUNDWATER FOR TREATMENT ON SITE. COMPLAINT OF ODORS BY NEIGHBOR AT 1332 WEST AVE. ADVISED TO COVER REMOVED SOIL BEING STAGED FOR TREATMENT. 05/09/94: JDC TELCON W/ OFFICER DIAZ, BFD ON ODOR COMPLAINT FROM 1332/34 WEST AVE. NO FIRE SAFTY CONCERN, WILL INSPECT SITE W/ HNU FOR ODOR CONCENTRATIONS. 05/10/94: JDC ON SITE COLLECTED HNU READINGS DUE TO RESIDENT COMPLAINTS, FOUND LOW PPM INDICATIONS. WAITING FOR REMEDIATION PLAN FROM R.P. 5/16/94. 05/19/94: JDC/ C. COSTA, SAMPLES FROM EXCAVTION TAKEN. WILL SUBMIT ANALYSIS W/ REMEDIATION PLAN. CK BACK 6/1/94. 06/27/94: SENT LETTER TO RP REQUESTING REMEDIATION PLAN. CK BK 7/16/94. 06/28/94: JDC TELCON W/ P GERACE AND REQUESTED CLEANUP STATUS IN WRITING. HE SAID LETTER WOULD BE FORWARDED. CK BK 7/14. 07/13/94: JDC TELCON W/ PETER GERACE-BIOTREAT GOING OUT TO BID THIS WEEK. WHEN QUOTES EXPECTED BY END OF THIS MONTH. CK BK 7/29/94. 07/29/94: SENT NO RESPONSE LETTER W/ LEGAL ACTION. CK BK 8/12/94. 08/19/94: RECEIVED RESPONSE FROM RP STATING CONTRACTOR BIDS NOT RETURNED AND RIGHT OF ENTRY FROM LOCAL RESIDENT NOT RECEIVED. 11/10/94: SENT LETTER REQUESTING STATUS BY 11/18/94. 03/13/95: JDC TELCON W/ P GERACE, REQUESTED SITE REMEDIATION PLAN BY 3/17/95, IF NOT RECEIVED LEGAL ACTION WILL BEGIN. 03/23/95: RECEIVED LETTER FROM CES THAT THEY WILL BE SAMPLING GW AND BIOTREATING SOILS ON SITE, PLAN WILL BE FORWARDED. CK BK 4/17/95. 03/27/95: RECEIVED LETTER FROM CES THAT THEY WILL BE SAMPLING GW AND BIOTREATING SOILS ON SITE, PLAN WILL BE FORWARDED. CK BK 4/17/95. 04/20/95: SENT LETTER TO RP REQUESTING BIOTREATMENT PLAN AND GW ANALYSIS AS PROMISED IN CES LETTER DATED 3/23/95. 07/17/95: RECEIVED ANALYSIS AND FOUND EXTREME EXCEEDENCES OF GW STANDARDS. SENT FOLLOWUP LETTER RP REQUESTING STATUS. 11/16/95: JDC SENT LETTER TO RP REQUESTING SITE REMEDIATION PLAN. WILL INITIATE LEGAL ACTION IF NO RESPONSE BY 12/14/95. 12/28/95: NO RESPONSE FROM RP REGARDING CLEANUP ACTION AS REQUESTED LETTER DATED 11/16/95. INITIATED LEGAL ACTION. 1/19/96: ACCORDING TO CURRENT TAX RECORDS. QUALECON LEASE CO INC, 2320 W. OAKFIELD DR, GRAND ISLAND IS CURRENT ADDRESS WERE TAX BILL IS MAILED. 1/22/96: LOCATED 2320 OAKFIELD ST., FOUND TO BE LOCAL RESIDENCE, NO BUSINESS SIGN OR MAILBOX NAME. 1/24/96: OBTAINED PHONE NUMBER FOR SPILL SITE UNDER GandG PETROLEUM, 1543 NIAGARA ST, BUFFALO. LEFT MESSAGE FOR MR GERACE TO RETURN MY CALL. 1/25/96: SENT FINAL LETTER TO RP REQUESTING REMEDIATION PLAN. 1/26/96: RECEIVED CERT MAIL RECEIPT. 2/14/96: NO RESPONSE FROM RP WILL INITIATE LEGAL ACTION. 4/18/96: INSPECTED PROPERTY, NO REMEDIAL ACTIVITY. 4/2/97: COMPLAINT RECEIVED UNDER SPILL NUMBER 9700094 THAT SHEEN, AND STRONG PETROLEUM ODORS WERE PRESENT IN HIS BACK AT 58 BIRD AVE. FG RESPONDED AND MET W/ MR ARTHUR SMITH AND CONFIRMED SITE CONDITIONS. 4/3/97: SAC CONTACTED ABBY SNYDER, LEGAL AND ARRANGED TO HAVE A LETTER SERVED TO MR GERACE, RP W/ A R.O.E FORM TO ALL DEC TO REMOVE SOIL. LEGAL ACTION IS ONGOING AGAINST RP. 4/10/97: JDC MET W/ DAVE STEVER AND MARK PHELPS, ECO, ORDER OF ROE WILL BE SERVED TODAY. MR GERACE HAS UNTIL THE END OF THIS MONTH TO RESPOND TO ORDER, OTHERWISE CONTRACTOR WILL BE HIRED VIA COURT ORDER ALLOWING ACCESS. 6/17/97: JDC TELCON W/ TODD DAVISON, MODERN - HE STATED THAT PINTO WAS TO COLLECT THEIR OWN SAMPLES AND SUBMIT VIRGIN LETTER STATING THE CONTAMINATE WAS GASOLINE. LEFT MESSAGE FOR GEORGR PINTO TO RETURN MY CALL. 6/18/97: JDC TELCON W/ GEORGE PINTO WHO HAD AGREED TO ARRANGE AND TRANSPORT CONTAMINATED SOILS FROM THE SITE FOR THE RP. THIS WAS PER SEVERAL CONFERENCE CALLS W/ PETER GERACE, SAL CALANDRA AND DAVE STEVER. ACCORDING TO MR PINTO HE AGREED TO LOAD THE SOIL NOT TRANSPORT OR ARRANGE DISPOSAL. MRGERACE WAS TO CONTACT JOE HICKMAN AT MODERN AND ARRAGE W/ MODERN TRANSPORTATION AND

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 155 **DIST/DIR:** 0.06 SE **MAP ID:** 48

<p>NAME: G and G PETROLEUM ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:</p>	<p>REV: 2/5/08 ID1: 9400660 ID2: 284152 STATUS: ACTIVE PHONE:</p>
-----------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------

DISPOSAL. JDC TELCON W/ P GERACE - MODERN HAS NOT CONTACTED HIM REGARDING DISPOSAL, HE HAS DONE ALL THAT WAS REQUESTED BY MODERN. HE WILL CALL JOE HICKMAN AND RETURN A CALL W/ UPDATE. 7/2/97: JDC LEFT MESSAGE FOR G PINTO TO RETURN MY CALL. 7/2/97: JDC TELCON W/ JOE HICKMAN, MODERN - SAMPLE RESULTS ARE ACCEPTABLE, HE WILL ADVISE P GERACE TO DETERMINE DATE FOR SOILS TO BE TRANSPORTED. SOME FINANCIAL ASPECTS NEEDED TO BE WORKED OUT BETWEEN MODERN AND RP. 7/30/97: JDC INSPECTED SITE AND FOUND ONLY A MINOR AMOUNT OF SOIL REMOVED. WILL FOLLOWUP W/ MODERN TO DETERMINE HOW MUCH SOIL WAS RECEIVED. 8/6/97: JDC LEFT MESSAGE FOR J HICKMAN TO RETURN MY CALL. 8/13/97: JDC LEFT MESSAGE FOR JOE HICKMAN TO RETURN MY CALL. SENT LETTER TO PETER GERACE REQUESTING DISPOSAL RECEIPTS. 8/14/97: ACCORDING TO MR HICKMAN 800 TONS OF SOIL WAS REMOVED. WILL NEED DISPOSAL RECEIPTS TO CONFIRM. 8/26/97: RECEIVED PRINT OUT OF SOIL RECEIVED AT MODERN. REQUESTED COVER LETTER FROM JOE HICKMAN TO ASSOCIATE OWNERSHIP. 8/29/97: JDC INSPECTED SITE AND CONFIRMED ALL BUT 100 TRDS OF SOIL HAS BEEN REMOVED. WILL REQUESTED GandG TO SAMPLE SOILS TO CONFIRM CLEAN. SENT LETTER REQUESTING WORK CONTINUE TO REMEDIATE SUBSURFACE CONTAMINATION. 9/3/97: RECEIVED DISPOSAL CONFIRMATION OF 832 TONS TO MODERN DISPOSAL. 3/12/98: LEFT MESSAGE FOR MR GERACE TO RETURN MY CALL REGARDING STATUS. JDC ON SITE AND MET W/ PETER GERACE, WALKED THE PROPERTY AND DISCUSSED CLEANUP REQUIREMENTS. REQUESTED HE SAMPLE SOIL PILE UNDER 8021 TO ENSURE NO CONTAMINATION IS PRESENT. HE STATED THAT THE SOIL WAS CLEAN FROM EARLY STORE CONSTRUCTION AT RESCALS AT 1516 NIAGARA. WILL SEND LETTER OUTLINING/ RESTATING REQUIREMENTS. SPOKE W/ A MR ART SMITH, RESIDENT AT 58 BIRD REGARDING COMPLAINT OF FREE PETROLEUM PRODUCT CONTAMINATING HIS KIDS CLOTHS. STATES THE SOURCE TO BE GERACE PROPERTY. CLAIMS THERE IS A LARGE ROCK THAT IS COVERING AN AREA OF CONTAMINATION. AGREED TO MEET HIM ON SITE TO INSPECT THIS AREA. SPOKE W/ HIS WIFE AND REQUESTED HE CONTACT ME W/ A TIME AT HIS CONVICIENCE. 10/2/98: REVIEWD FILE AND DISCUSSED CURENT STATUS W/ DAVE STEVER AND B LEARY. WAS DETERMINED TO ADVIS E MR GERACE THAT HE MUST PROVIDE REQUESTED SAMPLING DATA AND SITE REMEDIATION PLAN OR ROW WOULD BE REQUIRED TO ALLOW DEC TO DO THE WORK. WILL SEND LETTER. 2/8/99: JDC TELCON W/ PETER GERACE WHO REQUESTED A STATEMENT LETTER TO SHOW CLEANUP PROGRESS. INTENDED TO REFINANCE THE PROPERTY. REQUESTED HE FORWARD SAMPLE RESULTS W/ A REMEDIATION PLAN. HE CLAIMS THAT CES HAS REFUSED TO DO THE WORK, HOWEVER HE HAS MADE ARRANGMENTS W/ A LAB TO PERFORM TESTING ON ALL SITE WELLS. HE STATED THAT ALL CORRISPONDANCE HAD BEEN GIVEN TO GES, THEREFORE HE HAS NONE OF OUR CLEANUP LETTERS. ADVISED THAT WE WOULD FAX THEM OVER FOR HIS RECORDS. 2/9/99: FAXED FILE LETTERS TO RP. 2/24/99: JDC TELCON W/ BRENDA EDWARDS, NEW COURT LENDING (973-606-4934), SHE WAS REQUESTING CURRENT INFO ON THE SITE REMEDIATION AND CLEANUP. RP IS LOOKING TO CONSOLIDATE DEBT TO GENERATE FUNDS TO DO CLEANUP WORK. SHE ALSO SPOKE W/ JOHN OTTO REGARDING RASCALS, ADVISED DAVE STEVER OF SAME. 12/5/01:SAC MET W/BILL HEITZENRATER OF AFI, MR. HEITZENRATER MET W/DAVE STEVER TO DISCUSS WORK TO BE DONE ON SITE ACROSS THE STREET AND THIS ONE, HE IS GOING TO SAMPLE THE FOUR ON-SITE WELLS NEXT WEEK INCLUDING TAKING A HEADSPACE OF THE SAMPLES AND THEN SUBMIT THEM FOR ANALYSIS, HE WILL LOOK INTO THE ADDITIONAL SOIL OUT BACK AND POSSIBILITY OF PERFORMING A SITE ASSESSMENT AT THE SITE. 12/10/01:SAC SPOKE TO JFO WHO INSPECTED SITE, PID METER READINGS ARE ELEVATED FOR THE WATER SAMPLES THAT WERE TAKEN, 3 OF THE 4 SAMPLES HAD READINGS IN EXCESS OF 500 ppm AND ONE WELL HAD A READING OF 230 ppm. 1/7/02:RECEIVED ANALYTICAL RESULTS FROM THE WELL SAMPLES FROM THE TANK FIELD, THE RESULTS EXCEED GW STANDARDS IN ALL 4 WELLS AND ARE HIGHEST IN MW-1 and MW-2. 1/9/02:SAC MET W/DAVE STEVER - DEC LEGAL AFFAIRS AND BILL HEITZENRATER, AFTER DISCUSSING AND REVIEWING THE FILE IT WAS DETERMINED THAT ORIGINAL SPILL WAS AROUND THE CANOPY WHICH IS WHERE THE OLD TANK FARM AND PUMP ISLAND WERE, THE SAMPLES WERE TAKEN FROM WELLS AROUND NEW TANK FIELD, SO IT IS UNCLEAR WHETHER LEVELS THAT WERE FOUND IN THE WELLS WERE FROM CONTAMINATION FOUND WHEN THE TANKS WERE REMOVED OR FROM A NEW SPILL FROM THE OPERATION OF THE NEW TANKS, MR. HEITZENRATER PROPOSED SAMPLING AND ARRANGING THE DISPOSAL OF SOIL THAT REMAINS STAGED IN THE BACK OF THE SITE, HE WILL INSTALL 3 WELLS AROUND THE SITE TO TRIANGULATE AND DETERMINE GW QUALITY OF THE SITE, THIS WORK WILL TAKE PLACE IN SPRING 02, THEN HE WILL INSTALL GEO PROBES TO DETERMINE LEVELS OF CONTAMINATION IN THE SOIL. 1/14/02:RECEIVED COPY OF LETTER FROM BILL HEITZENRATER TO DAVID STEVER REGARDING WHAT WAS AGREED TO AT 1/9/02 MEETING. 11/21/02:SAC TELECON BILL HEITZENRATER, MR. HEITZENRATER SAID HE NO WORK HAS BEEN DONE THAT WAS PROPOSED AND AGREED TO AT THE 1/9/02 MEETING AND STATED IN 1/9/02 LETTER. 11/29/02:DRAFTED LETTER TO HAROLD GEIGER REQUIRING WORK SCHEDULE BY 1/15/03 FOR THE WORKPLAN DATED 1/9/02 SUBMITTED BY AFI ENVIRONMENTAL. 2/17/03:LETTER DRAFTED ON 11/29/02 AND SENT ON 12/2/02 WAS CERTIFIED BUT RETURNED AS UNDELIVERABLE, SAC SPOKE TO HAROLD GEIGER ON 1/14/03 DURING SAMPLING EVENT AT 473 EAST DELAVAN, MR. GEIGER SAID THAT 1060 SHERIDAN DRIVE ADDRESS WAS THE CORRECT ADDRESS, SAC DRAFTED SAME LETTER THAT WAS SENT ON 12/2/02 ONLY THIS TIME RESPONSE REQUIRED BY 3/31/03. 4/2/03:SAC AND DAVE STEVER MET W/HAROLD GEIGER, THE LETTER DRAFTED ON 2/17/03 WAS ALSO UNDELIVERABLE, SO SAC HAND DELIVERED THE LETTER TO MR. GEIGER, MR. STEVER TOLD MR. GEIGER HE NEEDS TO SPEAK TO PETER GERACE AND TELL HIM WORK MUST BEGIN SOON WITH A POSSIBLE STIPULATION BEING SIGNED OR ELSE FILE WILL BE REFERRED TO THE ATTORNEY GENERAL S

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 156 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLIUM ADDRESS: 1543 NIARAGA ST BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0110881 ID2: 221266 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 2/12/2002 CLOSED DATE: 2/25/2002	DATE REPORTED: 2/14/2002 INSP DATE: 2/25/2002
---------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: GASOLINE MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 10 G AMOUNT RECOVERED: 0 G
-----------------------------------------------------------------------	-------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: OTHER

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE: (716) 882-8334

SPILLER: SAME

ADDRESS:
 , NN

TELEPHONE:

REPORTED BY: OTHER

LAST DEC UPDATE: 2/25/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0110881 CALLER SAYS THAT HIS WIFE WAS PUMPING GAS AND THE HOSE LEAKED...SPILLING APPROX 10 GAL. UNK IF IT HAS BEEN CLEANED UP OR NOT. END CALLERREMARK - 0110881

DEC REMARKS:
Start DECRemark - 0110881 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 02/14/02 JFO ON SITE MET WITH ETHEL GAUDETTE THE MANAGER OF THE STORE. SHE SAID MIKE THAT OPERATES THE SERVICE GARAGE WASHED THE SPILL DOWN

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 156

DIST/DIR: 0.06 SE

MAP ID: 48

NAME: G and G PETROLIUM

REV: 2/5/08

ADDRESS: 1543 NIARAGA ST
BUFFALO NY
ERIE

ID1: 0110881

ID2: 221266

STATUS: CLOSED

CONTACT:

PHONE:

WITH WATER. I THEN SPOKE WITH MIKE GEIGER, HE SAID THE SPILL WAS ONLY ABOUT A GALLON. THERE IS NO ACTION POSSIBLE. THERE IS SOME SPILLAGE AROUND THE DIESEL PUMP. I CALLED MR GEIGER AGAIN AND EXPLAINED TO HIM THAT THIS HAS TO BE CLEANED UP WITH PADS OR SPEEDY DRY. HE AGREED AND WILL TAKE CARE OF IT. I WILL CHECK NEXT WEEK. 02/20/02 JFO ON SITE, NOT MUCH CLEANUP COMPLETED. I WILL CHECK AGAIN MONDAY THE 25TH. IF IS NOT CLEANED I WILL CALL MR GEIGER AND SEND A LETTER. 02/25/02 JFO ON SITE. THE SPILL AREA IS CLEANED UP. NO FURTHER ACTION POSSIBLE. CLOSED END DECRemark - 0110881

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 221 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: VINNIES GULF SERVICE ADDRESS: 1543 NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8810060 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 03/07/89	DATE REPORTED: 03/07/89
SPILL TIME: 08:00	TIME REPORTED: 11:30

MATERIAL SPILLED: WASTE OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: DELIBERATE
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: GASOLINE STATION
REPORTED BY: CITIZEN
CALLER REMARKS:
ANOMOYOUS COMPLAINT TO BECI UNIT OF IMPROPER DISPOSAL OF WASTE OIL

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MJH	TELEPHONE:
SPILL CONTACT:	

SPILLER: VINNIES GULF SERVICE ADDRESS: 1543 NIAGARA STREET BUFFALO, NY	TELEPHONE: (716) 886-1626
SPILLER CONTACT:	

CALLER: JIM GROBE AGENCY: NYSDEC-BECI TELEPHONE: (716) 847-4590	NOTIFIER: AGENCY: TELEPHONE:
--------------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 06/07/89	CLOSE DATE: 05/31/89
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO

DEC REMARKS:
04/04/89: MJH AND J. GROBE SITE INSPECTION, REQUESTED DISPOSAL RECIEPTS FOR WASTE OIL, REQUESTED CLEANUP OF OIL AROUND FILL PORT. 05/31/89: MJH RECEIVED DISPOSAL RECEIPT 05/31/89, STIE COMPLETE.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 235 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1531-1543 NIAGARA BUFFALO NY 14213 ERIE CONTACT: MICHAEL J. GEIGER	REV: 2/5/08 ID1: PBS9-222658 ID2: STATUS: ACTIVE PHONE: (716) 695-0935
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: RETAIL GASOLINE SALES
TYPE NAME:
TOTAL NUMBER OF TANKS: 8
NUMBER OF ACTIVE TANKS: 4
NUMBER OF INACTIVE TANKS: 4
TOTAL FACILITY CAPACITY: 24000 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: QUAL-ECON LEASE CO. INC
TITLE: VICE PRESIDENT
NAME: MICHAEL J. GEIGER
ADDRESS: 14 COLONIAL DRIVE
NY 14150
PHONE: (716) 695-0935
EMERGENCY CONTACT: MICHAEL GEIGER
PHONE: (716) 310-9392

MAILING INFORMATION

COMPANY: G and G PETROLEUM
TITLE:
CONTACT: PETER GERACE
ADDRESS: 1531-1543 NIAGARA ST
BUFFALO NY 14213
PHONE: (716) 882-8334
EMAIL:

EXP. DATE: 10/17/2010
RENEWAL DATE: 5/27/1992

COMMENTS: 12/1/00 There are 2 12k split tanks at this site. One has premium gas and diesel, the other has regular unleaded and kerosene. AES

TANK INFORMATION

<u>TANK NUMBER:</u> 1	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 1/1/1967
CLOSED: 4/1/1994	TANK CAPACITY: 8000 GALLONS
PRODUCT: GASOLINE	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 235 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1531-1543 NIAGARA BUFFALO NY 14213 ERIE CONTACT: MICHAEL J. GEIGER	REV: 2/5/08 ID1: PBS9-222658 ID2: STATUS: ACTIVE PHONE: (716) 695-0935
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: VAPOR WELL
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUBMERSIBLE
SPILL PREVENTION:
DATE TESTED: 7/1/1991
NEXT TEST: 12:00:00 AM
TEST METHOD: VACUTEST

<u>TANK NUMBER:</u> 1A	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 5/1/1994	
CLOSED: 12:00:00 AM	TANK CAPACITY: 7000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: JACKETED
EXTERNAL PROTECTION 2:

PIPE TYPE: FIBERGLASS REINFORCED PLASTIC (FRP)
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: FIBERGLASS
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: DOUBLE-WALLED (UNDERGROUND)
SECONDARY CONTAINMENT 2:
LEAK DETECTION: GROUNDWATER WELL
LEAK DETECTION 2: IN-TANK SYSTEM (ATG)

OVERFILL PROTECTION: HIGH LEVEL ALARM
OVERFILL PROTECTION 2: VENT WHISTLE
DISPENSER: SUBMERSIBLE
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 5/1/2009
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 1B	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 5/1/1994	
CLOSED: 12:00:00 AM	TANK CAPACITY: 5000 GALLONS	
PRODUCT: DIESEL		

TANK TYPE: STEEL/CARBON STEEL/IRON

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 235 **DIST/DIR:** 0.06 SE **MAP ID:** 48

NAME: G and G PETROLEUM ADDRESS: 1531-1543 NIAGARA BUFFALO NY 14213 ERIE CONTACT: MICHAEL J. GEIGER	REV: 2/5/08 ID1: PBS9-222658 ID2: STATUS: ACTIVE PHONE: (716) 695-0935
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: JACKETED
EXTERNAL PROTECTION 2:

PIPE TYPE: FIBERGLASS REINFORCED PLASTIC (FRP)
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: FIBERGLASS
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: DOUBLE-WALLED (UNDERGROUND)
SECONDARY CONTAINMENT 2:
LEAK DETECTION: GROUNDWATER WELL
LEAK DETECTION 2: IN-TANK SYSTEM (ATG)

OVERFILL PROTECTION: HIGH LEVEL ALARM
OVERFILL PROTECTION 2: VENT WHISTLE
DISPENSER: SUBMERSIBLE
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 5/1/2009
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 2	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 1/1/1967	
CLOSED: 4/1/1994	TANK CAPACITY: 6000 GALLONS	
PRODUCT: GASOLINE		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: VAPOR WELL
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 7/1/1991
NEXT TEST: 12:00:00 AM
TEST METHOD: VACUTEST

<u>TANK NUMBER:</u> 2A	TANK STATUS: IN SERVICE	
-------------------------------	--------------------------------	--

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 191 **DIST/DIR:** 0.07 NW **MAP ID:** 53

NAME: NIMO-TRANSFORMER	REV: 2/5/08
ADDRESS: 215 NOTTINGHAM TERR	ID1: 0102953
BUFFALO NY	ID2: 253854
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 6/15/2001	DATE REPORTED: 6/16/2001
CLOSED DATE: 6/19/2001	INSP DATE: 6/18/2001

MATERIAL SPILLED: DIELECTRIC FLUID	AMOUNT SPILLED: 1 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 1 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT: CALLER
TELEPHONE:

SPILLER: NIMO
A C REED
ADDRESS: 144 KENSINGTON AVE
BUFFALO, NY 14214-

TELEPHONE: (315) 428-3549

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 6/27/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0102953 TRANSFORMER OVERHEATED CAUSING SEAL TO LEAK 1 GAL OF TRANSFORMER OIL ONTO SOIL. OIL TESTED FOR LESS THAN 50 PPM. CLEAN UP COMPLETED END CALLERREMARK - 0102953

DEC REMARKS:
Start DECRemark - 0102953 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 06/19/01: MF DUPLICATE OF SPILL 0102941.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 191	DIST/DIR: 0.07 NW	MAP ID: 53
-----------------------	--------------------------	-------------------

NAME: NIMO-TRANSFORMER ADDRESS: 215 NOTTINGHAM TERR BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0102953 ID2: 253854 STATUS: CLOSED PHONE:
---------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

THIS SPILL CAN BE CLOSED. END DECRemark - 0102953

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 242 **DIST/DIR:** 0.07 NW **MAP ID:** 55

NAME: 2000 DELAWARE APARTMENTS ADDRESS: 1960-2000 DELAWARE AVE BUFFALO NY 14216 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-600814 ID2: STATUS: UNREGISTERED PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: APARTMENT BUILDING/OFFICE BUILDING
TYPE NAME:
TOTAL NUMBER OF TANKS: 3
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 3
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE:
COMPANY: CDL REALTIES
TITLE:
NAME:
ADDRESS: 1962 DELAWARE AVE
NY 14216
PHONE:
EMERGENCY CONTACT:
PHONE:

MAILING INFORMATION

COMPANY:
TITLE:
CONTACT:
ADDRESS:

PHONE:
EMAIL:

EXP. DATE: 12:00:00 AM
RENEWAL DATE: 12:00:00 AM

COMMENTS:

TANK INFORMATION

<u>TANK NUMBER:</u> 1	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12:00:00 AM
CLOSED: 12/14/1998	TANK CAPACITY: 10000 GALLONS
PRODUCT: 2 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

PIPE TYPE:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 242 **DIST/DIR:** 0.07 NW **MAP ID:** 55

NAME: 2000 DELAWARE APARTMENTS ADDRESS: 1960-2000 DELAWARE AVE BUFFALO NY 14216 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-600814 ID2: STATUS: UNREGISTERED PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------

PIPE LOCATION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT:
SECONDARY CONTAINMENT 2:
LEAK DETECTION:
LEAK DETECTION 2:

OVERFILL PROTECTION:
OVERFILL PROTECTION 2:
DISPENSER:
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 2	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12:00:00 AM
CLOSED: 12/14/1998	TANK CAPACITY: 10000 GALLONS
PRODUCT: 2 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

PIPE TYPE:
PIPE LOCATION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT:
SECONDARY CONTAINMENT 2:
LEAK DETECTION:
LEAK DETECTION 2:

OVERFILL PROTECTION:
OVERFILL PROTECTION 2:
DISPENSER:
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 3	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12:00:00 AM
CLOSED: 12/14/1998	TANK CAPACITY: 10000 GALLONS
PRODUCT: 2 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 242	DIST/DIR: 0.07 NW	MAP ID: 55
-----------------------	--------------------------	-------------------

NAME: 2000 DELAWARE APARTMENTS
ADDRESS: 1960-2000 DELAWARE AVE
BUFFALO NY 14216
ERIE

REV: 2/5/08
ID1: PBS9-600814
ID2:
STATUS: UNREGISTERED
PHONE:

CONTACT:

INTERNAL PROTECTION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

PIPE TYPE:
PIPE LOCATION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT:
SECONDARY CONTAINMENT 2:
LEAK DETECTION:
LEAK DETECTION 2:

OVERFILL PROTECTION:
OVERFILL PROTECTION 2:

DISPENSER:

SPILL PREVENTION:

DATE TESTED:	12:00:00 AM
NEXT TEST:	12:00:00 AM
TEST METHOD:	TESTING NOT REQUIRED

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 83 **DIST/DIR:** 0.07 SE **MAP ID:** 51

NAME: VOLLAND ELECTRIC EQUIP CORP ADDRESS: 1511 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004339412 ID2: NYD002130060 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110004339412 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:	
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------	--

PROGRAM: NCDB PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: I02 1980102210195 3 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED: 10/27/2003 12:59:53 PM	
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--

REG PROGRAM: COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/31/1991 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002130060 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:46:23 AM	
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--

REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 5/18/2001 3:44:46 AM
ENTERED PERSON/METHOD: FRS
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 83	DIST/DIR: 0.07 SE	MAP ID: 51
----------------------	--------------------------	-------------------

NAME: VOLLAND ELECTRIC EQUIP CORP
ADDRESS: 1511 NIAGARA ST
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110004339412
ID2: NYD002130060
STATUS: FRS
PHONE:

FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 54	DIST/DIR: 0.07 SE	MAP ID: 54
----------------------	--------------------------	-------------------

NAME: BUFFALO TRANSFORMER CORP
ADDRESS: 1507 NIAGARA ST
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD013708359
ID2:
STATUS:
PHONE:

RCRIS : NYD013708359
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 53 **DIST/DIR:** 0.07 SE **MAP ID:** 51

NAME: BUFFALO TRANSFORMER CO ADDRESS: 1511 NIAGARA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110011757893 ID2: I02 1980102220002 1 STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: NCDB PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.	PROGRAM ID: I02 1980102220002 1 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110011757893 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY INTEREST STATUS: ACTIVE DATA QUALITY: V LOCATION DESC: ADDRESS TYPE: REGULAR URBAN LAST REPORTED: POSTED TO DATABASE: 3/1/2000 DATA UPDATED: 7/11/2002 12:41:14 PM ENTERED PERSON/METHOD: PSCHAEFF PARENT REG ID: CONFIDENCE IN ADDR: MEDIUM ENFORCEMENT SENSITIVE: N REQ MANUAL REVIEW: REASON MAN REVIEW: SMALL BUS POLICY: ENFORCEMENT ACTION: DATA PUB ACCESS: YES INTERNAL SYS ID:	
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--

FEDERAL FACILITY: FEDERAL AGENCY: TRIBAL LAND: NO TRIBAL LAND NAME: CONGRESSIONAL DIST: LEGISLATIVE DIST: HYDROLOGICAL UNTIS: EPA REGION: 02 AIRSHED: CENSUS BLOCK:	
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 53	DIST/DIR: 0.07 SE	MAP ID: 51
----------------------	--------------------------	-------------------

NAME: BUFFALO TRANSFORMER CO
ADDRESS: 1511 NIAGARA ST
 BUFFALO NY 14207
 ERIE

REV: 11/1/06
ID1: 110011757893
ID2: I02 1980102220002 1
STATUS: FRS
PHONE:

CONTACT:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 55 **DIST/DIR:** 0.07 SE **MAP ID:** 54

NAME: BUFFALO TRANSFORMER CORP ADDRESS: 1507 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004350103 ID2: NYD013708359 STATUS: FRS PHONE:
-------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110004350103 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/26/1991 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD013708359 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: CESQG - HAZARDOUS WASTE CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS
 GENERATE: A) 100 KILOGRAMS OR LESS OF HAZARDOUS WASTE PER CALENDAR MONTH, AND ACCUMULATE 1000 KG OR LESS OF HAZARDOUS WASTE AT ANY TIME; OR (B) ONE KILOGRAM OR LESS OF ACUTELY HAZARDOUS WASTE PER CALENDAR MONTH, AND ACCUMULATE AT ANY TIME: 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE; OR 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE; OR (C) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE AT ANY TIME: 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE; OR 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE.

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 11:26:00 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 55	DIST/DIR: 0.07 SE	MAP ID: 54
----------------------	--------------------------	-------------------

NAME: BUFFALO TRANSFORMER CORP
ADDRESS: 1507 NIAGARA ST
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110004350103
ID2: NYD013708359
STATUS: FRS
PHONE:

TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 82	DIST/DIR: 0.07 SE	MAP ID: 51
----------------------	--------------------------	-------------------

NAME: VOLLAND ELECTRIC EQUIP CORP
ADDRESS: 1511 NIAGARA ST
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD002130060
ID2:
STATUS:
PHONE:

RCRIS : NYD002130060
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB : I02 1980102220002 1
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 269 **DIST/DIR:** 0.07 SE **MAP ID:** 51

NAME: BUFFALO TRANSFORMER CO	REV: 12/14/07
ADDRESS: 1511 NIAGARA ST	ID1: NCDB-0801-009126
BUFFALO NY 14207	ID2: 1980102220002 1
ERIE	STATUS: TSCA
CONTACT:	PHONE:

SITE INFORMATION

EPA REGION: 02	INSPECTION REG OR ST: 02
INSPECTOR ID: 20002	INSPECTION DATE: 10/22/80
INSPECTOR NAME: A. GERVITZ	NUMBER OF SAMPLES: 0
NUMBER OF AUDITS: 0	DUNN and BRAD NUMBER:
FEDERAL FACILITY: N	LEGISLATION CODE: T
NUMBER OF SCHOOLS: 0	SCHOOL TYPE:
EPA PESTICIDE ID:	EPA FIFRA REG ID:

FACILITY FUNCTION: US - USER

INVESTIGATION TYPE: 6PF - SECTION 6 PCB FEDERAL CONDUCTED

REASON: NSR - NEUTRAL SCHEME, REGION

REFERRAL TYPE :

PRINT INFO: BUFFALO TRANSFORMER CO
1511 NIAGARA ST
BUFFALO NY 14207-

SIC INFORMATION:

SIC 1:

SIC 2:

SIC 3:

SIC 4:

SIC 5:

SIC 6:

SAMPLE INFORMATION

CASE REVIEW INFORMATION:

SAMPLE NUMBER: 0	ACTION WARRANTED: N
DOCKET NUMBER:	CASE NUMBER:
START DATE: 10/22/80	COMPLETION DATE: 10/22/80

IMPORT INFORMATION

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 269

DIST/DIR: 0.07 SE

MAP ID: 51

NAME: BUFFALO TRANSFORMER CO
ADDRESS: 1511 NIAGARA ST
BUFFALO NY 14207
ERIE

REV: 12/14/07
ID1: NCDB-0801-009126
ID2: 1980102220002 1
STATUS: TSCA
PHONE:

CONTACT:

REFERRAL INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 271	DIST/DIR: 0.07 SE	MAP ID: 51
-----------------------	--------------------------	-------------------

NAME: VOLLARD ELECTRICAL EQUIPMENT CORP ADDRESS: 1511 NIAGARA ST BUFFALO NY 14210 Erie CONTACT:	REV: 4/30/04 ID1: NCDB-0104-001476 ID2: 1980102210195 3 STATUS: TSCA PHONE:
----------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

SITE INFORMATION:

EPA REGION:	02
INSPECTOR ID:	1980102210195 3
INSPECTION DATE:	10/22/1980
INSPECTOR NAME:	D. KRAFT, AG
LEGISLATION CODE:	T
FACILITY FUNCTION:	US - USER
INVESTIGATION TYPE:	SECTION 6 FEDERAL CONDUCTED
REASON:	NSA - NEUTRAL SCHEME, ASSOCIATED

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 272	DIST/DIR: 0.07 SE	MAP ID: 51
-----------------------	--------------------------	-------------------

NAME: VOLLARD ELECTRICAL EQUIPMENT CORP ADDRESS: 1511 NIAGARA ST BUFFALO NY 14210 ERIE CONTACT:	REV: 12/14/07 ID1: NCDB-1980102210195 3 ID2: 1980102210195 3 STATUS: TSCA PHONE:
----------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------

SITE INFORMATION:

EPA REGION:	02
INSPECTOR ID:	1980102210195 3
INSPECTION DATE:	10/22/1980
INSPECTOR NAME:	D. KRAFT, AG
LEGISLATION CODE:	T
FACILITY FUNCTION:	US - USER
INVESTIGATION TYPE:	SECTION 6 FEDERAL CONDUCTED
REASON:	NSA - NEUTRAL SCHEME, ASSOCIATED

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 5 **DIST/DIR:** 0.07 SE **MAP ID:** 54

NAME: BUFFALO TRANSFORMER CORP	REV: 6/6/06
ADDRESS: 1507 NIAGARA ST	ID1: NYD013708359
BUFFALO NY 14213	ID2:
ERIE	STATUS: VGN
CONTACT: RICHARD WAGNER	PHONE: 7166882843

SITE INFORMATION

CONTACT INFORMATION: RICHARD WAGNER
75 ENSBROOK DR
BUFFALO NY 14225

PHONE: 7166882843

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO

GENERATOR STATUS: CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZA

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

X002

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 34 **DIST/DIR:** 0.07 SE **MAP ID:** 51

NAME: VOLLAND ELECTRIC EQUIP CORP ADDRESS: 1511 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 6/6/06 ID1: NYD002130060 ID2: STATUS: NLR PHONE:
----------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: RICHARD WAGNER
1511 NIAGARA ST
BUFFALO NY 14213

PHONE: 7168842713

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	5/15/1991
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	5/15/1991	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	10/29/1991		

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 34	DIST/DIR: 0.07 SE	MAP ID: 51
----------------------	--------------------------	-------------------

NAME: VOLLAND ELECTRIC EQUIP CORP
ADDRESS: 1511 NIAGARA ST
BUFFALO NY 14213
ERIE

REV: 6/6/06
ID1: NYD002130060
ID2:
STATUS: NLR
PHONE:

CONTACT:

TYPE: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)

HAZARDOUS WASTE INFORMATION:

Ignitable waste

The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichlorethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 261 **DIST/DIR:** 0.07 SW **MAP ID:** 52

NAME: CANISIUS COL. BOSCH HALL	REV: 2/5/08
ADDRESS: EASTWOOD PLACE	ID1: 0475017
BUFFALO NY	ID2: 92477
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/14/2004	DATE REPORTED: 4/14/2004
CLOSED DATE: 4/15/2004	INSP DATE: 4/14/2004

MATERIAL SPILLED: 2 FUEL OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 0475017 YESTERDAY AT 4:30PM WHILE EXCAVATING FOR A FOUNDATION THEY DISCOVERED PETROLEUM ODORS END CALLERREMARK - 0475017

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: BUTCH PASTUSZYNSKI
TELEPHONE: (716) 883-0081

SPILLER: CANISIUS
BUTCH S CELL

ADDRESS:
ZZ

TELEPHONE: (716) 818-2964

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 4/19/2004
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 0475017 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 04/14/04 JFO ON SITE MET WITH BUTCH P OF GPS CONSTRUCTION, AND BOB OVERHOFF OF CIMINELLI. THEY SHOWED ME WHERE THEY HAD ODORS. THERE ARE NO ODORS TODAY AND NO VISUAL CONTAMINATION. THERE IS AN EXCAVATOR IN THE HOLE WHICH IS APPROX 14 DEEP. THE ODORS MAY HAVE COME FROM THE EQUIPMENT. THEY WILL BE EXCAVATING A VERY LARGE AREA AROUND THIS AREA TO A DEPTH OF ABOUT 14. THE COLLEGE SAID THERE WERE NEVER ANY TANKS ON THE PROPERTY. IF THEY COME ACROSS ANY CONTAMINATION THEY WILL CALL ME. NO ACTION NECESSARY. CLOSED END DECRemark - 0475017

THERE MAYBE MORE DEC REMARKS AVAILABLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 201 **DIST/DIR:** 0.07 SW **MAP ID:** 52

NAME: CANISIUS COL. BOSCH HALL ADDRESS: EASTWOOD PLACE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0475017 ID2: 92477 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 4/14/2004 CLOSED DATE: 4/15/2004	DATE REPORTED: 4/14/2004 INSP DATE: 4/14/2004
---------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: 2 FUEL OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: BUTCH PASTUSZYNSKI
TELEPHONE: (716) 883-0081

SPILLER: CANISIUS
BUTCH S CELL

ADDRESS:
ZZ

TELEPHONE: (716) 818-2964

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 4/19/2004
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0475017 YESTERDAY AT 4:30PM WHILE EXCAVATING FOR A FOUNDATION THEY DISCOVERED PETROLEUM ODORS END CALLERREMARK - 0475017

DEC REMARKS:
Start DECRemark - 0475017 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 04/14/04 JFO ON SITE MET WITH BUTCH P OF GPS CONSTRUCTION, AND BOB OVERHOFF OF CIMINELLI. THEY SHOWED ME WHERE THEY HAD ODORS. THERE ARE NO ODORS

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 201	DIST/DIR: 0.07 SW	MAP ID: 52
-----------------------	--------------------------	-------------------

NAME: CANISIUS COL. BOSCH HALL
ADDRESS: EASTWOOD PLACE
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 0475017
ID2: 92477
STATUS: CLOSED
PHONE:

TODAY AND NO VISUAL CONTAMINATION. THERE IS AN EXCAVATOR IN THE HOLE WHICH IS APPROX 14 DEEP. THE ODORS MAY HAVE COME FROM THE EQUIPMENT. THEY WILL BE EXCAVATING A VERY LARGE AREA AROUND THIS AREA TO A DEPTH OF ABOUT 14 . THE COLLEGE SAID THERE WERE NEVER ANY TANKS ON THE PROPERTY. IF THEY COME ACROSS ANY CONTAMINATION THEY WILL CALL ME. NO ACTION NECESSARY. CLOSED END DECRemark - 0475017

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

AIRS

SEARCH ID: 278 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL	REV: 1/12/08
ADDRESS: 2157 MAIN ST	ID1: NY0008030
BUFFALO NY 14214	ID2: 9140200465
ERIE	STATUS: AIRS DATABASE
CONTACT:	PHONE:

OPERATING STATUS: O
YEAR MEASURED: 90
PRINCIPAL PRODUCT:
LAST UPDATED: 9/18/2007
AMBIENT MONITORING:
SOURCE MONITORING EQUIP:
STATE IMPLIMENTED PROG: OZONE
PLANT DESC: GENERAL MEDICAL and SURGICA

FINDS

SEARCH ID: 121 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL	REV:
ADDRESS: 2157 MAIN STREET	ID1: NYD156390890
BUFFALO NY 14214	ID2:
Erie	STATUS:
CONTACT:	PHONE:

RCRIS : NYD156390890
PCS :
AFS/AIRS : 360298140, 3602900101
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB : 074023144
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 120 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN ST BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110001568465 ID2: NYD156390890 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: AIRS/AFS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/10/2006 ENFORCEMENT ACT: REG PROGRAM: AIR SYNTHETIC MINOR - A FACILITY IS CLASSIFIED AS A CLEAN AIR ACT STATIONARY SOURCE SYNTHETIC MINOR DISCHARGER OF AIR POLLUTANTS IF: (A) POTENTIAL EMISSIONS ARE BELOW ALL APPLICABLE MAJOR SOURCE THRESHOLDS IF AND ONLY IF THE SOURCE COMPLIES WITH FEDERALLY ENFORCEABLE REGULATIONS OR LIMITATIONS; OR (B) ACTUAL EMISSIONS < 100 TONS/YEAR, BUT POTENTIAL UNCONTROLLED EMISSIONS > 100 TONS/YEAR; OR (C) UNREGULATED POLLUTANT ACTUAL EMISSIONS < 100 TONS/YEAR.	PROGRAM ID: 3602900101 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: AIRS/AFS LAST EXTRACTED: 3/8/2005 10:43:05 AM
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NEI PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: CRITERIA AND HAZARDOUS AIR POLLUTANT INVENTORY	PROGRAM ID: NEINY17030 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NEI LAST EXTRACTED: 6/14/2005 11:07:42 AM
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110001568465 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 5/2/1988 ENFORCEMENT ACT: REG PROGRAM: SQG - HAZARDOUS WASTE SMALL QUANTITY GENERATORS GENERATE: (A) MORE THAN 100 AND LESS THAN 1000 KILOGRAMS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH AND ACCUMULATE LESS THAN 6000 KG OF HAZARDOUS WASTE AT ANY TIME; OR (B) 100 KG OR LESS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1000 KG OF HAZARDOUS WASTE AT ANY TIME.	PROGRAM ID: NYD156390890 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT:	PROGRAM ID: 9-1402-00465 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 6:39:36 PM
----------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 120 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN ST BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110001568465 ID2: NYD156390890 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

REG PROGRAM: STATE MASTER -

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 325189 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 4/21/2007 10:02:55 PM	
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------	--

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 4/21/2007 10:02:55 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW: Y
REASON MAN REVIEW: , COUNTY MISMATCH-NJ-NJEMS
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 268 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: CONSOLIDATED FRGHTWYS CORP DEL ADDRESS: 2157 MAIN STREET BUFFALO NY 14214 ERIE CONTACT:	REV: 3/15/05 ID1: 1996040614 ID2: STATUS: HIGHWAY (FOR HIRE) PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

TOTAL NUMBER OF HAZARDOUS MATERIALS: 1

MULTIPLE CODE: A
MODE OF TRANSPORT: 4 - H-H: HIGHWAY (FOR HIRE)
OTHER MODE:

INCIDENT DATE: 4/5/1996	INCIDENT TIME: 14:00
CARRIER RPT NUMBER:	ORIG SAME AS SHIP: YES
DEST SAME AS CONS: YES	

INCIDENT: 2157 MAIN STREET BUFFALO NY ERIE	CARRIER: ID: 12228 CONSOLIDATED FRGHTWYS CORP DEL 175 LINFIELD DRIVE MENLO PARK CA 940253799
SHIPPER: ID: 26956 BAXTER HEALTH CARE 1210 WAUKEGAN ROAD MCGAW PARK IL 60085	CONSIGNEE: ID: 61919 SISTERS OF CHARITY HOSP 2157 MAIN STREET BUFFALO NY 14214
ORIGIN: 1210 WAUKEGAN ROAD MCGAW PARK IL 60085	DESTINATION: 2157 MAIN STREET BUFFALO NY 14214

COMMODITY INFORMATION

MULTIPLE CODE: A	SHIPPING PAPER: PRO 699846394
HAZ SUBSTANCE: NO	UN NUMBER: UN1040
RQ MET: NO	QUAN REL CODE: 0
QUANTITY RELEASED: 0.08 GAL	COMMODITY CODE: 04740

COMMODITY SHIP NAME: ETHYLENE OXIDE
COMMODITY TRADE NAME: ETHYLENE OXIDDE
COMMODITY CLASS: 23 - POI GAS: POISONOUS GAS

OTHER MATERIAL INFORMATION

DEATHS: 0	MAJOR INJURIES: 0
MINOR INJURIES: 0	NUMBER EVACUATED: 0
PRODUCT LOSS: 25	PROD LOSS CODE: 0
CARRIER DAMAGE: 0	CARRIER DAM CODE: 0
PUB PRI DAMAGE: 0	PUB PRI DAM CODE: 0
DECON DAMAGE: 0	DECON DAM CODE: 0
OTHER DAMAGE: 0	OTHER DAM CODE: 0
REPORT DAMAGE: 25	REPORT DAM CODE: 0
INCIDENT DAMAGE: 0	DAMAGE CODE:
RESULT VAPOR: YES	RESULT SEWER: NO

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 268 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: CONSOLIDATED FRGHTWYS CORP DEL ADDRESS: 2157 MAIN STREET BUFFALO NY 14214 ERIE CONTACT:	REV: 3/15/05 ID1: 1996040614 ID2: STATUS: HIGHWAY (FOR HIRE) PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

RESULT SPILL:	YES	RESULT FIRE:	NO
RESULT EXPLOSION:	NO	RESULT ENVIRONMENT:	NO
RESULT NONE:	NO	RESULT OTHER:	NO
RESULT OTHER DESC:		VEHICLE CARGO:	NO
VEHICLE VAN:	YES	VEHICLE FLAT:	NO
VEHICLE TANK CAR:	NO	VEHICLE RAIL CAR:	NO
VEHICLE TOFC:	0	VEHICLE AIRCRAFT:	NO
VEHICLE BARGE:	NO	VEHICLE SHIP:	NO
VEHICLE OTHER:	NO	VEHICLE OTHER DESC:	
TRANSPORT PHASE:	999	LAND USE:	272
COMMUNITY TYPE:	281	ACCIDENT OR DERAIL:	NO
ESTIMATED SPEED:		HIGHWAY TYPE:	
HIGHWAY LANES:		GENERAL CAUSE:	10
MISC INFO 1:	100	MISC INFO 2:	100
ATTACHMENTS:	NO	RECOMMENDATIONS:	NO

REPORTER NAME: MICHAEL A SCHLEICHER
REPORTER TITLE: SUPT BLDG MAINT
REPORTER PHONE: 7166953110
REPORT DATE: 4/12/1996

CONTAINER INFORMATION

MULTIPLE CODE: A
CONTAINER TYPE: CONT - CONTAINER: CONTAINER, NO DESCRIPTION GIVEN (DO NOT USE IF AT ALL POSSIBLE)

MANUFACTURER: **ID:** 16222
 NOT REPORTED BY CARRIER
 UNKNOWN XX

CONTAINER CAPACITY:	0.03 GAL	CONTAINER CAP CODE:	0
NUMBER FAILED:	3	NUMBER FAILED CODE:	0
NUMBER IN SHIPMENT:	96	NUMBER IN SHIP CODE:	0
GAUGE OF CONTAINER:		TANK SERIAL NUMBER:	
LABEL OR PLACARD:		REGISTRATION NUMBER:	
INSPECTION DATE:		EXEMPTION NUMBER:	

VEHICLE COLLISION:	NO	VEHICLE OVERTURN:	NO
OVERLOAD OR OVERFILL:	NO	LOOSE FITTING:	NO
DEFECTIVE FITTING:	NO	DROPPED:	NO
STRUCK OR RAMMED:	NO	IMPROPER LOADING:	NO
IMPROPER BLOCKING:	NO	CORROSION:	NO
METAL FATIGUE:	NO	FRICTION OR RUBBING:	NO
FIRE OR HEAT:	NO	FREEZING:	NO
VENTING:	NO	VANDALISM:	NO

RUPTURED:	NO	HOW FAILED OTHER:	NO
HOW FAILED OTH DESC:		END FORWARD:	NO
END REAR:	NO	SIDE RIGHT:	NO
SIDE LEFT:	NO	TOP:	NO
BOTTOM:	NO	CENTER:	YES

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 268 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: CONSOLIDATED FRGHTWYS CORP DEL ADDRESS: 2157 MAIN STREET BUFFALO NY 14214 ERIE CONTACT:	REV: 3/15/05 ID1: 1996040614 ID2: STATUS: HIGHWAY (FOR HIRE) PHONE:
--------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

AREA OTHER: NO PACKAGE MATERIAL: YES CLOSURE: NO WELD SEAM: NO INNER LINING: NO WHAT FAILED OTH DESC:	AREA OTHER DESC: FITTING VALVE: NO CHIME: NO HOSE PIPING: NO WHAT FAILED OTHER: NO	CONTRIBUTING OTHER: YES OTHER FREIGHT: NO NAIL PROTRUSION: NO WATER: NO ROADSIDE OBSTACLE: NO OBJECT OTHER: YES CRACKED: NO RIPPED: NO RUBBED OR ABRADED: NO
----------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

MULTIPLE CODE: A
CONTAINER TYPE: 4G - BOX FIBER: FIBERBOARD BOX

MANUFACTURER: **ID:** 15527
 MENASHA CORPORATION
 UNKNOWN XX

CONTAINER CAPACITY: 0.32 GAL NUMBER FAILED: 3 NUMBER IN SHIPMENT: 8 GAUGE OF CONTAINER: 4GX17S95 LABEL OR PLACARD: INSPECTION DATE:	CONTAINER CAP CODE: 0 NUMBER FAILED CODE: 0 NUMBER IN SHIP CODE: 0 TANK SERIAL NUMBER: REGISTRATION NUMBER: EXEMPTION NUMBER: E10695
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

VEHICLE COLLISION: NO OVERLOAD OR OVERFILL: NO DEFECTIVE FITTING: NO STRUCK OR RAMMED: NO IMPROPER BLOCKING: NO METAL FATIGUE: NO FIRE OR HEAT: NO VENTING: NO	VEHICLE OVERTURN: NO LOOSE FITTING: NO DROPPED: NO IMPROPER LOADING: NO CORROSION: NO FRICTION OR RUBBING: NO FREEZING: NO VANDALISM: NO
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

RUPTURED: NO HOW FAILED OTH DESC: END REAR: NO SIDE LEFT: NO BOTTOM: NO AREA OTHER: NO PACKAGE MATERIAL: YES CLOSURE: NO WELD SEAM: NO INNER LINING: NO WHAT FAILED OTH DESC:	HOW FAILED OTHER: NO END FORWARD: NO SIDE RIGHT: YES TOP: NO CENTER: NO AREA OTHER DESC: FITTING VALVE: NO CHIME: NO HOSE PIPING: NO WHAT FAILED OTHER: NO
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 262 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTER S HOSPITAL	REV: 2/5/08
ADDRESS: 2157 MAIN STREET	ID1: 8705066
BUFFALO NY	ID2: 103207
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/16/1987	DATE REPORTED: 9/16/1987
CLOSED DATE: 1/10/1989	INSP DATE: 1/11/1988

MATERIAL SPILLED: 2 FUEL OIL	AMOUNT SPILLED: 20 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 20 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 8705066 8000 GALLON TANK END CALLERREMARK - 8705066

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: SISTER S HOSPITAL

ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-2000

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 1/12/1989
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8705066 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF / / : RNL TELECON 09/16/87, TANK TO BE PARTIALLY EMPTIED, SECOND 20000 TANK TO BE TESTED 09/17/87. / / : RNL TELECON 10/08/87, 8000 GALLON TANK EMPTY, TO BE REMOVED, OBTAINING BIDS FOR WORK, WILL CONTACT US WHEN REMOVAL SCHEDULED. / / : RNL TELECON 11/16/87, FLEISHMANN TO REMOVE TANK, WILL CALL US FOR DATE. / / : MF 1/7/88 SITE VISIT TANK REMOVAL, GROUNDWATER CONTAMINATED IN CRADLE, VACCED OUT, SOME SOIL CONTAMINATED,REMOVED and PLACED ON PLASTIC. / / : MF 1/8/88 SITE VISIT/LARRY THOMPSON and JOE SALM, MORE CONTAMINATED SOIL TO BE REMOVED (6FO) TOLD HIM I NEED RECEIPTS. / / : MF 1/11/88 SITE VISIT, FLEISHMANN S WORKING ON PIPING, CONTAMINATED SOIL ON SITE. / / : MF 1/25/88 TELECON LARRY THOMPSON, CONTAMINATED SOIL STILL ON SITE, TAKING BIDS TO HAVE SOIL REMOVED, WILL KEEP ME INFORMED. 02/11/88: MF TELECON LARRY THOMPSON, HE HAS A PRICE FROM DON BROOKS FOR SOIL REMOVAL, HE WILL KEEP ME INFORMED. 03/08/88: MF TELECON LARRY THOMPSON, THEY ARE STILL TAKING BIDS FOR SOIL REMOVAL. 03/28/88: MF TELECON LARRY,HE IS IN THE PROCESS OF CONTACTING LABS FOR SOIL TESTING. BFI TO HANDLE DISPOSAL. 05/31/88: MF TELECON LARRY THOMPSON, LAB RESULTS BACK FROM THE SOIL ANAYLSIS, CID WILL REMOVE SOIL WHEN PAPER WORK IS IN. LETTER SENT TO LARRY. 06/22/88: MF TELECON LARRY THOMPSON, HE CLAIMED HE IS WAITING FOR THE LANDFILL TO GET IN TOUCH WITH HIM, and HE SHOULD BE GETTING RID OF IT WITHIN 2 WEEKS. 07/25/88: MF TELECON LARRY, HE CLAIMED SOIL IS IN A CONTAINER and BFI WILL REMOVE IT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 262	DIST/DIR: 0.08 NE	MAP ID: 57
-----------------------	--------------------------	-------------------

NAME: SISTER S HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8705066 ID2: 103207 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

AS SOON AS PAPER WORK IS RECEIVED. 08/16/88: MF TELECON LARRY, HE CLAIMED SOIL WILL BE REMOVED IN 2 WEEKS, ALL PAPER WORK IS COMPLETE. HE WILL CALL ME WHEN SOIL IS GONE and SEND ME THE PAPERWORK. 09/09/88: MF TELECON LARRY THOMPSON, HE CLAIMED SOIL SHOULD BE REMOVED BY NOW, HE WILL CALL B.F.I. TO MAKE SURE and GET BACK TO ME. 10/14/88: MF TELECON LARRY THOMSON, HE CLAIMED BFI IS ALL SET and THE ONLY THING HOLDING THIS UP IS STATE APPROVAL. 12/13/88: MF TELECON LARRY THOMSON, HE CLAIMED HE TOTALLY FORGOT ABOUT RECEIPTS. HE WILL CALL BFI FOR THEM and GET THEM TO ME. 01/05/89: MF TELECON LARRY, HE WILL MAIL ALL RECEIPTS TODAY. 01/10/89: MF RECEIVED COPY OF LAB RESULTS. NO FUTHER ACTION NECESSARY. END DECRemark - 8705066

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 263 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9208731 ID2: 103209 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/28/1992 CLOSED DATE: 10/7/1993	DATE REPORTED: 10/28/1992 INSP DATE: 12:00:00 AM
----------------------------------------------------------------	-------------------------------------------------------------------

MATERIAL SPILLED: DIESEL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------	------------------------------------------------------------

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 9208731 TANK TEST FAILURE. END CALLERREMARK - 9208731

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: SISTERS HOSPITAL
ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-2810

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9208731 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 10/29/92: RMC/LARRY THOMPSON/PHONE WENT OVER OPTIONS....LETTER...RESPONSE DUE 1/30/93. 03/15/93: RMC/LARRY THOMPSON/PHONE WENT OVER OPTIONS....LETTER...RESPONSE DUE 1/30/93 REST DUE 05/01/93. 07/02/93: RMC/LEN P/PHONE RETEST WILL BE DONE BY 8/7/93. 09/24/93: RMC/LEN P/PHONE RETEST SCHEDULED 9/27, RESULTS DUE 10/7/93. 10/07/93: RMC/RECEIVED TANK RETEST, PASSED, CLOSE OUT. END DECRemark - 9208731

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 264 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9205780 ID2: 103208 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 8/18/1992	DATE REPORTED: 8/18/1992
CLOSED DATE: 2/26/1993	INSP DATE: 10/5/1992

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 9205780 FAILED TANK TEST END CALLERREMARK - 9205780

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: SISTERS OF CHARITY HOPSPI

ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-2810

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9205780 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 08/19/92: RMC/LEN P./PHONE DISCUSSED OPTIONS..LETTER SENT. 8/25 LEN AGAIN CONTRACT AWARDED TO FLEISHMANS TO EXCAVATE TO TOP OF TANK. 09/03/92: RMC/JAKE S. /PHONE TANK IS VISUALLY BAD , TO BE REMOVED IN THREE WEEKS. SCHEDULE WILL BE SENT. 10/05/92: RMC/LEN P /SITE HOLE LOOKS GOOD, RESULTS DUE 10/06/92, 5-10 YARDS FOR DISPOSAL. NEW TANK DUE 10/27/92. 10/29/92: RMC/RECEIVED CLEAN HOLE RESULTS/ LARRY THOMPSON/PHONE REQUIRES ADDITIONAL WORK...LETTER RESPONSE DUE 11/30/92. 11/10/92: RMC/RECEIVED CLEAN HOLE RESULTS/ LARRY THOMPSON/PHONE REQUIRES ADDITIONAL WORK...LETTER RESPONSE DUE 11/30/92 PLAN TO RETESTDUE 1/1/93. 02/26/93: RMC/RECEIVED SECOND SET OF SAMPLE RESULTS. VIOLATION FOR TCLP BENZENE, REMEDIATION NOT REQUIRED AT THIS TIME. LETTER TO RP OF INACTIVE STATUS. END DECRemark - 9205780

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 25 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL	REV: 6/6/06
ADDRESS: 2157 MAIN ST	ID1: NYD156390890
BUFFALO NY 14214	ID2:
ERIE	STATUS: SGN
CONTACT: JACOB SCHU	PHONE: 7168622409

SITE INFORMATION

CONTACT INFORMATION: JACOB SCHU
2157 MAIN ST
BUFFALO NY 14214

PHONE: 7168622409

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

X002

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 204 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9208731 ID2: 103209 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/28/1992	DATE REPORTED: 10/28/1992
CLOSED DATE: 10/7/1993	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: SISTERS HOSPITAL
ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-2810

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9208731 TANK TEST FAILURE. END CALLERREMARK - 9208731

DEC REMARKS:

Start DECRemark - 9208731 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 10/29/92: RMC/LARRY THOMPSON/PHONE WENT OVER OPTIONS....LETTER...RESPONSE DUE 1/30/93. 03/15/93: RMC/LARRY THOMPSON/PHONE WENT OVER OPTIONS....LETTER...RESPONSE DUE 1/30/93 REST DUE 05/01/93. 07/02/93: RMC/LEN P/PHONE RETEST WILL BE DONE BY 8/7/93.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 204	DIST/DIR: 0.08 NE	MAP ID: 57
-----------------------	--------------------------	-------------------

NAME: SISTERS HOSPITAL
ADDRESS: 2157 MAIN STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9208731
ID2: 103209
STATUS: CLOSED
PHONE:

09/24/93: RMC/LEN P/PHONE RETEST SCHEDULED 9/27, RESULTS DUE 10/7/93. 10/07/93: RMC/RECEIVED TANK RETEST, PASSED, CLOSE OUT. END DECRemark - 9208731

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 202 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9205780 ID2: 103208 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 8/18/1992	DATE REPORTED: 8/18/1992
CLOSED DATE: 2/26/1993	INSP DATE: 10/5/1992

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: SISTERS OF CHARITY HOPSPI

ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-2810

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9205780 FAILED TANK TEST END CALLERREMARK - 9205780

DEC REMARKS:

Start DECRemark - 9205780 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 08/19/92: RMC/LEN P./PHONE DISCUSSED OPTIONS..LETTER SENT. 8/25 LEN AGAIN CONTRACT AWARDED TO FLEISHMANS TO EXCAVATE TO TOP OF TANK. 09/03/92: RMC/JAKE S. /PHONE TANK IS VISUALLY BAD , TO BE REMOVED IN THREE WEEKS. SCHEDULE WILL BE SENT. 10/05/92: RMC/LEN

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 202	DIST/DIR: 0.08 NE	MAP ID: 57
-----------------------	--------------------------	-------------------

NAME: SISTERS HOSPITAL
ADDRESS: 2157 MAIN STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9205780
ID2: 103208
STATUS: CLOSED
PHONE:

P/SITE HOLE LOOKS GOOD, RESULTS DUE 10/06/92, 5-10 YARDS FOR DISPOSAL. NEW TANK DUE 10/27/92. 10/29/92: RMC/RECEIVED CLEAN HOLE RESULTS/ LARRY THOMPSON/PHONE REQUIRES ADDITIONAL WORK...LETTER RESPONSE DUE 11/30/92. 11/10/92: RMC/RECEIVED CLEAN HOLE RESULTS/ LARRY THOMPSON/PHONE REQUIRES ADDITIONAL WORK...LETTER RESPONSE DUE 11/30/92
PLAN TO RETESTDUE 1/1/93. 02/26/93: RMC/RECEIVED SECOND SET OF SAMPLE RESULTS. VIOLATION FOR TCLP BENZENE, REMEDIATION NOT REQUIRED AT THIS TIME. LETTER TO RP OF INACTIVE STATUS. END DECRemark - 9205780

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 203 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9608662 ID2: 103210 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 10/1/1995 CLOSED DATE: 9/9/1998	DATE REPORTED: 10/10/1996 INSP DATE: 11/6/1996
--------------------------------------------------------------	-----------------------------------------------------------------

MATERIAL SPILLED: 4 FUEL OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-------------------------------------------------------------------------	------------------------------------------------------------

MATERIAL SPILLED: DIESEL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------	------------------------------------------------------------

MATERIAL SPILLED: GASOLINE MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-----------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: WATERBODY AFFECTED: SOURCE OF SPILL: REPORTED BY:	UNKNOWN COMMERCIAL VEHICLE OTHER
--------------------------------------------------------------------------------------------------------	--------------------------------------------

REGION: UST TRUST?	9 YES
-------------------------------------	----------

SPILL INVESTIGATOR:	RMCROSSE
----------------------------	----------

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 203 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9608662 ID2: 103210 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SPILL CONTACT:
TELEPHONE:

SPILLER: SISTERS OF CHARITY HOSPIT
RUSS RADDER
ADDRESS: 2157 MAIN STREET
BUFFALO, NY 14214

TELEPHONE: (716) 862-1105

REPORTED BY: OTHER

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9608662 BORINGS SHOW CONTAMINATION TANKS TO BE REMOVED REPORTS WILL BE FORWARDED SCHEDULED 10-21-96 CONTRACTOR KOESTER 3-20K TANKS 240 MG KG GAS TPH 8015
END CALLERREMARK - 9608662

DEC REMARKS:

Start DECRemark - 9608662 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 10/10/96 RMC/DENNIS BRINKLEY/PHONE TO SEND REPORTS TO DATE, TANK REMOVALS SCHEDULED FOR WEEK OF 10/22 10/30/96 RMC/SITE NO REMOVALS YET, CLEANING TANKS IN PLACE, 11/1/96 SAC/ATKINS/SITE TANK REMOVALS BEGUN, WATER TO DEAL WITH, CONTAMINATION TO DEAL WITH, TO REINSPECT 11/4/96 SAC/ATKINS/SITE, ALL TANKS REMOVED, PRODUCT IN WATER, EXCAVATION OF CONTAMINATED SOILS CONTINUES 11/6/96 SAC/DENNIS JOCHEM, KOESTER/SITE EXCAVATION CONTINUES, TO INSTALL TWO WELLS, 11/7/96 RMC/ATKINS/PHONE ATKINS FAXED SAMPLE RESULTS FROM OVERBURDEN SOILS, EXCEEDANCES, TO DISPOSE OF ALSO, TO USE BFI FOR DISPOSAL, SAMPLES TAKEN, RESULTS AND DISPOSAL RECEIPTS DUE 11/30/96 11/18/96 RMC/FILE RECEIVED SAMPLING REPORT, FURTHER WORK REQUIRED, LETTER, RESPONSE DUE 12/31/96 12/23/96 RMC/SCOTT JOHNSON/PHONE ESE TO SAMPLE TANK PIT WELLS NOW AND INSTALL WELLS EARLY SPRING, MW RESULTS DUE 2/28/96 02/11/97 RMC/FILE RECEIVED AND OKED WELL PLACEMENT PLAN, RESULTS DUE 3/30/97 06/03/97 RMC/RUSS RADDER, 862-1105/PHONE WELLS NOT YET PLACED, RP TO CONTACT CONTRACTOR, REPORT DUE 6/30/97 06/16/97 RMC/GEORGE FLAN, QST, (ENVIRONMENTAL CONSULTANT) 1-800-736-2219/PHONE WORK NOT YET APPROVED BY SISTERS, RMC ADVISED CONTACTOR TO GET IN CONTACT WITH RP FOR APPROVAL, REPORT DUE 7/30/97 08/27/97 RMC/FILE LETTER REQUESTING SITE ASSESSMENT, DUE 9/26/97 12/26/97 RMC/FILE NO RESPONSE LETTER, RESPONSE DUE 1/9/98 03/03/98 RMC/FILE RECEIVED MESSAGE FORM BRIAN LOUGHNANE 610-941-9700 THAT THEY ARE GOING FOWARD WITH WELLS, UPDATE 5/1/98 03/98 RMC/SAVAGE/SITE ONE WELL COMPLETED, TWO TO GO, REPORT DUE 5/30/98 09/09/98 RMC/FILE REVIEWED MW REPORT, ONLE MINOR EXCEEDANCES, WELLS PLACE AROUND AND IMMEDIATELY OUTSIDE THE ORIGINAL TANK PIT EXCAVATION, DISPOSED OF SEVERAL HUNDRED TONS OF SOIL, SITE CONTINUES TO BE A PBS SITE AND ORIGINAL EXCAVATION HAS TANK REINSTALLED, I PER RNL LETTER END DECRemark - 9608662

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 227 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTER S HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8705066 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 09/16/87	DATE REPORTED: 09/16/87
SPILL TIME: 12:30	TIME REPORTED: 13:00

MATERIAL SPILLED: 2 FUEL OIL	AMOUNT SPILLED: 20 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 20 G

CAUSE OF SPILL: TANK TEST FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: NON-COMMERCIAL/INSTITUTIONAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
 8000 GALLON TANK

REGION: 9 **UST TRUST?** YES

SPILL INVESTIGATOR: MF	TELEPHONE:
SPILL CONTACT:	

SPILLER: SISTER S HOSPITAL ADDRESS: 2157 MAIN STREET BUFFALO, NY 14214 SPILLER CONTACT:	TELEPHONE: (716) 862-2000
-----------------------------------------------------------------------------------------------------------------------	----------------------------------

CALLER: LARRY THOMPSON	NOTIFIER:
AGENCY: SISTERS HOSPITAL	AGENCY:
TELEPHONE: (716) 862-2000	TELEPHONE:

LAST DEC UPDATE: 01/12/89	CLOSE DATE: 01/10/89
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

// : RNL TELECON 09/16/87, TANK TO BE PARTIALLY EMPTIED, SECOND 20000 TANK TO BE TESTED 09/17/87. // : RNL TELECON 10/08/87, 8000 GALLON TANK EMPTY, TO BE REMOVED, OBTAINING BIDS FOR WORK, WILL CONTACT US WHEN REMOVAL SCHEDULED. // : RNL TELECON 11/16/87, FLEISHMANN TO REMOVE TANK, WILL CALL US FOR DATE. // : MF 1/7/88 SITE VISIT TANK REMOVAL, GROUNDWATER CONTAMINATED IN CRADLE, VACCED OUT, SOME SOIL CONTAMINATED, REMOVED and PLACED ON PLASTIC. // : MF 1/8/88 SITE VISIT/LARRY THOMPSON and JOE SALM, MORE CONTAMINATED SOIL TO BE REMOVED (6FO) TOLD HIM I NEED RECEIPTS. // : MF 1/11/88 SITE VISIT, FLEISHMANN S WORKING ON PIPING, CONTAMINATED SOIL ON SITE. // : MF 1/25/88 TELECON LARRY THOMPSON, CONTAMINATED SOIL STILL ON SITE, TAKING BIDS TO HAVE SOIL REMOVED, WILL KEEP ME INFORMED. 02/11/88: MF TELECON LARRY THOMPSON, HE HAS A PRICE FROM DON BROOKS FOR SOIL REMOVAL, HE WILL KEEP ME INFORMED. 03/08/88: MF TELECON LARRY THOMPSON, THEY ARE STILL TAKING BIDS FOR SOIL REMOVAL. 03/28/88: MF TELECON LARRY, HE IS IN THE PROCESS OF CONTACTING LABS FOR SOIL TESTING. BFI TO HANDLE DISPOSAL. 05/31/88: MF TELECON LARRY THOMPSON, LAB RESULTS BACK FROM THE SOIL ANALYSIS, CID WILL REMOVE SOIL WHEN PAPER WORK IS IN. LETTER SENT TO LARRY. 06/22/88: MF TELECON LARRY THOMPSON, HE CLAIMED HE IS WAITING FOR THE LANDFILL TO GET IN TOUCH WITH HIM, and HE SHOULD BE GETTING RID OF IT WITHIN 2 WEEKS. 07/25/88: MF TELECON LARRY, HE CLAIMED SOIL IS IN A CONTAINER and BFI WILL REMOVE IT AS SOON AS PAPER WORK IS RECEIVED. 08/16/88: MF TELECON LARRY, HE CLAIMED SOIL WILL BE REMOVED IN 2 WEEKS, ALL PAPER WORK IS COMPLETE. HE WILL CALL ME WHEN SOIL IS GONE and SEND ME THE PAPERWORK. 09/09/88: MF TELECON LARRY THOMPSON, HE CLAIMED SOIL SHOULD BE REMOVED BY NOW, HE WILL CALL B.F.I. TO MAKE SURE and GET BACK TO ME. 10/14/88: MF TELECON LARRY THOMPSON, HE CLAIMED BFI IS ALL SET and THE ONLY THING HOLDING THIS UP IS STATE APPROVAL. 12/13/88: MF TELECON LARRY THOMPSON, HE CLAIMED HE TOTALLY FORGOT ABOUT RECEIPTS. HE WILL CALL BFI FOR THEM and GET THEM TO ME. 01/05/89: MF TELECON LARRY, HE WILL MAIL ALL RECEIPTS TODAY. 01/10/89: MF RECEIVED COPY OF LAB RESULTS. NO FUTHER ACTION NECESSARY.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 245 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL ADDRESS: 2157 MAIN ST BUFFALO NY 14214 ERIE CONTACT: BRUCE JOHNSON	REV: 2/5/08 ID1: PBS9-383252 ID2: STATUS: ACTIVE PHONE: (716) 862-1000
---------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: OTHER
TYPE NAME:
TOTAL NUMBER OF TANKS: 7
NUMBER OF ACTIVE TANKS: 2
NUMBER OF INACTIVE TANKS: 5
TOTAL FACILITY CAPACITY: 21000 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: SISTERS OF CHARITY HOSPITAL
TITLE: DIRECTOR FACILITIES AND ENGINEERING
NAME: BRUCE JOHNSON
ADDRESS: 2157 MAIN ST
NY 14214
PHONE: (716) 862-1000
EMERGENCY CONTACT: JOSEPH RACSUMBERGER
PHONE: (716) 862-1101

MAILING INFORMATION

COMPANY: SISTERS OF CHARITY HOSPITAL
TITLE:
CONTACT: BRUCE JOHNSON
ADDRESS: 2157 MAIN ST
BUFFALO NY 14214
PHONE: (716) 862-1102
EMAIL:

EXP. DATE: 8/17/2012
RENEWAL DATE: 4/4/2002

COMMENTS: 02/04/04 Len Popielinski provided most of documentation requested in NOV (updated registration, leak monitoring, 10-day recon, tank CP reading and 614 Tag). He will determine status of piping for gas UST and take action accordingly. Same with fill port CB. pfk

TANK INFORMATION

TANK NUMBER: 1	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 8/1/1962
CLOSED: 10/1/1996	TANK CAPACITY: 20000 GALLONS
PRODUCT: 6 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 245 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL	REV: 2/5/08
ADDRESS: 2157 MAIN ST	ID1: PBS9-383252
BUFFALO NY 14214	ID2:
ERIE	STATUS: ACTIVE
CONTACT: BRUCE JOHNSON	PHONE: (716) 862-1000

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: ABOVEGROUND/UNDERGROUND COMBINATION
EXTERNAL PROTECTION: WRAPPED
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 2	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 8/1/1962	
CLOSED: 10/1/1996	TANK CAPACITY: 20000 GALLONS	
PRODUCT: 6 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: ABOVEGROUND/UNDERGROUND COMBINATION
EXTERNAL PROTECTION: WRAPPED
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 3	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91	
ACTIVE STATUS: INACTIVE	INSTALLED: 8/1/1962	
CLOSED: 12:00:00 AM	TANK CAPACITY: 8000 GALLONS	
PRODUCT: 2 FUEL OIL		

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 245 **DIST/DIR:** 0.08 NE **MAP ID:** 57

NAME: SISTERS OF CHARITY HOSPITAL	REV: 2/5/08
ADDRESS: 2157 MAIN ST	ID1: PBS9-383252
BUFFALO NY 14214	ID2:
ERIE	STATUS: ACTIVE
CONTACT: BRUCE JOHNSON	PHONE: (716) 862-1000

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 4	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 1/1/1974	
CLOSED: 10/1/1996	TANK CAPACITY: 20000 GALLONS	
PRODUCT: 2 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: ABOVEGROUND/UNDERGROUND COMBINATION
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 9/1/1993
NEXT TEST: 12:00:00 AM
TEST METHOD: PETRO-TITE/PETRO COMP

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 190 **DIST/DIR:** 0.08 NW **MAP ID:** 58

NAME: NIMO-POLE TRANSFORMER	REV: 2/5/08
ADDRESS: 232 LINCOLN PARKWAY	ID1: 0102941
BUFFALO NY	ID2: 285102
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 6/15/2000	DATE REPORTED: 6/16/2001
CLOSED DATE: 8/21/2001	INSP DATE: 6/16/2001

MATERIAL SPILLED: TRANSFORMER OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT: ROGER WOODARD
TELEPHONE: (716) 873-0719

SPILLER: NIAGARA MOHAWK
FRANK GRABOWSKI
ADDRESS: 7437 HENRY CLAY BLVD
LIVERPOOL, NY 13088-

TELEPHONE: (315) 440-2351

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 8/21/2001
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0102941 CALLER STATES TRANSFORMER EXPLODED IN HIS BACKYARD LAST NIGHT. CALLER SUSPECT MATERIAL CONTAINS PCB S. CALLER HAS CONTACTED NIAGARA MOHAWK AND THEY HAVE NOT YET RESPONDED. END CALLERREMARK - 0102941

DEC REMARKS:
Start DECRemark - 0102941 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 06/16/01: MF S/I/NIMO, RICK JORDEN,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 190	DIST/DIR: 0.08 NW	MAP ID: 58
-----------------------	--------------------------	-------------------

NAME: NIMO-POLE TRANSFORMER ADDRESS: 232 LINCOLN PARKWAY BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0102941 ID2: 285102 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

831-7349 ET AL. POLE TRANSFORMER IN THE CORNER OF 3 YARDS, 232 LINCOLN PKY, 218 MIDDLESEX and 215 NOTTINGHAM CAUGHT ON FIRE DUE TO HEAVY LOADING and EXPLODED. I WAS TOLD IT HOLD 40 GALLONS OF NON PCB OIL. IT WILL BE TESTED. OIL MIST GOT OVER A FENCE, TREE, GROUND VEGETATION and IN AN INGROUND SWIMMING POOL AT 232. I DID NOT NOTICE SHEEN IN THE POOL. POOL HAS A SAND FILTER. I MET WITH ROGER WOODLAND AT 232 LINCOLN. SOME FROUND COVER HAS BEEN REMOVED. I TOLD HIM WHAT NOMO TOLD ME. THE CONTAMINATION WILL BE REMOVED and AN ADJUSTER WILL BE SENT. I ALSO TOLD THIS TO THE HOMEOWNER AT 218 and 215. I ESTIMATE < 5 GALLONS OF OIL MADE IT TO THE GROUND. THE REST BURNED. 06/25/01: MF RECEIVED PCB SAMPLE RESULTS, ND. 07/16/01: MF E-MAIL FROM ROGER WOODARD, 232 LINCOLN PKY. HE SUGGEST A NON-NI MO PARTY TEST THE TRANSFORMER OIL. HE ALSO CLAIMS THAT IT SEEMS PECULIAR THAT ONLY ONE SAMPLE TAKEN. 07/19/01: MF DISCUSSED WITH FRANK GROBOWSKI OF NI MO. HE CLAIMED THAT AN OUTSIDE LAB IS ALWAYS HIRED TO PREFORM ANALYSIS WHEN RESIDENTIAL PROPERTY IS AFFECTED. TX LIQUID IS SAMPLED TO DETERMINE EXTENT OF CLEAN UP IF PCB S ARE DETECTED. LETTER TO ROGER WOODARD WITH THIS INFO. 08/21/01: MF RECEIVED FAX OF SOIL DISPOSAL RECEIPTS. NO FURTHER ACTION NECESSARY. END DECRemark - 0102941

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 193 **DIST/DIR:** 0.08 NW **MAP ID:** 59

NAME: SOOT IN MADORE HOME	REV: 2/5/08
ADDRESS: 1966 DELAWARE AVE. APT 1	ID1: 0075613
BUFFALO NY	ID2: 303136
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 1/1/2001	DATE REPORTED: 2/16/2001
CLOSED DATE: 2/16/2001	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: NO	AIR: YES
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: PRIVATE DWELLING
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT: DONAT MADORE
TELEPHONE: (716) 447-0782

SPILLER: UNKNOWN

ADDRESS:
 , ZZ

TELEPHONE:

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 2/22/2001
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0075613 CALLER CLAIMS BLACK SOOT COVERS INTERIOR OF HOME, STARTED SEVERAL WEEKS AGO, REMOTE BASE BOARD HOT WATER HEATING, BOILER IS LOCATED FLOOR ABOVE THE APARTMENT, CARBON MONOXIDE DETECTOR IN PLACE. END CALLERREMARK - 0075613

DEC REMARKS:
Start DECRemark - 0075613 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 02/16/01: RMC REFERRED TO DOA AND

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 193	DIST/DIR: 0.08 NW	MAP ID: 59
-----------------------	--------------------------	-------------------

NAME: SOOT IN MADORE HOME ADDRESS: 1966 DELAWARE AVE. APT 1 BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0075613 ID2: 303136 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

NYSDOH, NO SPILL ACTION REQUIRED, CLOSE OUT END DECRemark - 0075613

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 211 **DIST/DIR:** 0.08 NW **MAP ID:** 56

NAME: OIL IN SCAJAQUADA CREEK	REV: 10/18/00
ADDRESS: TONAWANDA AND WEST STREET	ID1: 8907953
BUFFALO NY	ID2:
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SPILL DATE: 11/10/89	DATE REPORTED: 11/10/89	
SPILL TIME: 07:00	TIME REPORTED: 09:00	

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 1700 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 1600 G

CAUSE OF SPILL:	EQUIPMENT FAILURE
RESOURCE AFFECTED:	SURFACE WATER
WATERBODY AFFECTED:	SCAJAQUADA CREEK
SOURCE OF SPILL:	NON-COMMERCIAL/INSTITUTIONAL
REPORTED BY:	CITIZEN
CALLER REMARKS:	
OIL IN CREEK	

REGION: 9	UST TRUST? NO	
------------------	----------------------	--

SPILL INVESTIGATOR: RNL	
SPILL CONTACT:	TELEPHONE:

SPILLER: NYS OFFICE OF MENTAL HEAL	
ADDRESS: 400 FOREST AVENUE	
BUFFALO, NY 14213	
SPILLER CONTACT:	TELEPHONE:

CALLER: ANONYMOUS	NOTIFIER:
AGENCY: CITIZEN	AGENCY:
TELEPHONE:	TELEPHONE:

LAST DEC UPDATE: 02/22/96	CLOSE DATE: 09/13/90
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

11/13/89: LQR ON SITE W/ USCG, STATE HIRED CONTRACTOR TO REMIDATE 11/10/89. 12/19/89: LQR ON SITE W/ SPILLER REMOVED DEBRIS AND DISPOSED OF. 12/22/89: DISPOSAL RECIEPT REC. 09/13/90: RNL SITE INSP. OF CREEK, NO SHEENS AT SEWER OUTFALL OR IN CREEK, STIE CLOSED.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

DOCKET

SEARCH ID: 280	DIST/DIR: 0.08 SE	MAP ID: 60
-----------------------	--------------------------	-------------------

NAME: S.A. DAY MFG. CO. INC. ADDRESS: 1489 NIAGARA STREET BUFFALO NY 14213 ERIE CONTACT:	REV: 1/9/06 ID1: 02-2004-4202 ID2: 110017770697 STATUS: ICIS PHONE:
---------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

ENFORCEMENT TYPE:	EPCRA 325 AO FOR COMPLIANCE AND/OR PENALTY
VIOLATION TYPE:	TOXIC RELEASE INVENTORY (SECTION 313)
REFIEF REQUESTED:	

DEFENDANT NAME:	S.A. DAY MFG. CO., INC. (THE)	NAMED IN COMPLAINT:	YES
NAMED IN SETTLEMENT:	YES		

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 80 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: S A DAY MANUFACTURING ADDRESS: 1489 NIAGARA STREET BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110017770697 ID2: 14213SDYMF1489N STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 12/31/1979 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002110815 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:46:24 AM NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NCDB PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: D02 E-02-2004-4202 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED: 5/27/2005 11:36:47 AM COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: TRIS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 6/28/2006 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 14213SDYMF1489N AGENCY INTERESTED: 12/31/1999 INTEREST ENDED: 1/1/2006 SOURCE OF DATA: TRI REPORTING FORM LAST EXTRACTED: 12/8/2002 1:56:04 PM TRI REPORTER - A TOXIC RELEASE INVENTORY REPORTER IS A FACILITY WHICH: EMPLOYS THE EQUIVALENT OF 10 OR MORE FULL-TIME EMPLOYEES; AND IS INCLUDED IN STANDARD INDUSTRIAL CLASSIFICATION (SIC) CODES 10XX, 12XX, 20XX-39XX, 4911, 4931, 4939, 4953, 5169, 5171, OR 7389; AND MANUFACTURES (DEFINED TO INCLUDE IMPORTING), PROCESSES, OR OTHERWISE USES ANY EMERGENCY PLANNING AND COMMUNITY RIGHT-TO-KNOW ACT (EPCRA) SECTION 313 CHEMICAL IN QUANTITIES GREATER THAN THE ESTABLISHED THRESHOLD IN THE COURSE OF A CALENDAR YEAR (I.E., MANUFACTURES OR PROCESSES OVER 25,000 POUNDS OF THE APPROXIMATELY 600 DESIGNATED CHEMICALS OR 28 CHEMICAL CATEGORIES SPECIFIED IN THE REGULATIONS, OR USES MORE THAN 10,000 POUNDS OF ANY DESIGNATED CHEMICAL OR CATEGORY).
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 5/18/2004 12:35:18 PM ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110017770697 AGENCY INTERESTED: 5/18/2004 12:35:16 PM INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED: FACILITY -
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL:	PROGRAM ID: 9-1402-00452 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS
------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 80 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: S A DAY MANUFACTURING	REV: 11/1/06
ADDRESS: 1489 NIAGARA STREET	ID1: 110017770697
BUFFALO NY 14213	ID2: 14213SDYMF1489N
ERIE	STATUS: FRS
CONTACT:	PHONE:

LAST REPORTED: **LAST EXTRACTED:** 11/19/2004 11:55:01 PM

ENFORCEMENT ACT:
REG PROGRAM: STATE MASTER -

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 5/18/2004 12:35:18 PM
DATA UPDATED: 10/18/2005 3:44:19 PM
ENTERED PERSON/METHOD: GHAZNAVI
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 79 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: S A DAY MANUFACTURING	REV: 9/12/05
ADDRESS: 1489 NIAGARA ST	ID1: 110019426352
BUFFALO NY 14213	ID2: D02 E-02-2004-4202
ERIE	STATUS: FRS
CONTACT:	PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: NCDB	PROGRAM ID: D02 E-02-2004-4202	
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:	INTEREST ENDED:	
INT END QUAL:	SOURCE OF DATA: NCDB	
LAST REPORTED:	LAST EXTRACTED: 5/27/2005 11:36:47 AM	
ENFORCEMENT ACT:		
REG PROGRAM: COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.		

PROGRAM: FRS	PROGRAM ID: 110019426352	
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED: 11/19/2004 11:54:59 PM	
AGENCY INT QUAL:	INTEREST ENDED:	
INT END QUAL:	SOURCE OF DATA: FIS	
LAST REPORTED: 11/19/2004 11:55:01 PM	LAST EXTRACTED:	
ENFORCEMENT ACT:		
REG PROGRAM: FACILITY -		

PROGRAM: FIS	PROGRAM ID: 9-1402-00452	
PROVIDED BY: STATE AGENCY	AGENCY INTERESTED:	
AGENCY INT QUAL:	INTEREST ENDED:	
INT END QUAL:	SOURCE OF DATA: NYSDEC	
LAST REPORTED:	LAST EXTRACTED: 11/19/2004 11:55:01 PM	
ENFORCEMENT ACT:		
REG PROGRAM: STATE MASTER -		

SITE TYPE: STATIONARY	
INTEREST STATUS: ACTIVE	
DATA QUALITY: V	
LOCATION DESC: 1489 NIAGARA ST	
ADDRESS TYPE: REGULAR URBAN	
LAST REPORTED:	
POSTED TO DATABASE: 11/19/2004 11:55:01 PM	
DATA UPDATED:	
ENTERED PERSON/METHOD: REFRESH	
PARENT REG ID:	
CONFIDENCE IN ADDR:	
ENFORCEMENT SENSITIVE:	
REQ MANUAL REVIEW: D	
REASON MAN REVIEW: DUPLICATE	
SMALL BUS POLICY:	
ENFORCEMENT ACTION:	
DATA PUB ACCESS: YES	
INTERNAL SYS ID:	
FEDERAL FACILITY: NO	

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 79	DIST/DIR: 0.08 SE	MAP ID: 60
----------------------	--------------------------	-------------------

NAME: S A DAY MANUFACTURING
ADDRESS: 1489 NIAGARA ST
 BUFFALO NY 14213
 ERIE

REV: 9/12/05
ID1: 110019426352
ID2: D02 E-02-2004-4202
STATUS: FRS
PHONE:

CONTACT:

FEDERAL AGENCY:
TRIBAL LAND:
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 57	DIST/DIR: 0.08 SE	MAP ID: 61
----------------------	--------------------------	-------------------

NAME: DAY S A MFG CO ADDRESS: 1483-85 NIAGARA ST BUFFALO NY 14213 Erie CONTACT:	REV: ID1: NYD002110815 ID2: STATUS: PHONE:
------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

RCRIS : NYD002110815
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 267 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: HUNT J B SPECIAL COMMODITIES I ADDRESS: 1489 NIAGRA BUFFALO NY 14213 ERIE CONTACT:	REV: 3/15/05 ID1: 1993090891 ID2: STATUS: HIGHWAY (FOR HIRE) PHONE:
---------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

TOTAL NUMBER OF HAZARDOUS MATERIALS: 1

MULTIPLE CODE: A
MODE OF TRANSPORT: 4 - H-H: HIGHWAY (FOR HIRE)
OTHER MODE:

INCIDENT DATE: 9/3/1993 CARRIER RPT NUMBER: 456913 DEST SAME AS CONS: YES	INCIDENT TIME: 13:25 ORIG SAME AS SHIP: YES
------------------------------------------------------------------------------------------------------	--------------------------------------------------------------

INCIDENT: 1489 NIAGRA BUFFALO NY ERIE	CARRIER: ID: 46764 HUNT J B SPECIAL COMMODITIES I 615 J B HUNT CORP DR LOWELL AR 72745
SHIPPER: ID: 13974 GREAT LAKES CHEMICAL CORP HWY 15 SOUTH EL DORADO AR 71730	CONSIGNEE: ID: 51406 S A DAY MFG 1489 NIAGRA ST BUFFALO NY 14201
ORIGIN: HWY 15 SOUTH EL DORADO AR 71730	DESTINATION: 1489 NIAGRA ST BUFFALO NY 14201

COMMODITY INFORMATION

MULTIPLE CODE: A HAZ SUBSTANCE: NO RQ MET: NO QUANTITY RELEASED: 0.13 GAL	SHIPPING PAPER: 32506 UN NUMBER: UN1788 QUAN REL CODE: 0 COMMODITY CODE: 05668
----------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------

COMMODITY SHIP NAME: HYDROBROMIC ACID >49%
COMMODITY TRADE NAME:
COMMODITY CLASS: 80 - CORROS: CORROSIVE MATERIAL

OTHER MATERIAL INFORMATION

DEATHS: 0 MINOR INJURIES: 0 PRODUCT LOSS: 0 CARRIER DAMAGE: 0 PUB PRI DAMAGE: 0 DECON DAMAGE: 0 OTHER DAMAGE: 0 REPORT DAMAGE: 0 INCIDENT DAMAGE: 0 RESULT VAPOR: NO	MAJOR INJURIES: 0 NUMBER EVACUATED: 0 PROD LOSS CODE: 1 CARRIER DAM CODE: 1 PUB PRI DAM CODE: 1 DECON DAM CODE: 1 OTHER DAM CODE: 1 REPORT DAM CODE: 0 DAMAGE CODE: RESULT SEWER: NO
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 267 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: HUNT J B SPECIAL COMMODITIES I
ADDRESS: 1489 NIAGRA
BUFFALO NY 14213
ERIE
CONTACT:

REV: 3/15/05
ID1: 1993090891
ID2:
STATUS: HIGHWAY (FOR HIRE)
PHONE:

RESULT SPILL:	YES	RESULT FIRE:	NO
RESULT EXPLOSION:	NO	RESULT ENVIRONMENT:	NO
RESULT NONE:	NO	RESULT OTHER:	NO
RESULT OTHER DESC:		VEHICLE CARGO:	NO
VEHICLE VAN:	YES	VEHICLE FLAT:	NO
VEHICLE TANK CAR:	NO	VEHICLE RAIL CAR:	NO
VEHICLE TOFC:	0	VEHICLE AIRCRAFT:	NO
VEHICLE BARGE:	NO	VEHICLE SHIP:	NO
VEHICLE OTHER:	NO	VEHICLE OTHER DESC:	
TRANSPORT PHASE:	263	LAND USE:	271
COMMUNITY TYPE:	282	ACCIDENT OR DERAIL:	NO
ESTIMATED SPEED:		HIGHWAY TYPE:	
HIGHWAY LANES:		GENERAL CAUSE:	20
MISC INFO 1:	100	MISC INFO 2:	100
ATTACHMENTS:	NO	RECOMMENDATIONS:	NO

REPORTER NAME: HERBERT R JORDAN
REPORTER TITLE: DIR OF SAFETY
REPORTER PHONE: 5018208291
REPORT DATE: 9/8/1993

CONTAINER INFORMATION

MULTIPLE CODE: A
CONTAINER TYPE: DRUM PLS - DRUM NON-METAL: PLASTIC DRUM

MANUFACTURER: **ID:** 16222
NOT REPORTED BY CARRIER
UNKNOWN XX

CONTAINER CAPACITY:	55 GAL	CONTAINER CAP CODE:	0
NUMBER FAILED:	2	NUMBER FAILED CODE:	0
NUMBER IN SHIPMENT:	64	NUMBER IN SHIP CODE:	0
GAUGE OF CONTAINER:		TANK SERIAL NUMBER:	
LABEL OR PLACARD:	WHITE	REGISTRATION NUMBER:	
INSPECTION DATE:		EXEMPTION NUMBER:	

VEHICLE COLLISION:	NO	VEHICLE OVERTURN:	NO
OVERLOAD OR OVERFILL:	NO	LOOSE FITTING:	NO
DEFECTIVE FITTING:	YES	DROPPED:	NO
STRUCK OR RAMMED:	NO	IMPROPER LOADING:	NO
IMPROPER BLOCKING:	NO	CORROSION:	NO
METAL FATIGUE:	NO	FRICTION OR RUBBING:	NO
FIRE OR HEAT:	NO	FREEZING:	NO
VENTING:	NO	VANDALISM:	NO

RUPTURED:	NO	HOW FAILED OTHER:	NO
HOW FAILED OTH DESC:		END FORWARD:	NO
END REAR:	NO	SIDE RIGHT:	NO
SIDE LEFT:	NO	TOP:	YES
BOTTOM:	NO	CENTER:	NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

HMIRS

SEARCH ID: 267 **DIST/DIR:** 0.08 SE **MAP ID:** 60

NAME: HUNT J B SPECIAL COMMODITIES I ADDRESS: 1489 NIAGRA BUFFALO NY 14213 ERIE CONTACT:	REV: 3/15/05 ID1: 1993090891 ID2: STATUS: HIGHWAY (FOR HIRE) PHONE:
---------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

AREA OTHER: NO		AREA OTHER DESC:	
PACKAGE MATERIAL: NO		FITTING VALVE: NO	
CLOSURE: YES		CHIME: NO	
WELD SEAM: NO		HOSE PIPING: NO	
INNER LINING: NO		WHAT FAILED OTHER: NO	
WHAT FAILED OTH DESC:			
INCOMPATIBLE MATERIAL: NO		CONTRIBUTING OTHER: NO	
CONTRIB OTHER DESC:		OTHER FREIGHT: NO	
FORKLIFT: NO		NAIL PROTRUSION: NO	
OTHER VEHICLE: NO		WATER: NO	
GROUND FLOOR RDWAY: NO		ROADSIDE OBSTACLE: NO	
NO OBJECT: YES		OBJECT OTHER: NO	
PUNCTURED: NO		CRACKED: NO	
BURST INTER PRESSURE: YES		RIPPED: NO	
CRUSHED: NO		RUBBED OR ABRADED: NO	

REMARKS

ARRIVED AT THE RECEIVER TO FIND THAT TWO OF THE PLASTIC DRUMS HAD BUNG CLOSURES. THE CLOSURES WERE SEALED FROM THE SHIPPER AND WERE AS LEAKING UNTIL A LARGE AMOUNT OF PRODUCT LEAKED FROM UNDER PLASTIC SEAL. THE LEAKED MATERIAL SPILLED ONTO CARDBOARD UNDERNEATH DRUMS AND THIS AIDED IN CLEANING. ALL WASTE and PRODUCT WAS ACCEPTED BY .

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 28 **DIST/DIR:** 0.08 SE **MAP ID:** 61

NAME: DAY S A MANUFACTURING CO ADDRESS: 1483-85 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT:	REV: 6/6/06 ID1: NYD002110815 ID2: STATUS: NLR PHONE:
----------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

42184 - INDUSTRIAL SUPPLIES WHOLESALERS
42172 - PLUMBING AND HEATING EQUIPMENT AND SUPPLIES (HYDRONICS) WHOLESALERS
42161 - ELECTRICAL APPARATUS AND EQUIPMENT, WIRING SUPPLIES, AND CONSTRUCTION MATERIAL WHOLESALERS
42171 - HARDWARE WHOLESALERS

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 136	DIST/DIR: 0.08 SE	MAP ID: 60
-----------------------	--------------------------	-------------------

NAME: S.A. DAY MANUFACTURING CO INC
ADDRESS: 1489 NIAGARA ST
BUFFALO NY 14213
ERIE
CONTACT: JACKSON H. BOWLING

REV: 11/1/07
ID1: 14213SDYMF1489N
ID2:
STATUS: OPEN
PHONE: 7168813030

SITE INFORMATION

SIC INFORMATION

NA -

REPORTED INFORMATION

REPORTING YEAR:	CONTACT PERSON:	CONTACT PHONE:
-----------------	-----------------	----------------

1999

2000

2001

2002

2003

2004

2005

CHEMICAL

ONE TIME RELEASE QTY(LBS)

HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)

HYDROGEN FLUORIDE

ZINC COMPOUNDS

ETHYLENE GLYCOL

ETHYLENE GLYCOL

HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)

HYDROGEN FLUORIDE

ZINC COMPOUNDS

ETHYLENE GLYCOL

HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)

HYDROGEN FLUORIDE

ZINC COMPOUNDS

ZINC COMPOUNDS

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 136	DIST/DIR: 0.08 SE	MAP ID: 60
-----------------------	--------------------------	-------------------

NAME: S.A. DAY MANUFACTURING CO INC ADDRESS: 1489 NIAGARA ST BUFFALO NY 14213 ERIE CONTACT: JACKSON H. BOWLING	REV: 11/1/07 ID1: 14213SDYMF1489N ID2: STATUS: OPEN PHONE: 7168813030
-------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

ETHYLENE GLYCOL

HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)

HYDROGEN FLUORIDE

ZINC COMPOUNDS

ETHYLENE GLYCOL

HYDROGEN FLUORIDE

ETHYLENE GLYCOL

HYDROGEN FLUORIDE

ZINC COMPOUNDS

ETHYLENE GLYCOL

HYDROGEN FLUORIDE

ZINC COMPOUNDS

OFF SITE TREATMENT LOCATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SWL

SEARCH ID: 229	DIST/DIR: 0.08 SW	MAP ID: 63
-----------------------	--------------------------	-------------------

NAME: SQUAW ISLAND SLF ADDRESS: NIAGARA STREET BUFFALO NY 14202 ERIE CONTACT:	REV: 05/03/06 ID1: 9-15T07 ID2: 15T07 STATUS: INACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------

SITE INFORMATION

OWNER INFORMATION

NAME:
TYPE:
ADDRESS: ,
EMAIL:
PHONE:

SITE INFORMATION

OWNER INFORMATION

NAME:
TYPE:
ADDRESS: ,
EMAIL:
PHONE:

SITE INFORMATION

OWNER INFORMATION

NAME:
TYPE:
ADDRESS: ,
EMAIL:
PHONE:

CONTACT INFORMATION

NAME:
ADDRESS: ,
EMAIL:
PHONE:

CONTACT INFORMATION

NAME:
ADDRESS: ,
EMAIL:
PHONE:

CONTACT INFORMATION

NAME:
ADDRESS: ,
EMAIL:
PHONE:

ACTIVITY NUMBER: 15T07

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SWL

SEARCH ID: 229	DIST/DIR: 0.08 SW	MAP ID: 63
-----------------------	--------------------------	-------------------

NAME: SQUAW ISLAND SLF ADDRESS: NIAGARA STREET BUFFALO NY 14202 ERIE CONTACT:	REV: 05/03/06 ID1: 9-15T07 ID2: 15T07 STATUS: INACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------

ACTIVITY DESC:	TRANSFER STATION - REGULATED
REG STATUS:	NONE
WASTE TYPE:	
AUTH NUMBER:	NONE
AUTH ISSUE DATE:	
EXPIRATION DATE:	

ACTIVITY NUMBER:	15T07
ACTIVITY DESC:	LANDFILL - MIXED SOLID WASTE
REG STATUS:	NONE
WASTE TYPE:	
AUTH NUMBER:	NONE
AUTH ISSUE DATE:	
EXPIRATION DATE:	

ACTIVITY NUMBER:	15T07
ACTIVITY DESC:	COMPOSTING - YARD WASTE
REG STATUS:	NONE
WASTE TYPE:	
AUTH NUMBER:	NONE
AUTH ISSUE DATE:	
EXPIRATION DATE:	

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SWL

SEARCH ID: 230	DIST/DIR: 0.08 SW	MAP ID: 62
-----------------------	--------------------------	-------------------

NAME: SQUAW ISLAND SLF ADDRESS: NIAGARA STREET BUFFALO NY 14202 ERIE CONTACT:	REV: 05/03/06 ID1: 9-15Y17 ID2: 15T07 STATUS: INACTIVE PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------

SITE INFORMATION

OWNER INFORMATION

NAME:
TYPE:
ADDRESS: ,
EMAIL:
PHONE:

CONTACT INFORMATION

NAME:
ADDRESS: ,
EMAIL:
PHONE:

ACTIVITY DESC:	COMPOSTING - YARD WASTE
REG STATUS:	NONE
WASTE TYPE:	
AUTH NUMBER:	NONE
AUTH ISSUE DATE:	
EXPIRATION DATE:	

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 10	DIST/DIR: 0.09 NW	MAP ID: 66
----------------------	--------------------------	-------------------

NAME: NYSDOT BIN 103989B - D123456	REV: 6/6/06
ADDRESS: SCAJAQUADA CRK EXPWY I-190	ID1: NYR000127720
BUFFALO NY 14207	ID2:
ERIE	STATUS: LGN
CONTACT: TOM MOORE	PHONE: 7166356291

SITE INFORMATION

CONTACT INFORMATION: TOM MOORE
CAYUGA ST SUITE 800
CHEEKTOWAGA NY 14225

PHONE: 7166356291

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Lead

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 176 **DIST/DIR:** 0.09 NW **MAP ID:** 67

NAME: SCHOOL HOUSE COMMONS ADDRESS: 1005 GRANT ST. BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0275096 ID2: 80574 STATUS: CLOSED PHONE:
--------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 5/22/2002	DATE REPORTED: 5/22/2002
CLOSED DATE: 5/22/2002	INSP DATE: 5/22/2002

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: RAINE SCHREINER
TELEPHONE: (716) 447-1334

SPILLER: SAME

ADDRESS:
ZZ -

TELEPHONE:

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 5/23/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0275096 CALLER SAID THAT SHE SMELLED GASOLINE ODORS IN THE BASEMENT OF A DAY CARE CENTER. END CALLERREMARK - 0275096

DEC REMARKS:
Start DECRemark - 0275096 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 05/22/02 JFO ON SITE MET WITH MS RAINE SCHREINER. THERE WERE ODORS IN THE BASEMENT ON APRIL 10, 2002. THE BUFFALO FIRE DEPT AND THE COUNTY HASMAT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 176	DIST/DIR: 0.09 NW	MAP ID: 67
-----------------------	--------------------------	-------------------

NAME: SCHOOL HOUSE COMMONS
ADDRESS: 1005 GRANT ST.
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 0275096
ID2: 80574
STATUS: CLOSED
PHONE:

TEAM WERE CALLED AND EVACUATED THE BLDG. THEY DETERMINED THAT THE CAUSE WAS SEWER GAS. IT WAS VENTED AND THE PEOPLE WERE ALLOWED BACK IN THE BLDG. NO ACTION NECESSARY. CLOSED THERE IS NO PAPER FILE FOR THIS SPILL
END DECRemark - 0275096

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 68	DIST/DIR: 0.09 SE	MAP ID: 64
----------------------	--------------------------	-------------------

NAME: NATL FUEL GAS - SCAJAQUADA CR ADDRESS: 100 A FOREST AVE BUFFALO NY 14213 Erie CONTACT:	REV: ID1: NY0002421352 ID2: STATUS: PHONE:
-------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 86 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: WESTWOOD SQUIBB PHARMACEUTICALS INC ADDRESS: 100 FOREST AVENUE BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110000327058 ID2: 14213WSTWD100FO STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: LAST REPORTED: 2/26/2002 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD048391080 AGENCY INTERESTED: 12/31/1989 INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:09 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 36425 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 12/12/2005 1:58:54 PM STATE MASTER -
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 9-1402-00657 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 3:23:38 PM STATE MASTER -
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110000327058 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 6/17/2005 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD048391080 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 86 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: WESTWOOD SQUIBB PHARMACEUTICALS INC
ADDRESS: 100 FOREST AVENUE
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110000327058
ID2: 14213WSTWD100FO
STATUS: FRS
PHONE:

WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: RCRAINFO
PROVIDED BY: FEDERAL AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED: 7/13/2005
ENFORCEMENT ACT:

PROGRAM ID: NYR000135780
AGENCY INTERESTED:
INTEREST ENDED:
SOURCE OF DATA: RCRAINFO
LAST EXTRACTED: 1/9/2006 5:41:01 PM

REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: FIS
PROVIDED BY: STATE AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED:
ENFORCEMENT ACT:
REG PROGRAM: STATE MASTER -

PROGRAM ID: 9-1402-00533
AGENCY INTERESTED:
INTEREST ENDED:
SOURCE OF DATA: FIS
LAST EXTRACTED: 11/19/2004 3:26:04 PM

PROGRAM: TRIS
PROVIDED BY: FEDERAL AGENCY
AGENCY INT QUAL: FIRST REPORTING YEAR
INT END QUAL: YEAR REPORTING STOPPED
LAST REPORTED: 8/1/2006
ENFORCEMENT ACT:

PROGRAM ID: 14213WSTWD100FO
AGENCY INTERESTED: 12/31/1987
INTEREST ENDED: 1/1/2006
SOURCE OF DATA: TRI REPORTING FORM
LAST EXTRACTED:

REG PROGRAM: TRI REPORTER - A TOXIC RELEASE INVENTORY REPORTER IS A FACILITY WHICH: EMPLOYS THE EQUIVALENT OF 10 OR MORE FULL-TIME EMPLOYEES; AND IS INCLUDED IN STANDARD INDUSTRIAL CLASSIFICATION (SIC) CODES 10XX, 12XX, 20XX-39XX, 4911, 4931, 4939, 4953, 5169, 5171, OR 7389; AND MANUFACTURES (DEFINED TO INCLUDE IMPORTING), PROCESSES, OR OTHERWISE USES ANY EMERGENCY PLANNING AND COMMUNITY RIGHT-TO-KNOW ACT (EPCRA) SECTION 313 CHEMICAL IN QUANTITIES GREATER THAN THE ESTABLISHED THRESHOLD IN THE COURSE OF A CALENDAR YEAR (I.E., MANUFACTURES OR PROCESSES OVER 25,000 POUNDS OF THE APPROXIMATELY 600 DESIGNATED CHEMICALS OR 28 CHEMICAL CATEGORIES SPECIFIED IN THE REGULATIONS, OR USES MORE THAN 10,000 POUNDS OF ANY DESIGNATED CHEMICAL OR CATEGORY).

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 4/14/2007 3:56:35 PM
ENTERED PERSON/METHOD: REFRESH

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 86	DIST/DIR: 0.09 SE	MAP ID: 64
----------------------	--------------------------	-------------------

NAME: WESTWOOD SQUIBB PHARMACEUTICALS INC
ADDRESS: 100 FOREST AVENUE
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110000327058
ID2: 14213WSTWD100FO
STATUS: FRS
PHONE:

PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW: Y
REASON MAN REVIEW: , COUNTY MISMATCH-NJ-NJEMS
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 81 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: SCAJAQUADA CREEK ADDRESS: 100 FOREST AVENUE BUFFALO NY 14203 ERIE CONTACT:	REV: 11/1/06 ID1: 110019388777 ID2: STATUS: FRS PHONE:
-------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 9-1402-00813 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 10:39:25 PM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 11/19/2004 10:39:25 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110019388777 AGENCY INTERESTED: 11/19/2004 10:39:25 PM INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED:
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC: 100 FOREST AVENUE
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 11/19/2004 10:39:25 PM
DATA UPDATED: 8/23/2005 12:36:15 PM
ENTERED PERSON/METHOD: GHAZNAVI
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 84	DIST/DIR: 0.09 SE	MAP ID: 64
----------------------	--------------------------	-------------------

NAME: WESTWOOD PHARMACEUTICALS
ADDRESS: 100 FOREST AVE
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD986930758
ID2:
STATUS:
PHONE:

RCRIS :
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS : 14213WSTWD100FO
DandB : 048391080
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 67 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: NATIONAL FUEL GAS - SCAJAQUADA CREEK ADDRESS: 100-A FOREST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004456044 ID2: NYD986930758 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 1/1/2001 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD986930758 AGENCY INTERESTED: 12/31/1999 INTEREST ENDED: 1/1/2001 SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:24 PM HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/13/2005 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD986930758 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 8/18/2005 2:52:46 PM LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110004456044 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED: FACILITY -
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 9:34:53 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW: Y
REASON MAN REVIEW: , ADDRESS MISMATCH -RCRAINFO
SMALL BUS POLICY:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 67	DIST/DIR: 0.09 SE	MAP ID: 64
----------------------	--------------------------	-------------------

NAME: NATIONAL FUEL GAS - SCAJAQUADA CREEK ADDRESS: 100-A FOREST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110004456044 ID2: NYD986930758 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

ENFORCEMENT ACTION:

DATA PUB ACCESS:	YES
INTERNAL SYS ID:	

FEDERAL FACILITY:	NO
FEDERAL AGENCY:	
TRIBAL LAND:	NO
TRIBAL LAND NAME:	
CONGRESSIONAL DIST:	29
LEGISLATIVE DIST:	NY
HYDROLOGICAL UNTIS:	04120104
EPA REGION:	02
AIRSHED:	
CENSUS BLOCK:	

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 248 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: BRISTOL-MEYER-SQUIBB ADDRESS: 100 FOREST AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0550407 ID2: 347230 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 6/8/2005	DATE REPORTED: 6/8/2005
CLOSED DATE: 8/19/2005	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 0550407 CALLER STATES WHILE REMOVING A 25,000 GAL 6 FUEL OIL TANK, THEY ENCOUNTERED PETROLEUM CONTAMINATED SOIL AND ODORS...THEY WILL STAGE CONTAMINATED SOIL ON SITE AND REMEDIATE. END CALLERREMARK - 0550407

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: JACK HYME
TELEPHONE: (716) 432-3447

SPILLER: BRISTOL-MEYER-SCRIBB
JACK HYME
ADDRESS: 100 FOREST AVE.
BUFFALO, NY

TELEPHONE: (716) 432-3447

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 8/19/2005
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

DEC REMARKS:
Start DECRemark - 0550407 6/8/05 FG SITE INSPECTION. ESG ON SITE EXCAVATING CONTAMINATED SOIL AND STAGING ON PLASTIC ON SITE. 25K 6FUEL OIL UST UNCOVERED. MET DONALD MILLER WITH BRISTOL-MYERS SQUIBB. HE WILL PROVIDE A CLOSURE REPORT ONCE ALL WORK IS COMPLETE. 8/19/05 RECD CLOSURE REPORT. ALL EXCAVATION ANALYTICAL RESULTS ARE ND. ALL DISPOSAL RECEIPTS HAVE BEEN RECEIVED. THE SITE IS CLOSED. END DECRemark - 0550407

THERE MAYBE MORE DEC REMARKS AVAILABLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 8 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: NATIONAL FUEL GAS - SCAJAQUADA CREEK	REV: 6/6/06
ADDRESS: 100-A FOREST AVE	ID1: NYD986930758
BUFFALO NY 14213	ID2:
ERIE	STATUS: SGN
CONTACT: JAMES A CLARK	PHONE: 7169272357

SITE INFORMATION

CONTACT INFORMATION: CHRIS CEJ
10 LAFAYETTE SQ
BUFFALO NY 14203

PHONE: 7168577358

CONTACT INFORMATION: JAMES CLARK
MAIN ST
WILLIAMSVILLE NY 14213

PHONE: 7169272357

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

5133 - TELECOMMUNICATIONS
2212 - NATURAL GAS DISTRIBUTION

ENFORCEMENT INFORMATION:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 8	DIST/DIR: 0.09 SE	MAP ID: 64
---------------------	--------------------------	-------------------

NAME: NATIONAL FUEL GAS - SCAJAQUADA CREEK ADDRESS: 100-A FOREST AVE BUFFALO NY 14213 ERIE CONTACT: JAMES A CLARK	REV: 6/6/06 ID1: NYD986930758 ID2: STATUS: SGN PHONE: 7169272357
----------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

D000
Benzene
Lead
B007
Ignitable waste
Arsenic

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 6 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: CONTRACT PHARMACEUTICALS LTD NIAGARA	REV: 6/6/06
ADDRESS: 100 FOREST AVE	ID1: NYR000135780
BUFFALO NY 14213	ID2:
ERIE	STATUS: LGN
CONTACT: KENNETH A BABCOCK	PHONE: 7168873706

SITE INFORMATION

CONTACT INFORMATION: KENNETH BABCOCK
FOREST AVE
BUFFALO NY 142131091

PHONE: 7168873706

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Ignitable waste
Mercury
Reactive waste
Benzene

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 6	DIST/DIR: 0.09 SE	MAP ID: 64
---------------------	--------------------------	-------------------

NAME: CONTRACT PHARMACEUTICALS LTD NIAGARA
ADDRESS: 100 FOREST AVE
BUFFALO NY 14213
ERIE
CONTACT: KENNETH A BABCOCK

REV: 6/6/06
ID1: NYR000135780
ID2:
STATUS: LGN
PHONE: 7168873706

Trichloroethylene
Methyl ethyl ketone
Corrosive waste

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b

The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to

The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane

Tetrachloroethylene

Pyridine

Chloroform

Carbon tetrachloride

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 33	DIST/DIR: 0.09 SE	MAP ID: 64
----------------------	--------------------------	-------------------

NAME: NATIONAL FUEL GAS - SCAJAQUADA CR ADDRESS: 100-A FOREST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 7/12/04 ID1: NYD986930758 ID2: STATUS: NLR PHONE:
-----------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: CHRIS CEJ
AST ENGINEER
10 LAFAYETTE SQ
BUFFALO NY 14203

PHONE: 7168577358

UNIVERSE TYPE:

SIC INFORMATION:

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 150 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: BRISTOL-MEYER-SQUIBB ADDRESS: 100 FOREST AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0550407 ID2: 347230 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 6/8/2005 CLOSED DATE: 8/19/2005	DATE REPORTED: 6/8/2005 INSP DATE: 12:00:00 AM
--------------------------------------------------------------	-----------------------------------------------------------------

MATERIAL SPILLED: 6 FUEL OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
-------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: TANK TESTER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT: JACK HYME
TELEPHONE: (716) 432-3447

SPILLER: BRISTOL-MEYER-SCRIBB
JACK HYME
ADDRESS: 100 FOREST AVE.
BUFFALO, NY

TELEPHONE: (716) 432-3447

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 8/19/2005
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0550407 CALLER STATES WHILE REMOVING A 25,000 GAL 6 FUEL OIL TANK, THEY ENCOUNTERED PETROLEUM CONTAMINATED SOIL AND ODORS...THEY WILL STAGE CONTAMINATED SOIL ON SITE AND REMEDIATE. END CALLERREMARK - 0550407

DEC REMARKS:
Start DECRemark - 0550407 6/8/05 FG SITE INSPECTION. ESG ON SITE EXCAVATING CONTAMINATED SOIL AND STAGING ON PLASTIC

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 150	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: BRISTOL-MEYER-SQUIBB ADDRESS: 100 FOREST AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0550407 ID2: 347230 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

ON SITE. 25K 6FUEL OIL UST UNCOVERED. MET DONALD MILLER WITH BRISTOL-MYERS SQUIBB. HE WILL PROVIDE A CLOSURE REPORT ONCE ALL WORK IS COMPLETE. 8/19/05 RECD CLOSURE REPORT. ALL EXCAVATION ANALYTICAL RESULTS ARE ND. ALL DISPOSAL RECEIPTS HAVE BEEN RECEIVED. THE SITE IS CLOSED. END DECRemark - 0550407

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 167 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: TRUCK AT WESTWOOD SQUIBB ADDRESS: 100 FOREST AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9800516 ID2: 187088 STATUS: CLOSED PHONE:
---------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 4/11/1998 CLOSED DATE: 6/23/1998	DATE REPORTED: 4/13/1998 INSP DATE: 12:00:00 AM
---------------------------------------------------------------	------------------------------------------------------------------

MATERIAL SPILLED: HERBICIDES MATERIAL CLASS: OTHER	AMOUNT SPILLED: 18 G AMOUNT RECOVERED: 18 G
---------------------------------------------------------------------	--------------------------------------------------------------

MATERIAL SPILLED: FERTILIZERS MATERIAL CLASS: OTHER	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
----------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: HUMAN ERROR
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL VEHICLE
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: PRINGLE
SPILL CONTACT:
TELEPHONE:

SPILLER: TRU GREEN CHEM LAWN
KEN TERHAR
ADDRESS: 100 MID COUNTY DRIVE
ORCHARD PARK, NY 14127-

TELEPHONE: (716) 662-1200

REPORTED BY: RESPONSIBLE PARTY

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 167 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: TRUCK AT WESTWOOD SQUIBB	REV: 2/5/08
ADDRESS: 100 FOREST AVENUE	ID1: 9800516
BUFFALO NY	ID2: 187088
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

LAST DEC UPDATE: 7/9/1998
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9800516 EMPLOYEE TURNED WRONG VALVE ON TRUCK SPILLING FERTILIZER - HERBICIDE MIX ONTO PARKING LOT. SPILL CLEANED UP W/SORBENT PILLONS AND DISPOSED RESPONSIBLE PARTY DUMPSTER END CALLERREMARK - 9800516

DEC REMARKS:
Start DECRemark - 9800516 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 6/23/98 FG SPOKE TO KEN TERHAR WITH TRU GREEN. HE SAID THAT THE SPILL WAS NITROGEN PHOSPHATE MIX AND PRE M. IT WAS PICKED UP WITH SORBENT PADS AND THEN RECYCLED AT THEIR OFFICE IN ORCHARD PARK. THE PADS ARE TRIPLE RINSED AND THE SOLUTION IS REUSED AND THE PADS ARE THEN PUT IN THE REGULAR GARBAGE. MR. TERHAR CLEANED UP THE SPILL WHEN IT HAPPENED AND INFORMED THE SECURITY GUARD AT WESTWOOD SQUIBB. IT HAPPENED ON A SATURDAY. NO FURTHER WORK REQUIRED. SITE CAN BE CLOSED. 6/23/98 COPY OF SPILL REPORT GIVEN TO DEC PESTICIDES FOR THEIR INFORMATION. END DECRemark - 9800516

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 137	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: WESTWOOD-SQUIBB ADDRESS: 100 FOREST AVE. BUFFALO NY 14213 ERIE CONTACT: JUDI SPEAR	REV: ID1: NYD986930758 ID2: 14213WSTWD100FO STATUS: OPEN PHONE: 7168873400
---------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------

DETAILS NOT AVAILABLE

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 131	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: CONTRACT PHARMACEUTICALS LTD NIAGARA ADDRESS: 100 FOREST AVE BUFFALO NY 14213 ERIE CONTACT: JOHN ROSS	REV: 11/1/07 ID1: 14213WSTWD100FO ID2: STATUS: OPEN PHONE: 7168873400
----------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

SIC INFORMATION

NA -
2834

REPORTED INFORMATION

REPORTING YEAR:	CONTACT PERSON:	CONTACT PHONE:
1987	JUDI SPEAR	7168873400
1988	JUDI SPEAR	7168873400
1989	JUDI SPEAR	7168873400
1990	JUDI SPEAR	7168873400
1991	JUDI SPEAR	7168873400
1992	JUDI SPEAR	7168873400
1993	JUDI SPEAR	7168873400
1994	JUDI SPEAR	7168873400
1995	JUDI SPEAR	7168873400
1995		
1996		
1996	CAROL BLACKLEY	7168873400
1997	CAROL BLACKLEY	7168873400
1997		
1998	DONALD MILLER	7168873400
1998		
1999		
2000		
2000	DONALD MILLER	7168873400
2001	DONALD MILLER	7168873400
2001		

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 131	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: CONTRACT PHARMACEUTICALS LTD NIAGARA ADDRESS: 100 FOREST AVE BUFFALO NY 14213 ERIE CONTACT: JOHN ROSS	REV: 11/1/07 ID1: 14213WSTWD100FO ID2: STATUS: OPEN PHONE: 7168873400
----------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

2002	DONALD MILLER	7168873400
2002		
2003		
2003	DONALD MILLER	7168873400
2004		
2004	DONALD MILLER	7168873400
2005		
2005	JOHN ROSS	7168873400

CHEMICAL

ONE TIME RELEASE QTY(LBS)

HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	
SODIUM HYDROXIDE (SOLUTION)	
CERTAIN GLYCOL ETHERS	
HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	
SODIUM HYDROXIDE (SOLUTION)	
CERTAIN GLYCOL ETHERS	
HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	
HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	
CERTAIN GLYCOL ETHERS	
BENZOYL PEROXIDE	
CERTAIN GLYCOL ETHERS	0
HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	0
BENZOYL PEROXIDE	0
CERTAIN GLYCOL ETHERS	
AMMONIA	0
HYDROCHLORIC ACID (1995 AND AFTER ACID AEROSOLS ONLY)	0
BENZOYL PEROXIDE	0
BENZOYL PEROXIDE	0

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 131	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: CONTRACT PHARMACEUTICALS LTD NIAGARA	REV: 11/1/07
ADDRESS: 100 FOREST AVE	ID1: 14213WSTWD100FO
BUFFALO NY 14213	ID2:
ERIE	STATUS: OPEN
CONTACT: JOHN ROSS	PHONE: 7168873400

CERTAIN GLYCOL ETHERS	0
AMMONIA	0
AMMONIA	0
CERTAIN GLYCOL ETHERS	0
CERTAIN GLYCOL ETHERS	0
CHROMIUM	
MANGANESE	
NICKEL	
CHROMIUM	
MANGANESE	
CERTAIN GLYCOL ETHERS	0
NICKEL	
CERTAIN GLYCOL ETHERS	0
CHROMIUM	
MANGANESE	
NICKEL	
MANGANESE	
NICKEL	
CERTAIN GLYCOL ETHERS	0
CHROMIUM	
CHROMIUM	
MANGANESE	
NICKEL	
BENZO(G,H,I)PERYLENE	0
CERTAIN GLYCOL ETHERS	0
CHROMIUM	
MANGANESE	

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 239 **DIST/DIR:** 0.09 SE **MAP ID:** 65

NAME: BUFFALO STRUCTURAL STEEL	REV: 2/5/08
ADDRESS: 166 DART ST.	ID1: PBS9-446939
BUFFALO NY 14213	ID2:
ERIE	STATUS: ACTIVE
CONTACT:	PHONE: (716) 886-2204

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: MANUFACTURING (OTHER THAN CHEMICAL)/PROCESSING
TYPE NAME:
TOTAL NUMBER OF TANKS: 4
NUMBER OF ACTIVE TANKS: 3
NUMBER OF INACTIVE TANKS: 1
TOTAL FACILITY CAPACITY: 5400 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: BUFFALO STRUCTURAL STEEL
TITLE:
NAME:
ADDRESS: 166 DART ST.
NY 14213
PHONE: (716) 886-2204
EMERGENCY CONTACT: GARY ELDRIDGE
PHONE: (716) 892-6172

MAILING INFORMATION

COMPANY: BUFFALO STRUCTURAL STEEL
TITLE:
CONTACT:
ADDRESS: 166 DART ST.
BUFFALO NY 14213
PHONE: (716) 886-2204
EMAIL:

EXP. DATE: 7/28/1998
RENEWAL DATE: 4/1/1993

COMMENTS: This site is abandoned and all locked up. Tanks as of 04/17/95 remain on site rusting away on their rack. JES (04/17/95) Site is now owned by City of Buffalo who is planning to renovate the site to a motor vehicle impoundment area. jes (04/26/99)

TANK INFORMATION

<u>TANK NUMBER:</u>	1	TANK STATUS:	IN SERVICE
ACTIVE STATUS:	ACTIVE	INSTALLED:	12:00:00 AM
CLOSED:	12:00:00 AM	TANK CAPACITY:	1800 GALLONS
PRODUCT:	2 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND - IN CONTACT WITH SOIL
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 239 **DIST/DIR:** 0.09 SE **MAP ID:** 65

NAME: BUFFALO STRUCTURAL STEEL ADDRESS: 166 DART ST. BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-446939 ID2: STATUS: ACTIVE PHONE: (716) 886-2204
----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER:
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 2	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 12:00:00 AM	
CLOSED: 12:00:00 AM	TANK CAPACITY: 1800 GALLONS	
PRODUCT: 2 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND - IN CONTACT WITH SOIL
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER:
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 3	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 12:00:00 AM	
CLOSED: 12:00:00 AM	TANK CAPACITY: 1800 GALLONS	
PRODUCT: 2 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 239 **DIST/DIR:** 0.09 SE **MAP ID:** 65

NAME: BUFFALO STRUCTURAL STEEL ADDRESS: 166 DART ST. BUFFALO NY 14213 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-446939 ID2: STATUS: ACTIVE PHONE: (716) 886-2204
----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

TANK LOCATION: ABOVEGROUND - IN CONTACT WITH SOIL
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:

DISPENSER:
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 4	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12:00:00 AM
CLOSED: 2/1/1992	TANK CAPACITY: 4000 GALLONS
PRODUCT: DIESEL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: GALVANIZED STEEL
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:

DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 238 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: WESTWOOD-SQUIBB PHARMACEUTICALS ADDRESS: 100 FOREST AVENUE BUFFALO NY 14213 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000336 ID2: STATUS: UNREGULATED PHONE:
----------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

CHEMICAL BULK STORAGE FACILITY INFORMATION

TYPE OF SITE:	MANUFACTURING		
TOTAL ACTIVE TANKS ON SITE:	0		
TOTAL FACILITY CAPACITY:	0 GALLONS		
PBS NUMBER:	9-027766	ICS NUMBER:	MOSF NUMBER:
ADDITIONAL ADDRESS INFO:			

TYPE OF OWNER:	CORPORATE/COMMERCIAL
OWNER SUB TYPE:	
OWNER ADDRESS:	100 FOREST AVENUE BUFFALO NY 14213
PHONE:	(716) 887-3400

EMERGENCY CONTACT:	WESTWOOD-SQUIBB SECURITY
PHONE:	(716) 887-3437

MAILING NAME:	WESTWOOD-SQUIBB PHARMACEUTICALS
ADDRESS:	100 FOREST AVENUE BUFFALO NY 14213
ATTENTION:	BEVERLY PAULY
PHONE:	(716) 887-3400

CERTIFICATE DATE:	12/31/92	EXP. DATE:	12/31/94
RENEWAL DATE:	9/1/94		

TANK INFORMATION

TANK NUMBER:	HLC-1	STATUS:	TANK CONVERTED TO NON-REGULATED USE
INSTALLED:	12/92	CLOSED:	09/94
TANK CAPACITY:	2000 GALLONS		
SUBSTANCE STORED:	HYDROCHLORIC ACID		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	6		

TANK TYPE:	FIBERGLASS REINFORCED PLASTIC (FRP)
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	DIKING

PIPE TYPE:	OTHER
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	DIKING

LEAK DETECTION:	NONE
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 232 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: CONTRACT PHARMACEUTICALS LIMITED NIAGARA	REV: 2/5/08
ADDRESS: 100 FOREST AVENUE	ID1: PBS9-027766
BUFFALO NY 14213	ID2:
ERIE	STATUS: ACTIVE
CONTACT: PAUL PICKLES	PHONE: (716) 887-3400

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: MANUFACTURING (OTHER THAN CHEMICAL)/PROCESSING
TYPE NAME:
TOTAL NUMBER OF TANKS: 3
NUMBER OF ACTIVE TANKS: 1
NUMBER OF INACTIVE TANKS: 2
TOTAL FACILITY CAPACITY: 20000 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: CONTRACT PHARMACEUTICALS LIMITED NIAGARA
TITLE: CEO
NAME: PAUL PICKLES
ADDRESS: 100 FOREST AVENUE
NY 14213
PHONE: (716) 887-3400
EMERGENCY CONTACT: CONTRACT PHARMACEUTICALS LIMITED NIAGARA
PHONE: (716) 887-3437

MAILING INFORMATION

COMPANY: CONTRACT PHARMACEUTICALS LIMITED NIAGARA
TITLE:
CONTACT: DON MILLER, EHS MANAGER
ADDRESS: 100 FOREST AVENUE
BUFFALO NY 14213
PHONE: (716) 887-3400
EMAIL:

EXP. DATE: 8/12/2010
RENEWAL DATE: 12:00:00 AM

COMMENTS:

TANK INFORMATION

TANK NUMBER: F	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91
ACTIVE STATUS: INACTIVE	INSTALLED: 4/1/1964
CLOSED: 12:00:00 AM	TANK CAPACITY: 15000 GALLONS
PRODUCT: 6 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 232 **DIST/DIR:** 0.09 SE **MAP ID:** 64

NAME: CONTRACT PHARMACEUTICALS LIMITED NIAGARA	REV: 2/5/08
ADDRESS: 100 FOREST AVENUE	ID1: PBS9-027766
BUFFALO NY 14213	ID2:
ERIE	STATUS: ACTIVE
CONTACT: PAUL PICKLES	PHONE: (716) 887-3400

PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> G	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 6/1/2005
CLOSED: 12:00:00 AM	TANK CAPACITY: 25000 GALLONS
PRODUCT: 6 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND - 10% OR MORE BELOW GROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: ABOVEGROUND
EXTERNAL PROTECTION: JACKETED
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: NONE
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> I	TANK STATUS: IN SERVICE
ACTIVE STATUS: ACTIVE	INSTALLED: 9/12/2005
CLOSED: 12:00:00 AM	TANK CAPACITY: 20000 GALLONS
PRODUCT: 6 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND ON CRIB, RACK, OR CRADLE

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 232	DIST/DIR: 0.09 SE	MAP ID: 64
-----------------------	--------------------------	-------------------

NAME: CONTRACT PHARMACEUTICALS LIMITED NIAGARA ADDRESS: 100 FOREST AVENUE BUFFALO NY 14213 ERIE CONTACT: PAUL PICKLES	REV: 2/5/08 ID1: PBS9-027766 ID2: STATUS: ACTIVE PHONE: (716) 887-3400
--------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	

PIPE TYPE:
PIPE LOCATION:
EXTERNAL PROTECTION:
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	NONE
LEAK DETECTION 2:	

OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:	
DISPENSER:	
SPILL PREVENTION:	
DATE TESTED:	12:00:00 AM
NEXT TEST:	12:00:00 AM
TEST METHOD:	TESTING NOT REQUIRED

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

AIRS

SEARCH ID: 274	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS COMPANY INC ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 1/12/08 ID1: NY0090691 ID2: 9140200615 STATUS: AIRS DATABASE PHONE:
--------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------

OPERATING STATUS:	O
YEAR MEASURED:	90
PRINCIPAL PRODUCT:	
LAST UPDATED:	10/31/2002
AMBIENT MONITORING:	
SOURCE MONITORING EQUIP:	
STATE IMPLIMENTED PROG:	OZONE
PLANT DESC:	AUTOMOTIVE

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

DOCKET

SEARCH ID: 279 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTOMOTIVE COMPONENTS CO ADDRESS: 57 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 1/30/07 ID1: 02-1989-0103 ID2: 02-1989-0103 STATUS: ICIS PHONE:
---------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

ICIS = INTEGRATED COMPLIANCE INFORMATION SYSTEM

ENFORCEMENT NUMBER:	02-1989-0103
ACTION TYPE:	ADMINISTRATIVE - FORMAL
ACTIVITY STATUS:	CLOSED
COURT DOCKET NUM:	89-0204
HQ DIVISION:	TOX
ENFORCEMENT OUTCOME:	FINAL ORDER WITH PENALTY
BRANCH:	AWTS
VOL SELF DISCLOSURE:	
ENFORCEMENT TYPE:	EPCRA 325 AO FOR COMPLIANCE AND/OR PENALTY
VIOLATION TYPE:	TOXIC RELEASE INVENTORY (SECTION 313)
REFIEF REQUESTED:	
DEFENDANT NAME:	FEDCO AUTOMOTIVE COMPONENTS CO
NAMED IN COMPLAINT:	YES
NAMED IN SETTLEMENT:	YES
CONCLUSION ID:	2669
CONCLUSION NAME:	FEDCO AUTOMOTIVE COMPONENTS CO
SETTLE LODGE DATE:	03/30/1989
SETTLE ENTERED DATE:	06/03/1991
PENALTY SOUGHT AMT:	\$21,000
FED PENALTY ACCESSED AMT:	\$21,000
LOCAL PENALTY AMT:	
TOTAL SEP AMT(DERIVED):	
COMP ACTION AMT:	
COST REC AWARDED AMT:	

CASE SUMMARY:

40 CFR SECTION 372.30

FACILITY NAME: FEDDERS AUTOMOTIVE COMPONENTS 57 TONAWANDA STREET BUFFALO, N.Y. 14207 PRIVATE SIC CODE: 3741 EPID NYD002115087	OWNERSHIP:
-------------------------------------------------------------------------------------------------------------------------------------------------	------------

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

ERNS

SEARCH ID: 47 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE	REV: 11/2/90 0: ID1: 184750 ID2: STATUS: HIGHWAY RELATED PHONE:
CONTACT:	

SPILL INFORMATION

DATE OF SPILL: 11/2/90 **TIME OF SPILL:** 0810

PRODUCT RELEASED (1): OIL: DIESEL
QUANTITY (1): 0
UNITS (1): UNK

PRODUCT RELEASED (2):
QUANTITY (2):
UNITS (2):

PRODUCT RELEASED (3):
QUANTITY (3):
UNITS (3):

MEDIUM/MEDIA AFFECTED

AIR: NO	GROUNDWATER: NO
LAND: YES	FIXED FACILITY: NO
WATER: NO	OTHER: NO
WATERBODY AFFECTED BY RELEASE:	DIRT

CAUSE OF RELEASE

DUMPING: NO	EQUIPMENT FAILURE: NO	
NATURAL PHENOMENON: NO	OPERATOR ERROR: NO	
OTHER CAUSE: NO	TRANSP. ACCIDENT: NO	
UNKNOWN: NO		

ACTIONS TAKEN: FD ON SCENE

RELEASE DETECTION: TWO TRUCKS INVOLVED IN ACCIDENT, FUEL TANK LEAK / SPILLED DIESEL FUEL

MISC. NOTES:

DISCHARGER INFORMATION

DISCHARGER ID: 184750	DUN and BRADSTREET :
TYPE OF DISCHARGER:	
NAME OF DISCHARGER:	
ADDRESS:	

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 58	DIST/DIR: 0.10 NW	MAP ID: 69
----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS
ADDRESS: 57 TONAWANDA ST
BUFFALO NY 14207
Erie
CONTACT:

REV:
ID1: NY0000968867
ID2:
STATUS:
PHONE:

RCRIS :
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB : I02 198810201980 2
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 60	DIST/DIR: 0.10 NW	MAP ID: 69
----------------------	--------------------------	-------------------

NAME: FEDDERS AUTOMOTIVE COMPONENTS
ADDRESS: 57 TONAWANDA ST
BUFFALO NY 14207
Erie
CONTACT:

REV:
ID1: NYD002115087
ID2:
STATUS:
PHONE:

RCRIS : NYD002115087
PCS :
AFS/AIRS : 3602900016, 360290551
SSTS :
CERCLIS : NYD002115087
NCDB : I02 198810201980 2, D02 EPCRA-89-0204
ENF DOCKET : 02-89-0103
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS : 14207FDCTM57TON
DandB : 627360282
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 59 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTOMOTIVE CO ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000326898 ID2: 14207FDCTM57TON STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 285368 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 4/24/2007 6:50:16 AM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: LAST REPORTED: 1/25/2002 ENFORCEMENT ACT: REG PROGRAM: HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER	PROGRAM ID: NYD002115087 AGENCY INTERESTED: 12/31/1989 INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 11/8/2004 1:45:57 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110000326898 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: AIRS/AFS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/27/2001 ENFORCEMENT ACT: REG PROGRAM: AIR MINOR - A FACILITY IS CLASSIFIED AS A CLEAN AIR ACT STATIONARY SOURCE MINOR DISCHARGER OF AIR POLLUTANTS IF: (A) POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR; OR (B) MAJOR SOURCE THRESHOLDS ARE NOT DEFINED, OR CLASSIFICATION IS UNKNOWN.	PROGRAM ID: 3602900016 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: AIRS/AFS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: TRIS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: LAST REPORTED: 6/25/2001 ENFORCEMENT ACT: REG PROGRAM: TRI REPORTER - A TOXIC RELEASE INVENTORY REPORTER IS A FACILITY WHICH: EMPLOYS THE EQUIVALENT OF 10 OR MORE FULL-TIME EMPLOYEES; AND IS INCLUDED IN STANDARD INDUSTRIAL CLASSIFICATION (SIC) CODES 10XX, 12XX, 20XX-39XX, 4911, 4931, 4939, 4953, 5169, 5171, OR 7389; AND MANUFACTURES (DEFINED TO INCLUDE IMPORTING), PROCESSES, OR OTHERWISE USES ANY EMERGENCY PLANNING AND COMMUNITY RIGHT-TO-KNOW ACT (EPCRA) SECTION 313 CHEMICAL IN QUANTITIES GREATER THAN THE ESTABLISHED THRESHOLD IN THE COURSE OF A CALENDAR YEAR (I.E.,	PROGRAM ID: 14207FDCTM57TON AGENCY INTERESTED: 12/31/1987 INTEREST ENDED: SOURCE OF DATA: TRI REPORTING FORM LAST EXTRACTED: 9/23/2002 6:00:44 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 59 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTOMOTIVE CO ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000326898 ID2: 14207FDCTM57TON STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

MANUFACTURES OR PROCESSES OVER 25,000 POUNDS OF THE APPROXIMATELY 600 DESIGNATED CHEMICALS OR 28 CHEMICAL CATEGORIES SPECIFIED IN THE REGULATIONS, OR USES MORE THAN 10,000 POUNDS OF ANY DESIGNATED CHEMICAL OR CATEGORY).

PROGRAM: NCDB PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.	PROGRAM ID: D02 EPCRA-89-0204 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED:
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: ICIS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: COMPLAINT/PROPOSED ORDER INT END QUAL: LAST REPORTED: 3/28/1995 8:01:00 AM ENFORCEMENT ACT: REG PROGRAM: FORMAL ENFORCEMENT ACTION - A CIVIL JUDICIAL OR ADMINISTRATIVE ENFORCEMENT CASE UNDER AN ENVIRONMENTAL STATUTE.	PROGRAM ID: 24072 AGENCY INTERESTED: 3/30/1989 INTEREST ENDED: SOURCE OF DATA: ICIS LAST EXTRACTED: 2/6/2003 11:39:09 AM
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 9-1402-00615 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 4:23:45 PM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/27/2004 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NYD002115087 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 5/5/2005 1:11:43 PM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NEI PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: CRITERIA AND HAZARDOUS AIR POLLUTANT INVENTORY	PROGRAM ID: NEI35748 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NEI LAST EXTRACTED: 6/14/2005 11:13:01 AM
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 59 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTOMOTIVE CO ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000326898 ID2: 14207FDCTM57TON STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PROGRAM: NCDB PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: COMPLIANCE ACTIVITY - A COMPLIANCE MONITORING OR ENFORCEMENT ACTIVITY, FROM THE TIME AN INSPECTOR CONDUCTS AN INSPECTION UNTIL THE TIME THE INSPECTOR CLOSSES OR THE CASE SETTLES THE ENFORCEMENT ACTION.	PROGRAM ID: I02 198810201980 2 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCDB LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: INTEREST STATUS: DATA QUALITY: LOCATION DESC: ADDRESS TYPE: LAST REPORTED: POSTED TO DATABASE: DATA UPDATED: ENTERED PERSON/METHOD: PARENT REG ID: CONFIDENCE IN ADDR: ENFORCEMENT SENSITIVE: REQ MANUAL REVIEW: REASON MAN REVIEW: SMALL BUS POLICY: ENFORCEMENT ACTION: DATA PUB ACCESS: INTERNAL SYS ID: FEDERAL FACILITY: FEDERAL AGENCY: TRIBAL LAND: TRIBAL LAND NAME: CONGRESSIONAL DIST: LEGISLATIVE DIST: HYDROLOGICAL UNTIS: EPA REGION: AIRSHED: CENSUS BLOCK:	STATIONARY ACTIVE V REGULAR URBAN 3/1/2000 6/6/2007 4:04:00 AM REFRESH MEDIUM N Y , COUNTY MISMATCH-NJ-NJEMS YES NO NO 29 NY 04120104 02
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 270 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS ADDRESS: 57 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 12/14/07 ID1: NCDB-0801-007259 ID2: 198810201980 2 STATUS: EPCRA PHONE:
----------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

EPA REGION: 02	INSPECTION REG OR ST: 02
INSPECTOR ID: 1980	INSPECTION DATE: 10/20/88
INSPECTOR NAME: B. MEYER	NUMBER OF SAMPLES: 0
NUMBER OF AUDITS: 0	DUNN and BRAD NUMBER:
FEDERAL FACILITY: N	LEGISLATION CODE: E
NUMBER OF SCHOOLS: 0	SCHOOL TYPE:
EPA PESTICIDE ID:	EPA FIFRA REG ID:

FACILITY FUNCTION: MN - MANUFACTURER

INVESTIGATION TYPE: EEF - EPCRA, ENFORCEMENT, FEDERAL CONDUCTED

REASON: NSR - NEUTRAL SCHEME, REGION

REFERRAL TYPE :

PRINT INFO: FEDCO AUTOMOTIVE COMPONENTS
57 TONAWANDA ST
BUFFALO NY 14207-

SIC INFORMATION:

SIC 1: 3714

SIC 2:

SIC 3:

SIC 4:

SIC 5:

SIC 6:

SAMPLE INFORMATION

CASE REVIEW INFORMATION:

SAMPLE NUMBER: 0	ACTION WARRANTED: Y
DOCKET NUMBER: EPCRA-89-0204	CASE NUMBER:
START DATE: 10/20/88	COMPLETION DATE: 11/15/88

MAJOR ACTION:

DOCKET NUMBER: EPCRA-89-0204

CASE NUMBER:

ACTION TYPE: CC - CIVIL ADMIN COMPLAINT

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NCDB

SEARCH ID: 270 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS	REV: 12/14/07
ADDRESS: 57 TONAWANDA ST	ID1: NCDB-0801-007259
BUFFALO NY 14207	ID2: 198810201980 2
ERIE	STATUS: EPCRA
CONTACT:	PHONE:

VIOLATION CODE 1: EFR - EPCRA,NONREPORTING/FAILURE TO RPT TO EPA

VIOLATION CODE 2:

VIOLATION CODE 3:

VIOLATION CODE 4:

VIOLATION CODE 5:

REFERRAL CODE:

PROPOSED PENALTY: 50000	FINAL PENALTY: 21000	
EPA REG NUMBER:	CHEMICAL INVOLVED:	

RESPONSIBLE PARTY: FEDCO AUTOMOTIVE COMPONENTS CO
57 TONAWANDA ST.
BUFFALO NY 14207-

RESP PART DandB:	DATE SENT:
DATE CONCURRED:	DATE REFERRED:
ACTION ISSUED:	APPEAL FILED:
DATE CLOSED: 6/3/91	DATE VACATED:
OFFICER: B. MEYER	

MILESTONE INFORMATION:

DOCKET NUMBER: EPCRA-89-0204	MAJOR ACTION ISSUED: 3/31/89	
CAFO SIGNED BY EPA: 6/3/91	CAFO MAILED:	
CAFO RECEIVED:	CAFO SIGNED BY RES PAR: 4/15/91	
ACTION WITHDRAWN:	HEARING HELD:	
FINAL DECISION:	DOJ REFERRAL:	
DIST COURT ACTION:		

IMPORT INFORMATION

REFERRAL INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

NFRAP

SEARCH ID: 2	DIST/DIR: 0.10 NW	MAP ID: 69
---------------------	--------------------------	-------------------

NAME: FEDDERS AUTO CO ADDRESS: 57 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 1/23/08 ID1: NYD002115087 ID2: 0201399 STATUS: NFRAP-N PHONE:
----------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------

DESCRIPTION:
SITE MFG AUTOMOTIVE COMPONENTS. 7 1/2 ACRE. 1974 DEQAPD REQUIWASTE OIL SPRD 2 ACRE PRKG LOT TO CONTRL DUST. EST 165 GALLSPR YR WAS APPLIED.NO TRNFMR OIL USED. DISCNTD 1976. LOT COVRGRAVEL 1981. SI 4/30/86 REVEAL 66 DRM PAINT MATRL,WASTE OIL,

ACTION/QUALITY	AGENCY/RPS	START/RAA	END
ARCHIVE SITE	EPA In-House		06-30-1992
DISCOVERY	EPA Fund-Financed		04-01-1980
PRELIMINARY ASSESSMENT Low	State, Fund Financed		09-29-1986
SITE INSPECTION NFRAP (No Futher Remedial Action Planned	EPA Fund-Financed	09-19-1986	09-24-1986

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 7 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO ADDRESS: 57 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT: DANIEL M SCHRANTZ	REV: 2/14/05 ID1: NYD002115087 ID2: STATUS: SGN PHONE: 7168778000
-------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

SNC:	N - NO
BOYSNC:	N - NO
GPRA PERMIT:	N - NO
GPRA POSTCLOSURE:	N - NO
GPRA CA:	N - NO
GPRA CME:	N - NO
PERM PROG:	----
PREM WRKLD:	----
CLOSURE WRKLD:	----
P C WRKLD:	----
SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO
CA WRKLD:	N - NO
GEN STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000 KG/MONTH OF HAZARDOUS WASTE

UNIVERSE INFORMATION:

IMPORTER ACTIVITY:	U - UNKNOWN	MIX WASTE GEN:	U - UNKNOWN
RECYCLER ACT:	U - UNKNOWN	TRANS ACT:	U - UNKNOWN
TSD ACT:	N - NO	U GRND INJ ACT:	U - UNKNOWN
UNIV WASTE FAC:	U	TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN
IMPORTER ACTIVITY:	U - UNKNOWN	MIX WASTE GEN:	U - UNKNOWN
RECYCLER ACT:	N - NO	TRANS ACT:	N - NO
TSD ACT:	N - NO	U GRND INJ ACT:	N - NO
UNIV WASTE FAC:	U	TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN
IMPORTER ACTIVITY:	N - NO	MIX WASTE GEN:	N - NO
RECYCLER ACT:	U - UNKNOWN	TRANS ACT:	U - UNKNOWN
TSD ACT:	N - NO	U GRND INJ ACT:	U - UNKNOWN
UNIV WASTE FAC:	U	TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN
IMPORTER ACTIVITY:	N - NO	MIX WASTE GEN:	N - NO
RECYCLER ACT:	N - NO	TRANS ACT:	N - NO
TSD ACT:	N - NO	U GRND INJ ACT:	N - NO
UNIV WASTE FAC:	N	TRANSFER FAC:	N - NO
OS BURNER EXEMPT:	N - NO	FURNACE EXEMP:	N - NO
IMPORTER ACTIVITY:	U - UNKNOWN	MIX WASTE GEN:	U - UNKNOWN
RECYCLER ACT:	N - NO	TRANS ACT:	N - NO
TSD ACT:	N - NO	U GRND INJ ACT:	N - NO
UNIV WASTE FAC:	U	TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN

USED OIL INFORMATION

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 7 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO	REV: 2/14/05
ADDRESS: 57 TONAWANDA ST	ID1: NYD002115087
BUFFALO NY 14207	ID2:
ERIE	STATUS: SGN
CONTACT: DANIEL M SCHRANTZ	PHONE: 7168778000

BURNER: N - NO	PROCESSOR: N - NO
REFINER: N - NO	MARKET BURNER: N
SPEC MARKETER: N - NO	TRANSFER FAC: N - NO
TRANSPORTER: N - NO	
BURNER: U - UNKNOWN	PROCESSOR: U - UNKNOWN
REFINER: U - UNKNOWN	MARKET BURNER: U
SPEC MARKETER: U - UNKNOWN	TRANSFER FAC: U - UNKNOWN
TRANSPORTER: U - UNKNOWN	
BURNER: N - NO	PROCESSOR: N - NO
REFINER: N - NO	MARKET BURNER: N
SPEC MARKETER: N - NO	TRANSFER FAC: N - NO
TRANSPORTER: N - NO	
BURNER: U - UNKNOWN	PROCESSOR: U - UNKNOWN
REFINER: U - UNKNOWN	MARKET BURNER: U
SPEC MARKETER: U - UNKNOWN	TRANSFER FAC: U - UNKNOWN
TRANSPORTER: U - UNKNOWN	
BURNER: N - NO	PROCESSOR: N - NO
REFINER: N - NO	MARKET BURNER: N
SPEC MARKETER: N - NO	TRANSFER FAC: N - NO
TRANSPORTER: N - NO	
SECOND ID:	OFF SITE RECEIPT: U - UNKNOWN
ACCESSIBILITY:	COUNTY OWNER:
FED WSTE GEN OWNER: HQ	FED WASTE GEN: 2
STATE WSTE GEN OWNER:	STATE WSTE GEN:
SECOND ID:	OFF SITE RECEIPT: U - UNKNOWN
ACCESSIBILITY:	COUNTY OWNER:
FED WSTE GEN OWNER: HQ	FED WASTE GEN: 1
STATE WSTE GEN OWNER:	STATE WSTE GEN:
SECOND ID:	OFF SITE RECEIPT:
ACCESSIBILITY:	COUNTY OWNER:
FED WSTE GEN OWNER: HQ	FED WASTE GEN: 1
STATE WSTE GEN OWNER: NY	STATE WSTE GEN: 1
SECOND ID:	OFF SITE RECEIPT:
ACCESSIBILITY:	COUNTY OWNER:
FED WSTE GEN OWNER: HQ	FED WASTE GEN: 2
STATE WSTE GEN OWNER: 02	STATE WSTE GEN: 4

NAIC INFORMATION

SECOND ID:	OFF SITE RECEIPT: U - UNKNOWN
ACCESSIBILITY:	COUNTY OWNER:
FED WSTE GEN OWNER: HQ	FED WASTE GEN: 1

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 7 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO ADDRESS: 57 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT: DANIEL M SCHRANTZ	REV: 2/14/05 ID1: NYD002115087 ID2: STATUS: SGN PHONE: 7168778000
-------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------

STATE WSTE GEN OWNER:

STATE WSTE GEN:

333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION EQUIPMENT MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION EQUIPMENT MANUFACTURING
336312 - GASOLINE ENGINE AND ENGINE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION EQUIPMENT MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	5/6/1994
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	12/1/1986	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	7/6/1987
TYPE:	GER - GENERATOR ALL REQUIREMENTS		

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	5/6/1994	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	6/24/1994
TYPE:	GLB - GENERATOR LAND BAN REQUIREMENTS		

VIOLATION NUMBER:	0003	RESPONSIBLE:	S - STATE
DETERMINED:	5/6/1994	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	6/24/1994
TYPE:	GER - GENERATOR ALL REQUIREMENTS		

HAZARDOUS WASTE INFORMATION:

The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichlorethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl
Lead
Ignitable waste
Corrosive waste

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 29 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: GO/DAN INDUSTRIES INC	REV: 6/6/06
ADDRESS: TONAWANDA ST	ID1: NYD002115087
BUFFALO NY 14207	ID2:
ERIE	STATUS: NLR
CONTACT: JANE A KRUPP	PHONE: 7168778000 333

SITE INFORMATION

CONTACT INFORMATION: GEORGE COOK
57 TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168778000

CONTACT INFORMATION: DANIEL SCHRANTZ
TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168778000

CONTACT INFORMATION: DANIEL SCHRANTZ
57 TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168778000

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 29 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: GO/DAN INDUSTRIES INC	REV: 6/6/06
ADDRESS: TONAWANDA ST	ID1: NYD002115087
BUFFALO NY 14207	ID2:
ERIE	STATUS: NLR
CONTACT: JANE A KRUPP	PHONE: 7168778000 333

336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION
EQUIPMENT MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION
EQUIPMENT MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
336312 - GASOLINE ENGINE AND ENGINE PARTS MANUFACTURING
336399 - ALL OTHER MOTOR VEHICLE PARTS MANUFACTURING
333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION
EQUIPMENT MANUFACTURING

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	5/6/1994
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	12/1/1986	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	7/6/1987		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	5/6/1994	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	6/24/1994		
TYPE:	GENERATOR-LAND BAN REQUIREMENTS		

VIOLATION NUMBER:	0003	RESPONSIBLE:	S - STATE
DETERMINED:	5/6/1994	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	6/24/1994		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

HAZARDOUS WASTE INFORMATION:

Ignitable waste
The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichlorethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl
Lead
Corrosive waste

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 154 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS ADDRESS: 57 TONAWANDA STREET BUFFALO NY ERIE	REV: 2/5/08 ID1: 9975208 ID2: 270139 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 6/15/1999	DATE REPORTED: 6/15/1999
CLOSED DATE: 8/30/1999	INSP DATE: 8/2/1999

MATERIAL SPILLED: OTHER	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: OTHER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: RMCROSSE
SPILL CONTACT:
TELEPHONE:

SPILLER: FEDCO
THOMAS WEISBECK
ADDRESS: 57 TONAWANDA STREET
BUFFALO, NY 14207-

TELEPHONE: (716) 877-8000

REPORTED BY: OTHER

LAST DEC UPDATE: 9/30/1999
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9975208 UST TAKING ON WATER, HAS NOT BEEN USED FOR 25 YEARS, PETROLEUM BASED PRODUCT, TANK WILL BE REMOVED 7/7/99, MATERIAL IN TANK IS BEING PROFILED INTO BSA, 550 GALLON TANK END CALLERREMARK - 9975208

DEC REMARKS:
Start DECRemark - 9975208 Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 06/15/99: RMC MEETING WITH DAN KING,

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 154	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9975208
ID2: 270139
STATUS: CLOSED
PHONE:

RMC ADVISED HIM OF SPILL, REFERED TO ABUL 06/16/99: RMC MEETING WITH ABUL, TO SAMPLE FOR STARS, ABUL NEEDS SITE SKETCH AND TO BE NOTIFIED WHEN TANK WILL BE PULLED UPDATE 7/30 07/26/99: RMC RECEIVED MESSAGE TANK WILL BE PULLED 7/31/99 08/02/99: RMC TELECON CHRIS A, 867-2560, TANK IS ACTUALLY 3K, TANK REMOVED TODAY, LAYER OF CONTAMINATION FOUND AT THE SURFACE, DECLINES RAPIDLY LATERALLY, TO CONCRETE PAD EDGES, RMC ADVISED THAT THEY CAN CHASE OR LEAVE BUT IF THEY LEAVE IT MUST BE SAMPLED AND DEPENDANT ON THE RESULTS FURTHER WORK MAY BE REQUIRED, RMC UPDATED ABUL, REPORT DUE 9/15 08/02/99: RMC SITE INSPECTION, TANK REMOVED ALONG WITH 40 TO 60 TONS CONTAMINATED SOIL, EXCAVATION SAMPLED, REPORT DUE 9/99 08/10/99: RMC RECEIVED AND REVIEWED EXCAVATION SAMPLE RESULTS WITH RNL, SITE TO BE MADE INACTIVE PER RNL UPON OBTAINING DISPOSAL DOCUMENTS, DUE 9/99 08/30/99: RMC RECEIVED REPORT WITH DISPOSAL RECEIPTS FOR 1000 GALLONS WATER AND 80 TONS SOIL, NO FURTHER ACTION REQUIRED, SENT INACTIVE LETTER END DECRemark - 9975208

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 209 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDER CORPORATION	REV: 10/18/00
ADDRESS: 57 TONAWANDA STREET	ID1: 8809528
BUFFALO NY	ID2:
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SPILL DATE: 03/09/89	DATE REPORTED: 03/09/89
SPILL TIME: 16:00	TIME REPORTED: 16:40

CAUSE OF SPILL: EQUIPMENT FAILURE
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
WATER IN PAINT DEPARTMENT, WATER MIXED WITH SPILLED PAINT AND DRIPPINGS ON FLOOR

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: RNL
SPILL CONTACT: **TELEPHONE:**

SPILLER: FEDDER CORPORATION
ADDRESS: 57 TONAWANDA STREET
BUFFALO, NY
SPILLER CONTACT: **TELEPHONE:** (761) 877-8000

CALLER: RICHARD PINK	NOTIFIER:
AGENCY: FEDDER CORPORATION	AGENCY:
TELEPHONE: (761) 877-8000	TELEPHONE:

LAST DEC UPDATE: / / **CLOSE DATE:** 03/10/89
DOES CLEAN UP MEET STANDARDS? YES **PENALTY RECOMMENDED?** NO

DEC REMARKS:
03/10/89: RNL TELECON 03/10/89, SPILL CLEANED UP BY SPILLER, LESS THAN TWO GALLONS OF PAINT SPILLED, NO INSPECTION NECESSARY, SITE COMPLETE. 09/29/95: THIS IS ADDITIONAL INFORMATION ABOUT MATERIAL SPILLED FROM THE TRANSLATION OF THE OLD SPILL FILE: PAINT AND WATER.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 138 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTO COMPONENTS ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 2/5/08 ID1: 915024 ID2: 56554.00 STATUS: PHONE:
----------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------

SITE INFORMATION

REGION: 9 **SIZE (ACRES):** 2.000

SITE TYPE:

OPEN DUMP: NO LAGOON: NO POND: NO	STRUCTURE: NO LANDFILL: NO
--------------------------------------------------------------	---------------------------------------------

CLASS: The classification assigned to a site at which the disposal of a consequential quantity of hazardous waste has been confirmed and the presence of such hazardous waste or its components or breakdown products, under current conditions at the site, do not represent a significant threat to the environment or to health as described in 6 NYCRR Part 375-1.4. This classification is used only when there is sufficient information available to conclude that the site does not pose a significant threat. This classification is not used for sites where the information is insufficient to make a definitive decision concerning significant threat.

SITE OWNER/OPERATOR INFORMATION:

NAME: PAUL KUNKMUELLER
COMPANY: FEDDERS AUTO COMPONENTS
ADDRESS: 57 TONAWANDA ST.
BUFFALO NY 14207
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: FEDDERS AUTO COMPONENTS
ADDRESS: ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: FEDDERS AUTO COMPONENTS
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: FEDCO AUTOMOTIVE COMPONENTS
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: FEDDERS AUTO COMPONENTS
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
COUNTRY: UNITED STATES OF AMERICA

HAZARDOUS WASTE:
SOLVENT STILL BOTTOMS (F001 WASTE)

QUANTITY:
165 GALLONS/YEAR (EST.)

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 138 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDDERS AUTO COMPONENTS
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
ERIE
CONTACT:

REV: 2/5/08
ID1: 915024
ID2: 56554.00
STATUS:
PHONE:

HAZARDOUS WASTE DISPOSAL PERIOD: 1974 TO unknown

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

Volatile organics, PCBs and lead contaminants were detected in site soil and sediments of Scajaquada Creek. VOCs were detected in groundwater. The Scajaquada Creek sediment was remediated in 1998 - 1999 as part of site 915141. The remaining contamination is not currently posing a significant threat to the environment.

ASSESSMENT OF HEALTH PROBLEMS:

The potential for direct contact with contaminated soil is low because the site is fenced and partially covered with gravel. Exposures via drinking water are not expected because the community near the site is served by public water and there are no known private wells in the immediate area.

DESCRIPTION:

The site was a 2 acre parking lot for the Fedco Automotive Components Company located at 57 Tonawanda Street in the city of Buffalo, Erie County. The site is located in an urban commercial and industrial area within the City of Buffalo immediately adjacent to Scajaquada Creek. The nearest residential area is approximately 0.5 miles north of the site. In 1936-1942 a building housing furnace kilns that existed at the same location as the site was torn down and used as fill for the parking lot. Historically, waste oils (consisting of hydraulic fluids and light lubrication oils) were spread over the parking area as a dust suppressant. Further it was alleged that the waste oil contained PCBs. Reportedly 165 Gal/yr of waste oil was used. A 1978 Site Inspection reports that solvent still bottoms were used for this purpose. Conflicting reports exist as to when this spreading practice was discontinued (1976 vs 1981). In 1981, the lot was covered with gravel so no further dust control measures were necessary. Investigations conducted at this site to date include a USEPA Site Inspection, NYSDEC Phase I and Phase II Investigations (1985, 1992) and a Site Investigation conducted on behalf of Fedco Automotive in 1989. As a result of remedial activities at the adjacent Iroquois Gas/Westwood Pharmaceutical Site 915141, a highly concentrated oily material was found adjacent to Fedco property in 1998. This material would be removed with extraction wells as part of ongoing remediation for the Iroquois/Westwood Pharmaceutical Company. NYSDEC reclassified the site to a 3 in 1993. A subsurface soil investigation around the naphthalene underground storage tank was conducted by Sandamp;W Redevelopment in 2002.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 133 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT: MICHAEL PLOTNER	REV: 11/1/07 ID1: 14207FDCTM57TON ID2: STATUS: OPEN PHONE: 7168778000
-------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

SIC INFORMATION

3714
NA -

REPORTED INFORMATION

REPORTING YEAR:	CONTACT PERSON:	CONTACT PHONE:
1987		
1987	GARY MOOSE	7168778000
1988	GARY MOOSE	7168778000
1989	GARY G. MOOSE	7168778000
1990	GARY G. MOOSE	7168778000
1991	GARY G. MOOSE	7168778000
1992	GARY G. MOOSE	7168778000
1992	GARY G. MOOSE	7168778000
1993	GARY G. MOOSE	7168778000
1994	GARY G MOOSE	7168778000
1995	TIMOTHY G. BRODENE	7168778000
1996	TIMOTHY G. BRODENE	7168778000
1997	MAURICE M. PLOTNER	7168778000
1998	REYNEL J. RODRIGUEZ	7168778000
1999	REYNEL J. RODRIGUEZ	7168778000
2000	KERSI DORDI	7168778000
2000	KERSI DORD	7168778000
2001	KERSI DORDI	7168778000
2002	MICHAEL PLOTNER	7168778000

CHEMICAL

ONE TIME RELEASE QTY(LBS)

LEAD COMPOUNDS

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 133	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT: MICHAEL PLOTNER	REV: 11/1/07 ID1: 14207FDCTM57TON ID2: STATUS: OPEN PHONE: 7168778000
-------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

ZINC COMPOUNDS

COPPER COMPOUNDS

COPPER COMPOUNDS

LEAD COMPOUNDS

ZINC COMPOUNDS

COPPER COMPOUNDS

ZINC COMPOUNDS

LEAD COMPOUNDS

ZINC COMPOUNDS

LEAD COMPOUNDS

COPPER COMPOUNDS

COPPER COMPOUNDS 0

ZINC COMPOUNDS 0

LEAD COMPOUNDS 0

COPPER COMPOUNDS 0

LEAD COMPOUNDS 0

ZINC COMPOUNDS 0

ZINC COMPOUNDS 0

COPPER COMPOUNDS 0

LEAD COMPOUNDS 0

METHYLENEBIS(PHENYLISOCYANATE) 0

ZINC COMPOUNDS 0

METHYLENEBIS(PHENYLISOCYANATE) 0

COPPER COMPOUNDS 0

LEAD COMPOUNDS 0

COPPER COMPOUNDS 0

DIISOCYANATES 0

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 133	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT: MICHAEL PLOTNER	REV: 11/1/07 ID1: 14207FDCTM57TON ID2: STATUS: OPEN PHONE: 7168778000
-------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------

LEAD COMPOUNDS	0
ZINC COMPOUNDS	0
DIISOCYANATES	0
LEAD COMPOUNDS	0
COPPER COMPOUNDS	0
ZINC COMPOUNDS	0
COPPER COMPOUNDS	0
LEAD COMPOUNDS	0
ZINC COMPOUNDS	0
COPPER COMPOUNDS	0
LEAD COMPOUNDS	0
MANGANESE	0
ZINC COMPOUNDS	0
COPPER COMPOUNDS	0
ZINC COMPOUNDS	0
LEAD COMPOUNDS	0
MANGANESE	0
COPPER COMPOUNDS	0
LEAD COMPOUNDS	0
COPPER COMPOUNDS	0
LEAD COMPOUNDS	0
LEAD COMPOUNDS	0
COPPER COMPOUNDS	0

OFF SITE TREATMENT LOCATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 132	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS
ADDRESS: 57 TONAWANDA ST.
BUFFALO NY 14207
ERIE
CONTACT: GARY MOOSE

REV:
ID1: NYD002115087
ID2: 14207FDCTM57TON
STATUS: OPEN
PHONE: 7168778000

DETAILS NOT AVAILABLE

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 234 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000207 ID2: STATUS: UNREGULATED PHONE:
---------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

CHEMICAL BULK STORAGE FACILITY INFORMATION

TYPE OF SITE:	MANUFACTURING		
TOTAL ACTIVE TANKS ON SITE:	0		
TOTAL FACILITY CAPACITY:	0 GALLONS		
PBS NUMBER:	ICS NUMBER:	9-178244	MOSF NUMBER:
ADDITIONAL ADDRESS INFO:			
TYPE OF OWNER:	CORPORATE/COMMERCIAL		
OWNER SUB TYPE:			
OWNER ADDRESS:	57 TONAWANDA ST. BUFFALO NY 14207		
PHONE:	(716) 877-8000		
EMERGENCY CONTACT:	GARY MOOSE		
PHONE:	(716) 877-8000		
MAILING NAME:	FEDCO AUTOMOTIVE COMPONENTS COMPANY INC.		
ADDRESS:	57 TONAWANDA ST. BUFFALO NY 14207		
ATTENTION:	GARY MOOSE		
PHONE:	(716) 877-8000		
CERTIFICATE DATE:	7/16/91	EXP. DATE:	7/14/93
RENEWAL DATE:	8/23/93		

TANK INFORMATION

TANK NUMBER:	001	STATUS:	CLOSED - REMOVED
INSTALLED:	07/87	CLOSED:	03/91
TANK CAPACITY:	250 GALLONS		
SUBSTANCE STORED:	ZINC (SEE FOOTNOTE 1)		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	60		
TANK TYPE:	FIBERGLASS COATED STEEL		
TANK LOCATION:	ABOVEGROUND		
INTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION:	NONE		
SECONDARY CONTAINMENT:	NONE		
PIPE TYPE:	6		
PIPE LOCATION:	ABOVE GROUND		
INTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION:	NONE		
SECONDARY CONTAINMENT:	NONE		
LEAK DETECTION:	NONE		
OVERFILL PROTECTION:	NONE		

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 234 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000207 ID2: STATUS: UNREGULATED PHONE:
---------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

TANK NUMBER:	002	STATUS:	CLOSED - REMOVED
INSTALLED:	07/87	CLOSED:	03/91
TANK CAPACITY:	250 GALLONS		
SUBSTANCE STORED:	ZINC (SEE FOOTNOTE 1)		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	60		

TANK TYPE:	FIBERGLASS COATED STEEL
TANK LOCATION:	ABOVEGROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	NONE

PIPE TYPE:	6
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	NONE

LEAK DETECTION:	NONE
OVERFILL PROTECTION:	NONE

TANK NUMBER:	003	STATUS:	CLOSED - REMOVED
INSTALLED:	07/87	CLOSED:	03/91
TANK CAPACITY:	250 GALLONS		
SUBSTANCE STORED:	ZINC (SEE FOOTNOTE 1)		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	60		

TANK TYPE:	FIBERGLASS COATED STEEL
TANK LOCATION:	ABOVEGROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	NONE

PIPE TYPE:	6
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	NONE

LEAK DETECTION:	NONE
OVERFILL PROTECTION:	NONE

TANK NUMBER:	004	STATUS:	CLOSED - REMOVED
INSTALLED:	07/87	CLOSED:	03/91
TANK CAPACITY:	250 GALLONS		
SUBSTANCE STORED:	ZINC (SEE FOOTNOTE 1)		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	60		

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 234 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO. ADDRESS: 57 TONAWANDA ST. BUFFALO NY 14207 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000207 ID2: STATUS: UNREGULATED PHONE:
---------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

TANK TYPE: FIBERGLASS COATED STEEL
TANK LOCATION: ABOVEGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE

PIPE TYPE: 6
PIPE LOCATION: ABOVE GROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE

LEAK DETECTION: NONE
OVERFILL PROTECTION: NONE

TANK NUMBER: 005	STATUS: CLOSED - REMOVED
INSTALLED: 00/00	CLOSED: 03/91
TANK CAPACITY: 1000 GALLONS	
SUBSTANCE STORED: XYLENE (MIXED)	
SUBSTANCE DESCRIPTION: SINGLE HAZARDOUS SUBSTANCE ON DEC LIST	
HAZARDOUS SUBSTANCE %: 50	

TANK TYPE: STEEL/CARBON STEEL
TANK LOCATION: ABOVEGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE

PIPE TYPE: STEEL/IRON
PIPE LOCATION: ABOVE GROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE

LEAK DETECTION: NONE
OVERFILL PROTECTION: NONE

TANK NUMBER: 006	STATUS: CLOSED - REMOVED
INSTALLED: 03/91	CLOSED: 12/92
TANK CAPACITY: 250 GALLONS	
SUBSTANCE STORED: ZINC (SEE FOOTNOTE 1)	
SUBSTANCE DESCRIPTION: SINGLE HAZARDOUS SUBSTANCE ON DEC LIST	
HAZARDOUS SUBSTANCE %: 50	

TANK TYPE: FIBERGLASS COATED STEEL
TANK LOCATION: ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
SECONDARY CONTAINMENT: NONE

PIPE TYPE: 6

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 233 **DIST/DIR:** 0.10 NW **MAP ID:** 69

NAME: FEDCO AUTOMOTIVE COMPONENTS CO ADDRESS: 57 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-448249 ID2: STATUS: UNREGULATED PHONE: (716) 877-8000
-----------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: UNKNOWN
TYPE NAME:
TOTAL NUMBER OF TANKS: 1
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 1
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: FEDCO AUTOMOTIVE COMPONENTS CO
TITLE:
NAME:
ADDRESS: 57 TONAWANDA STREET
NY 14207
PHONE: (716) 877-8000
EMERGENCY CONTACT: TIM BRODENE
PHONE: (716) 688-6942

MAILING INFORMATION

COMPANY: FEDCO AUTOMOTIVE COMPONENTS CO
TITLE:
CONTACT:
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
PHONE: (716) 877-8000
EMAIL:

EXP. DATE: 7/28/1993
RENEWAL DATE: 12:00:00 AM

COMMENTS: Archived 10+years SA

TANK INFORMATION

<u>TANK NUMBER:</u>	1	TANK STATUS:	CLOSED - REMOVED
ACTIVE STATUS:	INACTIVE	INSTALLED:	12/1/1961
CLOSED:	9/1/1992	TANK CAPACITY:	15000 GALLONS
PRODUCT:	6 FUEL OIL		
TANK TYPE:	STEEL/CARBON STEEL/IRON		
TANK LOCATION:	UNDERGROUND		
INTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION:	NONE		
EXTERNAL PROTECTION 2:			
PIPE TYPE:	STEEL/CARBON STEEL/IRON		

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 233	DIST/DIR: 0.10 NW	MAP ID: 69
-----------------------	--------------------------	-------------------

NAME: FEDCO AUTOMOTIVE COMPONENTS CO
ADDRESS: 57 TONAWANDA STREET
BUFFALO NY 14207
ERIE

REV: 2/5/08
ID1: PBS9-448249
ID2:
STATUS: UNREGULATED
PHONE: (716) 877-8000

CONTACT:

PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: OTHER
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 170 **DIST/DIR:** 0.10 SE **MAP ID:** 70

NAME: RUAN TRANSPORT TRUCK	REV: 2/5/08
ADDRESS: 175 DART STREET	ID1: 9707480
BUFFALO NY	ID2: 134689
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/24/1997	DATE REPORTED: 9/24/1997
CLOSED DATE: 11/17/1997	INSP DATE: 9/24/1997

MATERIAL SPILLED: DIESEL	AMOUNT SPILLED: 50 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 50 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL:	EQUIPMENT FAILURE
WATERBODY AFFECTED:	
SOURCE OF SPILL:	COMMERCIAL VEHICLE
REPORTED BY:	FIRE DEPARTMENT

REGION:	9
UST TRUST?	NO

SPILL INVESTIGATOR:	COOKE
SPILL CONTACT:	DISPT PITTS
TELEPHONE:	(716) 851-5510

SPILLER:	RUAN TRANSPORT
	MIKE FREESE
ADDRESS:	601 LOCUST STREET
	DES MOINES, IA 50304-

TELEPHONE:	(515) 245-5688
-------------------	----------------

REPORTED BY:	FIRE DEPARTMENT
---------------------	-----------------

LAST DEC UPDATE:	12/24/1997
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

CALLER REMARKS: START CALLERREMARK - 9707480 CALLER REPORTS SADDLE TANK RUPTURED ON TRUCK - UNK WHAT CAUSED IT FIRE DEPT ON SCENE CONTAINING SPILL TRUCKING COMPANY CALLED AT 19:49 TO ADVISE OF SPILL END CALLERREMARK - 9707480

DEC REMARKS:
Start DECRemark - 9707480 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 9/24/97: JDC ON SITE AND MET WITH

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 170	DIST/DIR: 0.10 SE	MAP ID: 70
-----------------------	--------------------------	-------------------

NAME: RUAN TRANSPORT TRUCK
ADDRESS: 175 DART STREET
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9707480
ID2: 134689
STATUS: CLOSED
PHONE:

BUFFALO FIRE CHEIF, RON ENDLE, FUEL TANK WAS PLUGGED AND SORBENTS WERE PLACED IN THE AREA. DOCS TOWING WAS HIRED AND PUMPED OF TANK INTO 55 GALLON DRUM. REQUESTED DRIVER TO ARRANGE A SITE CLEANUP THROUGH HIS OFFICE. SORBENTS WILL BE ON THE SPILL AREA, APPRX. 9 SQ FT, UNTIL CLEANUP CAN BE ARRANGED. MET WITH MR HAROLD RUSLANDER, REPRESENTATIVE OF RUSLANDER and SON, PROPERTY WERE SPILL HAD OCCURED. HE PROVIDED DRUMS AND A PUMP AT THE SCENE THAT PREVENTED MORE FUEL FROM SPILLING OUT OF THE DAMAGED TANK CELL. HE AGREED THAT THE TRAILER COULD BE STAGED ON SITE UNTIL A REPLACEMENT TRACTOR WAS FOUND. 9/25/97: JDC TELECON WITH MR MIKE FREEZE, RUAN TRUCKING, HE AGREED TO HIRE A LOCAL CONTRACTOR TO COLLECT CONTAMINATED SOILS. ADVISED HIM OF CLEANUP REQUIREMENTS AND PROVIDED NAMES OF LOCAL CONTRACTORS. ESG WAS HIRED, MET PAUL SUOZZI (ESG) ON SITE AND DIRECTED CLEANUP. ONE (55) GALLON DRUM OF DEBRIS WAS COLLECTED AND WILL BE STAGED ON SITE UNTIL DISPOSAL CAN BE ARRANGED BY ESG. WILL SEND LETTER TO RP OUTLINING CLEANUP REQUIREMENTS. 11/17/97: JDC RECEIVED CLOSURE REPORT. INFORMATION SATISFACTORY. NO FURTHER ACTION REQUIRED, SITE CLOSED. END DECRemark - 9707480

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

AIRS

SEARCH ID: 277	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE
ADDRESS: 1300 ELMWOOD AVE
BUFFALO NY 14222
ERIE

REV: 1/12/08
ID1: NY0007973
ID2: 9140200573
STATUS: AIRS DATABASE
PHONE:

CONTACT:

OPERATING STATUS:	O
YEAR MEASURED:	96
PRINCIPAL PRODUCT:	
LAST UPDATED:	9/18/2007
AMBIENT MONITORING:	
SOURCE MONITORING EQUIP:	
STATE IMPLIMENTED PROG:	OZONE
PLANT DESC:	STATE TEACHERS COLLEGE

**Environmental FirstSearch
Site Detail Report**

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

ERNS

SEARCH ID: 49 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 9/7/99
ADDRESS: 1300 ELMWOOD AVE CORNER OF GRANT AND AMHERST	ID1: 641645
BUFFALO NY 14222	ID2:
ERIE	STATUS: UNDERGROUND STORAGE TANK
CONTACT:	PHONE:

SPILL INFORMATION

DATE OF SPILL: 9/7/99 **TIME OF SPILL:** 0920

PRODUCT RELEASED (1): OIL, FUEL: NO. 6
QUANTITY (1): 1000
UNITS (1): GAL

PRODUCT RELEASED (2):
QUANTITY (2):
UNITS (2):

PRODUCT RELEASED (3):
QUANTITY (3):
UNITS (3):

MEDIUM/MEDIA AFFECTED

AIR: NO	GROUNDWATER: NO	
LAND: YES	FIXED FACILITY: NO	
WATER: NO	OTHER: NO	
WATERBODY AFFECTED BY RELEASE:		

CAUSE OF RELEASE

DUMPING: NO	EQUIPMENT FAILURE: NO	
NATURAL PHENOMENON: NO	OPERATOR ERROR: NO	
OTHER CAUSE: YES	TRANSP. ACCIDENT: NO	
UNKNOWN: NO		

ACTIONS TAKEN: REMOVED FREE PRODUCT / HIRED CONTRACTOR

RELEASE DETECTION: UNDERGROUND STORAGE TANK UNDERGROUND STORAGE TANK (SIZE UNKNOWN) / TANK DAMAGED
DURING CONSTRUCTION WORK

MISC. NOTES: NYSDEC CASE 99-06828

DISCHARGER INFORMATION

DISCHARGER ID: 641645	DUN and BRADSTREET :
TYPE OF DISCHARGER: STATE GOVERNMENT	
NAME OF DISCHARGER: BUFFALO STATE COLLEGE	
ADDRESS: 1300 ELMWOOD AVE	
BUFFALO NY	

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

ERNS

SEARCH ID: 48 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE ADDRESS: 1300 ELMWOOD AVE CORNER OF GRANT AND AMHERST BUFFALO NY 14222 ERIE	REV: 9/7/99 ID1: 640339 ID2: STATUS: FIXED FACILITY PHONE:
CONTACT:	

SPILL INFORMATION

DATE OF SPILL: 9/7/99 **TIME OF SPILL:** 0920

PRODUCT RELEASED (1): OIL, FUEL: NO. 6
QUANTITY (1): 1000
UNITS (1): GAL

PRODUCT RELEASED (2):
QUANTITY (2):
UNITS (2):

PRODUCT RELEASED (3):
QUANTITY (3):
UNITS (3):

MEDIUM/MEDIA AFFECTED

AIR: NO	GROUNDWATER: NO
LAND: YES	FIXED FACILITY: NO
WATER: NO	OTHER: NO
WATERBODY AFFECTED BY RELEASE: SOIL	

CAUSE OF RELEASE

DUMPING: 0	EQUIPMENT FAILURE: NO
NATURAL PHENOMENON: NO	OPERATOR ERROR: NO
OTHER CAUSE: NO	TRANSP. ACCIDENT: NO
UNKNOWN: NO	

ACTIONS TAKEN: REMOVED FREE PRODUCT / HIRED CONTRACTOR

RELEASE DETECTION: UNDERGROUND STORAGE TANK (SIZE UNKNOWN) / TANK DAMAGED DURING CONSTRUCTION WORK

MISC. NOTES:

DISCHARGER INFORMATION

DISCHARGER ID: 640339	DUN and BRADSTREET :
TYPE OF DISCHARGER: STATE GOVERNMENT	
NAME OF DISCHARGER: BUFFALO STATE COLLEGE	
ADDRESS: 1300 ELMWOOD AVE BUFFALO NY	

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 100 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: ST UNIV-COLLEGE AT BUFFALO ADDRESS: 1300 ELMWOOD AVENUE BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110000880299 ID2: NYD071486211 STATUS: FRS PHONE:
-------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: NPDES PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: ORIGINAL PERMIT ISSUE DATE INT END QUAL: LAST REPORTED: 3/13/2006 ENFORCEMENT ACT: REG PROGRAM: ICIS-NPDES NON-MAJOR	PROGRAM ID: NYR20A504 AGENCY INTERESTED: 1/8/2003 INTEREST ENDED: SOURCE OF DATA: ICIS LAST EXTRACTED: 6/5/2007 10:56:43 AM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110000880299 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/27/2004 ENFORCEMENT ACT: REG PROGRAM: LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.	PROGRAM ID: NYD071486211 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: AIRS/AFS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 3/16/2007 ENFORCEMENT ACT: REG PROGRAM: AIR MAJOR - A CLEAN AIR ACT STATIONARY SOURCE MAJOR DISCHARGER OF AIR POLLUTANTS ACCORDING TO THE ALABAMA POWER DECISION S DEFINITION OF A MAJOR SOURCE OR THE 1993 EPA COMPLIANCE MONITORING BRANCH CLASSIFICATION GUIDANCE. A FACILITY IS CLASSIFIED AS A MAJOR DISCHARGER IF: (A) ACTUAL OR POTENTIAL EMISSIONS ARE ABOVE THE APPLICABLE MAJOR SOURCE THRESHOLDS; OR (B) ACTUAL OR POTENTIAL CONTROLLED EMISSIONS > 100 TONS/YEAR AS PER ALABAMA POWER DECISION; OR (C) UNREGULATED POLLUTANT ACTUAL OR POTENTIAL CONTROLLED EMISSIONS > 100 TONS/YEAR AS PER ALABAMA POWER DECISION.	PROGRAM ID: 3602900036 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: AIRS/AFS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO	PROGRAM ID: NYD071486211
--------------------------	---------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 100 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: ST UNIV-COLLEGE AT BUFFALO ADDRESS: 1300 ELMWOOD AVENUE BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110000880299 ID2: NYD071486211 STATUS: FRS PHONE:
-------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: LAST REPORTED: 2/25/2002 ENFORCEMENT ACT: REG PROGRAM:	AGENCY INTERESTED: 12/31/1989 INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 2/13/2004 6:35:11 PM	HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------

PROGRAM: NJ-NJEMS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 326705 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NJEMS LAST EXTRACTED: 4/24/2007 7:28:37 AM	STATE MASTER -
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 9-1402-00573 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/20/2004 2:05:16 AM	STATE MASTER -
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------

SITE TYPE: INTEREST STATUS: DATA QUALITY: LOCATION DESC: ADDRESS TYPE: LAST REPORTED: POSTED TO DATABASE: DATA UPDATED: ENTERED PERSON/METHOD: PARENT REG ID: CONFIDENCE IN ADDR: ENFORCEMENT SENSITIVE: REQ MANUAL REVIEW: REASON MAN REVIEW: SMALL BUS POLICY: ENFORCEMENT ACTION: DATA PUB ACCESS: INTERNAL SYS ID:	STATIONARY ACTIVE V REGULAR URBAN 3/1/2000 6/6/2007 4:08:18 AM REFRESH MEDIUM Y , NAME MISMATCH-NPDES YES
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------

FEDERAL FACILITY: FEDERAL AGENCY: TRIBAL LAND: TRIBAL LAND NAME: CONGRESSIONAL DIST: LEGISLATIVE DIST: HYDROLOGICAL UNTIS: EPA REGION:	NO NO 29 04120104 02
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 100

DIST/DIR: 0.10 SW

MAP ID: 68

NAME: ST UNIV-COLLEGE AT BUFFALO
ADDRESS: 1300 ELMWOOD AVENUE
 BUFFALO NY 14222
 ERIE

REV: 11/1/06
ID1: 110000880299
ID2: NYD071486211
STATUS: FRS
PHONE:

AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 103 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: STATE UNIVERSITY OF NY - BUFFALO(JT) ADDRESS: BUFFALO NY ERIE CONTACT:	REV: 9/12/05 ID1: 110016839616 ID2: STATUS: FRS PHONE:
------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: BMS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: PILOT START DATE INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 59761873542 AGENCY INTERESTED: 9/26/2000 INTEREST ENDED: SOURCE OF DATA: BMS LAST EXTRACTED: 2/27/2004 4:59:15 PM	BROWNFIELDS PILOT/GRANT - FUNDING FOR ASSESSMENT DEMONSTRATION PILOTS/JOB TRAINING PILOTS/CLEANUP REVOLVING LOAN FUND PILOTS AND SHOWCASE COMMUNITY PILOTS INCLUDED IN EPA S BROWNFIELDS ECONONMIC REDEVELOPMENT INITIATIVE.
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/27/2004 4:59:15 PM ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110016839616 AGENCY INTERESTED: 2/27/2004 4:59:15 PM INTEREST ENDED: SOURCE OF DATA: BMS LAST EXTRACTED:	FACILITY -
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------

SITE TYPE: BROWNFIELDS SITE
INTEREST STATUS: ACTIVE
DATA QUALITY: mAmZiM
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 2/27/2004 4:59:15 PM
DATA UPDATED:
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND:
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 103	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: STATE UNIVERSITY OF NY- BUFFALO(JT) ADDRESS: BUFFALO NY ERIE CONTACT:	REV: 9/12/05 ID1: 110016839616 ID2: STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 101

DIST/DIR: 0.10 SW

MAP ID: 68

NAME: STATE UNIVERSITY COLLEGE AT BUFFALO
ADDRESS: 1300 ELMWOOD AVE
BUFFALO NY 14222
Erie
CONTACT:

REV:
ID1: NYD071486211
ID2:
STATUS:
PHONE:

RCRIS : NYD071486211
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 97 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: CAMPUS WEST SCHOOL ADDRESS: BUFFALO NY 14222 ERIE CONTACT:	REV: 11/1/06 ID1: 110021748037 ID2: STATUS: FRS PHONE:
------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 5/20/2005 8:13:02 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110021748037 AGENCY INTERESTED: 5/20/2005 8:13:02 PM INTEREST ENDED: SOURCE OF DATA: NCES LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NCES PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: UNSPECIFIED UNIVERSE - THE HANDLER IS IN A HAZARDOUS WASTE UNIVERSE OTHER THAN TSD, GENERATOR (LQG, SQG, CESQG), TRANSPORTER, OR USED OIL PROGRAM.	PROGRAM ID: 360585000303 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NCES LAST EXTRACTED: 5/20/2005 8:13:03 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: mA
LOCATION DESC: 1
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 5/20/2005 8:13:02 PM
DATA UPDATED: 8/17/2006 12:37:00 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE:
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 102 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: STATE UNIVERSITY OF NY - BUFFALO(JT)	REV: 9/12/05
ADDRESS: BUFFALO NY	ID1: 110016839607
ERIE	ID2:
CONTACT:	STATUS: FRS
	PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: BMS	PROGRAM ID: 59761873541	
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED: 9/26/2000	
AGENCY INT QUAL: PILOT START DATE	INTEREST ENDED:	
INT END QUAL:	SOURCE OF DATA: BMS	
LAST REPORTED:	LAST EXTRACTED: 2/27/2004 4:59:15 PM	
ENFORCEMENT ACT:		
REG PROGRAM: BROWNFIELDS PILOT/GRANT - FUNDING FOR ASSESSMENT DEMONSTRATION PILOTS/JOB TRAINING PILOTS/CLEANUP REVOLVING LOAN FUND PILOTS AND SHOWCASE COMMUNITY PILOTS INCLUDED IN EPA S BROWNFIELDS ECONONMIC REDEVELOPMENT INITIATIVE.		

PROGRAM: FRS	PROGRAM ID: 110016839607	
PROVIDED BY: FEDERAL AGENCY	AGENCY INTERESTED: 2/27/2004 4:59:14 PM	
AGENCY INT QUAL:	INTEREST ENDED:	
INT END QUAL:	SOURCE OF DATA: BMS	
LAST REPORTED: 2/27/2004 4:59:15 PM	LAST EXTRACTED:	
ENFORCEMENT ACT:		
REG PROGRAM: FACILITY -		

SITE TYPE: BROWNFIELDS SITE
INTEREST STATUS: ACTIVE
DATA QUALITY: mAmZiM
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 2/27/2004 4:59:15 PM
DATA UPDATED:
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND:
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 102	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: STATE UNIVERSITY OF NY- BUFFALO(JT) ADDRESS: BUFFALO NY ERIE CONTACT:	REV: 9/12/05 ID1: 110016839607 ID2: STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 104 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: STATE UNIVERSITY OF NY - BUFFALO(JT) ADDRESS: BUFFALO NY ERIE CONTACT:	REV: 9/12/05 ID1: 110016839625 ID2: STATUS: FRS PHONE:
------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 2/27/2004 4:59:15 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110016839625 AGENCY INTERESTED: 2/27/2004 4:59:15 PM INTEREST ENDED: SOURCE OF DATA: BMS LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: BMS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: PILOT START DATE INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: BROWNFIELDS PILOT/GRANT - FUNDING FOR ASSESSMENT DEMONSTRATION PILOTS/JOB TRAINING PILOTS/CLEANUP REVOLVING LOAN FUND PILOTS AND SHOWCASE COMMUNITY PILOTS INCLUDED IN EPA S BROWNFIELDS ECONONMIC REDEVELOPMENT INITIATIVE.	PROGRAM ID: 59761873543 AGENCY INTERESTED: 9/26/2000 INTEREST ENDED: SOURCE OF DATA: BMS LAST EXTRACTED: 2/27/2004 4:59:15 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: BROWNFIELDS SITE
INTEREST STATUS: ACTIVE
DATA QUALITY: mAmZ
LOCATION DESC:
ADDRESS TYPE: IRREGULAR
LAST REPORTED:
POSTED TO DATABASE: 2/27/2004 4:59:15 PM
DATA UPDATED:
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR:
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY:
FEDERAL AGENCY:
TRIBAL LAND:
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST:
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 104	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: STATE UNIVERSITY OF NY- BUFFALO(JT) ADDRESS: BUFFALO NY ERIE CONTACT:	REV: 9/12/05 ID1: 110016839625 ID2: STATUS: FRS PHONE:
-----------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 255 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVE	ID1: 9975398
BUFFALO NY	ID2: 226552
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/7/1999	DATE REPORTED: 9/7/1999
CLOSED DATE: 11/9/1999	INSP DATE: 9/10/1999

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 200 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 200 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 9975398 20 X 40 AREA OF CONTAMINATION FOUND ON THE GROUND WHILE DOING DEMOLISHING, SUSPECT UST.. END CALLERREMARK - 9975398

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE
DAVE MILLER
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-1095

TELEPHONE: (716) 878-6653

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9975398 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 09/07/99: MF SITE INSPECTION, (AM) MET FRANK BODAMI, MIKE KURBAN, LEBIS ENTERPRISES, MAIN CONTRACTOR AND JOE BALL, DAVE MILLER, BUFFALO STATE COLLEGE (BSC), POOL OF 6 OIL, APPX 200 GALLONS IN LOW SPOT WHERE A SHEET METAL PROCESSING FACILITY WAS DEMOLISHED TO CONSTRUCT A PARKING LOT. OIL BERMED OFF, BSC TO CONTACT OGS. EXPLAINED REMEDIATION MUST PROCEED ASAP. THEY WILL VAC OIL and LOOK FOR A UST. 09/07/99: MF SITE INSPECTION (PM) MET DAVE MENDEL, TEG. BISON WASTE CALLED and WILL VAC UP MATERIAL. SAMPLE SENT TO WASTE STREAM TO ID IT and DO A PCB TEST. EXPECT DIGGING TO START TOMORROW. EXPLAINED TO DAVE MILLER WHAT MUST BE DONE. 09/08/99: MF SENT LETTER. 09/10/99: FG SITE INSPECTION. UST WAS BEING PULLED, ESTIMATED SIZE IS 6000 GALLON - 72 INCH DIAMETER BY 14 FT LONG. HOLES WERE NOTED IN THE UST. CONTAMINATION WAS FOUND UNDER THE UST. NATIVE SOIL BELOW AND ON THE SIDES OF THE UST ARE CLAY. ALL CONTAMINATED SOIL WILL BE REMOVED. THE SIDEWALLS AND THE BOTTOM WILL BE SAMPLED FOR 8021 and 8270 STARS. BISON WAS ON SITE PUMPING OUT THE UST. 2500 GALLONS WERE PUMPED OUT INITIALLY FROM THE SURFACE, ANOTHER 2400 GALLONS WERE PUMPED OUT FROM THE SURFACE THE 3600 GALLONS OF OIL/WATER WERE PUMPED OUT OF THE UST TODAY. ROGER WITH IWS WAS ON SITE AND BOB OSSMAN WITH IT WAS ON SITE. THE UST WILL BE CUT OPEN and CLEANED OUT. BISON WILL TAKE ALL

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 255	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE ADDRESS: 1300 ELMWOOD AVE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9975398 ID2: 226552 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

MATERIAL FROM THE UST. THE REMAINDER WILL BE PLACED ON THE SOIL PILE, SO THERE WILL BE NO DRUMMED WASTE FOR DISPOSAL. THE SOIL WILL BE DISPOSED OF BY TUESDAY OF NEXT WEEK. 10/05/99: MF SENT FIRST DISPOSAL and SAMPLING LETTER, DUE 11/15/99. 10/14/99: MF RECEIVED SOIL DISPOSAL RECEIPTS. WAITING FOR EXCAVATION TEST RESULTS. 10/25/99: MF TELETON TO OWEN BYRNE OF OGS, NOT IN, LEFT MESSAGE FOR EXCAVATION TEST RESULTS. 10/27/99: MF SENT LETTER TO OGS FOR SAMPLE RESULTS, DUE 11/15/99. 11/09/99: MF RECEIVED EXCAVATION SAMPLE RESULTS, 8021 and 8270 BN S, BELOW STARS. NO FURTHER ACTION NECESSARY. LETTER SENT. END DECRemark - 9975398

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 256 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE/NYS	REV: 2/5/08
ADDRESS: ELMWOOD AVENUE	ID1: 9310026
BUFFALO NY	ID2: 330729
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/9/1993	DATE REPORTED: 11/9/1993
CLOSED DATE: 8/10/1994	INSP DATE: 7/28/1994

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 L
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 L

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 9310026 300-GAL. FUEL TANK FOUND LEAKING AFTER REMOVAL.
END CALLERREMARK - 9310026

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT:
TELEPHONE:

SPILLER: NYSOGS - SUNY
ADDRESS: PO BOX 268
ALDEN, NY 14004

TELEPHONE:

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 10/8/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9310026 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 11/11/93: SAC/DAVE MILLER, BUFF STATE/BILL KITCHEN, OGS/SITE - VISIBLE CONTAMINATION IN EXCAVATION. ADVISED TO REMOVE ALL VISIBLE CONTAMINATION. OGS TO FURTHER EVALUATE BUILDING SITUATION. 07/13/94: OGS/BILL KITCHEN SAID SOIL HAS BEEN DISPOSED OF. HE IS WAITING TO RECEIVE DISPOSAL RECEIPTS WHICH WILL THEN BE SUBMITTED TO THIS OFFICE. 08/10/94: DISPOSAL RECEIPTS SUBMITTED FOR SOIL FROM SPILL. SITE CAN BE CLOSED. END DECRemark - 9310026

THERE MAYBE MORE DEC REMARKS AVAILABLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 257 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: SUNY COLLEGE	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVENUE	ID1: 9902022
BUFFALO NY	ID2: 204504
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 5/21/1999	DATE REPORTED: 5/21/1999
CLOSED DATE: 6/20/1999	INSP DATE: 6/4/1999

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 9902022 MINOR FAILURE - NO PRODUCT LEAKAGE END
CALLERREMARK - 9902022

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: SCOTT ECKERT
TELEPHONE: (716) 878-3143

SPILLER: SUNY COLLEGE AT BUFFALO
DAVID MILLER
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-

TELEPHONE:

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 6/23/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 9902022 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 05/24/99: JFO TELECON DAVID MILLER OF SUNY. WHILE UPGRADING TANK. THE TOP OF THE TANK WAS CRACKED. WATER IS ENTERING THE TANK. NO LOSS OF PRODUCT. OGS IS BRINGING IN ELMWOOD TANK TO ASSESS DAMAGE AND REPAIR IF POSSIBLE. IF NOT, THE TANK WILL BE TAKEN OUT OF SERVICE. MR MILLER WILL KEEP ME INFORMED. 05/27/99: JFO TELECON FROM SCOTT ECKERT. ELMWOOD TANK WILL BE ON SITE TOMORROW TO UNCOVER TANK TO ACCESS DAMAGE. 05/28/99: JFO ON SITE, MET SCOTT ECKERT. ELMWOOD TANK DID NOT SHOW UP. 06/01/99: JFO TELECON FROM JOE SALM OF ELMWOOD TANK. THEY ARE ON SITE. THEY UNCOVERED FILL PIPE, NO DAMAGE, THEY WILL CONTINUE TOMORROW. 06/02/99: JFO ON SITE, MET ELMWOOD TANK CREW. THEY ARE TESTING LINES. 06/04/99: JFO TELECON JOE SALM OF ELMWOOD TANK. THEY WILL BE RETESTING TANK TODAY AT 11:00. I WILL VISIT SITE FOR RETEST, RESULTS TO FOLLOW. 06/18/99: JFO RECEIVED COPY OF RETEST (PASSED). NO FURTHER ACTION REQUIRED. CLOSED
END DECRemark - 9902022

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 254 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: ELMWOOD AVENUE	ID1: 8911283
BUFFALO NY	ID2: 330725
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 2/28/1990	DATE REPORTED: 2/28/1990
CLOSED DATE: 2/28/1990	INSP DATE: 2/28/1990

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 1 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 1 G

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: OTHER
CALLER REMARKS: START CALLERREMARK - 8911283 LINE LEAK, NOTIFIED BY CONTRACTOR END
CALLERREMARK - 8911283

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: ROSS
SPILL CONTACT:
TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE

ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-1095

TELEPHONE: (716) 878-6653

REPORTED BY: OTHER

LAST DEC UPDATE: 7/25/2000
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8911283 Prior to Sept, 2004 data translation this spill Lead_DEC Field was LQR 02/28/90: LQR ON SITE SPILLER
CONTRACTOR REMOVING AND REPLACING PIPING. END DECRemark - 8911283

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 21 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: STATE UNIVERSITY COLLEGE AT BUFFALO	REV: 6/6/06
ADDRESS: ELMWOOD AVE	ID1: NYD071486211
BUFFALO NY 14222	ID2:
ERIE	STATUS: LGN
CONTACT: DAVID N MILLER	PHONE: 7168786113

SITE INFORMATION

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS
61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS
61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS
61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS
61131 - COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	4/3/1990
TYPE:	120 - WRITTEN INFORMAL		
 AGENCY:	S - STATE	DATE:	11/2/1999
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	3/29/1990	DETERMINED BY:	S - STATE

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 21 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: STATE UNIVERSITY COLLEGE AT BUFFALO	REV: 6/6/06
ADDRESS: ELMWOOD AVE	ID1: NYD071486211
BUFFALO NY 14222	ID2:
ERIE	STATUS: LGN
CONTACT: DAVID N MILLER	PHONE: 7168786113

CITATION:
RESOLVED: 7/26/1990
TYPE: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	10/14/1999	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	1/28/2000		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

HAZARDOUS WASTE INFORMATION:

Carbon tetrachloride
Selenium
Ignitable waste
The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to
The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane
1,4-Dichlorobenzene
Silver
Mercury
Reactive waste
Nitrogen dioxide (OR) Nitrogen oxide NO2
Benzene
The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichloroethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl
Lead
Trichloroethylene
Chromium
Corrosive waste
Cyanides (soluble cyanide salts), not otherwise specified
Diisopropylfluorophosphate (DFP) (OR) Phosphorofluoric acid, bis(1-methylethyl) ester
Hexachloroethane
The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 187 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: SUNY COLLEGE ADDRESS: 1300 ELMWOOD AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9902022 ID2: 204504 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 5/21/1999	DATE REPORTED: 5/21/1999
CLOSED DATE: 6/20/1999	INSP DATE: 6/4/1999

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: TANK TESTER

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT: SCOTT ECKERT
TELEPHONE: (716) 878-3143

SPILLER: SUNY COLLEGE AT BUFFALO
DAVID MILLER
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-

TELEPHONE:

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 6/23/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9902022 MINOR FAILURE - NO PRODUCT LEAKAGE END
CALLERREMARK - 9902022

DEC REMARKS:

Start DECRemark - 9902022 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 05/24/99: JFO TELECON DAVID MILLER OF SUNY. WHILE UPGRADING TANK. THE TOP OF THE TANK WAS CRACKED. WATER IS ENTERING THE TANK. NO LOSS OF PRODUCT. OGS IS BRINGING IN ELMWOOD TANK TO ASSESS DAMAGE AND REPAIR IF POSSIBLE. IF NOT, THE TANK WILL BE TAKEN OUT OF SERVICE. MR MILLER WILL KEEP ME INFORMED. 05/27/99: JFO TELECON FROM SCOTT ECKERT. ELMWOOD TANK WILL BE ON SITE TOMORROW TO UNCOVER TANK TO ACCESS DAMAGE. 05/28/99: JFO ON SITE, MET SCOTT ECKERT. ELMWOOD TANK DID NOT SHOW UP. 06/01/99: JFO TELECON FROM JOE SALM OF ELMWOOD TANK. THEY ARE ON SITE. THEY UNCOVERED FILL PIPE, NO DAMAGE, THEY WILL CONTINUE TOMORROW. 06/02/99: JFO ON SITE, MET ELMWOOD TANK CREW. THEY ARE TESTING LINES. 06/04/99: JFO TELECON JOE SALM OF ELMWOOD TANK. THEY WILL BE RETESTING TANK TODAY AT 11:00. I WILL VISIT SITE FOR RETEST, RESULTS TO FOLLOW. 06/18/99: JFO RECEIVED COPY OF RETEST (PASSED). NO FURTHER ACTION REQUIRED. CLOSED
END DECRemark - 9902022

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 187	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: SUNY COLLEGE ADDRESS: 1300 ELMWOOD AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9902022 ID2: 204504 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 186 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: SUNY COLLEGE ADDRESS: 1300 ELMWOOD AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8911892 ID2: 204503 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 3/15/1990	DATE REPORTED: 3/15/1990
CLOSED DATE: 3/21/1990	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 L
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: YES	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: HUMAN ERROR
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: COOKE
SPILL CONTACT:
TELEPHONE:

SPILLER: SUNY COLLEGE AT BUFFALO

ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY

TELEPHONE: (716) 878-6333

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 4/10/1990
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 8911892 PROPANE LEAK AT VALVE END CALLERREMARK - 8911892

DEC REMARKS:
Start DECRemark - 8911892 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 03/21/90: FIRE DEPT SECURED AREA AND REMOVED DANGER. NO CLEANUP POSSIBLE. PROPANE VENTED OFF. NO FURTHER REQUIRED. 09/29/95: This is additional information

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 186

DIST/DIR: 0.10 SW

MAP ID: 68

NAME: SUNY COLLEGE
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 8911892
ID2: 204503
STATUS: CLOSED
PHONE:

CONTACT:

about material spilled from the translation of the old spill file: PROPANE GAS. END DECRemark - 8911892

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 184 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: NEW BUILDING CONSTRUCTION AREA	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVENUE	ID1: 0751064
BUFFALO NY	ID2: 389352
ERIE	STATUS: ACTIVE
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/1/2007	DATE REPORTED: 11/2/2007
CLOSED DATE: 12:00:00 AM	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN

WATERBODY AFFECTED:

SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER

REPORTED BY: RESPONSIBLE PARTY

REGION: 9

UST TRUST? NO

SPILL INVESTIGATOR: fxgalleg

SPILL CONTACT: JOHN BLEECH

TELEPHONE: (716) 341-7240

SPILLER: BUFFALO STATE COLLEGE

JOHN BLEECH

ADDRESS: 1300 ELMWOOD AVENUE

BUFFALO, NY 14222

TELEPHONE: (716) 341-7420

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 1/22/2008

CLEAN UP MEET STANDARDS? NO

PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0751064 AREA OF CONCERN IS THE CONSTRUCTION SITE FOR A NEW BUILDING. SJB SERVICES INSTALLED BORINGS FOR SOIL LOADING PURPOSES. ONE OF THE BORINGS HAD A PETROLEUM ODOR FROM 6 TO 12 FT. IN DEPTH. THEY WILL BE DOING ADDITIONAL INVESTIGATIVE WORK TO DETERMINE THE EXTENT AND PERFORMING THE CLEANUP DURING CONSTRUCTION. DAVE STEINER IS THE CONTACT FROM SJB. END CALLERREMARK - 0751064

DEC REMARKS:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 184	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: NEW BUILDING CONSTRUCTION AREA
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 0751064
ID2: 389352
STATUS: ACTIVE
PHONE:

Start DECRemark - 0751064 11/2/07 FG SPOKE TO JOHN BLEECH WITH BUFFALO STATE COLLEGE. HE SAID BUFFALO STATE WILL BE BUILDING IN THIS AREA IN ABOUT ONE YEAR. THEY WILL PROPERLY DISPOSE OF THE PETROLEUM CONTAMINATED SOIL AT THAT TIME. THEY WILL THEN COLLECT EXCAVATION SAMPLES FOR 8260 AND 8270 STARS. THE DISPOSAL RECEIPTS AND EXCAVATION SAMPLES WILL BE SUBMITTED. MR. BLEECH WILL SUBMIT THE BORING LOGS COMPLETED BY SJB AND THE ANALYTICAL RESULTS FROM A SAMPLE OF THE MATERIAL. END DECRemark - 0751064

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 180 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVE	ID1: 9975398
BUFFALO NY	ID2: 226552
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/7/1999	DATE REPORTED: 9/7/1999
CLOSED DATE: 11/9/1999	INSP DATE: 9/10/1999

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 200 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 200 G

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: YES
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE
DAVE MILLER
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-1095

TELEPHONE: (716) 878-6653

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9975398 20 X 40 AREA OF CONTAMINATION FOUND ON THE GROUND WHILE DOING DEMOLISHING, SUSPECT UST.. END CALLERREMARK - 9975398

DEC REMARKS:
Start DECRemark - 9975398 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 09/07/99: MF SITE INSPECTION, (AM) MET FRANK BODAMI, MIKE KURBAN, LEBIS ENTERPRISES, MAIN CONTRACTOR AND JOE BALL, DAVE MILLER, BUFFALO STATE

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 180 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE ADDRESS: 1300 ELMWOOD AVE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9975398 ID2: 226552 STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

COLLEGE (BSC), POOL OF 6 OIL, APPX 200 GALLONS IN LOW SPOT WHERE A SHEET METAL PROCESSING FACILITY WAS DEMOLISHED TO CONSTRUCT A PARKING LOT. OIL BERMED OFF, BSC TO CONTACT OGS. EXPLAINED REMEDIATION MUST PROCEED ASAP. THEY WILL VAC OIL and LOOK FOR A UST. 09/07/99: MF SITE INSPECTION (PM) MET DAVE MENDEL, TEG. BISON WASTE CALLED and WILL VAC UP MATERIAL. SAMPLE SENT TO WASTE STREAM TO ID IT and DO A PCB TEST. EXPECT DIGGING TO START TOMORROW. EXPLAINED TO DAVE MILLER WHAT MUST BE DONE. 09/08/99: MF SENT LETTER. 09/10/99: FG SITE INSPECTION. UST WAS BEING PULLED, ESTIMATED SIZE IS 6000 GALLON - 72 INCH DIAMETER BY 14 FT LONG. HOLES WERE NOTED IN THE UST. CONTAMINATION WAS FOUND UNDER THE UST. NATIVE SOIL BELOW AND ON THE SIDES OF THE UST ARE CLAY. ALL CONTAMINATED SOIL WILL BE REMOVED. THE SIDEWALLS AND THE BOTTOM WILL BE SAMPLED FOR 8021 and 8270 STARS. BISON WAS ON SITE PUMPING OUT THE UST. 2500 GALLONS WERE PUMPED OUT INITIALLY FROM THE SURFACE, ANOTHER 2400 GALLONS WERE PUMPED OUT FROM THE SURFACE THE 3600 GALLONS OF OIL/WATER WERE PUMPED OUT OF THE UST TODAY. ROGER WITH IWS WAS ON SITE AND BOB OSSMAN WITH IT WAS ON SITE. THE UST WILL BE CUT OPEN and CLEANED OUT. BISON WILL TAKE ALL MATERIAL FROM THE UST. THE REMAINDER WILL BE PLACED ON THE SOIL PILE, SO THERE WILL BE NO DRUMMED WASTE FOR DISPOSAL. THE SOIL WILL BE DISPOSED OF BY TUESDAY OF NEXT WEEK. 10/05/99: MF SENT FIRST DISPOSAL and SAMPLING LETTER, DUE 11/15/99. 10/14/99: MF RECEIVED SOIL DISPOSAL RECEIPTS. WAITING FOR EXCAVATION TEST RESULTS. 10/25/99: MF TELETON TO OWEN BYRNE OF OGS, NOT IN, LEFT MESSAGE FOR EXCAVATION TEST RESULTS. 10/27/99: MF SENT LETTER TO OGS FOR SAMPLE RESULTS, DUE 11/15/99. 11/09/99: MF RECEIVED EXCAVATION SAMPLE RESULTS, 8021 and 8270 BN S, BELOW STARS. NO FURTHER ACTION NECESSARY. LETTER SENT. END DECRemark - 9975398

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 182 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE/NYS	REV: 2/5/08
ADDRESS: ELMWOOD AVENUE	ID1: 9310026
BUFFALO NY	ID2: 330729
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/9/1993	DATE REPORTED: 11/9/1993
CLOSED DATE: 8/10/1994	INSP DATE: 7/28/1994

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 L
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 L

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: FXGALLEG
SPILL CONTACT:
TELEPHONE:

SPILLER: NYSOGS - SUNY
ADDRESS: PO BOX 268
ALDEN, NY 14004

TELEPHONE:

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 10/8/1999
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9310026 300-GAL. FUEL TANK FOUND LEAKING AFTER REMOVAL.
END CALLERREMARK - 9310026

DEC REMARKS:
Start DECRemark - 9310026 Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 11/11/93: SAC/DAVE MILLER, BUFF STATE/BILL KITCHEN, OGS/SITE - VISIBLE CONTAMINATION IN EXCAVATION. ADVISED TO REMOVE ALL VISIBLE CONTAMINATION.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 182	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE/NYS
ADDRESS: ELMWOOD AVENUE
BUFFALO NY
ERIE
CONTACT:

REV: 2/5/08
ID1: 9310026
ID2: 330729
STATUS: CLOSED
PHONE:

OGS TO FURTHER EVALUATE BUILDING SITUATION. 07/13/94: OGS/BILL KITCHEN SAID SOIL HAS BEEN DISPOSED OF. HE IS WAITING TO RECEIVE DISPOSAL RECEIPTS WHICH WILL THEN BE SUBMITTED TO THIS OFFICE. 08/10/94: DISPOSAL RECEIPTS SUBMITTED FOR SOIL FROM SPILL. SITE CAN BE CLOSED. END DECRemark - 9310026

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 178 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVE MOORE WEST COMPLEX	ID1: 0750778
BUFFALO NY	ID2: 386532
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 8/28/2007	DATE REPORTED: 8/29/2007
CLOSED DATE: 9/4/2007	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: HYDRAULIC OIL	AMOUNT SPILLED: 10 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 10 G

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: YES

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: RESPONSIBLE PARTY

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: jfoto
SPILL CONTACT: CHRIS KOFFMAN
TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE
JOHN BLEACH
ADDRESS: 1300 ELMWOOD AVE
BUFFALO, NY

TELEPHONE: (716) 878-6136

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 9/4/2007
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0750778 HYDRAULIC FLUID (APPROX. 10 GALLONS)LEAKED FROM A CYLINDER ON THE ELEVATOR TO THE SOIL IN THE CYLINDER PIT. THE ELEVATOR HAS BEEN PLACED OUT OF SERVICE. THEY WILL CONTACT THE VENDER OTIS ELEVATOR MAINTENANCE. END CALLERREMARK - 0750778

DEC REMARKS:
Start DECRemark - 0750778 09/04/07 JFO E-MAIL FROM FG. SHE REC D A CALL FROM MR BLEECH. THEY RECOVERED 8-10 GALLONS

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 178	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE ADDRESS: 1300 ELMWOOD AVE MOORE WEST COMPLEX BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0750778 ID2: 386532 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

OF OIL FROM THE SHAFT. THE 2 GALLONS REMAINING ARE 40 DEEP AND ARE NOT ACCESSIBLE. NO FURTHER CLEANUP IS
POSSIBLE. CLOSED THERE IS NO PAPER FILE FOR THIS SPILL END DECRemark - 0750778

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 179 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVENUE	ID1: 9906828
BUFFALO NY	ID2: 204505
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 9/8/1999	DATE REPORTED: 9/8/1999
CLOSED DATE: 10/7/1999	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: 6 FUEL OIL	AMOUNT SPILLED: 200 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 200 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: EQUIPMENT FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: FEDERAL GOVERNMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT: OWEN BYRNE
TELEPHONE: (716) 674-0437

SPILLER: BUFFALO STATE COLLEGE
DAVID MILLER
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY

TELEPHONE: (716) 878-6113

REPORTED BY: FEDERAL GOVERNMENT

LAST DEC UPDATE: 3/21/2002
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9906828 DAMAGE DURING CONSTRUCTION - CLEANUP
CONTRACTOR HAS BEEN HIRED END CALLERREMARK - 9906828

DEC REMARKS:
Start DECRemark - 9906828 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 09/10/99: MF TELECON FROM DAVE MILLER WITH BUFF STATE, HE STATED THAT THE TANK CONTENTS ARE NOW BEING PUMPED OUT. THE TANK SIZE IS ESTIMATED AT 6000

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 179	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE
ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9906828
ID2: 204505
STATUS: CLOSED
PHONE:

GALLONS. THEY PLAN ON PULLING THE UST TODAY AND WILL REQUIRE AN INSPECTION. 09/10/99: MF TELECON FROM OWEN BYRNE WITH OGS, HE STATED THE UST WILL BE REMOVED TODAY. 10/07/99: MF NOTE, THIS SPILL IS DUPLICATE OF SPILL 9975398. 9975398 IS STILL ACTIVE. NO FURTHER ACTION ON THIS SPILL NECESSARY. END DECRemark - 9906828

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 181 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE	REV: 2/5/08
ADDRESS: ELMWOOD AVENUE	ID1: 8911283
BUFFALO NY	ID2: 330725
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 2/28/1990	DATE REPORTED: 2/28/1990
CLOSED DATE: 2/28/1990	INSP DATE: 2/28/1990

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 1 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 1 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: TANK FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER
REPORTED BY: OTHER

REGION: 9
UST TRUST? YES

SPILL INVESTIGATOR: ROSS
SPILL CONTACT:
TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE

ADDRESS: 1300 ELMWOOD AVENUE
BUFFALO, NY 14222-1095

TELEPHONE: (716) 878-6653

REPORTED BY: OTHER

LAST DEC UPDATE: 7/25/2000
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 8911283 LINE LEAK, NOTIFIED BY CONTRACTOR END
CALLERREMARK - 8911283

DEC REMARKS:
Start DECRemark - 8911283 Prior to Sept, 2004 data translation this spill Lead_DEC Field was LQR 02/28/90: LQR ON SITE SPILLER
CONTRACTOR REMOVING AND REPLACING PIPING. END DECRemark - 8911283

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 181	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE COLLEGE ADDRESS: ELMWOOD AVENUE BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8911283 ID2: 330725 STATUS: CLOSED PHONE:
---------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 183 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE-UPTON HALL	REV: 2/5/08
ADDRESS: 1300 ELMWOOD AVE	ID1: 0175417
BUFFALO NY	ID2: 226551
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 11/1/2001	DATE REPORTED: 11/14/2001
CLOSED DATE: 1/10/2002	INSP DATE: 11/19/2001

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: UNKNOWN

WATERBODY AFFECTED:

SOURCE OF SPILL: INSTITUTIONAL, EDUCATIONAL, GOV., OTHER

REPORTED BY: RESPONSIBLE PARTY

REGION: 9

UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO

SPILL CONTACT:

TELEPHONE:

SPILLER: BUFFALO STATE COLLEGE

DAVID MILLER

ADDRESS: 1300 ELMWOOD AVENUE

BUFFALO, NY

TELEPHONE: (716) 878-6113

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 3/21/2002

CLEAN UP MEET STANDARDS? NO

PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0175417 CALLER WAS DIGGING TO INSTALL A COLUMN IN AN OLD BOMB SHELTER AT UPTON HALL AND DISCOVERED OIL CONTAMINATION. END CALLERREMARK - 0175417

DEC REMARKS:

Start DECRemark - 0175417 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 11/19/01 JFO ON SITE MET WITH DAVE MILLER. OIL DROPLETS KEEP APPEARING ON WATER AROUND THE COLUMN TO BE REINFORCED. A SAMPLE WAS COLLECTED

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 183	DIST/DIR: 0.10 SW	MAP ID: 68
-----------------------	--------------------------	-------------------

NAME: BUFFALO STATE-UPTON HALL
ADDRESS: 1300 ELMWOOD AVE
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 0175417
ID2: 226551
STATUS: CLOSED
PHONE:

CONTACT:

(ANALYZE FOR 310.13) TO IDENTIFY THE OIL. THEY CUT THROUGH THE FLOOR TO THE NORTH, SOUTH, EAST AND WEST OF THE COLUMN. SAMPLES WILL BE COLLECTED AND WILL BE ANALYZED FOR 8021 AND 8270 IF IT IS DETERMINED THAT IT IS A PETROLEUM PRODUCT. RESULTS TO FOLLOW. 12/06/01 JFO REC D A SITE UPDATE. THE LAB IDENTIFIED THE OIL AS 6 FUEL OIL. SAMPLES WERE COLLECTED AND SENT TO THE LAB. THEY HAVE NO RECORD OF USING 6 OIL ON THIS SITE. AN OUTSIDE CONSULTANT BELIEVES THE MATERIAL MAY BE AN EXCESSIVE AMOUNT OF FORM OIL USED WHEN CONSTRUCTING THE CONCRETE PILLAR. 01/10/02 JFO RECEIVED ANALYTICAL RESULTS FOR THE SAMPLES COLLECTED DECEMBER 6, 2001. ALL FOUR 8021 S ARE NON-DETECT. THE N,S and E 8270 S ARE NON-DETECT. THE WEST SAMPLE ID WS89754 IS OVER TAGMS ON ONLY 1 COMPOUND, RESULTS LIMIT BENZO[A]PYRENE 89PPB 61PPB I REVIEWED WITH SAL C. WE AGREED THAT THIS SITE CAN BE INACTIVE . INACTIVE LETTER IS ATTACHED. CLOSED END DECRemark - 0175417

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 222 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE ADDRESS: BUFFALO STATE COLLEGE BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8605107 ID2: STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 11/10/86	DATE REPORTED: 11/10/86
SPILL TIME: 17:00	TIME REPORTED: 17:45

MATERIAL SPILLED: ASBESTOS	AMOUNT SPILLED: 0
MATERIAL CLASS: HAZARDOUS	AMOUNT RECOVERED: 0

CAUSE OF SPILL: OTHER
RESOURCE AFFECTED: AIR
WATERBODY AFFECTED:
SOURCE OF SPILL: NON-COMMERCIAL/INSTITUTIONAL
REPORTED BY: CITIZEN
CALLER REMARKS:
SUSPECTED ASBESTOS IN AIR FROM BUILDING RENOVATION

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: RNL	TELEPHONE:
SPILL CONTACT:	

SPILLER: NONE
ADDRESS:

SPILLER CONTACT:	TELEPHONE:
-------------------------	-------------------

CALLER: AGENCY: TELEPHONE:	NOTIFIER: AGENCY: TELEPHONE:
-------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 01/14/87	CLOSE DATE: 01/13/87
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

/ / : REFERED TO AIR RESOUCES H.SANDANTO 11/12/86. / / : REFERED TO AIR,H. SANDANTO, 11/12/86; AIR, H. SANDANTO, SATISFIED 01/13/87, MATERIAL WAS NOT ASBESTOS, NO CLEANUP REQUIRED.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 241 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE (SUNY) ADDRESS: 1300 ELMWOOD AVE BUFFALO NY 14222 ERIE CONTACT: DAVID N. MILLER	REV: 2/5/08 ID1: PBS9-049115 ID2: STATUS: ACTIVE PHONE: (716) 878-6333
----------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: SCHOOL
TYPE NAME:
TOTAL NUMBER OF TANKS: 16
NUMBER OF ACTIVE TANKS: 11
NUMBER OF INACTIVE TANKS: 5
TOTAL FACILITY CAPACITY: 268575 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: SUNY (STATE GOVERNMENT)
COMPANY: BUFFALO STATE COLLEGE (SUNY)
TITLE: DIRECTOR, ENVIRONMENTAL HEALTH and SAFETY
NAME: DAVID N. MILLER
ADDRESS: 1300 ELMWOOD AVE
NY 14222
PHONE: (716) 878-6333
EMERGENCY CONTACT: UNIVERSITY POLICE DEPT.
PHONE: (716) 878-6333

MAILING INFORMATION

COMPANY: BUFFALO STATE COLLEGE (SUNY)
TITLE:
CONTACT: DAVID N MILLER
ADDRESS: 1300 ELMWOOD AVE D C 206
BUFFALO NY 14222
PHONE: (716) 878-6113
EMAIL: MILLERDN BUFFALOSTATE.EDU

EXP. DATE: 12/2/2011
RENEWAL DATE: 10/17/1991

COMMENTS: 05/21/01 Telecon w/David Miller - galvanized piping to be replaced with non-corroding material. Information update will follow. PFK 06/25/01 Diesel line changed to Omniflex piping (Total Containment) in 11/00. Unleaded changed in 05/01 - Omniflex also. PFK 07/30/02 Joe Ball (878-6111), contact for daily operations. PFK

TANK INFORMATION

TANK NUMBER: 531	TANK STATUS: IN SERVICE
ACTIVE STATUS: ACTIVE	INSTALLED: 1/1/1949
CLOSED: 12:00:00 AM	TANK CAPACITY: 42000 GALLONS
PRODUCT: 6 FUEL OIL	

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 241 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE (SUNY) ADDRESS: 1300 ELMWOOD AVE BUFFALO NY 14222 ERIE CONTACT: DAVID N. MILLER	REV: 2/5/08 ID1: PBS9-049115 ID2: STATUS: ACTIVE PHONE: (716) 878-6333
----------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: OTHER
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 532	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 1/1/1949	
CLOSED: 12:00:00 AM	TANK CAPACITY: 42000 GALLONS	
PRODUCT: 6 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: OTHER
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 533	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 1/1/1949	
CLOSED: 12:00:00 AM	TANK CAPACITY: 42000 GALLONS	
PRODUCT: 6 FUEL OIL		

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 241 **DIST/DIR:** 0.10 SW **MAP ID:** 68

NAME: BUFFALO STATE COLLEGE (SUNY) ADDRESS: 1300 ELMWOOD AVE BUFFALO NY 14222 ERIE CONTACT: DAVID N. MILLER	REV: 2/5/08 ID1: PBS9-049115 ID2: STATUS: ACTIVE PHONE: (716) 878-6333
----------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: OTHER
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 534	TANK STATUS: IN SERVICE	
ACTIVE STATUS: ACTIVE	INSTALLED: 1/1/1949	
CLOSED: 12:00:00 AM	TANK CAPACITY: 42000 GALLONS	
PRODUCT: 6 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: UNDERGROUND
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: PAINTED/ASPHALT COATING
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: UNDERGROUND/ON-GROUND
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: NONE
SECONDARY CONTAINMENT 2:
LEAK DETECTION: NONE
LEAK DETECTION 2:

OVERFILL PROTECTION: OTHER
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

HOSPITAL										
<table style="width: 100%;"><tr><td style="width: 33%;">SEARCH ID: 282</td><td style="width: 33%;">DIST/DIR: 0.11 NE</td><td style="width: 33%;">MAP ID: 75</td></tr></table>	SEARCH ID: 282	DIST/DIR: 0.11 NE	MAP ID: 75							
SEARCH ID: 282	DIST/DIR: 0.11 NE	MAP ID: 75								
<table style="width: 100%;"><tr><td style="width: 50%;">NAME: SISTERS HOSPITAL</td><td style="width: 50%;">REV: 1/1/05</td></tr><tr><td>ADDRESS: NY</td><td>ID1: NY-102984</td></tr><tr><td> ERIE</td><td>ID2:</td></tr><tr><td>CONTACT:</td><td>STATUS:</td></tr><tr><td></td><td>PHONE:</td></tr></table>	NAME: SISTERS HOSPITAL	REV: 1/1/05	ADDRESS: NY	ID1: NY-102984	ERIE	ID2:	CONTACT:	STATUS:		PHONE:
NAME: SISTERS HOSPITAL	REV: 1/1/05									
ADDRESS: NY	ID1: NY-102984									
ERIE	ID2:									
CONTACT:	STATUS:									
	PHONE:									
DETAILS NOT AVAILABLE										

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 189 **DIST/DIR:** 0.11 NE **MAP ID:** 76

NAME: ROADSIDE CONTAINER	REV: 2/5/08
ADDRESS: 5 NOTTINGHAM AMHERST	ID1: 0375104
BUFFALO NY	ID2: 199807
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 5/28/2003	DATE REPORTED: 5/28/2003
CLOSED DATE: 10/23/2003	INSP DATE: 5/28/2003

MATERIAL SPILLED: UNKNOWN MATERIAL	AMOUNT SPILLED: 5 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 5 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: ABANDONED DRUMS
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
ZZ -

TELEPHONE:

REPORTED BY: FIRE DEPARTMENT

LAST DEC UPDATE: 8/13/2004
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? YES

CALLER REMARKS: START CALLERREMARK - 0375104 5 GALLON CONTAINER ON THE ROADSIDE. NOT LEAKING. ON THE CONTAINER IT SAYS WASH AND DESTROY. END CALLERREMARK - 0375104

DEC REMARKS:

Start DECRemark - 0375104 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 05/28/03 JFO ON SCENE MET WITH THE RESIDENCE AT 5 AND 7 NOTTINGHAM. THEY SAID THE CONTAINER HAS BEEN ON THE CURB FOR ABOUT A WEEK. I HIRED

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 189	DIST/DIR: 0.11 NE	MAP ID: 76
-----------------------	--------------------------	-------------------

NAME: ROADSIDE CONTAINER ADDRESS: 5 NOTTINGHAM AMHERST BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0375104 ID2: 199807 STATUS: CLOSED PHONE:
------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

OP-TECH TO HANDLE THE CONTAINER. THERE IS NO SPILLAGE. HE SAMPLED THE MATERIAL, OVERPACKED WITH A 30 GALLON DRUM AND HAS PERMISSION TO STAG AT THE BUFFALO SEWER AUTHORITY. HAULERS PERMIT ISSUED. 06/20/03 DEC REC D PAY PACK FROM LIFE SCIENCE FOR ANALYTICAL 11.39. SUBMITTED TO FG. 08/18/03 JFO REC D A PP FROM OP-TECH FOR WORK DONE ON MAY 19 AND JULY 23 FOR \$358.66. SUBMITTED TO FG. 08/29/03 JFO RECEIVED THE DISPOSAL RECEIPT FOR THE DRUM. 10/17/03 JFO REC D PP FROM OPTECH FOR 374.06 FOR PICK UP, DELIVERY AND DISPOSAL. (WORK DONE ON 7/30-31/03). NO FURTHER ACTION REQUIRED. CLOSED END DECRemark - 0375104

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

AIRS

SEARCH ID: 275 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: FORMER PRATT AND LAMBERT FACILITY	REV: 1/12/08
ADDRESS: 75 TONAWANDA STREET	ID1: NY0008021
BUFFALO NY 14207	ID2: 9140200430
ERIE	STATUS: AIRS DATABASE
CONTACT:	PHONE:

OPERATING STATUS: T
YEAR MEASURED: 90
PRINCIPAL PRODUCT:
LAST UPDATED: 7/15/2002
AMBIENT MONITORING:
SOURCE MONITORING EQUIP:
STATE IMPLIMENTED PROG: OZONE
PLANT DESC: PAINTS AND ALLIED PRODUCT

ERNS

SEARCH ID: 46 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: LEHIGH CONSTRUCTION	REV:
ADDRESS: 75 TONAWANDA ST	ID1: 396919
BUFFALO NY 14207	ID2:
ERIE	STATUS: UNKNOWN
CONTACT:	PHONE:

CERCLIS (Y/N):

MAT: AROMATIC 100 **QUANT:** 5 GALLONS

LOCATION: 75 TONAWANDA ST
CITY: **REPORTED:** 08/17/94

SOURCE: UNKNOWN **MEDIUM:** AIR
1 1/2 INCH PIPE/RESIDUAL MATERIAL WAS RELEASED DUE TO PIPE REMOVAL

CAUSE: UNKNOWN

ACT: DEPLOYING BOOMS/WILL CLEAN UP MATERIAL USING A SKIMMER AND ABSOR
BY:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 78	DIST/DIR: 0.11 NW	MAP ID: 72
----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT
ADDRESS: 75 TONAWANDA ST
BUFFALO NY 14207
Erie
CONTACT:

REV:
ID1: NYD002113322
ID2:
STATUS:
PHONE:

RCRIS : NYD002113322
PCS :
AFS/AIRS : 360291143, 3602900090
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS : 0055010
STATE :
PADS :
TRIS : 14207PRTTL75TON
DandB : 002113322
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 61 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: FORMER PRATT AND LAMBERT FACILITY ADDRESS: 75 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000881109 ID2: 14207PRTTTL75TON STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 9/23/1991 ENFORCEMENT ACT: REG PROGRAM: TRANSPORTER - HAZARDOUS WASTE HANDLERS ENGAGED IN THE TRANSPORTATION OF HAZARDOUS WASTE.	PROGRAM ID: NYD002113322 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: EPA INSPECTION LAST EXTRACTED:
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 9/23/1991 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002113322 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: EPA INSPECTION LAST EXTRACTED:
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------

LQG - HAZARDOUS WASTE LARGE QUANTITY GENERATORS GENERATE: (A) 1,000 KG OR MORE OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (B) MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (C) MORE THAN 100 KG OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH; OR (D) 1 KG OR LESS OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1 KG OF ACUTELY HAZARDOUS WASTE AT ANY TIME; OR (E) 100 KG OR LESS OF ANY RESIDUE OR CONTAMINATED SOIL, WASTE OR OTHER DEBRIS RESULTING FROM THE CLEANUP OF A SPILL, INTO OR ON ANY LAND OR WATER, OF ACUTELY HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATED MORE THAN 100 KG OF THAT MATERIAL AT ANY TIME.

PROGRAM: AIRS/AFS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 10/25/1999 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 3602900090 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: AIRS/AFS LAST EXTRACTED: 8/23/2002 4:07:02 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------

AIR MINOR - A FACILITY IS CLASSIFIED AS A CLEAN AIR ACT STATIONARY SOURCE MINOR DISCHARGER OF AIR POLLUTANTS IF: (A) POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR; OR (B) MAJOR SOURCE THRESHOLDS ARE NOT DEFINED, OR CLASSIFICATION IS UNKNOWN.

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110000881109 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL:	PROGRAM ID: NYD002113322 AGENCY INTERESTED: INTEREST ENDED:
-------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 61 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: FORMER PRATT AND LAMBERT FACILITY ADDRESS: 75 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 11/1/06 ID1: 110000881109 ID2: 14207PRTTL75TON STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------

INT END QUAL:	SOURCE OF DATA:	IMPLEMENTER
LAST REPORTED: 9/23/1991	LAST EXTRACTED:	5/18/2003 1:46:24 AM

ENFORCEMENT ACT:

REG PROGRAM: TSD - A HAZARDOUS WASTE TREATMENT, STORAGE, AND DISPOSAL (TSD) FACILITY PERFORMS ONE OR MORE OF THE FOLLOWING FUNCTIONS: (1) TREATMENT: ANY METHOD, TECHNIQUE, OR PROCESS, INCLUDING NEUTRALIZATION, DESIGNED TO CHANGE THE PHYSICAL, CHEMICAL OR BIOLOGICAL CHARACTER OR COMPOSITION OF ANY HAZARDOUS WASTE SO AS TO NEUTRALIZE SUCH WASTE, OR SO AS TO RECOVER ENERGY OR MATERIAL RESOURCES FROM THE WASTE, OR SO AS TO RENDER SUCH WASTE NON-HAZARDOUS, OR LESS HAZARDOUS; SAFER TO TRANSPORT, STORE OR DISPOSE OF; OR AMENABLE FOR RECOVERY, AMENABLE FOR STORAGE, OR REDUCED IN VOLUME. (2) STORAGE: THE HOLDING OF HAZARDOUS WASTE FOR A TEMPORARY PERIOD, AT THE END OF WHICH THE HAZARDOUS WASTE IS TREATED, DISPOSED OF, OR STORED ELSEWHERE. (3) DISPOSAL: THE DISCHARGE, DEPOSIT, INJECTION, DUMPING, SPILLING, LEAKING, OR PLACING OF ANY SOLID WASTE OR HAZARDOUS WASTE INTO OR ON ANY LAND OR WATER SO THAT SUCH SOLID WASTE OR HAZARDOUS WASTE OR ANY CONSTITUENT THEREOF MAY ENTER THE ENVIRONMENT OR BE EMITTED INTO THE AIR OR DISCHARGED INTO ANY WATERS, INCLUDING GROUNDWATERS.

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 9-1402-00430 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 3:07:48 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: NEI PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NEINY0291143 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NEI LAST EXTRACTED: 6/14/2005 11:12:57 AM
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: CRITERIA AND HAZARDOUS AIR POLLUTANT INVENTORY

PROGRAM: RCRINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 2/28/1998 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002113322 AGENCY INTERESTED: 12/31/1989 INTEREST ENDED: 1/1/1999 SOURCE OF DATA: RCRINFO LAST EXTRACTED: 2/13/2004 6:35:04 PM
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER

PROGRAM: TRIS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 7/9/1997 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 14207PRTTL75TON AGENCY INTERESTED: 12/31/1987 INTEREST ENDED: 1/1/1997 SOURCE OF DATA: TRI REPORTING FORM LAST EXTRACTED:
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: TRI REPORTER - A TOXIC RELEASE INVENTORY REPORTER IS A FACILITY WHICH: EMPLOYS THE EQUIVALENT OF 10 OR MORE FULL-TIME EMPLOYEES; AND IS INCLUDED IN STANDARD INDUSTRIAL CLASSIFICATION (SIC) CODES 10XX, 12XX, 20XX-39XX, 4911, 4931, 4939, 4953, 5169, 5171, OR 7389; AND MANUFACTURES (DEFINED TO INCLUDE IMPORTING), PROCESSES, OR OTHERWISE USES ANY EMERGENCY PLANNING AND COMMUNITY RIGHT-TO-KNOW ACT (EPCRA) SECTION 313

- Continued on next page -

JOB: 5466

SEARCH ID: 61 **DIST/DIR:** 0.11 NW **MAP ID:** 72

FEDERAL FACILITY:	NO
FEDERAL AGENCY:	
TRIBAL LAND:	NO
TRIBAL LAND NAME:	
CONGRESSIONAL DIST:	29
LEGISLATIVE DIST:	NY
HYDROLOGICAL UNTIS:	04120104
EPA REGION:	02
AIRSHED:	
CENSUS BLOCK:	

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 252 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT AND LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8908237 ID2: 276398 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 11/17/1989	DATE REPORTED: 11/17/1989
CLOSED DATE: 11/24/1992	INSP DATE: 11/24/1992

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS: START CALLERREMARK - 8908237 TANKS BEING REMOVED AT PRATT and LAMBERT END
CALLERREMARK - 8908237

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: COOKE
SPILL CONTACT:
TELEPHONE:

SPILLER: PRATT AND LAMBERT

ADDRESS: 75 TONAWANDA STREET
BUFFALO, NY 14207

TELEPHONE: (716) 873-6000

REPORTED BY: RESPONSIBLE PARTY

LAST DEC UPDATE: 11/25/1992
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8908237 Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 11/21/89: DRAFTED STANDARD FORM LETTER REQUIRING TANK REMOVAL. 11/27/89: JDC REQUESTED MR JOHNSON FORWARD A WRITTEN STATEMENT OF INTENTENT W/ RESPECT TO REMEDIAL ACTION ON THE 5 FAILED TANKS. HE STATED HE WOULD REQUIRE AT LEASED 30 DAYS TO DEVELOP A PLAN. 02/22/90: SPILL SECTION WILL BE COORDINATING CLEANUP W/ SPILLER PER MENO TO MR BIECCI FROM MR KING (MR LEARY) STATING SAME. CLEANUP IS SCHEDULED TO BEGIN FEB 26,90. 07/19/90: JDC ON SITE AND MET W/ MR JOHNSON AND FOUND ALL TANKS REMOVED. EXCAVATION CONTAINED SMALL AMOUNT OF FLOATING PETROLEUM. SOILS BEING STAGED PROPERLY. WILL REINSPECT WHEN CLEANUP IS COMPLETED. 07/24/90: JDC VISITED SITE AND OBSERVED AUTOSKIMMER IN OPERATION. ALL FLOATING CONTAMINATE REMOVED SATISFACTORILY. 07/30/90: JDC TELCON W/ MR JOHNSON. ALL WATER BEING PUMPED TO SANITARY SEWERS PER BSA TESTING REQUIREMENTS. REQUESTED MR JOHNSON FORWARD ME TEST RESULTS AND CORRESPONDANCE W/ BSA. 12/18/90: RNL SENT LETTER 12/18/90 TO PRATT and LAMBERT ASKING FOR FOR DISPOSAL RECEIPT OR TESTING. 12/21/90: RNL REC. LETTER FROM PRATT AND LAMBERT IN RESPONSE TO DEC LETTER, FURTHER AERATION PLANNED FOR THIS SUMMER (1991) FOR SOIL, HOLD. 11/24/92: JDC INSPECTED SITE AND FPOND SOILS FREE OF CONTAMINATION INDICATERS. TREATED SOIL REAPPLIED AS GRADING MATERIAL TO TREATMENT AREA. FILE REVIEWD AND FOUND COMPLETE. NO

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 252	DIST/DIR: 0.11 NW	MAP ID: 72
-----------------------	--------------------------	-------------------

NAME: PRATT AND LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8908237 ID2: 276398 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

FRUTHER ACTION WILL BE REQUIRED. 09/29/95: This is additional information about material spilled from the translation of the old spill file:
MINERAL SPIRITS. END DECRemark - 8908237

THERE MAYBE MORE DEC REMARKS AVAILBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

LUST

SEARCH ID: 250 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 8707798 ID2: 276397 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 12/10/1987	DATE REPORTED: 12/10/1987
CLOSED DATE: 2/8/1988	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: 2 FUEL OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: TANK TESTER
CALLER REMARKS: START CALLERREMARK - 8707798 12000 GALLON TANK, FAILURE RATE 0.1336 END
CALLERREMARK - 8707798

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: MXFRANKS
SPILL CONTACT:
TELEPHONE:

SPILLER: PRATT and LAMBERT

ADDRESS: 75 TONAWANDA STREET
BUFFALO, NY 14240

TELEPHONE: (716) 873-6000

REPORTED BY: TANK TESTER

LAST DEC UPDATE: 2/11/1988
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

DEC REMARKS:

Start DECRemark - 8707798 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF / / : MF 12/11/87 TRIED CALLING DENNIS ANDERSON, NO LUCK, LEFT MESSAGE. / / : MF 12/14/87 KEVIN JOHNSON CALLED, TANK PUMPED DOWN, LEAK BELIEVED TO BE TOP OF TANK, SCHEDULED FOR RETEST 1/18/88. / / : MF 1/19/88 TELECON KEVIN JOHNSON, TANK PASSED RETEST, RESULTS WILL BE SENT ME ASAP. / / : MF 2/8/88 RECEIVED RETEST RESULTS (PASSED). 02/11/88: MF RECEIVED TANK TEST RESULTS 01/19/88, TANKS TIGHT, SITE COMPLETE. END DECRemark - 8707798

THERE MAYBE MORE DEC REMARKS AVAILABLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRA

SEARCH ID: 3 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC	REV: 6/8/02
ADDRESS: 75 TONAWANDA ST	ID1: NYD002113322
BUFFALO NY 14207	ID2:
ERIE	STATUS: TSD
CONTACT: J MACLAUGHLAN	PHONE: 7168736000

SITE INFORMATION

CONTACT INFORMATION: J MACLAUGHLAN

75 TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168736000

UNIVERSE NAME:

TSDS SUBJECT TO CORRECTIVE ACT
SUBJECT TO CORRECTIVE ACTION
INCINERATOR
ST: STORAGE AND TREATMENT
SUBJECT TO CEI
DF: LAND DISPOSAL FACILITY

SIC INFORMATION:

2851 - MANUFACTURING - PAINTS AND ALLIED PRODUCTS
2821 - MANUFACTURING - PLASTICS MATERIALS AND RESINS
2891 - MANUFACTURING - ADHESIVES AND SEALANTS

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	23-MAR-93
TYPE:	120 - WRITTEN INFORMAL		
 AGENCY:	 S - STATE	 DATE:	 29-APR-94
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	23-MAR-93	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	05/24/1993
TYPE:	GER - GENERATOR ALL REQUIREMENTS		
 VIOLATION NUMBER:	 0003	 RESPONSIBLE:	 S - STATE
DETERMINED:	29-APR-94	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	06/01/1994
TYPE:	GER - GENERATOR ALL REQUIREMENTS		

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRACOR

SEARCH ID: 4 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC	REV: 6/6/06
ADDRESS: 75 TONAWANDA ST	ID1: NYD002113322
BUFFALO NY 14207	ID2:
ERIE	STATUS: CA
CONTACT:	PHONE:

SITE INFORMATION

CONTACT INFORMATION: J MACLAUGHLAN
75 TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168736000

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	Y - SUBJECT TO CORRECTIVE ACTION
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	---ST
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

32551 - PAINT AND COATING MANUFACTURING
325211 - PLASTICS MATERIAL AND RESIN MANUFACTURING
32552 - ADHESIVE MANUFACTURING
32551 - PAINT AND COATING MANUFACTURING
32551 - PAINT AND COATING MANUFACTURING
32551 - PAINT AND COATING MANUFACTURING
325211 - PLASTICS MATERIAL AND RESIN MANUFACTURING
32551 - PAINT AND COATING MANUFACTURING
325211 - PLASTICS MATERIAL AND RESIN MANUFACTURING
32551 - PAINT AND COATING MANUFACTURING

ENFORCEMENT INFORMATION:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRACOR

SEARCH ID: 4 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 6/6/06 ID1: NYD002113322 ID2: STATUS: CA PHONE:
----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------

AGENCY:	S - STATE	DATE:	3/23/1993
TYPE:	120 - WRITTEN INFORMAL		

AGENCY:	S - STATE	DATE:	4/29/1994
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	3/23/1993	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	5/24/1993		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

VIOLATION NUMBER:	0003	RESPONSIBLE:	S - STATE
DETERMINED:	4/29/1994	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	6/1/1994		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

CORRECTIVE ACTION INFORMATION

CA EVENT: 9/22/1992 CA050 - RFA COMPLETED

CA EVENT: 9/7/1993 CA075LO - CA PRIORITIZATION-LOW CA PRIORITY

HAZARDOUS WASTE INFORMATION:

Lead
Cyclohexanone (I)
D000
Ethane, 1,1,1-trichloro- (OR) Methyl chloroform
Formaldehyde
Ignitable waste
K078
K079
Corrosive waste
K082
Benzene, methyl- (OR) Toluene
Mercury
Methanol (I) (OR) Methyl alcohol (I)
Reactive waste
The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane
The following spent non-halogenated solvents: cresols, cresylic acid, and nitrobenzene; all spent solvent mixtures/blends containing, before use, a total of ten percent or more (by volume) of one or more of the above non-hal
The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to
K081
2-Propenoic acid, 2-methyl-, methyl ester (I,T) (OR) Methyl methacrylate (I,T)
1,2-Benzenedicarboxylic acid, dibutyl ester (OR) Dibutyl phthalate

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRACOR

SEARCH ID: 4 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 6/6/06 ID1: NYD002113322 ID2: STATUS: CA PHONE:
----------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------

1,2-Benzenedicarboxylic acid, dioctyl ester (OR) Di-n-octyl phthalate
1,3-Isobenzofurandione (OR) Phthalic anhydride
1-Butanol (I) (OR) n-Butyl alcohol (I)
1-Propanol, 2-methyl- (I,T) (OR) Isobutyl alcohol (I,T)
2,5-Furandione (OR) Maleic anhydride
2-Butanone (I,T) (OR) Methyl ethyl ketone (MEK) (I,T)
Chromium
2-Propenoic acid (I) (OR) Acrylic acid (I)
The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b
4-Methyl-2-pentanone (I) (OR) Methyl isobutyl ketone (I) (OR) Pentanol, 4-methyl-
Aziridine (OR) Ethyleneimine
Barium
Benzene, 1,3-diisocyanatomethyl- (R,T) (OR) Toluene diisocyanate (R,T)
Benzene, dimethyl- (I,T) (OR) Xylene (I)
Acetic acid ethyl ester (I) (OR) Ethyl acetate (I)
Cadmium
2-Propanone (I) (OR) Acetone (I)
2-Propenoic acid, ethyl ester (I) (OR) Ethyl acrylate (I)

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 15 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 12/9/02 ID1: NYD002113322 ID2: STATUS: LGN PHONE:
----------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: J MACLAUGHLAN

75 TONAWANDA ST
BUFFALO NY 14207

PHONE: 7168736000

UNIVERSE TYPE:

PERMPROG - PERMITTING/CLOSURE/POST-CLOSURE PROGRESS
SUBJCA - SUBJECT TO CORRECTIVE ACTION
TRANSPORT - TRANSPORTER
LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000 KG/MONTH OF HAZARDOUS WASTE

SIC INFORMATION:

2891 - MANUFACTURING - ADHESIVES AND SEALANTS
2851 - MANUFACTURING - PAINTS AND ALLIED PRODUCTS
2821 - MANUFACTURING - PLASTICS MATERIALS AND RESINS

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	23-MAR-93
TYPE:	120 - WRITTEN INFORMAL		
 AGENCY:	 S - STATE	 DATE:	 29-APR-94
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	23-MAR-93	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	24-MAY-93
 VIOLATION NUMBER:	 0003	 RESPONSIBLE:	 S - STATE
DETERMINED:	29-APR-94	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	01-JUN-94

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RELEASES

SEARCH ID: 266 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: LEHIGH CONSTRUCTION ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 Erie CONTACT:	REV: 8/17/94 ID1: 396919 ID2: STATUS: FIXED FACILITY PHONE:
--------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------

SPILL INFORMATION

DATE OF SPILL: 8/17/94 **TIME OF SPILL:** 1000

PRODUCT RELEASED (1): AROMATIC 100
QUANTITY (1): 5
UNITS (1): GAL

PRODUCT RELEASED (2):
QUANTITY (2):
UNITS (2):

PRODUCT RELEASED (3):
QUANTITY (3):
UNITS (3):

MEDIUM/MEDIA AFFECTED

AIR: YES	GROUNDWATER: NO
LAND: NO	FIXED FACILITY: NO
WATER: NO	OTHER: NO
WATERBODY AFFECTED BY RELEASE: SCAJAQUADA CREEK>NIAGARA RIVER	

CAUSE OF RELEASE

DUMPING: NO	EQUIPMENT FAILURE: NO
NATURAL PHENOMENON: NO	OPERATOR ERROR: NO
OTHER CAUSE: NO	TRANSP. ACCIDENT: NO
UNKNOWN: YES	

ACTIONS TAKEN: DEPLOYING BOOMS/WILL CLEAN UP MATERIAL USING A SKIMMER AND ABSORBENT PADS

RELEASE DETECTION: 1 1/2 INCH PIPE/RESIDUAL MATERIAL WAS RELEASED DUE TO PIPE REMOVAL

MISC. NOTES: SHEEN SIZE: 30YDS X 30YDS, RAINBOW IN COLOR

DISCHARGER INFORMATION

DISCHARGER ID: 396919	DUN and BRADSTREET :
TYPE OF DISCHARGER: PRIVATE ENTERPRISE	
NAME OF DISCHARGER: LEHIGH CONSTRUCTION	
ADDRESS:	

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 163 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 9406685 ID2: 276399 STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 8/17/1994	DATE REPORTED: 8/17/1994
CLOSED DATE: 8/31/1994	INSP DATE: 8/17/1994

CAUSE OF SPILL: HUMAN ERROR
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN CONTRACTOR

ADDRESS:
 , ZZ

TELEPHONE:

REPORTED BY: AFFECTED PERSONS

LAST DEC UPDATE: 9/15/1994
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9406685 PIPE LEAKED AT DEMOLITION SITE. END
CALLERREMARK - 9406685

DEC REMARKS:

Start DECRemark - 9406685 Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 08/17/94: SAC/KEVIN JOHNSTON, PRATT and LAMBERT/SITE - CUT PIPE SPILLED CONTENTS ONTO BRIDGE AND INTO CREEK. SLIGHT SHEEN REMAINING; SIMILAR TO IRON SHEEN. PADS TO BE DISPOSED IN HAZ. WASTE PICK UP. BOOMS IN PLAC. 08/31/94: RECEIVED DISPOSAL LETTER FROM KEVIN JOHNSTON/PRATT and LAMBERT. 09/29/95: This is additional information about material spilled from the translation of the old spill file: HYDROCARBON MIX. END DECRemark - 9406685

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 217 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT AND LAMBERT ADDRESS: NIAGARA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8603542 ID2: STATUS: CLOSED PHONE:
-----------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 08/28/86	DATE REPORTED: 08/28/86
SPILL TIME: 14:00	TIME REPORTED: 14:10

CAUSE OF SPILL:	DELIBERATE
RESOURCE AFFECTED:	SURFACE WATER
WATERBODY AFFECTED:	SCAJAQUADA CREEK
SOURCE OF SPILL:	COMMERCIAL/INDUSTRIAL
REPORTED BY:	CITIZEN
CALLER REMARKS:	
SPDES VIOLATION	

REGION: 9	UST TRUST?	NO
------------------	-------------------	----

SPILL INVESTIGATOR:	MNP	
SPILL CONTACT:		TELEPHONE:

SPILLER:	PRATT AND LAMBERT	
ADDRESS:	WEST AVENUE AND NAIGARA	
	BUFFALO, N. Y.,	
SPILLER CONTACT:		TELEPHONE:

CALLER:	NOTIFIER:
AGENCY:	AGENCY:
TELEPHONE:	TELEPHONE:

LAST DEC UPDATE: 10/03/86	CLOSE DATE: 08/28/86
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO

DEC REMARKS:
/ / : REFERRED TO WATER, M. SNIDER, 08/28/86. / / : REFERRED TO WATER, M. SNIDER, 08/28/86; SEE SPILL 863159. 09/29/95:
THIS IS ADDITIONAL INFORMATION ABOUT MATERIAL SPILLED FROM THE TRANSLATION OF THE OLD SPILL FILE: WHITE-GREEN
MATERIAL.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 212 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8603159 ID2: STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 08/11/86 SPILL TIME: 10:30	DATE REPORTED: 08/12/86 TIME REPORTED: 09:35
---------------------------------------------------------	---------------------------------------------------------------

MATERIAL SPILLED: XYLENE (MIXED) MATERIAL CLASS: HAZARDOUS	AMOUNT SPILLED: 198 G AMOUNT RECOVERED: 198 G
-----------------------------------------------------------------------------	----------------------------------------------------------------

CAUSE OF SPILL: EQUIPMENT FAILURE
RESOURCE AFFECTED: ON LAND
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
XYLENE SPILL IN SPDES DISCHARGE

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MNP SPILL CONTACT:	TELEPHONE:
---------------------------------------------------------	-------------------

SPILLER: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO, N. Y., SPILLER CONTACT:	TELEPHONE: (716) 873-6000
------------------------------------------------------------------------------------------------------------------------	----------------------------------

CALLER: AGENCY: TELEPHONE:	NOTIFIER: AGENCY: TELEPHONE:
-------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 02/11/87 DOES CLEAN UP MEET STANDARDS? YES DEC REMARKS:	CLOSE DATE: 01/20/87 PENALTY RECOMMENDED? NO
-----------------------------------------------------------------------------------------------------	---------------------------------------------------------------

// : TELECON 08/12/86, SPILLER NOTIFIED NRC, SPILLER CLEANING UP SPILL; REFERRED TO WATER, R. SMYTH, 08/12/86. //
: REFERRED TO WATER, R. SMYTH, 8/12/86; WATER SMYTHE SATISFIED 1/20/87.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 214 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8707798 ID2: STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 12/10/87	DATE REPORTED: 12/10/87
SPILL TIME: 13:45	TIME REPORTED: 15:04

MATERIAL SPILLED: 2 FUEL OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: TANK TESTER
CALLER REMARKS:
12000 GALLON TANK, FAILURE RATE 0.1336

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: MF SPILL CONTACT:	TELEPHONE:
--------------------------------------------------------	-------------------

SPILLER: PRATT and LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO, NY 14240 SPILLER CONTACT:	TELEPHONE: (716) 873-6000
--------------------------------------------------------------------------------------------------------------------------	----------------------------------

CALLER: JOHN SCHEIRWEILER AGENCY: TELEPHONE: (716) 684-5660	NOTIFIER: AGENCY: TELEPHONE:
----------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 02/11/88 DOES CLEAN UP MEET STANDARDS? YES DEC REMARKS:	CLOSE DATE: 02/08/88 PENALTY RECOMMENDED? NO
-----------------------------------------------------------------------------------------------------	---------------------------------------------------------------

// : MF 12/11/87 TRIED CALLING DENNIS ANDERSON, NO LUCK, LEFT MESSAGE. // : MF 12/14/87 KEVIN JOHNSON CALLED, TANK PUMPED DOWN, LEAK BELIEVED TO BE TOP OF TANK, SCHEDULED FOR RETEST 1/18/88. // : MF 1/19/88 TELECON KEVIN JOHNSON, TANK PASSED RETEST, RESULTS WILL BE SENT ME ASAP. // : MF 2/8/88 RECEIVED RETEST RESULTS (PASSED). 02/11/88: MF RECEIVED TANK TEST RESULTS 01/19/88, TANKS TIGHT, SITE COMPLETE.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 215 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT AND LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8908237 ID2: STATUS: CLOSED PHONE:
----------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 11/17/89	DATE REPORTED: 11/17/89
SPILL TIME: 12:00	TIME REPORTED: 14:30

MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: TANK TEST FAILURE
RESOURCE AFFECTED: GROUNDWATER
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: RESPONSIBLE PARTY
CALLER REMARKS:
TANKS BEING REMOVED AT PRATT and LAMBERT

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: JDC	TELEPHONE:
SPILL CONTACT:	

SPILLER: PRATT AND LAMBERT ADDRESS: 75 TONAWANDA STREET BUFFALO, NY 14207	TELEPHONE: (716) 873-6000
SPILLER CONTACT:	

CALLER: KEVIN JOHNSON AGENCY: PRATT AND LAMBERT TELEPHONE: (716) 873-6000	NOTIFIER: AGENCY: TELEPHONE:
------------------------------------------------------------------------------------------------------	---------------------------------------------------------

LAST DEC UPDATE: 11/25/92	CLOSE DATE: 11/24/92
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO
DEC REMARKS:	

11/21/89: DRAFTED STANDARD FORM LETTER REQUIRING TANK REMOVAL. 11/27/89: JDC REQUESTED MR JOHNSON FORWARD A WRITTEN STATEMENT OF INTENTENT W/ RESPECT TO REMEDIAL ACTION ON THE 5 FAILED TANKS. HE STATED HE WOULD REQUIRE AT LEAST 30 DAYS TO DEVELOP A PLAN. 02/22/90: SPILL SECTION WILL BE COORDINATING CLEANUP W/ SPILLER PER MENO TO MR BIECCI FROM MR KING (MR LEARY) STATING SAME. CLEANUP IS SCHEDULED TO BEGIN FEB 26,90. 07/19/90: JDC ON SITE AND MET W/ MR JOHNSON AND FOUND ALL TANKS REMOVED. EXCAVATION CONTAINED SMALL AMOUNT OF FLOATING PETROLEUM. SOILS BEING STAGED PROPERLY. WILL REINSPECT WHEN CLEANUP IS COMPLETED. 07/24/90: JDC VISITED SITE AND OBSERVED AUTOSKIMMER IN OPERATION. ALL FLOATING CONTAMINATE REMOVED SATISFACTORILY. 07/30/90: JDC TELCON W/ MR JOHNSON. ALL WATER BEING PUMPED TO SANITARY SEWERS PER BSA TESTING REQUIREMENTS. REQUESTED MR JOHNSON FORWARD ME TEST RESULTS AND CORRISPONDANCE W/ BSA. 12/18/90: RNL SENT LETTER 12/18/90 TO PRATT and LAMBERT ASKING FOR FOR DISPOSAL RECEIPT OR TESTING. 12/21/90: RNL REC. LETTER FROM PRATT AND LAMBERT IN RESPONSE TO DEC LETTER. FURTHER AERATION PLANNED FOR THIS SUMMER (1991) FOR SOIL, HOLD. 11/24/92: JDC INSPECTED SITE AND FPOND SOILS FREE OF CONTAMINATION INDICATORS. TREATED SOIL REAPPLIED AS GRADING MATERIAL TO TREATMENT AREA. FILE REVIEWD AND FOUND COMPLETE. NO FRUTHER ACTION WILL BE REQUIRED. 09/29/95: THIS IS ADDITIONAL INFORMATION ABOUT MATERIAL SPILLED FROM THE TRANSLATION OF THE OLD SPILL FILE: MINERAL SPIRITS.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS80

SEARCH ID: 216 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT AND LAMBERT ADDRESS: TONAWANDA STREET BUFFALO NY ERIE CONTACT:	REV: 10/18/00 ID1: 8701339 ID2: STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SPILL DATE: 05/18/87	DATE REPORTED: 05/18/87
SPILL TIME: 12:00	TIME REPORTED: 13:30

MATERIAL SPILLED: INDUSTRIAL WASTE	AMOUNT SPILLED: 0
MATERIAL CLASS: NON PETROLEUM/NON HAZARDOUS	AMOUNT RECOVERED: 0
MATERIAL SPILLED: UNKNOWN PETROLEUM	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

CAUSE OF SPILL: DELIBERATE
RESOURCE AFFECTED: SURFACE WATER
WATERBODY AFFECTED: SCAJAQUADA CREEK
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: CITIZEN
CALLER REMARKS:
T. WONTUCK, WATER INVESTIGATED - NO SPILL OF ANY KIND WAS LOCATED

REGION: 9 **UST TRUST?** NO

SPILL INVESTIGATOR: JDC	TELEPHONE:
SPILL CONTACT:	

SPILLER: UNKNOWN
ADDRESS:

SPILLER CONTACT:	TELEPHONE:
-------------------------	-------------------

CALLER: BRIAN MORRISON	NOTIFIER:
AGENCY: CITIZEN	AGENCY:
TELEPHONE: (716) 882-5987	TELEPHONE:

LAST DEC UPDATE: 08/24/88	CLOSE DATE: 05/21/87
DOES CLEAN UP MEET STANDARDS? YES	PENALTY RECOMMENDED? NO

DEC REMARKS:
/ / : REFERRED TO WATER, A SARKEES, 05/18/87, 1400. 05/21/87: WATER INVESTIGATED SITE AND FOUND NO EVIDENCE OF ANY SPILLAGE. NO FURTHER ACTION WILL BE REQUIRED.

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 134	DIST/DIR: 0.11 NW	MAP ID: 72
-----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT UNITED INC.
ADDRESS: 75 TONAWANDA ST.
BUFFALO NY 14207
ERIE
CONTACT: KEVIN W. JOHNSTON

REV:
ID1: NYD002113322
ID2: 14207PR TTL75TON
STATUS: OPEN
PHONE: 7168736000

DETAILS NOT AVAILABLE

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 135	DIST/DIR: 0.11 NW	MAP ID: 72
-----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT UNITED INC.
ADDRESS: 75 TONAWANDA ST.
BUFFALO NY 14207
ERIE
CONTACT: NICK MAOLONI

REV: 11/1/07
ID1: 14207PRTTL75TON
ID2:
STATUS: OPEN
PHONE: 2165662182

SITE INFORMATION

SIC INFORMATION

2851

REPORTED INFORMATION

REPORTING YEAR:	CONTACT PERSON:	CONTACT PHONE:
1987	K. W. JOHNSTON	7168736000
1987	K.W. JOHNSTON	7168736000
1988	KEVIN W. JOHNSTON	7168736000
1989	KEVIN W. JOHNSTON	7168736000
1989	KEVIN W. JOHNSTON	7160873600
1990	KEVIN W. JOHNSTON	7178736000
1990	KEVIN W. JOHNSTON	7168736000
1991	JAY A. ROBEY	7168736000
1992	KEVIN W. JOHNSTON	7168736000
1992	KEVIN J. JOHNSTON	7168736000
1993	KEVIN W. JOHNSTON	7168736000
1994	KEVIN W. JOHNSTON	7168736000
1995	JAMES C. GOUCK	7168736000
1996	NICK MAOLONI	2165662182

CHEMICAL

ONE TIME RELEASE QTY(LBS)

N-BUTYL ALCOHOL

XYLENE (MIXED ISOMERS)

PHTHALIC ANHYDRIDE

METHYL ISOBUTYL KETONE

METHYL ETHYL KETONE

ETHYLENE GLYCOL

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 135	DIST/DIR: 0.11 NW	MAP ID: 72
-----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT UNITED INC.
ADDRESS: 75 TONAWANDA ST.
BUFFALO NY 14207
ERIE
CONTACT: NICK MAOLONI

REV: 11/1/07
ID1: 14207PRTTL75TON
ID2:
STATUS: OPEN
PHONE: 2165662182

ETHYLBENZENE
DICHLOROMETHANE
CERTAIN GLYCOL ETHERS
ALUMINUM OXIDE (FIBROUS FORMS)
ALUMINUM (FUME OR DUST)
TOLUENE
ETHYLENE GLYCOL
TOLUENE
ALUMINUM OXIDE (FIBROUS FORMS)
CERTAIN GLYCOL ETHERS
ETHYLBENZENE
METHYL ISOBUTYL KETONE
METHYL METHACRYLATE
N-BUTYL ALCOHOL
PHTHALIC ANHYDRIDE
DICHLOROMETHANE
METHYL ISOBUTYL KETONE
CAPTAN
CERTAIN GLYCOL ETHERS
DICHLOROMETHANE
ETHYLENE GLYCOL
METHYL METHACRYLATE
N-BUTYL ALCOHOL
PHTHALIC ANHYDRIDE
TOLUENE
XYLENE (MIXED ISOMERS)
ETHYLBENZENE

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

TRIS

SEARCH ID: 135	DIST/DIR: 0.11 NW	MAP ID: 72
-----------------------	--------------------------	-------------------

NAME: PRATT and LAMBERT UNITED INC.	REV: 11/1/07
ADDRESS: 75 TONAWANDA ST. BUFFALO NY 14207	ID1: 14207PRTTL75TON
ERIE	ID2:
CONTACT: NICK MAOLONI	STATUS: OPEN
	PHONE: 2165662182

CERTAIN GLYCOL ETHERS

DICHLOROMETHANE

ETHYLBENZENE

ETHYLENE GLYCOL

METHYL ISOBUTYL KETONE

PHTHALIC ANHYDRIDE

XYLENE (MIXED ISOMERS)

CAPTAN

CAPTAN	0
--------	---

XYLENE (MIXED ISOMERS)	0
------------------------	---

PHTHALIC ANHYDRIDE	0
--------------------	---

METHYL ISOBUTYL KETONE	0
------------------------	---

ETHYLENE GLYCOL	0
-----------------	---

CERTAIN GLYCOL ETHERS	0
-----------------------	---

ETHYLBENZENE	0
--------------	---

METHYL ISOBUTYL KETONE	0
------------------------	---

CAPTAN	0
--------	---

ETHYLENE GLYCOL	0
-----------------	---

ETHYLBENZENE	0
--------------	---

CERTAIN GLYCOL ETHERS	0
-----------------------	---

XYLENE (MIXED ISOMERS)	0
------------------------	---

PHTHALIC ANHYDRIDE	0
--------------------	---

CERTAIN GLYCOL ETHERS	0
-----------------------	---

ETHYLENE GLYCOL	0
-----------------	---

XYLENE (MIXED ISOMERS)	0
------------------------	---

CERTAIN GLYCOL ETHERS	0
-----------------------	---

ETHYLENE GLYCOL	0
-----------------	---

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 236 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-079316 ID2: STATUS: UNREGULATED PHONE: (716) 873-6000
----------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PETROLEUM BULK STORAGE FACILITY INFORMATION

TYPE OF SITE: MANUFACTURING (OTHER THAN CHEMICAL)/PROCESSING
TYPE NAME:
TOTAL NUMBER OF TANKS: 22
NUMBER OF ACTIVE TANKS:
NUMBER OF INACTIVE TANKS: 22
TOTAL FACILITY CAPACITY: 0 GALLONS
ADDITIONAL ADDRESS INFO:

OWNER INFORMATION

TYPE: CORPORATE OR COMMERCIAL
COMPANY: PRATT and LAMBERT INC
TITLE:
NAME:
ADDRESS: P O BOX 22
NY 14240
PHONE: (716) 873-6000
EMERGENCY CONTACT: SECURITY OFFICER
PHONE: (716) 873-6000

MAILING INFORMATION

COMPANY: PRATT and LAMBERT INC
TITLE:
CONTACT:
ADDRESS: P O BOX 22
BUFFALO NY 14240
PHONE: (716) 873-6000
EMAIL:

EXP. DATE: 3/24/1997
RENEWAL DATE: 3/30/1992

COMMENTS: This site incorrectly reported they had closed the last of their tanks in 1992. The M2P2 inspection revealed they had not therefore a prorated fee of \$200 was assessed in Sept 1996 for the four free years they received. The site was reopened and \$50 of this fee was processed as an additional fee. The other \$150 was used to renew the registration (correct for one tank reopened). This new renewal will expire in 1997 and will again have to be renewed. Awaiting information on the exact tanks that are now inactive but not closed. Will modify certificate at that time. JES (09/20/96) **ARCHIVED**

TANK INFORMATION

<u>TANK NUMBER:</u> 100	TANK STATUS: CLOSED - REMOVED
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1924
CLOSED: 12/1/1990	TANK CAPACITY: 1500 GALLONS
PRODUCT: 2 FUEL OIL	
 TANK TYPE: STEEL/CARBON STEEL/IRON	
TANK LOCATION: ABOVEGROUND - IN CONTACT WITH SOIL	
INTERNAL PROTECTION: NONE	

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 236 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-079316 ID2: STATUS: UNREGULATED PHONE: (716) 873-6000
----------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: OTHER
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 101	TANK STATUS: CLOSED PRIOR TO MICRO CONVERSION, 03/91	
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1924	
CLOSED: 12:00:00 AM	TANK CAPACITY: 1500 GALLONS	
PRODUCT: 2 FUEL OIL		

TANK TYPE: STEEL/CARBON STEEL/IRON
TANK LOCATION: ABOVEGROUND - IN CONTACT WITH SOIL
INTERNAL PROTECTION: NONE
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

PIPE TYPE: STEEL/CARBON STEEL/IRON
PIPE LOCATION: NO PIPING
EXTERNAL PROTECTION: NONE
EXTERNAL PROTECTION 2:

SECONDARY CONTAINMENT: OTHER
SECONDARY CONTAINMENT 2:
LEAK DETECTION: OTHER
LEAK DETECTION 2:

OVERFILL PROTECTION: PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:
DISPENSER: SUCTION
SPILL PREVENTION:
DATE TESTED: 12:00:00 AM
NEXT TEST: 12:00:00 AM
TEST METHOD: TESTING NOT REQUIRED

<u>TANK NUMBER:</u> 241	TANK STATUS: CLOSED - REMOVED	
ACTIVE STATUS: INACTIVE	INSTALLED: 12/1/1959	
CLOSED: 12/1/1990	TANK CAPACITY: 12000 GALLONS	

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 236 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT INC ADDRESS: 75 TONAWANDA ST BUFFALO NY 14207 ERIE CONTACT:	REV: 2/5/08 ID1: PBS9-079316 ID2: STATUS: UNREGULATED PHONE: (716) 873-6000
----------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

PRODUCT:	2 FUEL OIL
TANK TYPE:	STEEL/CARBON STEEL/IRON
TANK LOCATION:	UNDERGROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
PIPE TYPE:	STEEL/CARBON STEEL/IRON
PIPE LOCATION:	NO PIPING
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	OTHER
LEAK DETECTION 2:	
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:	
DISPENSER:	SUBMERSIBLE
SPILL PREVENTION:	
DATE TESTED:	12/1/1987
NEXT TEST:	12:00:00 AM
TEST METHOD:	HORNER EZ CHECK I OR II

<u>TANK NUMBER:</u>	242	TANK STATUS:	CLOSED - REMOVED
ACTIVE STATUS:	INACTIVE	INSTALLED:	12/1/1959
CLOSED:	12/1/1990	TANK CAPACITY:	12000 GALLONS
PRODUCT:	2 FUEL OIL		

TANK TYPE:	STEEL/CARBON STEEL/IRON
TANK LOCATION:	UNDERGROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
PIPE TYPE:	STEEL/CARBON STEEL/IRON
PIPE LOCATION:	NO PIPING
EXTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION 2:	
SECONDARY CONTAINMENT:	NONE
SECONDARY CONTAINMENT 2:	
LEAK DETECTION:	OTHER
LEAK DETECTION 2:	
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE (A/G)
OVERFILL PROTECTION 2:	
DISPENSER:	SUBMERSIBLE
SPILL PREVENTION:	
DATE TESTED:	1/1/1988
NEXT TEST:	12:00:00 AM

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 237 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT, INC. ADDRESS: 75 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000142 ID2: STATUS: UNREGULATED PHONE:
----------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

CHEMICAL BULK STORAGE FACILITY INFORMATION

TYPE OF SITE:	MANUFACTURING		
TOTAL ACTIVE TANKS ON SITE:	0		
TOTAL FACILITY CAPACITY:	0 GALLONS		
PBS NUMBER:	9-079316	ICS NUMBER:	9-178277 MOSF NUMBER:
ADDITIONAL ADDRESS INFO:			

TYPE OF OWNER:	CORPORATE/COMMERCIAL
OWNER SUB TYPE:	
OWNER ADDRESS:	PO BOX 22 BUFFALO NY 14240
PHONE:	(716) 873-6000

EMERGENCY CONTACT:	J.C. GOUCK
PHONE:	(716) 873-6000

MAILING NAME:	PRATT and LAMBERT, INC.
ADDRESS:	PO BOX 22 BUFFALO NY 14240
ATTENTION:	J.C. GOUCK, PLANT MANAGER
PHONE:	(716) 873-6000

CERTIFICATE DATE:	9/12/95	EXP. DATE:	6/27/97
RENEWAL DATE:	3/1/95		

TANK INFORMATION

TANK NUMBER:	1022	STATUS:	TANK CONVERTED TO NON-REGULATED USE
INSTALLED:	12/29	CLOSED:	UNKNOWN
TANK CAPACITY:	1300 GALLONS		
SUBSTANCE STORED:	XYLENE (MIXED)		
SUBSTANCE DESCRIPTION:			
HAZARDOUS SUBSTANCE %:			

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	

LEAK DETECTION:	
OVERFILL PROTECTION:	

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 237 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT, INC. ADDRESS: 75 TONAWANDA STREET BUFFALO NY 14207 ERIE CONTACT:	REV: 6/4/07 ID1: CBS9-000142 ID2: STATUS: UNREGULATED PHONE:
----------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------

TANK NUMBER:	104	STATUS: CLOSED - IN PLACE
INSTALLED:	12/04	CLOSED: 06/96
TANK CAPACITY:	2500 GALLONS	
SUBSTANCE STORED:	XYLENE (MIXED)	
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST	
HAZARDOUS SUBSTANCE %:	2	

TANK TYPE:	STAINLESS STEEL ALLOY
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	FIBERGLASS LINER (FRP)
EXTERNAL PROTECTION:	NONE
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
SECONDARY CONTAINMENT:	OTHER

LEAK DETECTION:	OTHER
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE

TANK NUMBER:	1048	STATUS: TANK CONVERTED TO NON-REGULATED USE
INSTALLED:	12/14	CLOSED: UNKNOWN
TANK CAPACITY:	1100 GALLONS	
SUBSTANCE STORED:	XYLENE (MIXED)	
SUBSTANCE DESCRIPTION:		
HAZARDOUS SUBSTANCE %:		

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	

LEAK DETECTION:	
OVERFILL PROTECTION:	

TANK NUMBER:	1067	STATUS: CLOSED - IN PLACE
INSTALLED:	12/04	CLOSED: 06/96
TANK CAPACITY:	1550 GALLONS	
SUBSTANCE STORED:	XYLENE (MIXED)	
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST	
HAZARDOUS SUBSTANCE %:	3	

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

UST

SEARCH ID: 237 **DIST/DIR:** 0.11 NW **MAP ID:** 72

NAME: PRATT and LAMBERT, INC. ADDRESS: 75 TONAWANDA STREET BUFFALO NY 14207 ERIE	REV: 6/4/07 ID1: CBS9-000142 ID2: STATUS: UNREGULATED PHONE:
CONTACT:	

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
SECONDARY CONTAINMENT:	OTHER

LEAK DETECTION:	OTHER
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE

TANK NUMBER:	1069	STATUS:	CLOSED - IN PLACE
INSTALLED:	12/04	CLOSED:	06/96
TANK CAPACITY:	1500 GALLONS		
SUBSTANCE STORED:	XYLENE (MIXED)		
SUBSTANCE DESCRIPTION:	SINGLE HAZARDOUS SUBSTANCE ON DEC LIST		
HAZARDOUS SUBSTANCE %:	3		

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
PIPE LOCATION:	ABOVE GROUND
INTERNAL PROTECTION:	NONE
EXTERNAL PROTECTION:	PAINTED/ASPHALT COATING
SECONDARY CONTAINMENT:	OTHER

LEAK DETECTION:	OTHER
OVERFILL PROTECTION:	PRODUCT LEVEL GAUGE

TANK NUMBER:	1072	STATUS:	TANK CONVERTED TO NON-REGULATED USE
INSTALLED:	12/04	CLOSED:	UNKNOWN
TANK CAPACITY:	1500 GALLONS		
SUBSTANCE STORED:	XYLENE (MIXED)		
SUBSTANCE DESCRIPTION:			
HAZARDOUS SUBSTANCE %:			

TANK TYPE:	STEEL/CARBON STEEL
TANK LOCATION:	ABOVEGROUND ON SADDLES, LEGS, STILTS, RACK, OR CRADLE
INTERNAL PROTECTION:	
EXTERNAL PROTECTION:	
SECONDARY CONTAINMENT:	OTHER

PIPE TYPE:	STEEL/IRON
-------------------	------------

- More Details Exist For This Site; Max Page Limit Reached -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 85	DIST/DIR: 0.11 SE	MAP ID: 74
----------------------	--------------------------	-------------------

NAME: WESTWOOD PHARMACEUTICALS INC
ADDRESS: 468 DEWITT ST
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD048391080
ID2:
STATUS:
PHONE:

RCRIS : NYD048391080
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 123 **DIST/DIR:** 0.11 SE **MAP ID:** 73

NAME: BUFFALO CITY OF - VACANT LOT 413 E DELAV ADDRESS: 413 E DELAVAN AVE - VACANT LOT BUFFALO NY 14214 ERIE CONTACT:	REV: 11/1/06 ID1: 110004511724 ID2: NYR000001453 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: 110004511724 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:	
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------	--

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 7/8/1999 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYR000001453 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: IMPLEMENTER LAST EXTRACTED: 5/18/2003 1:43:10 AM	NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/6/2006 2:56:20 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 30
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 76	DIST/DIR: 0.11 SE	MAP ID: 71
----------------------	--------------------------	-------------------

NAME: PINTO EQUIPMENT RENTAL INC
ADDRESS: 66 BIRD AVE
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD074009382
ID2:
STATUS:
PHONE:

RCRIS : NYD074009382
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 77 **DIST/DIR:** 0.11 SE **MAP ID:** 71

NAME: PINTO EQUIPMENT RENTAL INC
ADDRESS: 66 BIRD AVE
BUFFALO NY 14213
ERIE
CONTACT:

REV: 11/1/06
ID1: 110004368069
ID2: NYD074009382
STATUS: FRS
PHONE:

FACILITY REGISTRATION INFORMATION:

PROGRAM: RCRAINFO
PROVIDED BY: FEDERAL AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED: 11/26/1980
ENFORCEMENT ACT:
REG PROGRAM: TRANSPORTER - HAZARDOUS WASTE HANDLERS ENGAGED IN THE TRANSPORTATION OF HAZARDOUS WASTE.

PROGRAM ID: NYD074009382
AGENCY INTERESTED:
INTEREST ENDED:
SOURCE OF DATA: NOTIFICATION (RCRA)
LAST EXTRACTED:

PROGRAM: FRS
PROVIDED BY: FEDERAL AGENCY
AGENCY INT QUAL:
INT END QUAL:
LAST REPORTED:
ENFORCEMENT ACT:
REG PROGRAM: FACILITY -

PROGRAM ID: 110004368069
AGENCY INTERESTED:
INTEREST ENDED:
SOURCE OF DATA: FRS
LAST EXTRACTED:

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 1/5/2006 10:43:29 PM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST: 29
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS: 04120104
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 122

DIST/DIR: 0.11 SE

MAP ID: 73

NAME: BUFFALO CITY OF - VACANT LOT 413 E DELAV
ADDRESS: 413 E DELAVAN AVE - VACANT LOT
BUFFALO NY 14214
Erie

REV:
ID1: NY0001177286
ID2:
STATUS:
PHONE:

CONTACT:

RCRIS : NYR000001453
PCS :
AFS/AIRS :
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB :
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 16 **DIST/DIR:** 0.11 SE **MAP ID:** 74

NAME: WESTWOOD-SQUIBB PHARMACEUTICALS INC	REV: 6/6/06
ADDRESS: 468 DEWITT ST	ID1: NYD048391080
BUFFALO NY 14213	ID2:
ERIE	STATUS: LGN
CONTACT: KENNETH A BABCOCK	PHONE: 7168873706

SITE INFORMATION

CONTACT INFORMATION: DAVID SMITH SR
468 DEWITT ST
BUFFALO NY 14213

PHONE: 7168873430

CONTACT INFORMATION: KENNETH BABCOCK
DEWITT ST
BUFFALO NY 14213

PHONE: 7168873706

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	LQG - LARGE QUANTITY GENERATORS: GENERATES MORE THAN 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 16 **DIST/DIR:** 0.11 SE **MAP ID:** 74

NAME: WESTWOOD-SQUIBB PHARMACEUTICALS INC	REV: 6/6/06
ADDRESS: 468 DEWITT ST	ID1: NYD048391080
BUFFALO NY 14213	ID2:
ERIE	STATUS: LGN
CONTACT: KENNETH A BABCOCK	PHONE: 7168873706

325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING
325412 - PHARMACEUTICAL PREPARATION MANUFACTURING

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	6/14/1989
TYPE:	120 - WRITTEN INFORMAL		

AGENCY:	S - STATE	DATE:	12/12/2001
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	4/14/1989	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	7/27/1989		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	11/28/2001	DETERMINED BY:	S - STATE
CITATION:	372.2(a)(8)(i)(a		
RESOLVED:	1/10/2002		
TYPE:	GENERATOR-OTHER REQUIREMENTS		

HAZARDOUS WASTE INFORMATION:

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b

Carbon tetrachloride

Mercury, (acetato-O)phenyl- (OR) Phenylmercury acetate

Silver

Chloroform

The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene,

1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane

Trichloroethylene

Tetrachloroethylene

Reactive waste

Pyridine

Lab Pack

Mercury

Methyl ethyl ketone

Ignitable waste

Corrosive waste

Benzene

The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 14 **DIST/DIR:** 0.11 SE **MAP ID:** 71

NAME: PINTO EQUIPMENT RENTAL INC	REV: 6/6/06
ADDRESS: 66 BIRD AVE	ID1: NYD074009382
BUFFALO NY 14213	ID2:
ERIE	STATUS: TRANSPORTER
CONTACT: JIM REIMANN	PHONE: 7168835400

SITE INFORMATION

CONTACT INFORMATION: JIM REIMANN
66 BIRD AVE
BUFFALO NY 14213

PHONE: 7168835400

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 43 **DIST/DIR:** 0.11 SE **MAP ID:** 73

NAME: BUFFALO CITY OF - VACANT LOT 413 E DELAV ADDRESS: 413 E DELAVAN AVE - VACANT LOT BUFFALO NY 14211 ERIE CONTACT:	REV: 6/6/06 ID1: NYR000001453 ID2: STATUS: NLR PHONE:
--------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: DENNIS GESEL
CITY HALL ROOM 616
BUFFALO NY 14202

PHONE: 7168514080

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

Ignitable waste

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 158 **DIST/DIR:** 0.11 SE **MAP ID:** 77

NAME: JUNKYARD ADDRESS: NIAGARA and POTOMAC BUFFALO NY ERIE CONTACT:	REV: 2/5/08 ID1: 0485102 ID2: 333210 STATUS: CLOSED PHONE:
-------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------

SITE INFORMATION

SPILL DATE: 11/1/2004 CLOSED DATE: 11/3/2004	DATE REPORTED: 11/2/2004 INSP DATE: 11/2/2004
---------------------------------------------------------------	----------------------------------------------------------------

MATERIAL SPILLED: WASTE OIL/USED OIL MATERIAL CLASS: PETROLEUM	AMOUNT SPILLED: 0 G AMOUNT RECOVERED: 0 G
---------------------------------------------------------------------------------	------------------------------------------------------------

RESOURCE AFFECTED

SOIL: YES INDOOR AIR: NO SURFACE WATER: NO SEWER: NO SUBWAY: NO	AIR: NO GROUNDWATER: NO DRINKING WATER: NO IMPERVIOUS SURFACE: NO UNDERGROUND UTILITIES: NO
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------

CAUSE OF SPILL: DELIBERATE
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: DEC

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: JFOTTO
SPILL CONTACT:
TELEPHONE:

SPILLER:

ADDRESS:

TELEPHONE:

REPORTED BY: DEC

LAST DEC UPDATE: 11/3/2004
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 0485102 CALLER COMPLAINED THAT THERE IS A JUNKYARD AT THIS LOCATION AND THEY ARE DUMPING WASTE OIL AND ALL FLUIDS ON THE GROUND. THE COMPLAINANT S NAME IS JOEL BEUT HE DID NOT LEAVE A PHONE NUMBER. END CALLERREMARK - 0485102

DEC REMARKS:
Start DECRemark - 0485102 11/02/04 JFO ON SITE IN FRONT OF CARPENTER AUTO PARTS AND INFINITY AUTO PARTS. THEY ARE NEXT

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 158

DIST/DIR: 0.11 SE

MAP ID: 77

NAME: JUNKYARD
ADDRESS: NIAGARA and POTOMAC
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 0485102
ID2: 333210
STATUS: CLOSED
PHONE:

DOOR TO EACH OTHER. IT IS RAINING AND WATER IS FLOWING FROM THE JUNKYARDS TO THE STREET AND SIDEWALK. THERE IS NO SHEEN ON THE RAINWATER. NO FURTHER ACTION REQUIRED. CLOSED END DECRemark - 0485102

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 148 **DIST/DIR:** 0.11 SE **MAP ID:** 71

NAME: AUTO RECOVERY SHOP	REV: 2/5/08
ADDRESS: 66 BIRD AVE	ID1: 0650077
BUFFALO NY	ID2: 362737
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/18/2006	DATE REPORTED: 4/18/2006
CLOSED DATE: 4/18/2006	INSP DATE: 12:00:00 AM

MATERIAL SPILLED: CONCRETE CLEANER	AMOUNT SPILLED: 0
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0

RESOURCE AFFECTED

SOIL: NO	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: YES
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL:	HUMAN ERROR
WATERBODY AFFECTED:	NONE
SOURCE OF SPILL:	COMMERCIAL/INDUSTRIAL
REPORTED BY:	DEC

REGION:	9
UST TRUST?	NO

SPILL INVESTIGATOR:	JFOTTO
SPILL CONTACT:	CHRIS GUADAGNO
TELEPHONE:	

SPILLER:	CHRIS GUARDAGNO
ADDRESS:	66 BIRD AVE
	BUFFALO, NY

TELEPHONE:

REPORTED BY:	DEC
---------------------	-----

LAST DEC UPDATE:	4/28/2006
CLEAN UP MEET STANDARDS?	YES
PENALTY RECOMMENDED?	NO

CALLER REMARKS: START CALLERREMARK - 0650077 GREEN LIQUID ACCUMULATING ALONG CURB ON BIRD AVE. 66 BIRD AVE JUST WASHED THEIR CONCRETE FLOOR. END CALLERREMARK - 0650077

DEC REMARKS:
Start DECRemark - 0650077 04/18/06 JFO ON SITE MET WITH CHRIS G. HE USED DJ CONCRETE CLEANER ON THE FLOOR AND SOME FLOWED TO THE STREET. THERE ARE 3 SMALL PUDDLES OF THE GREEN CLEANER ALONG THE CURB. CHRIS AND HIS HELPER

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 148

DIST/DIR: 0.11 SE

MAP ID: 71

NAME: AUTO RECOVERY SHOP

REV: 2/5/08

ADDRESS: 66 BIRD AVE
BUFFALO NY
ERIE

ID1: 0650077

ID2: 362737

STATUS: CLOSED

CONTACT:

PHONE:

ARE SOAKING UP THE MATERIAL. NONE THAT I COULD SEE REACHED THE STORM DRAIN. I INFORMED ECO LOHR. NO FURTHER ACTION REQUIRED BY SPILLS. CLOSED END DECRemark - 0650077

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

SCHOOL													
<table style="width: 100%;"><tr><td style="width: 33%;">SEARCH ID: 281</td><td style="width: 33%;">DIST/DIR: 0.12 NE</td><td style="width: 33%;">MAP ID: 82</td></tr></table> <table style="width: 100%;"><tr><td style="width: 50%;">NAME: STATE UNIVERSITY AT BUFFALO SCHOOL OF MEDICI</td><td style="width: 50%;">REV: 1/1/05</td></tr><tr><td>ADDRESS: NY</td><td>ID1: NY-103087</td></tr><tr><td> ERIE</td><td>ID2:</td></tr><tr><td>CONTACT:</td><td>STATUS:</td></tr><tr><td></td><td>PHONE:</td></tr></table> <div style="text-align: center; padding-top: 20px;">DETAILS NOT AVAILABLE</div>	SEARCH ID: 281	DIST/DIR: 0.12 NE	MAP ID: 82	NAME: STATE UNIVERSITY AT BUFFALO SCHOOL OF MEDICI	REV: 1/1/05	ADDRESS: NY	ID1: NY-103087	ERIE	ID2:	CONTACT:	STATUS:		PHONE:
SEARCH ID: 281	DIST/DIR: 0.12 NE	MAP ID: 82											
NAME: STATE UNIVERSITY AT BUFFALO SCHOOL OF MEDICI	REV: 1/1/05												
ADDRESS: NY	ID1: NY-103087												
ERIE	ID2:												
CONTACT:	STATUS:												
	PHONE:												

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 146 **DIST/DIR:** 0.12 NW **MAP ID:** 81

NAME: ABANDONED DRUMS ON RR	REV: 2/5/08
ADDRESS: 76 TONAWANDA STREET	ID1: 9501120
BUFFALO NY	ID2: 293162
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 4/26/1995	DATE REPORTED: 4/26/1995
CLOSED DATE: 12/6/1995	INSP DATE: 5/5/1995

MATERIAL SPILLED: PAINT THINNERS	AMOUNT SPILLED: 10 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 10 G

MATERIAL SPILLED: GASOLINE	AMOUNT SPILLED: 25 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 25 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: DELIBERATE
WATERBODY AFFECTED:
SOURCE OF SPILL: UNKNOWN
REPORTED BY: FIRE DEPARTMENT

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SORGI
SPILL CONTACT:
TELEPHONE:

SPILLER: UNKNOWN

ADDRESS:
ZZ

TELEPHONE:

REPORTED BY: FIRE DEPARTMENT

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 146 **DIST/DIR:** 0.12 NW **MAP ID:** 81

NAME: ABANDONED DRUMS ON RR	REV: 2/5/08
ADDRESS: 76 TONAWANDA STREET	ID1: 9501120
BUFFALO NY	ID2: 293162
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

LAST DEC UPDATE: 1/9/1996
CLEAN UP MEET STANDARDS? YES
PENALTY RECOMMENDED? NO

CALLER REMARKS: START CALLERREMARK - 9501120 RUBBISH FIRE BEHIND BLDG. FOUND CONTAINERS NEAR FIRE. CONTAINERS ARE INTACT. END CALLERREMARK - 9501120

DEC REMARKS:

Start DECRemark - 9501120 Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 04/26/95: 2145 HRS - MJS RECEIVED AFTER HOURS CALL FROM MARK HANS. MJS TELECON TO BUFFALO FIRE DEPT - SPOKE W/ CALLER. NO HOMES IN AREA - MJS TO INSPECT IN MORNING. 04/27/95: MJS SITE INSPECT. FOUND CONTAINERS. LABELED LAQUER THINNER AND ODOR IS SAME. LIQUID IS DARK - APPEARS TO BE WASTE LAQUER THINNER. APPROX 25 GALLONS TOTAL. CONRAIL PROPERTY. 04/28/95: MJS TELECON TO CONRAIL. LEFT MESSAGE FOR CRAIG CURRY. 05/04/95: MJS TELECON FROM PAUL SUOZZI(EPS). HE WAS CONTACTED BY CONRAIL TO CLEAN SPILL. 05/05/95: MJS MET W/ PAUL SUOZZI, MIKE ROTH AND CONRAIL ON SITE. PROPERTY NOT OWNED BY CONRAIL. POSSIBLY OWNED BY CANADIAN NATIONAL. MJS HIRED EPS TO DRUM LIQUIDS. COLLISION SHOPS ON BOTH SIDES OF CONTAINERS. 05/08/95: MJS TELECON W/ MIKE ROTH(EPS). EPS CANNOT DO JOB TODAY. RESCHEDULED FOR TOMORROW. 05/11/95: MJS TELECON W/ JIM WEHNER. LIQUIDS ARE DRUMMED AND DRUM STAGED ON SITE PENDING TRANSPORT TO BSA. 05/17/95: MJS TELECON W/ JIM WEHNER. TRANSPORT OF DRUM SCHEDULED FOR 5/18. MJS TELECON W/ JIM CARUSO(BSA) AND RECEIVED PERMISSION TO STAGE DRUM AT BSA PENDING DISPOSAL. EPS NEEDS EMERG TRANSPORT PERMIT. 05/18/95: 0920 HRS - MJS MET W/ GARY HAUSE(EPS) ON SITE AND GAVE HIM EMERG TRANSPORT PERMIT. DRUM TAKEN TO BSA METERING STATION ON NIAGARA ST. MJS MET W/ DENNIS YOUNG(BSA) ON NIAGARA ST. DRUM STAGED. 05/30/95: RECEIVED ANALYTICAL RESULTS. LIQUID IS HAZARDOUS BASED ON FLASHPOINT. MJS SPOKE W/ LINDA CARR. EPA ID NOT REQUIRED DUE TO SMALL QUANTITY. 07/09/95: RECEIVED PAY-PACK FOR DISPOSAL FROM EPS(\$221.34). 09/29/95: This is additional information about material spilled from the translation of the old spill file: LAQUER THINNER. 09/26/95: MJS MEETING W/ LINDA SCOTT. ADVISED THAT DEC NEEDS DISPOSAL CERTIFICATE FOR CLOSURE. SHE WILL CONTACT FACILITY FOR RECEIPT 11/01/95: MJS REVIEW FILE. DISPOSAL RECEIPT NOT YET RECEIVED. MJS CONTACT LINDA SCOTT AND SHE WILL CHECK ON STATUS. 12/06/95: MJS REVIEW FILE. COPIES OF HAZ-WASTE MANIFEST AND INVOICE FROM DISPOSAL FACILITY IN FILE. FILE COMPLETE. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE. END DECRemark - 9501120

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 66 **DIST/DIR:** 0.12 SE **MAP ID:** 78

NAME: METAL BINDING INC ADDRESS: 1340 WEST AVE BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110017246425 ID2: NYP000945006 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 3/11/2004 10:19:54 PM ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110017246425 AGENCY INTERESTED: 3/11/2004 10:19:53 PM INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED:
PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: FIRST REPORTING YEAR INT END QUAL: YEAR REPORTING STOPPED LAST REPORTED: 1/1/2001 ENFORCEMENT ACT: REG PROGRAM: HAZARDOUS WASTE BIENNIAL REPORTER - HAZARDOUS WASTE BIENNIAL REPORTER	PROGRAM ID: NYP000945006 AGENCY INTERESTED: 12/31/1999 INTEREST ENDED: 1/1/2001 SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 3/11/2004 10:19:54 PM
PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 4/23/2002 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NYN008013484 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 4/22/2004 9:28:39 AM
PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 1/1/2001 ENFORCEMENT ACT: REG PROGRAM: NOT IN A UNIVERSE - THE HANDLER IS NOT CURRENTLY IN ANY HAZARDOUS WASTE UNIVERSE.	PROGRAM ID: NYP000945006 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: RCRAINFO LAST EXTRACTED: 3/11/2004 10:19:54 PM
SITE TYPE: STATIONARY INTEREST STATUS: ACTIVE DATA QUALITY: iZ LOCATION DESC: ADDRESS TYPE: REGULAR URBAN LAST REPORTED: POSTED TO DATABASE: 3/11/2004 10:19:54 PM DATA UPDATED: 1/6/2006 6:37:37 PM ENTERED PERSON/METHOD: REFRESH PARENT REG ID: CONFIDENCE IN ADDR: ENFORCEMENT SENSITIVE: REQ MANUAL REVIEW:	

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 66	DIST/DIR: 0.12 SE	MAP ID: 78
----------------------	--------------------------	-------------------

NAME: METAL BINDING INC ADDRESS: 1340 WEST AVE BUFFALO NY 14123 ERIE CONTACT:	REV: 11/1/06 ID1: 110017246425 ID2: NYP000945006 STATUS: FRS PHONE:
----------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

FEDERAL FACILITY: NO
FEDERAL AGENCY:
TRIBAL LAND: NO
TRIBAL LAND NAME:
CONGRESSIONAL DIST:
LEGISLATIVE DIST: NY
HYDROLOGICAL UNTIS:
EPA REGION: 02
AIRSHED:
CENSUS BLOCK:

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 89 **DIST/DIR:** 0.12 SE **MAP ID:** 79

NAME: RUSLANDER and SONS ADDRESS: 18 LETCHWORTH ST BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110001569794 ID2: NYD002105666 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FACILITY REGISTRATION INFORMATION:

PROGRAM: FRS PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: FACILITY -	PROGRAM ID: 110001569794 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FRS LAST EXTRACTED:
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------

PROGRAM: RCRAINFO PROVIDED BY: FEDERAL AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: 5/12/1986 ENFORCEMENT ACT: REG PROGRAM:	PROGRAM ID: NYD002105666 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: NOTIFICATION (RCRA) LAST EXTRACTED:
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

REG PROGRAM: SQG - HAZARDOUS WASTE SMALL QUANTITY GENERATORS GENERATE: (A) MORE THAN 100 AND LESS THAN 1000 KILOGRAMS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH AND ACCUMULATE LESS THAN 6000 KG OF HAZARDOUS WASTE AT ANY TIME; OR (B) 100 KG OR LESS OF HAZARDOUS WASTE DURING ANY CALENDAR MONTH, AND ACCUMULATE MORE THAN 1000 KG OF HAZARDOUS WASTE AT ANY TIME.

PROGRAM: FIS PROVIDED BY: STATE AGENCY AGENCY INT QUAL: INT END QUAL: LAST REPORTED: ENFORCEMENT ACT: REG PROGRAM: STATE MASTER -	PROGRAM ID: 9-1402-00449 AGENCY INTERESTED: INTEREST ENDED: SOURCE OF DATA: FIS LAST EXTRACTED: 11/19/2004 2:40:54 PM
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------

SITE TYPE: STATIONARY
INTEREST STATUS: ACTIVE
DATA QUALITY: V
LOCATION DESC:
ADDRESS TYPE: REGULAR URBAN
LAST REPORTED:
POSTED TO DATABASE: 3/1/2000
DATA UPDATED: 4/9/2001 10:27:22 AM
ENTERED PERSON/METHOD: REFRESH
PARENT REG ID:
CONFIDENCE IN ADDR: MEDIUM
ENFORCEMENT SENSITIVE: N
REQ MANUAL REVIEW:
REASON MAN REVIEW:
SMALL BUS POLICY:
ENFORCEMENT ACTION:
DATA PUB ACCESS: YES
INTERNAL SYS ID:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 89	DIST/DIR: 0.12 SE	MAP ID: 79
----------------------	--------------------------	-------------------

NAME: RUSLANDER and SONS ADDRESS: 18 LETCHWORTH ST BUFFALO NY 14213 ERIE CONTACT:	REV: 11/1/06 ID1: 110001569794 ID2: NYD002105666 STATUS: FRS PHONE:
--------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------

FEDERAL FACILITY:	NO
FEDERAL AGENCY:	
TRIBAL LAND:	NO
TRIBAL LAND NAME:	
CONGRESSIONAL DIST:	29
LEGISLATIVE DIST:	NY
HYDROLOGICAL UNTIS:	04120104
EPA REGION:	02
AIRSHED:	
CENSUS BLOCK:	

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

FINDS

SEARCH ID: 90	DIST/DIR: 0.12 SE	MAP ID: 79
----------------------	--------------------------	-------------------

NAME: RUSLANDER and SONS INC
ADDRESS: 18 LETCHWORTH
BUFFALO NY 14213
Erie
CONTACT:

REV:
ID1: NYD002105666
ID2:
STATUS:
PHONE:

RCRIS : NYD002105666
PCS :
AFS/AIRS : 3602900407, 3602903039
SSTS :
CERCLIS :
NCDB :
ENF DOCKET :
CONTR LIST :
CRIM DOCKET :
FFIS :
CICIS :
STATE :
PADS :
TRIS :
DandB : 002105666
UNKNOWN :

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

INSTCONTROL

SEARCH ID: 273	DIST/DIR: 0.12 SE	MAP ID: 80
-----------------------	--------------------------	-------------------

NAME: IROQUOIS GAS/WESTWOOD PHARM. TERRESTRIAL ADDRESS: DART STREET BUFFALO NY 13213 ERIE CONTACT:	REV: 2/5/08 ID1: 915141A ID2: 56633.00 STATUS: INSTITUTIONAL CONTROL PHONE:
-------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

SITE INFORMATION

BCP = BROWNFIELD CLEANUP PROGRAM
ERP = ENVIRONMENTAL RESTORATION PROGRAM

SITE TYPE:

OPEN DUMP: -1	STRUCTURE: -1
LAGOON: 0	LANDFILL: 0
POND: 0	

SIZE (ACRES): 8.800	REGION: 9
----------------------------	------------------

CLASS CODE:

DESCRIPTION:

The Site is 8.8 acres in size and is located immediately west of Dart Street and north of Bradley Street in the City of Buffalo. Scajaquada Creek lies adjacent to the site on the west and has been impacted by site contaminants. Land use near the site is

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

Monitoring indicates that the wastes are effectively contained as a result of the remedial construction and the pump/treat system operation. Long term pump and treat and maintenance of the cap are ongoing to ensure that the remedy remains protective of t

ASSESSMENT OF HEALTH PROBLEMS:

Exposures via drinking water are not expected because homes in the area are served by public water and no known private wells exist in the immediate area. The entire site has been capped or paved and on-site access is restricted by fencing and 24-hour se

SITE OWNER/OPERATOR INFORMATION

WESTWOOD SQUIBB

100 FOREST AVENUE
BUFFALO NY 14213
UNITED STATES OF AMERICA

SITE OWNER/OPERATOR INFORMATION

WESTWOOD PHARMACEUTICAL

100 FOREST AVENUE
BUFFALO NY 14213
UNITED STATES OF AMERICA

SITE OWNER/OPERATOR INFORMATION

IROQUOIS GAS (NATIONAL FUEL GAS)
DONALD R. MILLER
100 FOREST AVE.
BUFFALO NY 142131091
UNITED STATES OF AMERICA

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

INSTCONTROL

SEARCH ID: 273 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARM. TERRESTRIAL ADDRESS: DART STREET BUFFALO NY 13213 ERIE CONTACT:	REV: 2/5/08 ID1: 915141A ID2: 56633.00 STATUS: INSTITUTIONAL CONTROL PHONE:
-------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------

SITE OWNER/OPERATOR INFORMATION

NATIONAL FUEL GAS DISTRIBUTION CORP.

ZZ
UNITED STATES OF AMERICA

SITE OWNER/OPERATOR INFORMATION

NATIONAL FUEL GAS DISTRIBUTION CORP.

ZZ
UNITED STATES OF AMERICA

SITE OWNER/OPERATOR INFORMATION

IROQUOIS GAS (NATIONAL FUEL GAS)

ZZ
UNITED STATES OF AMERICA

SITE OWNER/OPERATOR INFORMATION

IROQUOIS GAS (NATIONAL FUEL GAS)

ZZ
UNITED STATES OF AMERICA

INSTITUTIONAL AND ENGINEERING CONTROLS

CONTROL TYPE	CONTROL NAME
INST	DISCHARGE PERMIT
INST	DEED RESTRICTION

WASTE MATERIALS

WASTE NAME	WASTE QUANTITY
HEAVY METALS	UNKNOWN
CHLORINATED HYDROCARBONS	UNKNOWN
SOILS CONTAMINATED WITH OIL	UNKNOWN
VOLATILE ORGANICS	UNKNOWN
POLYNUCLEAR AROMATIC HYDROCARBONS (PAHS)	UNKNOWN
PHENOLS	UNKNOWN

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 17 **DIST/DIR:** 0.12 SE **MAP ID:** 79

NAME: RUSLANDER and SONS INC ADDRESS: 18 LETCHWORTH BUFFALO NY 14213 ERIE CONTACT: ERDEI MARTIN	REV: 6/6/06 ID1: NYD002105666 ID2: STATUS: SGN PHONE: 7168810030
----------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

SITE INFORMATION

CONTACT INFORMATION: ERDEI MARTIN
18 LETCHWORTH
BUFFALO NY 14213

PHONE: 7168810030

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000
KG/MONTH OF HAZARDOUS WASTE	

NAIC INFORMATION

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	7/18/1994
TYPE:	310 - FINAL 3008(A) COMPLIANCE ORDER		

AGENCY:	E - EPA	DATE:	10/5/1994
TYPE:	110 - VERBAL INFORMAL		

VIOLATION INFORMATION:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRAGN

SEARCH ID: 17	DIST/DIR: 0.12 SE	MAP ID: 79
----------------------	--------------------------	-------------------

NAME: RUSLANDER and SONS INC ADDRESS: 18 LETCHWORTH BUFFALO NY 14213 ERIE CONTACT: ERDEI MARTIN	REV: 6/6/06 ID1: NYD002105666 ID2: STATUS: SGN PHONE: 7168810030
----------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------

VIOLATION NUMBER:	0001	RESPONSIBLE:	E - EPA
DETERMINED:	10/5/1994	DETERMINED BY:	E - EPA
CITATION:	40 cfr 262.34		
VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	7/1/1994	DETERMINED BY:	S - STATE
CITATION:			
RESOLVED:	10/19/1994		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		
RESOLVED:	9/27/1994		
TYPE:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		

HAZARDOUS WASTE INFORMATION:

The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane
Ignitable waste

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 31 **DIST/DIR:** 0.12 SE **MAP ID:** 78

NAME: METAL BINDING INC	REV: 6/6/06
ADDRESS: 1340 WEST AVE	ID1: NYN008013484
BUFFALO NY 14213	ID2:
ERIE	STATUS: NLR
CONTACT: BRAD HAMILTON	PHONE:

SITE INFORMATION

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

RCRANLR

SEARCH ID: 32 **DIST/DIR:** 0.12 SE **MAP ID:** 78

NAME: METAL BINDING INC	REV: 6/6/06
ADDRESS: 1340 WEST AVE	ID1: NYP000945006
BUFFALO NY 14213	ID2:
ERIE	STATUS: NLR
CONTACT: BRAD HAMILTON	PHONE: 7168825370

SITE INFORMATION

UNIVERSE INFORMATION:

GOVERNMENT PERFORMANCE AND RESULTS ACT (GPRA)

GPRA PERMIT:	N - NO
GPRA POST CLOSURE:	N - NO
GPRA CA:	N - NO
GPRA COMPLIANCE MONITORING and ENFORCEMENT:	N - NO

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO

SIGNIFICANT NON-COMPLIANCE(SNC):	N - NO
BEGINNING OF THE YEAR SNC:	N - NO
PERMIT WORKLOAD:	----
CLOSURE WORKLOAD:	----
POST CLOSURE WORKLOAD:	----
PERMITTING /CLOSURE/POST-CLOSURE PROGRESS:	----
CORRECTIVE ACTION WORKLOAD:	N - NO
GENERATOR STATUS:	N

NAIC INFORMATION

333319 - OTHER COMMERCIAL AND SERVICE INDUSTRY MACHINERY MANUFACTURING

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 160 **DIST/DIR:** 0.12 SE **MAP ID:** 78

NAME: METAL BINDING INC	REV: 2/5/08
ADDRESS: 1340 WEST AVENUE	ID1: 9975145
BUFFALO NY	ID2: 260689
ERIE	STATUS: CLOSED
CONTACT:	PHONE:

SITE INFORMATION

SPILL DATE: 5/25/1999	DATE REPORTED: 5/26/1999
CLOSED DATE: 10/22/1999	INSP DATE: 6/23/1999

MATERIAL SPILLED: LUBE OIL	AMOUNT SPILLED: 0 G
MATERIAL CLASS: PETROLEUM	AMOUNT RECOVERED: 0 G

MATERIAL SPILLED: MINERAL SPIRITS	AMOUNT SPILLED: 0 G
MATERIAL CLASS: OTHER	AMOUNT RECOVERED: 0 G

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

RESOURCE AFFECTED

SOIL: YES	AIR: NO
INDOOR AIR: NO	GROUNDWATER: NO
SURFACE WATER: NO	DRINKING WATER: NO
SEWER: NO	IMPERVIOUS SURFACE: NO
SUBWAY: NO	UNDERGROUND UTILITIES: NO

CAUSE OF SPILL: HOUSEKEEPING
WATERBODY AFFECTED:
SOURCE OF SPILL: COMMERCIAL/INDUSTRIAL
REPORTED BY: AFFECTED PERSONS

REGION: 9
UST TRUST? NO

SPILL INVESTIGATOR: SACALAND
SPILL CONTACT:
TELEPHONE:

SPILLER: METAL BINDING INC
BRAD HAMILTON
ADDRESS: 1340 WEST AVENUE
BUFFALO, NY 14213-

TELEPHONE: (716) 882-5370

REPORTED BY: AFFECTED PERSONS

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 160 **DIST/DIR:** 0.12 SE **MAP ID:** 78

NAME:	METAL BINDING INC	REV:	2/5/08
ADDRESS:	1340 WEST AVENUE	ID1:	9975145
	BUFFALO NY	ID2:	260689
	ERIE	STATUS:	CLOSED
CONTACT:		PHONE:	

LAST DEC UPDATE: 5/4/2000
CLEAN UP MEET STANDARDS? NO
PENALTY RECOMMENDED? YES

CALLER REMARKS: START CALLERREMARK - 9975145 NFG WAS EXCAVATING TO REPLACE A GASLINE WHEN THEY ENCOUNTERED A SMALL AREA OF CONTAMINATED SOILS. THE MATERIAL APPEARS TO BE CONTAMINATED WITH MINERAL SPIRITS AND OIL. END CALLERREMARK - 9975145

DEC REMARKS:

Start DECRemark - 9975145 Prior to Sept. 2004 data translation this spill Lead_DEC Field was SAC 05/27/99: JDC ON SITE, MET BRAD HAMILTON OF METAL BINDING, NOTED TWO EXCAVATIONS BY NFG AND DETECTED SOLVENT ODOR IN EXCAVATION AT THE BUILDING, WEST SIDE OF GARAGE DOOR. FURTHER INVESTIGATION UNCOVERED A TANK FILL OR VENT PIPE. DETERMINED TANK SIZE TO BE 500 GALLONS, FULL OF WATER WITH 1/4 INCH OF UNKNOWN PRODUCT. ADVISED BRAD HAMILTON THAT THE TANK WOULD HAVE TO BE REMOVED. HE STATED HE COULD NOT AFFORD TO DO THE WORK, INFORMED HIM THAT HE COULD ALLOW THE STATE TO DO THE WORK TO REMOVE THE TANK AND ANY CONTAMINATION, HOWEVER HE WOULD BE RESPONSIBLE FOR ALL COSTS, PAYABLE AT A LATER DATE. HE AGREED, ADVISED THAT A LETTER WOULD BE SENT WITH A RIGHT-OF-ENTRY (ROE) FORM FOR HIM TO SIGN. 05/28/99: JDC TELECON WITH CHARLEY BURKE, NFG, STATED THAT SPILLS WOULD BE DOING THE CLEANUP AND THAT HE SHOULD FINISH HIS LINE WORK. 06/04/99: JDC RECEIVED SIGNED ROE FROM BRAD HAMILTON JDC TELECON TO GREEN ENVIRONMENTAL, HIRED THEM FOR THE WORK, REQUESTED AN ONSITE VISIT. 06/07/99: JDC ON SITE, MET JIM GREIG OF GREEN ENVIRONMENT AND BRAD HAMILTON, THE RP, AND DISCUSSED TANK REMOVAL WORK. 06/08/99: JDC RECEIVED REMEDIATION PLAN FROM GREEN ENVIRONMENT, JDC TELECON TO GREEN, DISCUSSED PLAN, START DATE NOT DETERMINED. 06/09/99: JDC TELECON JIM GREIG, START DATE WILL BE 6/23/99 AT 0800. 06/23/99: JDC ON SITE AND FOUND A 1000 GALLON TANK AND A 500 GALLON TANK REMOVED. TWO YARDS OF CONTAMINATED SOIL FOUND AND PLACED IN A MODERN ROLL-OFF. EXCAVATION BOTTOM WAS CLAY, APPROXIMATELY 1700 GALLONS OF CONTAMINATED WATER. 07/13/99: SAC ASSUMED SITE RESPONSIBILITY AS JDC NO LONGER WORKS FOR DEPARTMENT, SAC REVIEWED SAMPLE RESULTS, LEVELS IN CONTAMINATED SOIL WERE HAZARDOUS FOR LEAD, CHROME, NITROBENZENE, HEXACHLOROBENZENE, and BENZENE, THE CONFIRMATORY SAMPLE RESULTS WERE ANALYZED USING EPA METHODS 8021 and 8270 TCLP, LEVELS REPORTED FOR BENZENE FROM THIS SAMPLE WERE NON-HAZARDOUS, STARS GUIDANCE VALUES WERE NON-DETECTIBLE FOR THE 8270 RESULTS, STARS GUIDANCE VALUES WERE EXCEEDED FOR THE 8021 RESULTS SAC REVIEWED RESULTS WITH RNL, BASED ON LEVELS REPORTED, RNL WILLING TO GIVE AN I STATUS SAC DISCUSSED WITH MARTY DOSTER, HAZ-WASTE REMEDIATION, SITE REQUIRES RESAMPLING FOR PARAMETERS THAT WERE FOUND TO BE HAZARDOUS, FIRST USING A TOTAL ANALYSIS AND THEN BASED ON THOSE RESULTS POSSIBLY THE TCLP METHOD WOULD BE USED TO ANALYZE THE SAMPLES. 07/14/99: SAC TELECON JIM GREIG, GREEN ENVIRONMENTAL, BASED ON DISCUSSION WITH MARTY DOSTER, SAC TOLD MR. GREIG TO TAKE FIVE SEPARATE SAMPLES, ONE FROM THE BOTTOM AND ONE EACH FROM THE SIDES AND RUN A TOTAL ANALYSIS ON THE SAMPLES FOR THE PARAMETERS THAT ANALYZED AS BEING HAZARDOUS. 07/15/99: SAC RECEIVED ANALYTICAL RESULTS FOR THE WATER THAT WAS PUMPED FROM THE EXCAVATION, THE RESULTS WERE FOR METALS ONLY, THE RESULTS WERE BELOW HAZARDOUS LEVELS. 07/27/99: SAC RECEIVED RESULTS, SAC DISCUSSED WITH MARTY DOSTER, HE SAID LEVELS WERE OK FOR NO FURTHER WORK AS LONG AS IT WAS INDUSTRIAL SITE AND NOT A RESIDENTIAL SITE, HE WILL INSPECT AND MAKE A DETERMINATION. 07/28/99: SAC RECEIVED AN e-MAIL FROM MARTY DOSTER, HE INSPECTED THE SITE AND FOUND IT TO BE AN INDUSTRIAL SITE AND THEREFORE THE SAMPLE RESULTS ARE WITHIN ACCEPTABLE LEVELS AND NO FURTHER WORK IS REQUIRED UNLESS THERE IS ADDITIONAL INFORMATION WHICH SHOWS MIGRATION OFF THE SITE, THE ONLY SAMPLE RESULTS SRE FROM THE EXCAVATION FROM THE TWO TANK REMOVALS AND NOTHING ELSE TO INDICATE MIGRATION OFF THE SITE. 07/28/99: SAC TELECON BRAD HAMILTON, RP, SAC TOLD MR. HAMILTON SAMPLE RESULTS FROM EXCAVATION OF THE TWO TANK REMOVALS WERE ABOVE GUIDANCE LEVELS BUT THAT DEC WOULD ALLOW INACTIVE STATUS WHICH MEANT THAT IF ANY SOIL IS REMOVED FROM THE LOCATION IT WOULD EITHER HAVE TO BE RETESTED OR DISPOSED, SAC ASKED IF MR. HAMILTON WOULD LIKE DEC TO EXCAVATE ADDITIONAL SOIL TO REACH CLOSED STAUTS OR WOULD HE ACCEPT THE INACTIVE STATUS, MR. HAMILTON SAID HE DIDN T CARE AT THIS POINT, SINCE MR. HAMILTON DID NOT REQUEST ADDITIONAL EXCAVATION NO FURTHER EXCAVATION WILL BE DONE AND SITE WILL HAVE AN INACTIVE STATUS UPON COMPLETION OF DISPOSAL OF MATERIAL. 08/09/99: SAC TELECON MATT SCHIMPF, GREEN ENVIRONMENT, MR. SCHIMPF REQUESTED STATUS OF EPA ID NUMBER, SAC TOLD MR. SCHIMPF HE SPOKE TO JIM GREIG AND MR. GREIG INDICATED HE WOULD TAKE CARE OF THIS, BASED ON THIS MISUNDERSTANDING, SAC SENT REQUEST FOR PROVISIONAL EPA ID NUMBER, RECEIVED RESPONSE FROM JACK HOYT, EPA, ID NUMBER IS NYP000945006, SAC CALLED MATT SCHIMPF AND GAVE HIM THE NUMBER SO THAT HE COULD ARRANGE DISPOSAL.

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

SPILLS

SEARCH ID: 160

DIST/DIR: 0.12 SE

MAP ID: 78

NAME: METAL BINDING INC
ADDRESS: 1340 WEST AVENUE
BUFFALO NY
ERIE

REV: 2/5/08
ID1: 9975145
ID2: 260689
STATUS: CLOSED
PHONE:

09/01/99: SAC TELECON JIM GREIG, HE SAID THE DISPOSAL OF THE CONTAMINATED SOIL TOOK PLACE LAST WEEK, THE SOIL WAS TRANSPORTED TO CWM. 10/22/99: SAC PROCESSED PAY PACKAGE TWO WEEKS AGO SAC TELECON TO KATHY, GREEN ENVIRONMENT, KATHY CHECKED WITH JIM WEHNER, MR. WEHNER SAID ALL WORK THAT WAS PERFORMED WAS BILLED IN THE ONE INVOICE, NO FURTHER WORK REQUIRED, DRAFTED 1 LETTER. SITE CLOSED END DECRemark - 9975145

THERE MAYBE MORE DEC REMARKS AVIALBLE, PLEASE CONTACT THE NY DEC (518) 402-9549 FOR FURTHER INFORMATION

***Environmental FirstSearch
Site Detail Report***

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 140 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARM. TERRESTRIAL	REV: 2/5/08
ADDRESS: DART STREET	ID1: 915141A
BUFFALO NY 13213	ID2: 56633.00
ERIE	STATUS:
CONTACT:	PHONE:

SITE INFORMATION

REGION: 9 **SIZE (ACRES):** 8.800

SITE TYPE:

OPEN DUMP: YES	STRUCTURE: YES
LAGOON: NO	LANDFILL: NO
POND: NO	

CLASS: The classification assigned to a site that has been substantially remediated and/or closed, but that requires continued operation, maintenance and/or monitoring. A site whose remedial program stipulates more than one operable unit is eligible for this classification only when all of the operable units have been satisfactorily completed. Under certain circumstances, this classification may be assigned to a site where remedial activities have been completed, but conditions at the site have not been brought into compliance with applicable regulatory standards.

SITE OWNER/OPERATOR INFORMATION:

NAME:
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS:
ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: WESTWOOD SQUIBB
ADDRESS: 100 FOREST AVENUE
BUFFALO NY 14213
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: WESTWOOD PHARMACEUTICAL
ADDRESS: 100 FOREST AVENUE
BUFFALO NY 14213
COUNTRY: UNITED STATES OF AMERICA

NAME: DONALD R. MILLER
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS: 100 FOREST AVE.
BUFFALO NY 142131091
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS:
ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: NATIONAL FUEL GAS DISTRIBUTION CORP.
ADDRESS:
ZZ

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 140 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARM. TERRESTRIAL
ADDRESS: DART STREET
BUFFALO NY 13213
ERIE
CONTACT:

REV: 2/5/08
ID1: 915141A
ID2: 56633.00
STATUS:
PHONE:

COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: NATIONAL FUEL GAS DISTRIBUTION CORP.
ADDRESS:

ZZ
COUNTRY: UNITED STATES OF AMERICA

<u>HAZARDOUS WASTE:</u>	<u>QUANTITY:</u>
SOILS CONTAMINATED WITH OIL	UNKNOWN
PHENOLS	UNKNOWN
POLYNUCLEAR AROMATIC HYDROCARBONS (PAHS)	UNKNOWN
CHLORINATED HYDROCARBONS	UNKNOWN
VOLATILE ORGANICS	UNKNOWN
HEAVY METALS	UNKNOWN

HAZARDOUS WASTE DISPOSAL PERIOD: 1900 TO 1972

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

Monitoring indicates that the wastes are effectively contained as a result of the remedial construction and the pump/treat system operation. Long term pump and treat and maintenance of the cap are ongoing to ensure that the remedy remains protective of the environment.

ASSESSMENT OF HEALTH PROBLEMS:

Exposures via drinking water are not expected because homes in the area are served by public water and no known private wells exist in the immediate area. The entire site has been capped or paved and on-site access is restricted by fencing and 24-hour security which eliminates the potential for direct contact exposures to on-site contaminants.

DESCRIPTION:

The Site is 8.8 acres in size and is located immediately west of Dart Street and north of Bradley Street in the City of Buffalo. Scajaquada Creek lies adjacent to the site on the west and has been impacted by site contaminants. Land use near the site is mixed industrial and residential. The site is broken down into two projects noted as sites 915141A (Terrestrial) and 915141B (Reparian). The site was used by the Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation, for the manufacture and storage of manufactured gas from coal. Westwood-Squibb purchased the site from Iroquois Gas in 1972. During subsequent building construction at the site, soil and groundwater were found to be contaminated with polynuclear aromatic hydrocarbons (PAHs) and benzene, toluene, ethylbenzene and xylene (BTEX). A Remedial Investigation/Feasibility Study (RI/FS) was completed in 1993, and a Record of Decision (ROD) was issued in 1994. A Consent Decree issued by Federal Court in 1995 required Westwood to implement the approved remedy at this site. Westwood started the remedial construction in 1996 and completed the project in 1997. The remedy consists of contaminated groundwater and nonaqueous phase liquid (NAPL) containment and removal through the utilization of a pump and treat system. Six extraction wells were installed to pump contaminated groundwater and NAPL from the subsurface. An on-site treatment facility provides NAPL removal and pre-treatment of groundwater. The treated groundwater is then discharged to the municipal sewer system for further treatment at the Buffalo Sewer Authority (BSA). Recovered NAPL is disposed off site as hazardous waste. A sheet pile wall was installed to enhance the pump and treat system and to prevent migration of contaminated groundwater from the site to Scajaquada Creek. Surficial improvements to control storm water percolation into the subsurface were provided through a combination of site grading and soil and pavement covers. The system became operational in 1997. The site is now in long-term operation, maintenance and monitoring (OM&M). In July 2006, Westwood-Squibb Pharmaceuticals, Inc. became Contract Pharmaceuticals Limited Niagara. The site continues to be subject to the requirements set forth in the Consent Decree.

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 139 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARM. RIPARIAN	REV: 2/5/08
ADDRESS: SCAJAQUADA CREEK, UPSTREAM OF WEST AVE. BRIDGE	ID1: 915141B
BUFFALO NY 13213	ID2: 58902.00
ERIE	STATUS:
CONTACT:	PHONE:

SITE INFORMATION

REGION: 9 **SIZE (ACRES):** 1.000

SITE TYPE:

OPEN DUMP: NO	STRUCTURE: NO
LAGOON: NO	LANDFILL: NO
POND: NO	

CLASS: The classification assigned to a site that has been substantially remediated and/or closed, but that requires continued operation, maintenance and/or monitoring. A site whose remedial program stipulates more than one operable unit is eligible for this classification only when all of the operable units have been satisfactorily completed. Under certain circumstances, this classification may be assigned to a site where remedial activities have been completed, but conditions at the site have not been brought into compliance with applicable regulatory standards.

SITE OWNER/OPERATOR INFORMATION:

NAME:
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS:
ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: NEW YORK STATE
ADDRESS:
ZZ
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS: 10 LAFAYETTE SQUARE
BUFFALO NY 14203
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: IROQUOIS GAS (NATIONAL FUEL GAS)
ADDRESS: 10 LAFAYETTE SQUARE
BUFFALO NY 14203
COUNTRY: UNITED STATES OF AMERICA

NAME:
COMPANY: NEW YORK STATE
ADDRESS:
ZZ
COUNTRY: UNITED STATES OF AMERICA

HAZARDOUS WASTE:
VOLATILE ORGANICS
BENZENE, TOULENE, ETHYLBENZENE, XYLENE (BTX)

QUANTITY:
UNKNOWN
UNKNOWN

- Continued on next page -

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 139 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME:	IROQUOIS GAS/WESTWOOD PHARM. RIPARIAN	REV:	2/5/08
ADDRESS:	SCAJAQUADA CREEK, UPSTREAM OF WEST AVE. BRIDGE	ID1:	915141B
	BUFFALO NY 13213	ID2:	58902.00
	ERIE	STATUS:	
CONTACT:		PHONE:	

HAZARDOUS WASTE DISPOSAL PERIOD: 1900 TO 1972

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

Removal and off-site disposal of contaminated sediments, installation of the stream bed cap, aquatic habitat restoration and NAPL recovery under the long-term O&M plan have effectively addressed the environmental impacts at the site. The majority of wastes have been removed. NAPL recovery is active from the north and south recovery systems.

ASSESSMENT OF HEALTH PROBLEMS:

Exposures via drinking water are not expected because homes and businesses in the area are served by public water and no known private wells or public water intakes exist in the immediate area. The remediation of Scajaquada Creek sediments reduced the potential for direct contact exposure to site-related contaminants.

DESCRIPTION:

The Site is located immediately west of Dart Street and north of Bradley Street in the City of Buffalo. Scajaquada Creek lies adjacent to the site on the west and has been impacted by site contaminants. Land use near the site is mixed industrial and residential. The site is broken down into two projects noted as sites 915141A (Terrestrial) and 915141B (Riparian). This portion of the site is a 1600 foot long section of Scajaquada Creek, extending upstream from the West Avenue Bridge. The Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation, operated a manufactured gas plant during the early and middle part of the 1900s, in an area on the south bank of the creek on Dart Street. The wastes from the plant operations entered the creek via discharges from piped outlets, spills, and movement of surface and groundwater. The creek sediments were contaminated with high levels of polynuclear aromatic hydrocarbons (PAHs), benzene, toluene, ethylbenzene, and xylene (BTEX), the same contaminants found at the Terrestrial Site 915141A. A Record of Decision (ROD), signed in 1994, selected a site remedy that required removal of contaminated stream sediments and off site disposal. A Consent Decree issued by Federal Court in 1995 directed National Fuel Gas to implement the remedy and remove contaminated sediments to a depth of six feet. The presence of I-198 expressway bridge piers at the site did not allow the removal of all contaminated sediments to the maximum depth in some areas of the creek. The Remedial Design, therefore, was modified to include removal of sediments, coupled with capping of the stream bed to contain any residual contaminants, and long term pumping of two deep pockets of non-aqueous phase liquid (NAPL) from the substrata of the creek. Remedial Action (RA) was started in August 1998 and was completed in 2001. Approximately 19,000 cubic yards of contaminated sediments were excavated and disposed off-site. An 18 inch thick stream bed cap, comprised of geo-synthetic clay liner overlain by sand, geotextile and stone was installed after excavation and removal of the sediments. Restoration of aquatic habitat was included as a part of the RA to enhance the re-establishment of the stream fishery. Two NAPL recovery wells were installed using directional drilling technology to recover the NAPL from the substrata of the creek and both wells are operating. Long-term O&M is ongoing.

Environmental FirstSearch

Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 141 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARMACEUTICAL
ADDRESS: DART STREET
BUFFALO NY 13213
ERIE
CONTACT:

REV: 05/20/99
ID1: 915141
ID2:
STATUS:
PHONE:

CLASS CODE: D3 **REGION:** 9 **ESTIMATED SIZE:** 8.8 ACRES

SITE TYPE:

OPEN DUMP: X **STRUCTURE:** X
LAGOON: **LANDFILL:**
POND:

SITE OWNER/OPERATOR INFORMATION:

CURRENT OWNER(S) NAME: Westwood Pharmaceutical
CURRENT OWNER(S) ADDRESS: 100 Forest Ave.
Buffalo NY 14213

OPERATOR(S) DURING DISPOSAL: National Fuel Gas Distribution Corp.
OPERATOR(S) ADDRESS:
NY

OPERATOR(S) DURING DISPOSAL: Westwood Pharmaceutical
OPERATOR(S) ADDRESS: 100 Forest Ave.
Buffalo NY 14213

HAZARDOUS WASTE DISPOSAL PERIOD: 1900 **TO:** Present

SITE DESCRIPTION:

The site was used by the Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation. The site is partially covered by a building which is being used as a warehousing facility by Westwood Pharmaceuticals. The building is 103,000 square feet in area. Contaminated oily substances were found during the construction of the building. Subsequent investigations indicate that groundwater has been contaminated. Groundwater flow is toward the Scajaquada Creek which could be impacted by contaminated groundwater from this site. In 1989, The Department asked Westwood Pharmaceuticals to do a Remedial Investigation/Feasibility Study (RI/FS) program at the site under a Consent Order. Westwood refused and the NYS Attorney General's Office then filed a complaint against Westwood for summary judgment. Westwood eventually agreed to do the RI/FS and work began in April 1992. The RI/FS program was completed in February 1994. The Remedial Investigation confirmed that the primary contaminants at the site and in the adjacent Gill Creek are polynuclear aromatic hydrocarbons (PAHs). A Record of Decision (ROD) was signed in March 1994. The remedies for the main site include; construction of a containment system consisting of sheet pilings and a vertical barrier; operation of a pump and treat system to address the groundwater and non-aqueous phase liquid (NAPL) contamination at the site and bio-treatment of contaminated soil and groundwater. The remedy for the creek involves the removal of the contaminated sediments and disposal by thermal destruction or by other suitably approved methods. A Consent Decree was signed in US District Court for the implementation of the RD/RA in July 1995. The Consent Decree has divided the site into two components: (1) Terrestrial Component including the West Wood Plant area up to the creek bank and (2) Riparian Component including the Scajaquada Creek. The RD at the Terrestrial component was completed in 1996 and the RA was completed in 1997. Long term pump and treat of the contaminated groundwater has begun. Negotiations with National Fuel are underway for the remediation of the contaminated creek sediments.

CONFIRMED HAZARDOUS WASTE DISPOSAL:

Sludges from gas manufacturing
Soils contaminated with oil
Chlorinated Hydrocarbons
Polynuclear Aromatic Hydrocarbons
Phenols
Heavy Metals

QUANTITY:

Unknown
Unknown
Unknown
Unknown
Unknown
Unknown

- Continued on next page -

Environmental FirstSearch
Site Detail Report

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

STATE

SEARCH ID: 141 **DIST/DIR:** 0.12 SE **MAP ID:** 80

NAME: IROQUOIS GAS/WESTWOOD PHARMACEUTICAL ADDRESS: DART STREET BUFFALO NY 13213 ERIE CONTACT:	REV: 05/20/99 ID1: 915141 ID2: STATUS: PHONE:
---------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------

ANALYTICAL DATA AVAILABLE FOR:

GROUNDWATER: X	SURFACE WATER: X
AIR: X	SEDIMENT: X
SOIL: X	

APPLICABLE STANDARDS EXCEEDED FOR:

GROUNDWATER: X	SURFACE WATER:
AIR:	DRINKING WATER:

GEOTECHNICAL INFORMATION:

SOIL/ROCK TYPE: Silt, Clay, gravel, and random fill
DEPTH TO GROUNDWATER: 8-16 feet

LEGAL ACTION:

TYPE: Consent Order
STATUS: OS

REMEDATION:

PROPOSED: X	DESIGN:
ACTIVE:	COMPLETE:

ASSESSMENT OF ENVIRONMENTAL PROBLEMS:

The contaminants had been moving to the adjacent Scajaquada Creek, a tributary of the Niagara River. Groundwater was also impacted. The completion of the remedial action for the Terrestrial part of the site has addressed this problem. The problem of the contaminated creek sediments will be addressed upon completion of the remedial action for the Riparian part of the site.

ASSESSMENT OF HEALTH PROBLEMS:

Exposures via drinking water are not expected because homes in the area are served by public water and no known private wells exist in the immediate area. On-site access is restricted by fencing and 24-hour security which reduces the potential for direct contact exposures on-site. The proposed remedial program will eliminate the potential routes of human exposure to site-related contaminants.

Environmental FirstSearch Descriptions

NPL: EPA NATIONAL PRIORITY LIST - The National Priorities List is a list of the worst hazardous waste sites that have been identified by Superfund. Sites are only put on the list after they have been scored using the Hazard Ranking System (HRS), and have been subjected to public comment. Any site on the NPL is eligible for cleanup using Superfund Trust money.

A Superfund site is any land in the United States that has been contaminated by hazardous waste and identified by the Environmental Protection Agency (EPA) as a candidate for cleanup because it poses a risk to human health and/or the environment.

FINAL - Currently on the Final NPL

PROPOSED - Proposed for NPL

NPL DELISTED: EPA NATIONAL PRIORITY LIST Subset - Database of delisted NPL sites. The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

DELISTED - Deleted from the Final NPL

CERCLIS: EPA COMPREHENSIVE ENVIRONMENTAL RESPONSE COMPENSATION AND LIABILITY INFORMATION SYSTEM (CERCLIS)- CERCLIS is a database of potential and confirmed hazardous waste sites at which the EPA Superfund program has some involvement. It contains sites that are either proposed to be or are on the National Priorities List (NPL) as well as sites that are in the screening and assessment phase for possible inclusion on the NPL.

PART OF NPL- Site is part of NPL site

DELETED - Deleted from the Final NPL

FINAL - Currently on the Final NPL

NOT PROPOSED - Not on the NPL

NOT VALID - Not Valid Site or Incident

PROPOSED - Proposed for NPL

REMOVED - Removed from Proposed NPL

SCAN PLAN - Pre-proposal Site

WITHDRAWN - Withdrawn

NFRAP: EPA COMPREHENSIVE ENVIRONMENTAL RESPONSE COMPENSATION AND LIABILITY INFORMATION SYSTEM ARCHIVED SITES - database of Archive designated CERCLA sites that, to the best of EPA's knowledge, assessment has been completed and has determined no further steps will be taken to list this site on the National Priorities List (NPL). This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

NFRAP – No Further Remedial Action Plan

P - Site is part of NPL site

D - Deleted from the Final NPL

F - Currently on the Final NPL

N - Not on the NPL

O - Not Valid Site or Incident

P - Proposed for NPL

R - Removed from Proposed NPL

S - Pre-proposal Site

W – Withdrawn

RCRA COR ACT: EPA RESOURCE CONSERVATION AND RECOVERY INFORMATION SYSTEM SITES - Database of hazardous waste information contained in the Resource Conservation and Recovery Act Information (RCRAInfo), a national program management and inventory system about hazardous waste handlers. In general, all generators, transporters, treaters, storers, and disposers of hazardous waste are required to provide information about their activities to state environmental agencies. These agencies, in turn pass on the information to regional and national EPA offices. This regulation is governed by the Resource Conservation and Recovery Act (RCRA), as amended by the Hazardous and Solid Waste Amendments of 1984.

RCRAInfo facilities that have reported violations and subject to corrective actions.

RCRA TSD: EPA RESOURCE CONSERVATION AND RECOVERY INFORMATION SYSTEM

TREATMENT, STORAGE, and DISPOSAL FACILITIES. - Database of hazardous waste information contained in the Resource Conservation and Recovery Act Information (RCRAInfo), a national program management and inventory system about hazardous waste handlers. In general, all generators, transporters, treaters, storers, and disposers of hazardous waste are required to provide information about their activities to state environmental agencies. These agencies, in turn pass on the information to regional and national EPA offices. This regulation is governed by the Resource Conservation and Recovery Act (RCRA), as amended by the Hazardous and Solid Waste Amendments of 1984.

Facilities that treat, store, dispose, or incinerate hazardous waste.

RCRA GEN: EPA RESOURCE CONSERVATION AND RECOVERY INFORMATION SYSTEM GENERATORS - Database of hazardous waste information contained in the Resource Conservation and Recovery Act Information (RCRAInfo), a national program management and inventory system about hazardous waste handlers. In general, all generators, transporters, treaters, storers, and disposers of hazardous waste are required to provide information about their activities to state environmental agencies. These agencies, in turn pass on the information to regional and national EPA offices. This regulation is governed by the Resource Conservation and Recovery Act (RCRA), as amended by the Hazardous and Solid Waste Amendments of 1984. Facilities that generate or transport hazardous waste or meet other RCRA requirements.

LGN - Large Quantity Generators

SGN - Small Quantity Generators

VGN – Conditionally Exempt Generator.

Included are RAATS (RCRA Administrative Action Tracking System) and CMEL (Compliance Monitoring & Enforcement List) facilities.

RCRA NLR: EPA RESOURCE CONSERVATION AND RECOVERY INFORMATION SYSTEM SITES - Database of hazardous waste information contained in the Resource Conservation and Recovery Act Information (RCRAInfo), a national program management and inventory system about hazardous waste handlers. In general, all generators, transporters, treaters, storers, and disposers of hazardous waste are required to provide information about their activities to state environmental agencies. These agencies, in turn pass on the information to regional and national EPA offices. This regulation is governed by the Resource Conservation and Recovery Act (RCRA), as amended by the Hazardous and Solid Waste Amendments of 1984.

Facilities not currently classified by the EPA but are still included in the RCRAInfo database. Reasons for non classification:

Failure to report in a timely matter.

No longer in business.

No longer in business at the listed address.

No longer generating hazardous waste materials in quantities which require reporting.

Federal IC / EC: EPA BROWNFIELD MANAGEMENT SYSTEM (BMS) - database designed to assist EPA in collecting, tracking, and updating information, as well as reporting on the major activities and accomplishments of the various Brownfield grant Programs.

FEDERAL ENGINEERING AND INSTITUTIONAL CONTROLS- Superfund sites that have either an engineering or an institutional control. The data includes the control and the media contaminated.

ERNS: EPA/NRC EMERGENCY RESPONSE NOTIFICATION SYSTEM (ERNS) - Database of incidents reported to the National Response Center. These incidents include chemical spills, accidents involving chemicals (such as fires or explosions), oil spills, transportation accidents that involve oil or chemicals, releases of radioactive materials, sightings of oil sheens on bodies of water, terrorist incidents involving chemicals, incidents where illegally dumped chemicals have been found, and drills intended to prepare responders to handle these kinds of incidents. Data since January 2001 has been received from the National Response System database as the EPA no longer maintains this data.

Tribal Lands: DOI/BIA INDIAN LANDS OF THE UNITED STATES - Database of areas with boundaries established by treaty, statute, and (or) executive or court order, recognized by the Federal Government as territory in which American Indian tribes have primary governmental authority. The Indian Lands of the United States map layer shows areas of 640 acres or more, administered by the Bureau of Indian Affairs. Included are Federally-administered lands within a reservation which may or may not be considered part of the reservation.

State/Tribal Sites: NYSDEC ENVIRONMENTAL SITE REMEDIATION DATABASE - database of sites being remediated under a DER remedial program/s (i.e. State Superfund, Brownfield Cleanup, etc.). This database also includes the Registry of Institutional and Engineering Controls in New York State.

REGISTRY OF INACTIVE HAZARDOUSE WASTE DISPOSAL SITES –

HAZARDOUS SUBSTANCE SITE STUDY - (STATIC) This study was done in 1998 and was prepared by the

NY DEC, Hazardous Substances Waste Disposal Task Force In consultation with N.Y. Department of Health

State Spills 90: *NYSDEC* SPILL INCIDENTS DATABASE - database of chemical and petroleum spill incidents that occurred since 1990.

State Spills 80: *NYSDEC* SPILL INCIDENTS DATABASE - database of chemical and petroleum spill incidents that occurred before 1990.

State/Tribal SWL: *NYSDEC* ACTIVE FACILITIES REGISTRY - database of solid waste landfill facilities. The data includes location, waste type, owner and permit number.

State/Tribal LUST: *NYSDEC* SPILL INCIDENTS DATABASE SUBSET - database of chemical and petroleum spill incidents where the cause was a tank test failure or tank failure

State/Tribal UST/AST: *NYSDEC* DATABASE OF PETROLEUM BULK STORAGE, MAJOR OIL STORAGE (MOSF), AND CHEMICAL BULK STORAGE (CBS) FACILITIES - database of petroleum or chemical storage facilities. The data includes status, tank type, capacity and contents. The data also includes Nassau County Department of Health's PBS Tanks
Nassau County Fire Marshall's PBS Tanks
Suffolk County Department of Health Services PBS Tanks
Cortland County Health Department PBS Tanks
Rockland County Department of Health PBS Tanks
Westchester County Department of Health PBS Tanks.

State/Tribal EC: *NYSDEC* REGISTRY OF INSTITUTIONAL AND ENGINEERING CONTROLS Subset - database of sites from the Registry that have Engineering Controls.

State/Tribal IC: *NYSDEC* REGISTRY OF INSTITUTIONAL AND ENGINEERING CONTROLS Subset - database of sites from the Registry that have Institutional Controls.

State/Tribal VCP: *NYSDEC* VOLUNTARY CLEANUP PROGRAM - static database of voluntary clean up sites. The Brownfield Cleanup program has replaced the Voluntary Cleanup Program.

State/Tribal Brownfields: *NYSDEC* BROWNFIELD - database of old brownfield programs, brownfield cleanup programs, environmental restoration projects.

Receptors: *US DOC* SENSITIVE RECEPTORS - 2005 Census Bureau's TIGER (Topologically Integrated Geographic Encoding and Referencing System) database of schools and hospitals. List of schools and hospitals that may house individuals deemed sensitive to environmental discharges due to their fragile immune systems.

NPDES: *EPA* THE NATIONAL POLLUTION DISCHARGE ELIMINATION SYSTEM - Database of permitted facilities receiving and discharging effluents to and from a natural source where treatment of the effluent is monitored.

FINDS: *EPA* FACILITY INDEX SYSTEM(FINDS)/FACILITY REGISTRY SYSTEM(FRS) - The index of identification numbers associated with a property or facility which the EPA has investigated or has been made aware of in conjunction with various regulatory programs. Each record indicates the EPA office that may have files on the site or facility. A Facility Registry System site has an FRS in the status field.

TRIS: *EPA* TOXIC RELEASE INVENTORY SYSTEM (TRIS)– Database that contains information on toxic chemical releases and other waste management activities reported annually by certain covered industry groups as well as federal facilities. This inventory was established under the Emergency Planning and Community Right-to-Know Act of 1986 (EPCRA) and expanded by the Pollution Prevention Act of 1990.

HMIRS: *US DOT* HAZARDOUS MATERIALS INCIDENT RESPONSE SYSTEM - Database of information regarding materials, packaging, and a description of events for tracked incidents.

NCDB: *EPA* NATIONAL COMPLIANCE DATA BASE SYSTEM - Database of regional compliance and enforcement activity and manages the Pesticides and Toxic Substances Compliance and Enforcement program at a national level. The system tracks all compliance monitoring and enforcement activities from the time an inspector conducts an inspection until the time the inspector closes or the case settles the enforcement action. NCDB is the national repository of the 10 regional and Headquarters FIFRA/TSCA Tracking System (FTTS).

Data collected in the regional FTTS is transferred to NCDB to support the need for monitoring national performance of regional programs.

PADS: *EPA* DATABASE OF PCB HANDLERS - Database of PolyChlorinatedBiPhenol generators, transporters, storers and/or disposers that are required to register with the EPA. This database indicates the type of handler and registration number. Also included is the PCB Transformer Registration Database.

AIRS: *EPA* AEROMETRIC INFORMATION RETRIEVAL SYSTEM (AIRS) – database of detailed information pertaining to sites which submit air emissions reports. Developed under the Clean Air Act, this database also maintains data on compliance status and enforcement actions.

RADON: *NTIS* NATIONAL RADON DATABASE - EPA radon data from 1990-1991 national radon project collected for a variety of zip codes across the United States.

DOCKET: *EPA* INTERGRATED COMPLIANCE INFORMATION SYSTEM (ICIS) - database of federal administrative and federal judicial cases under the following environmental statutes: the Clean Air Act (CAA), the Clean Water Act (CWA), the Resource Conservation and Recovery Act (RCRA), the Emergency Planning and Community Right-to-Know Act (EPCRA) Section 313, the Toxic Substances Control Act (TSCA), the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA), the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA or Superfund), the Safe Drinking Water Act (SDWA), and the Marine Protection, Research, and Sanctuaries Act (MPRSA).

Nuclear Permits: *EPA/NRC* PERMITTED NUCLEAR FACILITIES - This database is a comprehensive listing of all facilities which have been issued permits for the handling of radioactive materials, in addition it also contains a complete listing of all licensed and active nuclear power plants located within the United States. THE RADINFO DATABASE - Database of basic information about facilities that are permitted and regulated for their use and handling of radioactive materials.

Federal Other: *EPA* SECTION SEVEN TRACKING SYSTEM (SSTS) – database of registration and production data for facilities which manufacture pesticides.

SETS PRP: *EPA* POTENTIALLY RESPONSIBLE PARTIES (PRP) – database of parties identified by the EPA as being potential responsible for contamination at a CERCLIS or NPL site.

State Permits: *NYSDEC* POLLUTION DISCHARGE ELIMINATION SYSTEM (SPDES) - database of all permitted facilities receiving and discharging effluents.

State Other: *NYSDEC* MAJOR OIL STORAGE FACILITIES - database of major oil storage facilities registered with the New York Department of Environmental Conservation. The data includes status, tank type, capacity and contents.

State Other: *US DOJ* NATIONAL CLANDESTINE LABORATORY REGISTER - Database of addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the U.S. Department of Justice ("the Department"), and the Department has not verified the entry and does not guarantee its accuracy. All sites that are included in this data set will have an id that starts with NCLR.

Environmental FirstSearch Database Sources

NPL: EPA Environmental Protection Agency

Updated quarterly

NPL DELISTED: EPA Environmental Protection Agency

Updated quarterly

CERCLIS: EPA Environmental Protection Agency

Updated quarterly

NFRAP: EPA Environmental Protection Agency.

Updated quarterly

RCRA COR ACT: EPA Environmental Protection Agency.

Updated quarterly

RCRA TSD: EPA Environmental Protection Agency.

Updated quarterly

RCRA GEN: EPA Environmental Protection Agency.

Updated quarterly

RCRA NLR: EPA Environmental Protection Agency

Updated quarterly

Federal IC / EC: EPA Environmental Protection Agency

Updated quarterly

ERNS: EPA/NRC Environmental Protection Agency

Updated semi-annually

Tribal Lands: DOI/BIA United States Department of the Interior

Updated annually

State/Tribal Sites: NYSDEC New York Department of Environmental Remediation

New York State Department of Environmental Conservation

Updated quarterly

State Spills 90: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State Spills 80: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State/Tribal SWL: *NYSDEC* New York State Department of Environmental Conservation

Updated annually

State/Tribal LUST: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State/Tribal UST/AST: *NYSDEC* New York State Department of Environmental Conservation
Nassau County Department of Health
Nassau County Fire Marshal
Cortland County Health Department
Rockland County Department of Health

Updated quarterly

State/Tribal EC: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State/Tribal IC: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State/Tribal VCP: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State/Tribal Brownfields: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

Receptors: *US DOC* US Department of Commerce, Census Bureau

Updated periodically

NPDES: *EPA* Environmental Protection Agency

Updated quarterly

FINDS: *EPA* Environmental Protection Agency

Updated annually

TRIS: *EPA* Environmental Protection Agency.

Updated quarterly

HMIRS: *US DOT* US Department of Transportation

Updated quarterly

NCDB: *EPA* Environmental Protection Agency

Updated quarterly

PADS: *EPA* Environmental Protection Agency

Updated quarterly

AIRS: *EPA* Environmental Protection Agency

Updated quarterly

RADON: *NTIS* Environmental Protection Agency, National Technical Information Services

Updated periodically

DOCKET: *EPA*

Updated

Nuclear Permits: *EPA/NRC* Nuclear Regulatory Commission

Updated periodically

Federal Other: *EPA* Environmental Protection Agency

Updated quarterly

SETS PRP: *EPA* Environmental Protection Agency, National Technical Information Services

Updated when available

State Permits: *NYSDEC* New York State Department of Environmental Conservation

Updated annually

State Other: *NYSDEC* New York State Department of Environmental Conservation

Updated quarterly

State Other: *US DOJ* U.S. Department of Justice

Updated when available

Environmental FirstSearch
Street Name Report for Streets within .25 Mile(s) of Target Property

Target Property: NY 198
 BUFFALO NY 14216

JOB: 5466

Street Name	Dist/Dir	Street Name	Dist/Dir
Academic Dr	0.25 SE	Jefferson Ave	0.24 SW
Agassiz Cir	0.02 NE	Jessemine	0.06 SW
Agassiz Cir Access	0.00 --	Kail St	0.18 NW
Amherst St	0.00 --	Kensington Ave	0.00 --
Appenheimer Ave	0.16 SE	Kensington Expy	0.00 --
Austin St	0.25 NW	Ketchum Pl	0.13 SW
Beaumaris Pl	0.15 NE	Letchworth St	0.11 SE
Bedford Ave	0.21 NW	Lincoln Pky	0.00 --
Bengal Dr	0.06 NE	Loring Ave	0.00 --
Berkley Pl	0.19 SW	Main St	0.00 --
Bird Ave	0.02 SE	Meadow Rd	0.18 NE
Blaine Ave	0.08 SW	Meadowview Pl	0.02 SW
Bradley St	0.11 SE	Meech Ave	0.09 SW
Bridgeman St	0.23 NE	Middlebury Ln	0.05 NE
Buell Ave	0.19 SE	Middlesex Rd	0.00 --
Burbank Dr	0.03 SW	Military Rd	0.14 NW
Burbank Ter	0.03 SW	Mohican Ave	0.06 SW
Bush St	0.08 N-	Monticello Pl	0.03 NE
Chatham Ave	0.16 NE	N Park Dr	0.00 --
Churchill St	0.21 NW	Niagara St	0.00 --
Clarendon Pl	0.25 SW	NORTH Park Dr	0.00 --
Clay St	0.15 SW	Northland Ave	0.20 SE
Cleveland Cir	0.18 SW	Nottingham Ct	0.08 NE
Cordage Aly	0.24 SE	Nottingham Ter	0.00 --
Crescent Ave	0.02 NE	Oakgrove Ave	0.04 SW
Daisy Pl	0.08 SW	Pansy Pl	0.15 SW
Dana Rd	0.10 NW	Park Rd	0.00 --
Danforth St	0.11 SE	Parkside Ave	0.00 --
Dart St	0.10 SE	Pauline St	0.24 NE
Dearborn St	0.12 NW	Penhurst Park	0.19 SW
Delaware Ave	0.00 --	Penhurst Pl	0.23 SW
Dewitt St	0.11 SE	Peter St	0.04 N-
Dignity Cir	0.12 SE	Piper St	0.01 SW
Donaldson Rd	0.23 SW	Pooley Pl	0.16 SE
E Delavan Ave	0.01 SE	Potomac Ave	0.11 SE
EAST Delavan Ave	0.01 SE	Randwood Ln	0.04 NE
Eastwood Pl	0.00 --	Rees St	0.11 SE
Elmview Pl	0.17 NE	Regina Pl	0.07 SW
Elmwood Ave	0.02 NE	Reservation St	0.20 N-
Fernwood Ave	0.05 SE	Rex Pl	0.17 SE
Fillmore Ave	0.15 SE	Robie Ave	0.11 NE
Florence Ave	0.23 NE	Rockwell Rd	0.17 SW
Florida St	0.14 SW	Rumsey Ln	0.19 SW
Fordham Dr	0.20 NE	Rumsey Rd	0.14 SW
Forest Ave	0.01 SE	Scajaquada Expy	0.00 --
Garner Ave	0.22 SE	Shelbourne Pl	0.05 NE
Germain St	0.04 NW	Sloan St	0.20 SW
Gillette Ave	0.02 NW	Tonawanda St	0.05 NW

Environmental FirstSearch
Street Name Report for Streets within .25 Mile(s) of Target Property

Target Property: NY 198
BUFFALO NY 14216

JOB: 5466

Street Name	Dist/Dir	Street Name	Dist/Dir
Glendale Pl	0.00 --	Trinidad Pl	0.13 NW
Glenny Dr	0.16 NE	Union Pl	0.21 SW
Glor St	0.14 NW	Viola Park	0.12 SW
Grant St	0.00 --	W Delavan Ave	0.23 SW
Hager St	0.21 SW	Watts St	0.12 NW
Hallam Rd	0.14 NE	Wayne St	0.17 NW
Hawley St	0.16 SE	West Ave	0.00 --
Hedley Pl	0.12 SW	WEST Delavan Ave	0.23 SW
Howell St	0.06 N-	Westwood Squibb	0.08 SE
Hughes Ave	0.04 SW	Woodette Pl	0.22 NE
Humboldt Pky	0.00 --	Woodward Ave	0.01 NE
I-190	0.00 --		
Iroquois	0.05 NE		




Environmental FirstSearch

1 Mile Radius from Line
ASTM Map: NPL, RCRACOR, STATE Sites



NY 198 , BUFFALO NY 14216

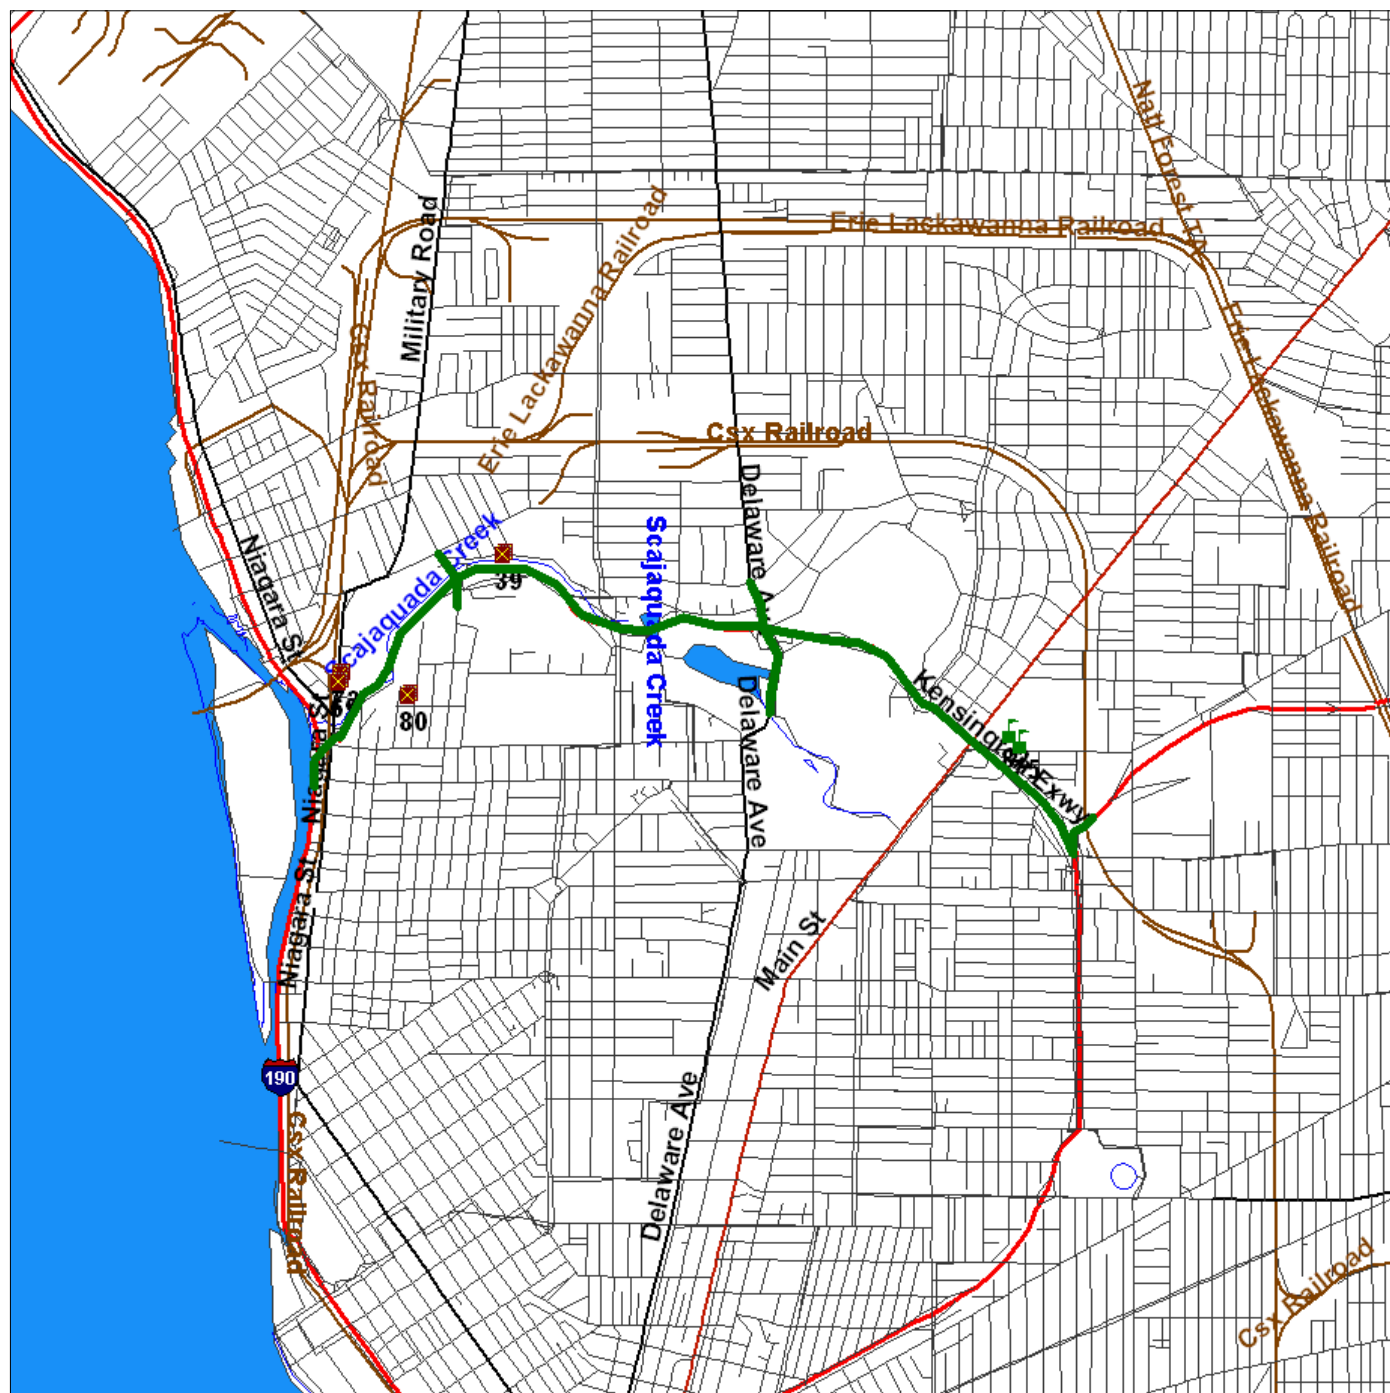

Source: 2005 U.S. Census TIGER Files

Linear Search Line
Identified Site, Multiple Sites, Receptor
NPL, DELNPL, Brownfield, Solid Waste Landfill (SWL), Hazardous Waste
Triballand.....
Railroads






Environmental FirstSearch

.5 Mile Radius from Line
ASTM Map: CERCLIS, RCRATSD, LUST, SWL



NY 198 , BUFFALO NY 14216

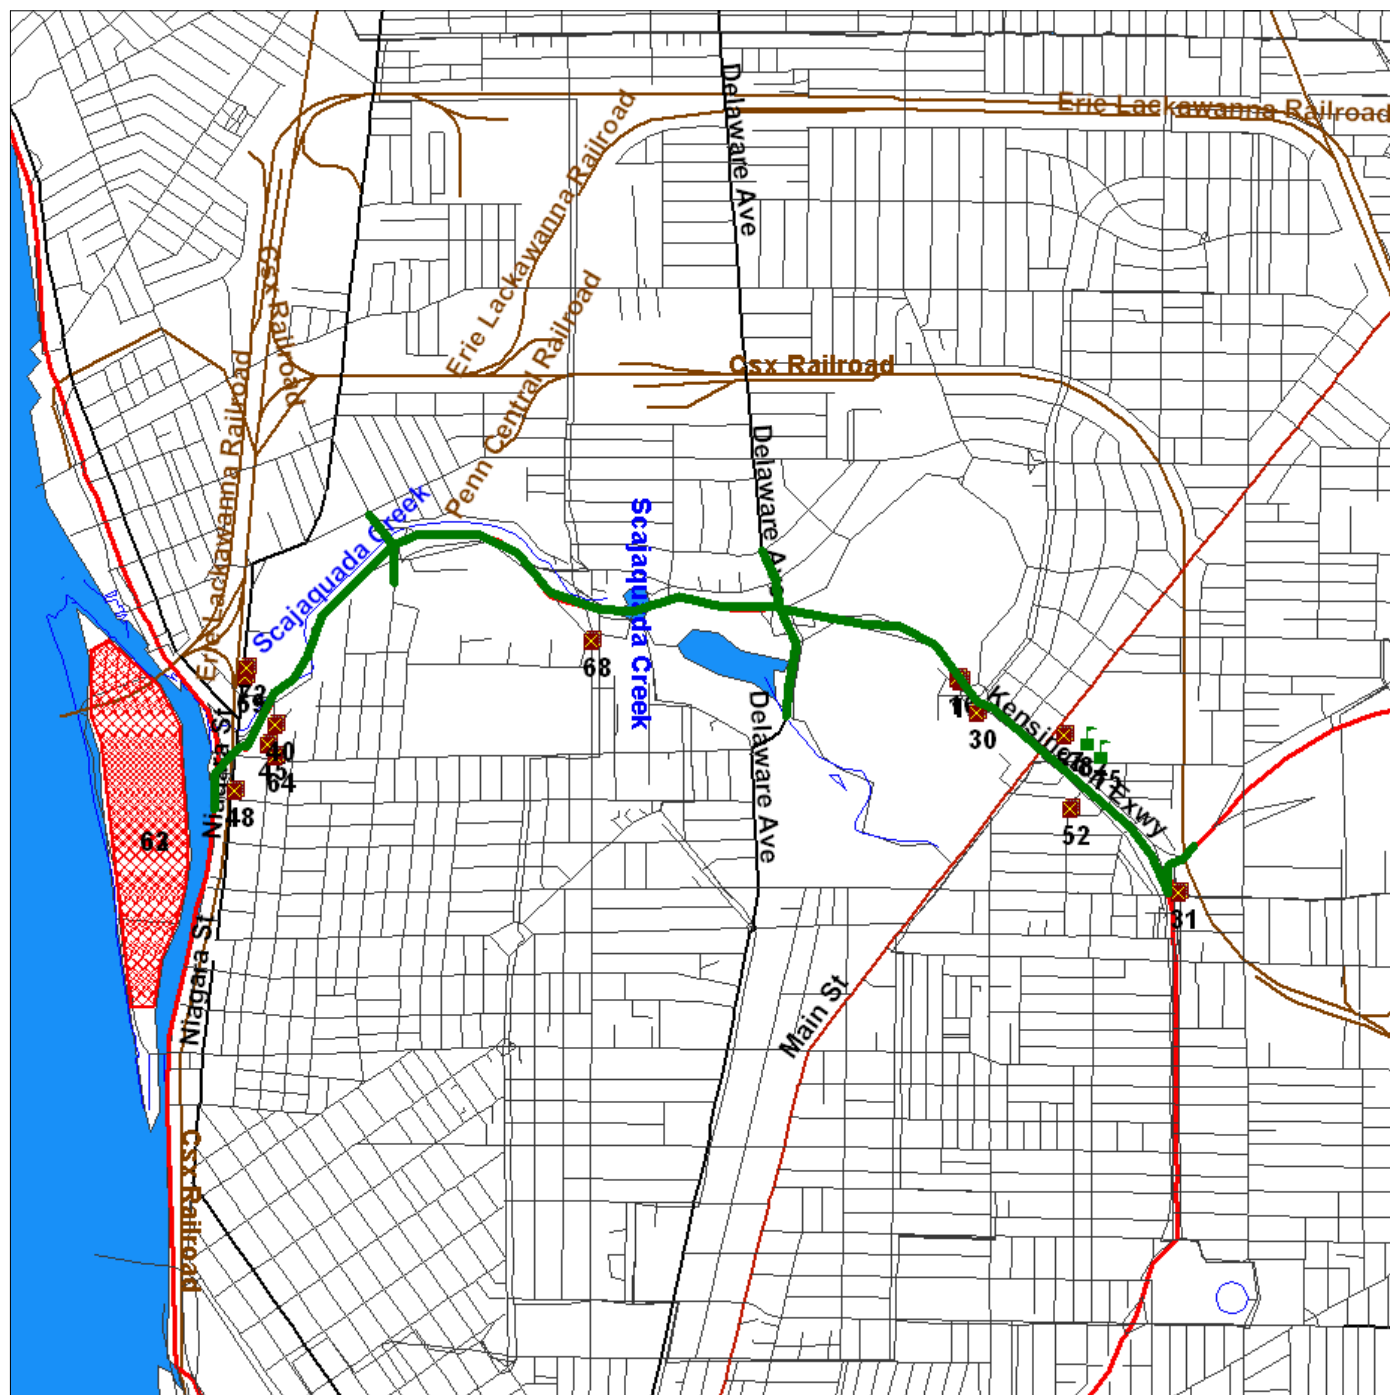

Source: 2005 U.S. Census TIGER Files

Linear Search Line
Identified Site, Multiple Sites, Receptor
NPL, DELNPL, Brownfield, Solid Waste Landfill (SWL), Hazardous Waste
Triballand.....
Railroads





Environmental FirstSearch

.25 Mile Radius from Line
ASTM Map: RCRAGEN, ERNS, UST

NY 198 , BUFFALO NY 14216



Source: 2005 U.S. Census TIGER Files

Linear Search Line
Identified Site, Multiple Sites, Receptor
NPL, DELNPL, Brownfield, Solid Waste Landfill (SWL), Hazardous Waste
Triballand.....
Railroads






Environmental FirstSearch

.12 Mile Radius from Line
Non-ASTM Map: Multiple Databases



NY 198 , BUFFALO NY 14216

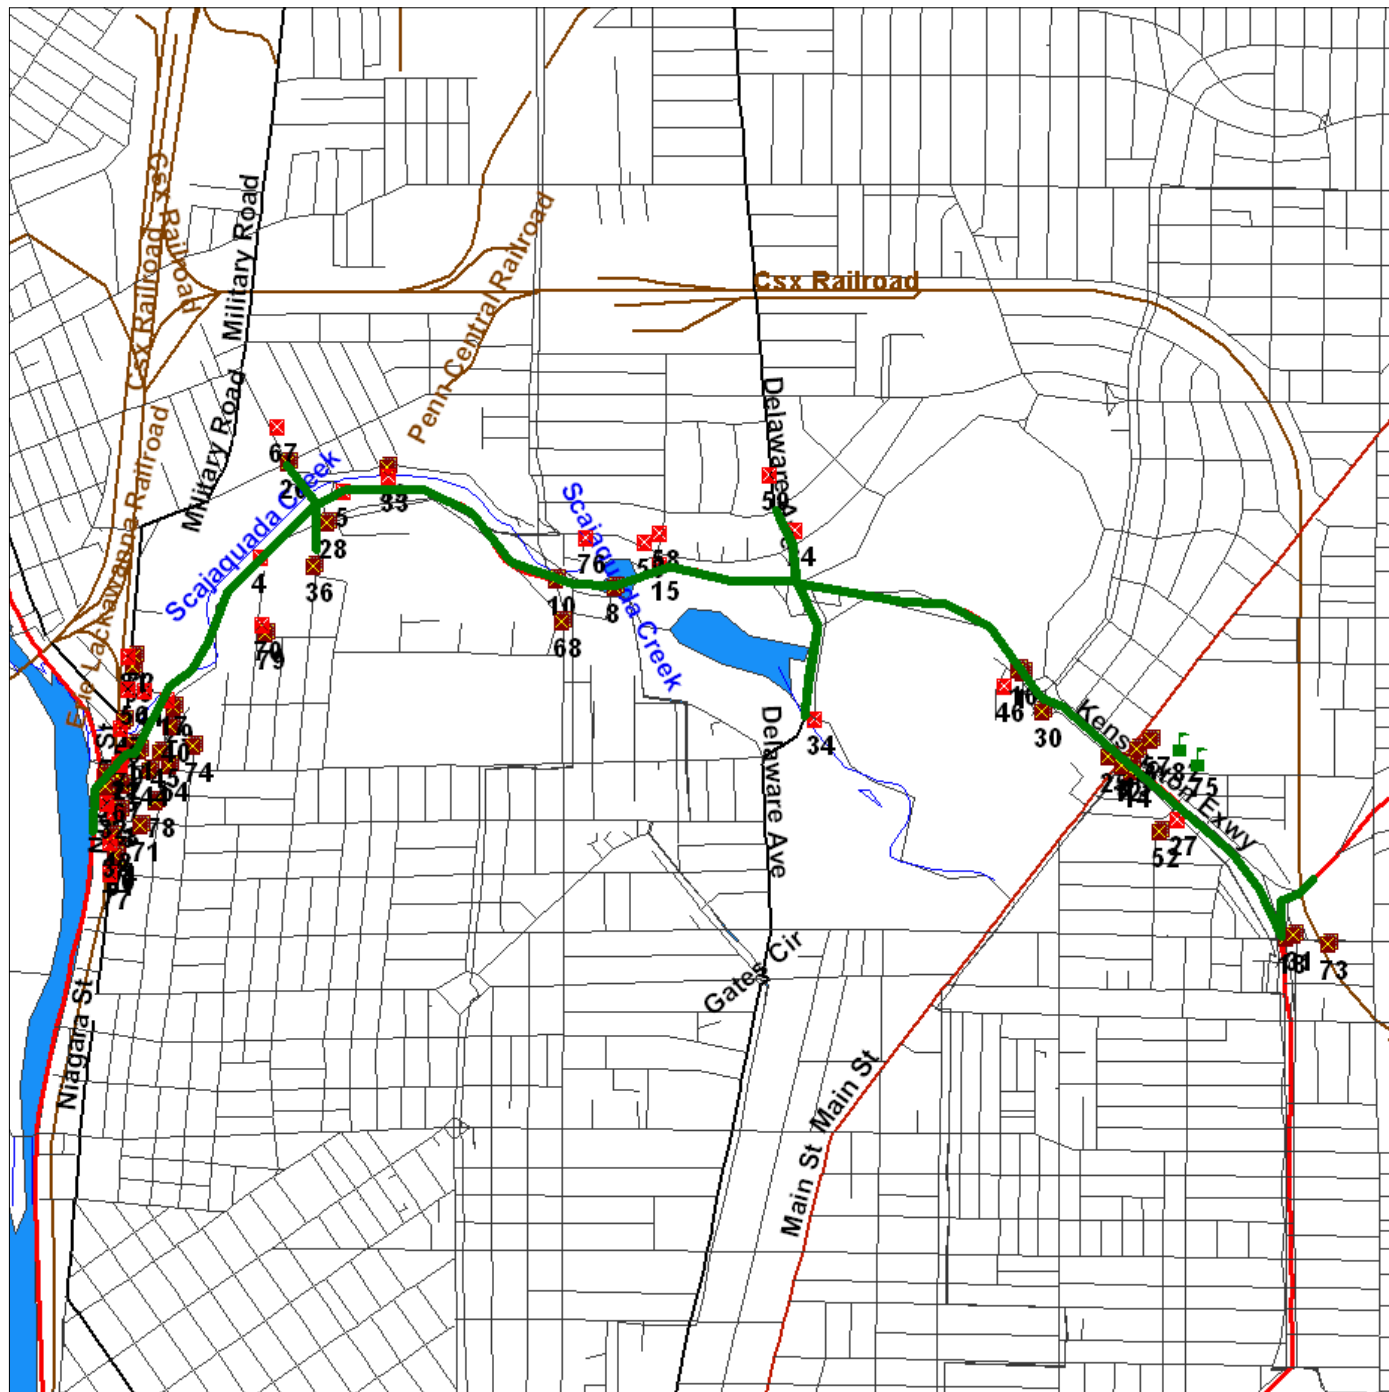

Source: 2005 U.S. Census TIGER Files

Linear Search Line
Identified Site, Multiple Sites, Receptor
NPL, DELNPL, Brownfield, Solid Waste Landfill (SWL), Hazardous Waste
Triballand.....
National Historic Sites and Landmark Sites
Railroads

